

4-USGS
1-Comm. of Public Lands
2-EPNG, El Paso, Farm.
1-Snoddy
1-Phillips
1-F

(SUBMIT IN TRIPLICATE)

Budget Bureau No. 42-R388.4.
Approval expires 12-31-60.

			X

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

Land Office _____
Lease No. **MM-012671**
Unit **San Juan 29-6**

SUNDRY NOTICES AND REPORTS ON WELLS

NOTICE OF INTENTION TO DRILL	SUBSEQUENT REPORT OF WATER SHUT-OFF	
NOTICE OF INTENTION TO CHANGE PLANS	SUBSEQUENT REPORT OF SHOOTING OR ACIDIZING	
NOTICE OF INTENTION TO TEST WATER SHUT-OFF	SUBSEQUENT REPORT OF ALTERING CASING	
NOTICE OF INTENTION TO RE-DRILL OR REPAIR WELL	SUBSEQUENT REPORT OF RE-DRILLING OR REPAIR	
NOTICE OF INTENTION TO SHOOT OR ACIDIZE	SUBSEQUENT REPORT OF ABANDONMENT	
NOTICE OF INTENTION TO PULL OR ALTER CASING	SUPPLEMENTARY WELL HISTORY	X
NOTICE OF INTENTION TO ABANDON WELL		

(INDICATE ABOVE BY CHECK MARK NATURE OF REPORT, NOTICE, OR OTHER DATA)

November 14, 1963

Well No. **69** is located **990** ft. from **[N]** line and **990** ft. from **[E]** line of sec. **25**
NE/4 NE/4 Sec. 26 **29 N** **6 W** **NMPN**
(1/4 Sec. and Sec. No.) (Twp.) (Range) (Meridian)
Basin Dakota **Rio Arriba** **New Mexico**
(Field) (County or Subdivision) (State or Territory)

The elevation of the ~~drill hole~~ above sea level is **6412** ft. G.L.


DETAILS OF WORK

(State names of and expected depths to objective sands; show sizes, weights, and lengths of proposed casings; indicate mudding jobs, cementing points, and all other important proposed work)

11/13/63 Drilled DV tools @ 3705' & 3449', CO to 7777', tested csg. to 4000# held OK. Displaced w/1% calcium chloride water. Spotted 1000 gals. 7% spearhead acid. Ran correlation log. Perf. 7763-75 w/2 JPF, ED w/acid @ 1500#. Perf. 7732-34, 7722-26, 7672-84 w/2JPF. SWF w/ 20,000# 20-40 sd, 40,000# 40-60 sd, 75,900 gals. gelled water. TP 3100-4000#, ATP 3800#, inj. rate 31.2 BPM. ISI 2600, SMT 2400#, SI 4 1/2 hrs.
11/14/63 Blew well, well unloaded behind frac. Landed 245 jts. 7729' 2" EUE tbg. @ 7738' KB. Set tree, pumped out plug. Cleaning prep. to SI for test.

I understand that this plan of work must receive approval in writing by the Geological Survey before operations may be commenced.

Company **Beta Development Co.**
Address **234 Petr. Club Plaza**
Farmington, New Mexico

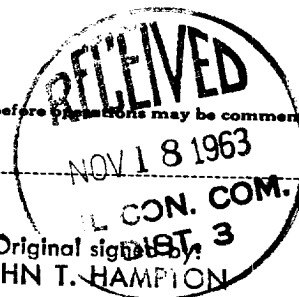

By **JOHN T. HAMPION**
Title **Manager**