

District I
P.O. Box 1980, Hobbs, NM
District II
P.O. Drawer DD, Artesia, NM 88211
District III
000 Rio Brazos Rd, Aztec, NM 87410

State of New Mexico
Energy, Minerals and Natural Resources Department

SUBMIT 1 COPY TO
APPROPRIATE
DISTRICT OFFICE
AND 1 COPY TO
SANTA FE OFFICE

OIL CONSERVATION DIVISION

P.O. Box 2088

Santa Fe, New Mexico 87504-2088

DEPUTY OIL & GAS INSPECTOR

OCT 31 1995

PIT REMEDIATION AND CLOSURE REPORT

Approved

Operator: Phillips Petroleum Company Telephone: (505) 599-3460

Address: 5525 Hwy. 64, NBU 3004, Farmington, NM 87401

Facility Or: San Juan 29-6 Unit #104

Well Name

Location: Unit or Qtr/Qtr Sec SE SW N sec 14 T 29N R 6W County Rio Arriba

Pit Type: Separator ☒ Dehydrator ☐ Other ☐

Land Type: BLM ☒ State ☐ Fee ☐ Other ☐

Pit Location: Pit dimensions: length 25', width 25', depth 3'

(Attach diagram)

Reference: wellhead ☒ other ☐

Footage from reference: 60

Direction from reference: 90 Degrees ☐ East North ☒
of
☒ West South ☐

Depth To Ground Water: 60'

(Vertical distance from
contaminants to seasonal
high water elevation of
ground water)

Less than 50 feet (20 points)
☒ 50 feet to 99 feet (10 points) 10
Greater than 100 feet (0 Points)

Wellhead Protection Area:

(Less than 200 feet from a private
domestic water source, or; less than
1000 feet from all other water sources)

Yes (20 points)
☒ No (0 points) 0

Distance To Surface Water:

(Horizontal distance to perennial
lakes, ponds, rivers, streams, creeks,
irrigation canals and ditches)

Less than 200 feet (20 points)
200 feet to 1000 feet (10 points)
☒ Greater than 1000 feet (0 points) 0

RANKING SCORE (TOTAL POINTS): 10

RECEIVED
MAY - 8 1994
OIL CON. DIV.
DIST. 3

Date Remediation Started: n/a Dated Completed: _____

Remediation Method: Excavation _____ Approx. cubic yards _____
(Check all appropriate sections) Landfarmed _____ Insitu Bioremediation _____
Other _____

Remediation Location: Onsite _____ Offsite _____
(ie. landfarmed onsite, name and location of offsite facility)

General Description Of Remedial Action: n/a

Initial assessment of pit showed soils to be clean
at the surface and at three feet below pit bottom.

Ground Water Encountered: No X Yes _____ Depth _____

Final Pit: Sample location deepest part of pit. Sampled with a backhoe.

Closure Sampling: (if multiple samples, attach sample results and diagram of sample locations and depths)
Sample depth 3' below pit bottom

Sample date 11/19/93 Sample time -

Sample Results

Benzene(ppm) -

Total BTEX(ppm) -

Field headspace(ppm) 0

TPH 6

Ground Water Sample: Yes _____ No x (If yes, attach sample results)

I HEREBY CERTIFY THAT THE INFORMATION ABOVE IS TRUE AND COMPLETE TO THE BEST OF MY KNOWLEDGE AND BELIEF

DATE 4-13-94

SIGNATURE Ed Hasely

PRINTED NAME AND TITLE Ed Hasely
Environmental Engineer

PIT NO.	WELL NAME	U.S.-T-R	PIT TYPE	RANK SCORE	CLOSURE STANDARD TPH (PPM)	DATE 1993	GROUNDWATER ENCOUNTERED Sub-Surf. Depth	SOIL TYPE	PIT TYPE	SAMPLE NO.	Organic Vapor Meter (PPM)	Total Recoverable Pet. Hydro. (PPM)	EPA METHOD 8020 (PPB)				TOTAL BTEX	STATUS
													Benzene	Toluene	Ethyl Benzene	Xylene		
PA087	SAN JUAN 20-0, #73A	D202006	SEP	10	1000	11-11	NO	CL/SP	EARTHEN	T1-4 T1-6.5	3.8 5	12						CLOSE
PA088	SAN JUAN 20-0, #74A	I202906	SEP	10	1000	11-11	NO	CL/SP/SM	EARTHEN	T1-7 T1-12 T1-15 T2-13	609 926 1124 6	7200 4800 2500 16						REM
PA089	SAN JUAN 20-0, #41-24	A242906	SEP	0	5000	11-17	NO	CL	EARTHEN	T1-4.5 T1-7	41 2047	110	2510	28200	2200	50000	82910	REM
PA090	SAN JUAN 20-0, #80	H242906	SEP	0	5000	11-17	NO	CL/SP	EARTHEN	T1-4 T1-6.5	46 131	1200	0	0	0	202	202	CLOSE
PA091	SAN JUAN 20-0, #82	A252906	SEP	10	1000	11-17	NO	SC	EARTHEN	T1-5	36	940						CLOSE
PA092	SAN JUAN 20-0, #42-25	H252906	SEP	10	1000	11-17	NO	CL	EARTHEN	T1-5.5	721	580	4380	19700	102	7000	31191	CLOSE
PA093	SAN JUAN 20-0, #70	M242906	SEP	0	5000	11-17	NO	SM	EARTHEN	T1-4.5 T1-7	587 103	1200	0	418	22	550	990	TEST
PA094	SAN JUAN 20-0, #40-23	H232906	SEP	0	5000	11-17	NO	CL	EARTHEN	T1-4.5 T1-7	32 908	20	130	900	51	1133	2253	CLOSE
PA095	SAN JUAN 20-0, #75	H232906	SEP	0	5000	11-17	NO	CL	EARTHEN	T1-4.5 T1-7	0 0	0						CLOSE
PA096	SAN JUAN 20-0, #27	K232906	SEP	0	5000	11-18	NO	CL	EARTHEN	T1-4.5 T1-7	0 0	0						CLOSE
PA097	SAN JUAN 20-0, #83	M132906	SEP	0	5000	11-18	NO	CL	EARTHEN	T1-2 T2-2 T3-2	26 0 0	4800 86 20						CLOSE
PA098	SAN JUAN 20-0, #20-13	K132906	SEP	0	5000	11-18	NO	SC	EARTHEN	T1-4.5 T1-7	0 2.5	10						CLOSE
PA099	SAN JUAN 20-0, #103	G112906	SEP	10	1000	11-18	NO	SC/SM	EARTHEN	T1-1.5 T2-2	134 2.5	15100 0	316	0	700	11500	12516	REM
PA100	SAN JUAN 20-0, #84	G142906	SEP	10	1000	11-18	NO	CL	EARTHEN	T1-4.5 T1-7	58 758	660	106	2000	167	3000	5303	CLOSE
PA101	SAN JUAN 20-0, #104	N142906	SEP	10	1000	11-19	NO	CL	EARTHEN	T1-3.5 T1-6	0 0	0						CLOSE
PA102	SAN JUAN 20-0, #93	B102906	SEP	10	1000	11-19	NO	SM	EARTHEN	T1-5	20	660						CLOSE


JOB No 93152
PAGE No 1 of 1

DATE STARTED: 11-14-93
DATE FINISHED: 11-19-93
ENVIRO. SPCLT: PEO
OPERATOR: CIMAFRON
ASSISTANT: K.S.

FIELD NOTES & REMARKS: PIT IS LOCATED APPROXIMATELY 60 FEET WEST OF WELLHEAD.
CLOSURE STD: 1000 PPM TPH T1: MOIST, BROWN, SILTY CLAY - NO OOR,
RANKING SCORE: 10

$$3 \times 2 = 6 \cdot GAC^* 0344$$

SITE DIAGRAM

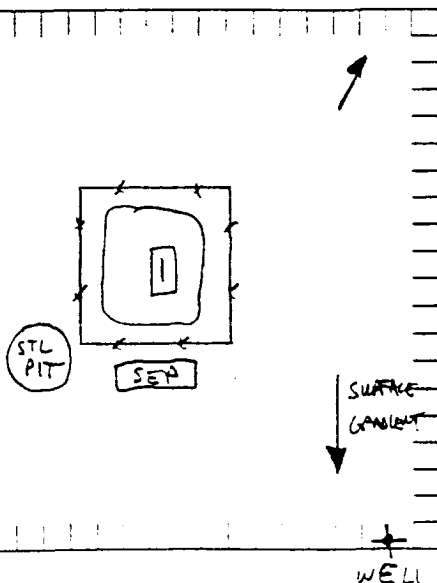

TH#: _____
SOIL SMPL OVM/
TYPE: TYPE: TPH

[illegible]

Sun - Free Mon - 70¢ Tues - 80¢ Wed - 90¢ Thurs - 100¢ Fri - 110¢ Sat - 120¢