

UNITED STATES  
DEPARTMENT OF THE INTERIOR  
GEOLOGICAL SURVEYSUBMIT IN TRIPLICATE\*  
(Other instructions on re-  
verse side)Form approved.  
Budget Bureau No. 42 R1424.  
5. LEASE DESIGNATION AND SERIAL NO.

NM - 18319

6. IF INDIAN, ALLOTTEE OR TRIBE NAME

## SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.  
Use "APPLICATION FOR PERMIT—" for such proposals.)

1. OIL WELL <input type="checkbox"/> GAS WELL <input checked="" type="checkbox"/> OTHER	7. UNIT AGREEMENT NAME
2. NAME OF OPERATOR Continental Oil Company	8. FARM OR LEASE NAME Conoco 29-4
3. ADDRESS OF OPERATOR 152 North Durbin, Casper, Wyoming 82601	9. WELL NO. 7
4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.* See also space 17 below.) At surface 1485' FNL, 793' FWL	10. FIELD AND POOL, OR WILDCAT Mesaverde E. San Juan - Pictured C.
14. PERMIT NO.	15. ELEVATIONS (Show whether DF, RT, GR, etc.) 6565' GR, 6577' KB
	11. SEC., T., R., M., OR BLK. AND SURVEY OR AREA Sec. 20, T29N, R4W
	12. COUNTY OR PARISH Rio Arriba
	13. STATE New Mexico

## 16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

## NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF	<input type="checkbox"/>	PULL OR ALTER CASING	<input type="checkbox"/>
FRACTURE TREAT	<input type="checkbox"/>	MULTIPLE COMPLETE	<input type="checkbox"/>
SHOOT OR ACIDIZE	<input type="checkbox"/>	ABANDON*	<input type="checkbox"/>
REPAIR WELL	<input type="checkbox"/>	CHANGE PLANS	<input type="checkbox"/>
(Other)	<input type="checkbox"/>		<input type="checkbox"/>

## SUBSEQUENT REPORT OF:


WATER SHUT-OFF	<input type="checkbox"/>	REPAIRING WELL	<input type="checkbox"/>
FRACTURE TREATMENT	<input type="checkbox"/>	ALTERING CASING	<input type="checkbox"/>
SHOOTING OR ACIDIZING	<input type="checkbox"/>	ABANDONMENT*	<input type="checkbox"/>
(Other)	<input checked="" type="checkbox"/>	Well Progress 5-24-74	<input checked="" type="checkbox"/>

(NOTE: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

## 17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)\*

Moved in completion unit 5 19-74. Perforated Mesaverde 5377-83' and 5386-91' with 2 JSRR. Fractured Mesaverde down annulus with 30,000 gal. "E-Z" Frac" containing 2½% HCl acid, 30#/1000 gal. J-160, 25#/1000 gal. ADOMITE AQUA, 3 gal./1000 gal. F-75, and 30,000# 10-20 sand. 540,360 SCF of CO<sub>2</sub> as follows: 6,344 gal. "E-Z-frac" pad and CO<sub>2</sub>; 4,000 gal. "E-Z-frac" with ½#/gal. 10-20 sand and CO<sub>2</sub>; 6,000 gal. "E-Z-frac" with 1#/gal. 10-20 sand and CO<sub>2</sub>; 8,656 gal. "E-Z-frac" with 1½#/gal. 10-20 sand and CO<sub>2</sub>; 5,000 gal. "E-Z-frac" with 2#/gal. 10-20 sand and CO<sub>2</sub>.

Recovering load water.

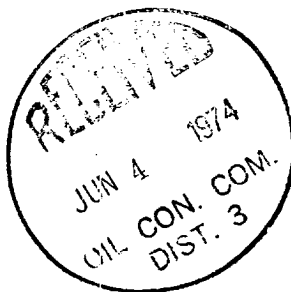

USGS(5) File

18. I hereby certify that the foregoing is true and correct

SIGNED

*J. A. Cohen*

TITLE Administrative Supervisor

DATE May 29, 1974

(This space for Federal or State office use)

APPROVED BY

CONDITIONS OF APPROVAL, IF ANY:

TITLE

DATE

\*See Instructions on Reverse Side