

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

SUBMIT IN TRIPLICATE*
(Other instructions on re-
verse side)

Form approved.
Budget Bureau No. 42-R1424.

5. LEASE DESIGNATION AND SERIAL NO.

SF 080377

6. IF INDIAN, ALLOTTEE OR TRIBE NAME

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.
Use "APPLICATION FOR PERMIT—" for such proposals.)

1.

OIL WELL ☐ GAS WELL ☒ OTHER

2. NAME OF OPERATOR

Northwest Pipeline Corporation

3. ADDRESS OF OPERATOR

P.O. Box 90, Farmington, New Mexico 87401

4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.*

See also space 17 below.)
At surface

1450' FNL & 1620' FWL

7. UNIT AGREEMENT NAME

San Juan 29-6 Unit

8. FARM OR LEASE NAME

San Juan 29-6 Unit

9. WELL NO.

72A

10. FIELD AND POOL, OR WILDCAT

Blanco Mesa Verde

11. SEC., T., R., M., OR BLK. AND
SURVEY OR AREA

Sec. 22, T29N, R6W

12. COUNTY OR PARISH 13. STATE

Rio Arriba

N.M.

14. PERMIT NO.

15. ELEVATIONS (Show whether DF, RT, GR, etc.)

6365' GR

16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF

☐
☐
☐
☐
☐

PULL OR ALTER CASING

☐
☐
☐
☐
☐

MULTIPLE COMPLETE

ABANDON*

CHANGE PLANS

REPAIR WELL

(Other)

SUBSEQUENT REPORT OF:

WATER SHUT-OFF

☐
☐
☐
☐
☐

REPAIRING WELL

ALTERING CASING

ABANDONMENT*

SHOOTING OR ACIDIZING

(Other) "Spud and Surface Casing"


☒

(NOTE: Report results of multiple completion on Well
Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

4-22-77 MOL & RU. Spud at 2:30 PM. Drilled 12 1/4" hole to 204'. Ran 181' of 9 5/8", 32.3#, H-40 casing set at 194'. Cemented with 125 sks. C1. "B" w/3% CC and 1/4# gel flake per sk. Cement circulated. WOC.

4-23-77 Tested csg. to 600 PSI for 30 minutes, OK.

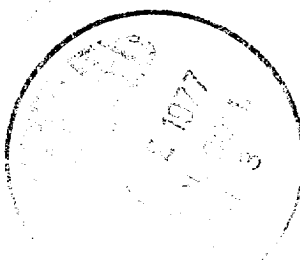

APR 27

U. S. GEOLOGICAL SURVEY

18. I hereby certify that the foregoing is true and correct

SIGNED

D.H. Maroncelli
D.H. Maroncelli

TITLE

Drilling Engineer

DATE

4/27/77

(This space for Federal or State office use)

APPROVED BY

TITLE

DATE

CONDITIONS OF APPROVAL, IF ANY:

*See Instructions on Reverse Side