
DEC 3 0 1997

DEPUTY OIL & GAS INSPECTOR cation Name: THREE STATES COM LS #1 SC-16 UL-L 1 - State NMOCD Zone: OUTSIDE **Hazard Ranking Score:00**

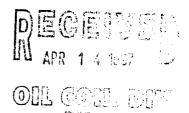

RATIONALE FOR RISK-BASED CLOSURE OF PRODUCTION PITS LOCATED OUTSIDE OF THE VULNERABLE ZONE IN THE SAN JUAN BASIN

This production pit location was ranked according to the criteria in the New Mexico Oil Conservation Division's Unlined Surface Impoundment Closure Guidelines and received a ranking score of zero. The estimated depth to groundwater is greater than 100-feet beneath ground surface (bgs), the pit is not in a well head protection area, and there are no surface water bodies within 1,000 horizontal feet of the pit location.

The primary source, discharge to the pit has been removed. There has been no discharge to the pits for at least 4 years and the pits have been closed for at least one year.

Each pit was backfilled with clean soil and graded in a manner to divert precipitation away from the excavated area. Minimal infiltration of rainfall is expected. Any rainfall that does infiltrate the ground surface must migrate through clean backfill before reaching the residual hydrocarbons.

There is no source material at the ground surface, so direct contact of hydrocarbons with livestock and the populous is not likely.

In general, outside of the vulnerable area and alluvial valleys, bedrock material is generally encountered within 20 feet of the ground surface. Bedrock material in the San Juan Basin consists of interbedded sandstones, shales and clays. According to Freeze and Cherry, 1979, the hydraulic conductivity of the bedrock material are as follows:

 10^{-9} to 10^{-13} cm/sec 10^{-12} to 10^{-16} cm/sec 10^{-12} to 10^{-15} cm/sec Sandstone Shale Clay

Based on this information, the residual hydrocarbons should not migrate to groundwater.

Natural process (bioremediation) are degrading the residual hydrocarbon to carbon dioxide and water and will continue until the source is gone, therefore minimizing any impact to the environment.

Based on the above information, it is highly unlikely that any source material will impact groundwater or ever find an exposure pathway to affect human health and therefore El Paso Field Services Company (EPFS) requests closure of this pit location.



FIELD PIT SITE ASSESSMENT FORM


GENERAL	Meter: 70696 Location: THREE STATES COM LS #/ Operator #: 0203 Operator Name: Aroco P/L District: Blown Field Coordinates: Letter: Section 16 Township: 29 Range: 8 Or Latitude Longitude Pit Type: Dehydrator X Location Drip: Line Drip: Other: Site Assessment Date: 5-13-94 Area: 10 Run: 92			
SITE ASSESSMENT	NMOCD Zone: Land Type: BLM (1) (From NMOCD State ★ (2) Maps) Inside (1) Fee (3) Outside ★ (2) Indian Indian Depth to Groundwater (1) (1) Less Than 50 Feet (20 points) (1) 50 Ft to 99 Ft (10 points) (2) Greater Than 100 Ft (0 points) ★ (3)			
	Wellhead Protection Area: Is it less than 1000 ft from wells, springs, or other sources of fresh water extraction?, or; Is it less than 200 ft from a private domestic water source? ☐ (1) YES (20 points) ☒ (2) NO (0 points)			
	Horizontal Distance to Surface Water Body Less Than 200 Ft (20 points) (1) 200 Ft to 1000 Ft (10 points) (2) Greater Than 1000 Ft (0 points) (3) Name of Surface Water Body			
	(Surface Water Body : Perennial Rivers,Major Wash,Streams,Creeks, Irrigation Canals,Ditches,Lakes,Ponds) Distance to Nearest Ephemeral Stream □ (1) < 100'(Navajo Pits Only) □ (2) > 100'			
	TOTAL HAZARD RANKING SCORE: POINTS			
REMARKS	Remarks: DEHYDRATOR DISCHARGING INTO PIT. PIT FULL OF BILY LIQUID. REDLINE - INSIDE VULNERABLE ZONE - TOPO SIDE VILNERABLE ZONE ONE PIT ON LOCATION			

REMARKS

ORIGINAL	חזת	TOCATION
ORIGINAL	PIT	LUCATION

Original Pit : a) Degrees from North $\frac{96}{6}$ Footage from Wellhead $\frac{62}{6}$

b) Length : 4/ Width : 25' Depth : 5'

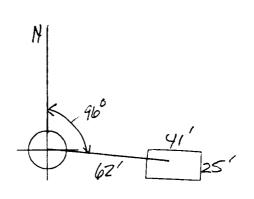

Remarks	:

RUNNING OF THE STATE OF

PHOTOGRAPHS AH-4(6-9)

CAKED KETH RODDY EPNG BLOOMFIELD - DEHY HAS BEIEN TAKEN OVER

BY AMOCO.

Completed By:

Aller Signature

*5-13-94*Date

FIE_ PIT REMEDIATION/CLOSU_E FORM

GENERAL	Meter: 70690 Location: Three statescom 15 # 1 Coordinates: Letter: Section 16 Township: Range: _8 Or					
FIELD OBSERVATIONS	Sample Number(s): MK 3/ Sample Depth: 13' Feet Final PID Reading 180 PID Reading Depth 12' Feet Yes No Groundwater Encountered □ (1) □ (2) Approximate Depth — Feet					
CLOSURE	Remediation Method: Excavation					
REMARKS	Remarks: pit Had 6" to 8" water & oil In pettom soil is light Gray Sand strong HYDro carbon edor EPNG lives were marked					
1	Signature of Specialist: Mogan Kilsian					



FIELD SERVICES LABORATORY ANALYTICAL REPORT PIT CLOSURE PROJECT - Soil

SAMPLE IDENTIFICATION

	Field	ID		Lab iD		
SAMPLE NUMBER:	MK 31		945	945510		
MTR CODE SITE NAME:	70690			N/A		
SAMPLE DATE TIME (Hrs):	Le - 23-	عدا	مار	1622		
SAMPLED BY:		V/A				
DATE OF TPH EXT. ANAL.:	6/27/94		6/27/94			
DATE OF BTEX EXT. ANAL.:	N N		NA	NA		
TYPE DESCRIPTION:	TYPE DESCRIPTION: V G		2 word	Brown Fine Sand		
REMARKS:		250111 70				
	<u> </u>	RESULTS				
PARAMETER	RESULT	UNITS	QUALIFIERS DF Q M(g) V(ml)			
BENZENE		MG/KG				
TOLUENE		MG/KG				
THYL BENZENE		MG/KG				
TOTAL XYLENES		MG/KG				
TOTAL BTEX		MG/KG				
TPH (418.1)	13,900	MG/KG			0.78	28
HEADSPACE PID	280	PPM				
PERCENT SOLIDS	93.1	%				
	- TPH is by EPA Method 41					
e Surrogate Recovery was at rrative:	NIA	% for this samp	le All QA/QC	was accep	otable.	

7/14/04

Date:

= Dilution Factor Used

