

(SUBMIT IN TRIPLICATE)

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

Land Office **Santa Fe**
Lease No. **SF-078132**
Unit **Annie L. Elliott "A"**

X			

SUNDRY NOTICES AND REPORTS ON WELLS

NOTICE OF INTENTION TO DRILL	SUBSEQUENT REPORT OF WATER SHUT-OFF	8-5/8" X
NOTICE OF INTENTION TO CHANGE PLANS	SUBSEQUENT REPORT OF SHOOTING OR ACIDIZING	RECEIVED NOV 7 1961 U. S. GEOLOGICAL SURVEY FARMINGTON, NEW MEXICO
NOTICE OF INTENTION TO TEST WATER SHUT-OFF	SUBSEQUENT REPORT OF ALTERING CASING	
NOTICE OF INTENTION TO RE-DRILL OR REPAIR WELL	SUBSEQUENT REPORT OF RE-DRILLING OR REPAIR	
NOTICE OF INTENTION TO SHOOT OR ACIDIZE	SUBSEQUENT REPORT OF ABANDONMENT	
NOTICE OF INTENTION TO PULL OR ALTER CASING	SUPPLEMENTARY WELL HISTORY	
NOTICE OF INTENTION TO ABANDON WELL		

(INDICATE ABOVE BY CHECK MARK NATURE OF REPORT, NOTICE, OR OTHER DATA)

Annie L. Elliott "A"

Farmington, New Mexico November 6, 1961

Well No. 2 is located 1085 ft. from N line and 1010 ft. from W line of sec. 11

NW/4 NW/4 of Section 11 T-29-N R-9-W N.M.P.M.
(1/4 Sec. and Sec. No.) (Twp.) (Range) (Meridian)


Blanco Pictured Cliffs San Juan New Mexico
(Field) (County or Subdivision) (State or Territory)

The elevation of the derrick floor above sea level is _____ ft. (To be reported later)

DETAILS OF WORK

(State names of and expected depths to objective sands; show sizes, weights, and lengths of proposed casings; indicate mudding jobs, cementing points, and all other important proposed work)

Spudded 12-1/4" hole November 1, 1961. Set 8-5/8" casing at 212' with 125 sacks Incon cement containing 2 percent Calcium Chloride and failed to circulate. Found top cement at 66'. Re-cemented through 1" pipe with 40 sacks Incon cement and circulated to surface. After waiting on cement, tested 8-5/8" casing with 400 psi for 15 minutes, which held with no indication of pressure drop. Reduced hole to 7-7/8" at 212' and resumed drilling operations.

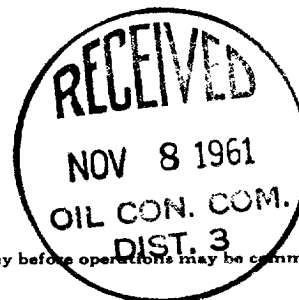

I understand that this plan of work must receive approval in writing by the Geological Survey before operations may be commenced.

Company Pan American Petroleum Corporation

Address P. O. Box 480

Farmington, New Mexico

Attn: L. O. Spear, Jr.

ORIGINAL SIGNED BY
R. M. Bauer, Jr.

By _____

Title Senior Petroleum Engineer