

(SUBMIT IN TRIPLICATE)

UNITED STATES  
DEPARTMENT OF THE INTERIOR  
GEOLOGICAL SURVEY

Land Office Santa Fe  
Lease No. 080711-B  
Unit San Juan 30-6 Unit  
14-08-001-538

SUNDRY NOTICES AND REPORTS ON WELLS

NOTICE OF INTENTION TO DRILL	SUBSEQUENT REPORT OF WATER SHUT-OFF	<div style="text-align: right;"> RECEIVED JUL 2 1959 U.S. GEOLOGICAL SURVEY FARMINGTON, N.M. X </div>
NOTICE OF INTENTION TO CHANGE PLANS	SUBSEQUENT REPORT OF SHOOTING OR ACIDIZING	
NOTICE OF INTENTION TO TEST WATER SHUT-OFF	SUBSEQUENT REPORT OF ALTERING CASING	
NOTICE OF INTENTION TO RE-DRILL OR REPAIR WELL	SUBSEQUENT REPORT OF RE-DRILLING OR REPAIR	
NOTICE OF INTENTION TO SHOOT OR ACIDIZE	SUBSEQUENT REPORT OF ABANDONMENT	
NOTICE OF INTENTION TO PULL OR ALTER CASING	SUPPLEMENTARY WELL HISTORY	
NOTICE OF INTENTION TO ABANDON WELL	<u>Water Free.</u>	

(INDICATE ABOVE BY CHECK MARK NATURE OF REPORT, NOTICE, OR OTHER DATA)

July 2, 1959

Well No. 31 (40) is located 790 ft. from S line and 1350 ft. from W line of sec. 33

S. Sec. 33 (1/4 Sec. and Sec. No.) 30N (Twp.) 6E (Range) N.M.L.M. (Meridian)


Blanco M. V. & Wildcat Dak. (Field) Rio Arriba (County or Subdivision) New Mexico (State or Territory)

The elevation of the derrick floor above sea level is 6367 ft.

DETAILS OF WORK

(State names of and expected depths to objective sands; show sizes, weights, and lengths of proposed casings; indicate mudding jobs, cementing points, and all other important proposed work)

6-15-59 Total Depth 7870'. C.O.T.D. 7800'. Water fractured Dakota perf. int. 7635-40; 7648-55; 7676-87; 7711-25; 7742-45; 7753-63 (2 DJ/ft.) w/54,000 gallons water and 54,000# sand. BD pr. 3100#, max. pr. 3500#, avg. tr. pr. 3100-3000-3200-3400-3500#. I.R. 51 BPM. Flush 3000 gallons.

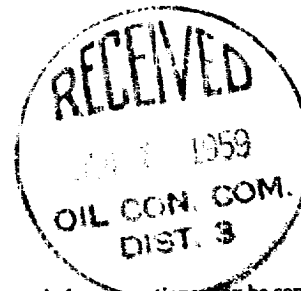

I understand that this plan of work must receive approval in writing by the Geological Survey before operations may be commenced.

Company El Paso Natural Gas Company

Address Box 997

Farmington, New Mexico

By ORIGINAL SIGNED H.E. McANALLY

Title Petroleum Engineer