

(SUBMIT IN TRIPLICATE)

UNITED STATES  
DEPARTMENT OF THE INTERIOR  
GEOLOGICAL SURVEY

Budget Bureau No. 42-R328.4  
Approval expires 12-31-60.

Land Office Santa Fe  
Lease No. 079488  
Unit San Juan 30-4 Unit  
14-00-001-1056

SUNDRY NOTICES AND REPORTS ON WELLS

NOTICE OF INTENTION TO DRILL.....	SUBSEQUENT REPORT OF WATER SHUT-OFF.....
NOTICE OF INTENTION TO CHANGE PLANS.....	SUBSEQUENT REPORT OF SHOOTING OR ACIDIZING.....
NOTICE OF INTENTION TO TEST WATER SHUT-OFF.....	SUBSEQUENT REPORT OF ALTERING CASING.....
NOTICE OF INTENTION TO RE-DRILL OR REPAIR WELL.....	SUBSEQUENT REPORT OF RE-DRILLING OR REPAIR.....
NOTICE OF INTENTION TO SHOOT OR ACIDIZE.....	SUBSEQUENT REPORT OF ABANDONMENT.....
NOTICE OF INTENTION TO PULL OR ALTER CASING.....	SUPPLEMENTARY WELL HISTORY.....
NOTICE OF INTENTION TO ABANDON WELL.....	

(INDICATE ABOVE BY CHECK MARK NATURE OF REPORT, NOTICE, OR OTHER DATA)

September 11, 1958

Well No. 251 is located 2700 ft. from N line and 800 ft. from E line of sec. 31


10/4 Sec. 31 30N 4W N.M.T.M.  
(1/4 Sec. and Sec. No.) (Twp.) (Range) (Meridian)  
Blanco M. V. Rio Arriba New Mexico  
(Field) (County or Subdivision) (State or Territory)

The elevation of the derrick floor above sea level is 7503 ft.

DETAILS OF WORK

(State names of and expected depths to objective sands; show sizes, weights, and lengths of proposed casings; indicate mudding jobs, cementing points, and all other important proposed work)

Total depth 4500'.  
Run 107 joints 7 5/8", 26.4#, J-55 casing (4570') set at 4579'  
w/50 sacks Dixie, 50 sacks regular cement w/2 1/2 Gal & 25 cu. ft.  
Strata Grite 6' followed by 50 sacks Neat.  
Held 1000#/30 minutes.  
Top of cement by temperature survey at 4250'.

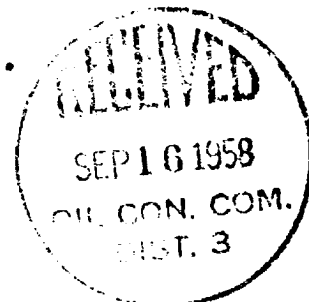

I understand that this plan of work must receive approval in writing by the Geological Survey before operations may be commenced.

Company El Paso Natural Gas Company  
Address Box 107  
El Paso, New Mexico  
Original Signed By: D. W. Meehan  
By Petroleum Engineer  
Title Petroleum Engineer