

(SUBMIT IN TRIPLICATE)

UNITED STATES  
DEPARTMENT OF THE INTERIOR  
GEOLOGICAL SURVEY

Land Office New Mexico

Lease No. 9330

Unit San Juan 30-6 Unit  
24-xx-001-530

SUNDRY NOTICES AND REPORTS ON WELLS

|                                                |                                            |
|------------------------------------------------|--------------------------------------------|
| NOTICE OF INTENTION TO DRILL                   | SUBSEQUENT REPORT OF WATER SHUT-OFF        |
| NOTICE OF INTENTION TO CHANGE PLANS            | SUBSEQUENT REPORT OF SHOOTING OR ACIDIZING |
| NOTICE OF INTENTION TO TEST WATER SHUT-OFF     | SUBSEQUENT REPORT OF ALTERING CASING       |
| NOTICE OF INTENTION TO RE-DRILL OR REPAIR WELL | SUBSEQUENT REPORT OF RE-DRILLING OR REPAIR |
| NOTICE OF INTENTION TO SHOOT OR ACIDIZE        | SUBSEQUENT REPORT OF ABANDONMENT           |
| NOTICE OF INTENTION TO PULL OR ALTER CASING    | SUPPLEMENTARY WELL HISTORY                 |
| NOTICE OF INTENTION TO ABANDON WELL            | <u>Water Frac.</u>                         |

(INDICATE ABOVE BY CHECK MARK NATURE OF REPORT, NOTICE, OR OTHER DATA)

September 19, 1951


Well No. 11 is located 600 ft. from N line and 1500 ft. from E line of sec. 10  
SW/4 sec. 10  
(1/4 Sec. and Sec. No.) (Twp.) (Range) (Meridian)  
Blanco (Field) San Juan (County or Subdivision) New Mexico (State or Territory)

The elevation of the derrick floor above sea level is 6040 ft.

DETAILS OF WORK

(State names of and expected depths to objective sands; show sizes, weights, and lengths of proposed casings; indicate mudding jobs, cementing points, and all other important proposed work)

9-11-51 Total Depth 5534'. Plug back T. D. 5-30'. Water fraced. Menefee  
perf. Int. 5534-5510; 5785-5805; 5755-5775 w/2DJ/ft. w/52,000 gal,  
water and 53,000 sand. Breakdown pressure 1700, maximum pressure  
3000, average treating pressure 1900, 1700, 1500, 2000. IR  
4, BPM. Flush 6000 gallons. Dropped 3 sets of 20 balls each.  
9-17-51 Total Depth 5534', Temporary bridge plug at 5700'. Water fraced  
Cliff House perf. Int. 5493-55' w/2DJ/ft. w/37,002 gals. water and  
40,000 sand. Breakdown pressure 1700, max. pr. 1800, avg. tr. pr.  
1500. IR 7.5 BPM. Flush 6000 gallons.

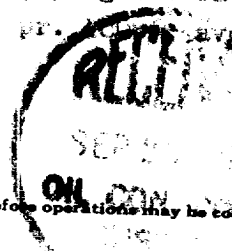

I understand that this plan of work must receive approval in writing by the Geological Survey before operations may be commenced.

Company El Paso Natural Gas Company

Address Box 307

Farmington, New Mexico

Original Signed D. C. Johnston

By \_\_\_\_\_

Title Petroleum Engineer