


Form 9-331a  
(Feb. 1951)

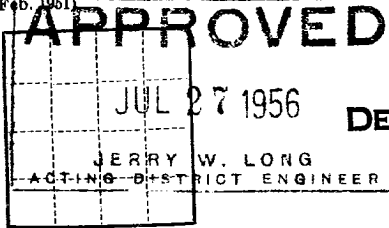

(SUBMIT IN TRIPLICATE)

UNITED STATES  
DEPARTMENT OF THE INTERIOR  
GEOLOGICAL SURVEY

Land Office Santa Fe  
Lease No. 079483  
Unit San Juan 30-4 Unit  
14-08-001-1056

## SUNDRY NOTICES AND REPORTS ON WELLS

NOTICE OF INTENTION TO DRILL	SUBSEQUENT REPORT OF WATER SHUT-OFF	<input checked="" type="checkbox"/>
NOTICE OF INTENTION TO CHANGE PLANS	SUBSEQUENT REPORT OF SHOOTING OR ACIDIZING	
NOTICE OF INTENTION TO TEST WATER SHUT-OFF	SUBSEQUENT REPORT OF ALTERING CASING	
NOTICE OF INTENTION TO RE-DRILL OR REPAIR WELL	SUBSEQUENT REPORT OF RE-DRILLING OR REPAIR	
NOTICE OF INTENTION TO SHOOT OR ACIDIZE	SUBSEQUENT REPORT OF ABANDONMENT	
NOTICE OF INTENTION TO PULL OR ALTER CASING	SUPPLEMENTARY WELL HISTORY	
NOTICE OF INTENTION TO ABANDON WELL		

(INDICATE ABOVE BY CHECK MARK NATURE OF REPORT, NOTICE, OR OTHER DATA)

July 6, 1956

Well No. 12 is located 1340 ft. from N line and 1190 ft. from W line of sec. 8  
Section 8 (1/4 Sec. and Sec. No.) 30N (Twp.) 4E (Range) 124N (Meridian)  
E. Blanco P.C. (Field) El Arriba (County or Subdivision) New Mexico (State or Territory)

The elevation of the derrick floor above sea level is 7073 ft.

### DETAILS OF WORK

(State names of and expected depths to objective sands; show sizes, weights, and lengths of proposed casings; indicate mudlogging jobs, cementing points, and all other important proposed work)

7-3-56. Total Depth 4172'.  
Run 129 joints 5 1/2", 15.50#, J-55 casing (4148') set at 4158' with 125 sacks  
regular cement, 125 sacks Fomix, 4# Gel, 1/4# Floccula/sk.  
Held 1000# 30 minutes.  
Top of cement by temperature survey at 3135'.

I understand that this plan of work must receive approval in writing by the Geological Survey before operations may be commenced.

Company El Paso Natural Gas Company

Address Box 971

Parlington, New Mexico

By [Signature]

Title Petroleum Engineer