

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEYSUBMIT IN TRIPLICATE*
(Other instructions on re-
verse side)Form approved.
Budget Bureau No. 42-R1424.

5. LEASE DESIGNATION AND SERIAL NO.

SF 079060

6. IF INDIAN, ALLOTTEE OR TRIBE NAME

7. UNIT AGREEMENT NAME

Northeast Blanco Unit

Agreement No. 1, Sec. 929

8. FARM OR LEASE NAME

Northeast Blanco Unit

9. WELL NO.

4A

10. FIELD AND POOL, OR WILDCAT

Blanco Mesaverde

11. SEC., T., R., M., OR BLK. AND
SURVEY OR AREA

D-21-30N-7W

12. COUNTY OR PARISH

Rio Arriba

13. STATE

New Mexico

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.
Use "APPLICATION FOR PERMIT—" for such proposals.)1. OIL ☐ WELL GAS ☒ WELL OTHER ☐

2. NAME OF OPERATOR

Blackwood & Nichols Co., Ltd.

3. ADDRESS OF OPERATOR

P.O. Box 1237, Durango, Colorado 81301

4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.*
See also space 17 below.)
At surface

990' F/NL - 990' F/WL

14. PERMIT NO.

15. ELEVATIONS (Show whether OF, RT GR, etc.)

6264' GL

16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

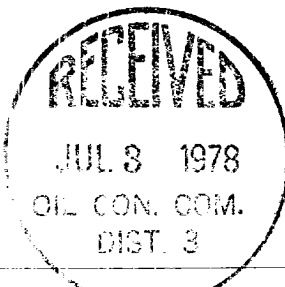
NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF ☐FRACTURE TREAT ☐SHOOT OR ACIDIZE ☐REPAIR WELL ☐(Other) ☐PULL OR ALTER CASING ☐MULTIPLE COMPLETE ☐ABANDON* ☐CHANGE PLANS ☐

SUBSEQUENT REPORT OF:

WATER SHUT-OFF ☒FRACTURE TREATMENT ☐SHOOTING OR ACIDIZING ☐(Other) ☐REPAIRING WELL ☐ALTERING CASING ☐ABANDONMENT* ☐Casing and Cement Record XX
(NOTE: Report results of multiple completion on Well
Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

6-17-78 Spudded 12 1/4" hole at 3:45 PM, 6-17-78, Ran 7 jts 9 5/8" 36.00# H-40 casing; 222' set at 234' cemented with 150 sacks of Class B cement with 2% CaCl₂, 1/4# flocele/sack. Plug down at 8:30 PM, 6-17-78. Tested casing with 1000 PSI for thirty minutes, held OK.6-23-78 Ran 88 jts 7" 23.00# Grade K casing; 3548' set at 3560', cemented with 300 sacks class B cement with 2% CaCl₂ and 1/4# flocele/sack. Ran temperature survey; top of cement 1550'. Tested casing with 1000 PSI for thirty minutes, held OK.6-26-78 Ran 57 jts 4 1/2" 10.50# K casing; 2434' set at 5815'; top of liner at 3381'; cemented with 300 sacks of 50-50 Poz mix with 2% CaCl₂, 1/4# flocele, 6 1/4# Gilsonite, 0.6% FLA. Reversed out sixteen bbls cement.

RECEIVED

JUN 29 1978

U. S. GEOLOGICAL SURVEY
DURANGO, COLO.

18. I hereby certify that the foregoing is true and correct

SIGNED

DeLass6 Loos

TITLE

District Manager

DATE

6-28-78

(This space for Federal or State office use)

APPROVED BY

TITLE

DATE

CONDITIONS OF APPROVAL, IF ANY:

*See Instructions on Reverse Side