

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir. Use Form 9-331-C for such proposals.)

1. oil well ☐ gas well ☒ other

2. NAME OF OPERATOR
Northwest Pipeline Corporation

3. ADDRESS OF OPERATOR
P.O. Box 90, Farmington, N.M. 87401

4. LOCATION OF WELL (REPORT LOCATION CLEARLY. See space 17 below.)
AT SURFACE: 900' FNL & 1760' FEL
AT TOP PROD. INTERVAL: Same as above
AT TOTAL DEPTH: Same as above

16. CHECK APPROPRIATE BOX TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

REQUEST FOR APPROVAL TO:

TEST WATER SHUT-OFF ☐
FRACTURE TREAT ☐
SHOOT OR ACIDIZE ☐
REPAIR WELL ☐
PULL OR ALTER CASING ☐
MULTIPLE COMPLETE ☐
CHANGE ZONES ☐
ABANDON* ☐
(other) ☒ Drlg Operations X

SUBSEQUENT REPORT OF:

☐
☐
☐
☐
☐
☐
☐
☐
☐
☐

5. LEASE
SF 078997

6. IF INDIAN, ALLOTTEE OR TRIBE NAME

7. UNIT AGREEMENT NAME
San Juan 30-5 Unit

8. FARM OR LEASE NAME
San Juan 30-5 Unit

9. WELL NO.
#73

10. FIELD OR WILDCAT NAME
Basin Dakota

11. SEC., T., R., M., OR BLK. AND SURVEY OR AREA
Sec 10, T30N, R5W


12. COUNTY OR PARISH
Rio Arriba

13. STATE
New Mexico

14. API NO.
30-039-22572

15. ELEVATIONS (SHOW DF, KDB, AND WD)
6537' GR

(NOTE: Report results of multiple completion or zone change on Form 9-330)

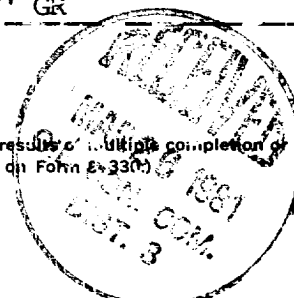

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

3-7-81 Drlg to a depth of 8035'.

3-8-81 GO Ran IES & SNP/CDL/GR Logs. Ran 204 jts (8021') of 4-1/2" (1295' of 11.6# & 6726' of 10.5#) K-55, ST&C & set @ 8035' KB. Float collar @ 8022'. National cmt'ed w/ 260 sx Cl "B" w/ 8% gel, 12-1/2# gilsonite/sx & 0.4% CDR-4. Tailed w/ 100 sx Cl "B" w/ 1/4# fine tuf-plug/sx & 0.4% CDR-4. Plug displaced w/ 125 bbls wtr & down @ 1915 hrs 3-8-81.

3-9-81 Rig released @0400 hrs. Wilson ran temp survey and found cmt top at 2600' w/ PBTD W 7958'.

NOW WAITING ON COMPLETION.

Subsurface Safety Valve: Manu. and Type _____

I hereby certify that the foregoing is true and correct

SIGNED Thomas J. Brace TITLE Production Clerk DATE 3-17-81

(This space for Federal or State office use)

APPROVED BY _____
CONDITIONS OF APPROVAL, IF ANY:

TITLE _____ DATE _____

ACCEPTED FOR RECORD

CONFIDENTIAL

*See Instructions on Reverse Side

MAR 24 1981

FARMINGTON DISTRICT

djb/