

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir. Use Form 9-331-C for such proposals.)

1. oil well ☐ gas well ☒ other

2. NAME OF OPERATOR
Northwest Pipeline Corporation

3. ADDRESS OF OPERATOR
P.O. Box 90, Farmington, N.M. 87401

4. LOCATION OF WELL (REPORT LOCATION CLEARLY. See space 17 below.)
AT SURFACE: 805' FSL & 820' FWL
AT TOP PROD. INTERVAL: Same as above
AT TOTAL DEPTH: Same as above

16. CHECK APPROPRIATE BOX TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

REQUEST FOR APPROVAL TO:

TEST WATER SHUT-OFF ☐
FRACTURE TREAT ☐
SHOOT OR ACIDIZE ☐
REPAIR WELL ☐
PULL OR ALTER CASING ☐
MULTIPLE COMPLETE ☐
CHANGE ZONES ☐
ABANDON* ☐
(other) ☒ Drlg Operations


SUBSEQUENT REPORT OF:

☐
☐
☐
☐
☐
☐
☐
☒

RECEIVED
MAR 02 1981

U. S. GEOLOGICAL SURVEY
FARMINGTON, N. M.

(NOTE: Report results of multiple completion or zone change on Form 9-330.)

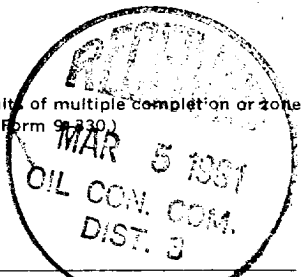

5. LEASE
SF 078997

6. IF INDIAN, ALLOTTEE OR TRIBE NAME

7. UNIT AGREEMENT NAME
San Juan 30-5 Unit

8. FARM OR LEASE NAME
San Juan 30-5 Unit

9. WELL NO.
#72

10. FIELD OR WILDCAT NAME
Basin Dakota

11. SEC., T., R., M., OR BLK. AND SURVEY OR AREA
Sec 10, T30N, R5W

12. COUNTY OR PARISH
Rio Arriba

13. STATE
New Mexico

14. API NO.
30-039-22573

15. ELEVATIONS (SHOW DF, KDB, AND WD)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*
2-24-81 Drlg ahead.

2-25-81 GO ran IEL & SNP/CDL/GR Logs. Loggers TD @ 7875'. Ran 190 jts (7858') of 4-1/2" (1186' of 11.6# & 6667' of 10.5#), K-55, ST&C & set at 7872'. BJ cmt'ed w/ 260 sx Cl "B" w/ 8% gel, 12-1/2# fine gils/sx & 0.4% HR-4. Tailed w/ 100 sx Cl "B" w/ 1/4# tuf-plug/sx & 0.4% HR-4. Plug displaced w/ 121.5 bbls of wtr & down at 1715 hrs. Wilson ran temp survey & found cmt top @ 2600' w/ PBTD @ 7860'. Rig released @ 2100 hrs.

NOW WAITING ON COMPLETION.

Subsurface Safety Valve: Manu. and Type _____ Set @ _____ Ft.

18. I hereby certify that the foregoing is true and correct

SIGNED Donna J. Brace TITLE Production Clerk DATE 2-26-81
Donna J. Brace

(This space for Federal or State office use)

APPROVED BY _____ TITLE _____ DATE _____
CONDITIONS OF APPROVAL, IF ANY:

CONFIDENTIAL

NMOCC

ACCEPTED FOR RECORD

MAR 4 1981

FARMINGTON DISTRICT

*See Instructions on Reverse Side

dib/