

NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	
FILE	
U.S.G.S.	
LAND OFFICE	
OPERATOR	

NEW MEXICO OIL CONSERVATION COMMISSION

Form C-103
Supersedes Old
C-102 and C-103
Effective 1-1-65

5a. Indicate Type of Lease	
State <input type="checkbox"/>	Fee <input checked="" type="checkbox"/>
5. State Oil & Gas Lease No.	

SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR.
USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)

1. <input type="checkbox"/> OIL WELL <input checked="" type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER-		7. Unit Agreement Name
2. Name of Operator Southland Royalty Company		8. Farm or Lease Name Simms Federal
3. Address of Operator P.O. Drawer 570, Farmington, New Mexico 87401		9. Well No. 1
4. Location of Well UNIT LETTER <u>J</u> , <u>1730</u> FEET FROM THE <u>South</u> LINE AND <u>1820</u> FEET FROM THE <u>East</u> LINE, SECTION <u>13</u> TOWNSHIP <u>30 North</u> RANGE <u>4 West</u> NMPM.		10. Field and Pool, or Wildcat East Blanco P.C./ Basin Dakota
15. Elevation (Show whether DF, RT, GR, etc.) 7023' GL		12. County Rio Arriba

Check Appropriate Box To Indicate Nature of Notice, Report or Other Data
NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK <input type="checkbox"/>	PLUG AND ABANDON <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	OTHER <input type="checkbox"/>


SUBSEQUENT REPORT OF:

REMEDIAL WORK <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
COMMENCE DRILLING OPNS. <input type="checkbox"/>	PLUG AND ABANDONMENT <input type="checkbox"/>
CASING TEST AND CEMENT JOB <input type="checkbox"/>	OTHER <u>Abandon Lower Dakota Perfs.</u> <input checked="" type="checkbox"/>

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

- 8-22-81 Set CIBP at 8650'. Perforated from 8633'-8636' (4 holes) with 1 SPF. Acidized with 500 gallons 15% HCl.
- 8-23-81 Swab tested well. Recovered 202.5 barrels water, no oil or gas. Total load fluid 54.5 barrels. Plug and abandoned by setting cement retainer at 8608'. Squeezed with 35 sacks of Class "B" cement.

VERBAL APPROVAL from Charles Gholson on 8/22/81.

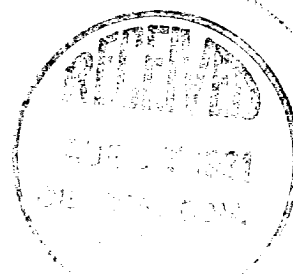

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED R. E. Fielder TITLE District Engineer DATE August 25, 1981

APPROVED BY Original Signed by FRANK T. CHAVEZ TITLE SUPERVISOR DISTRICT # 3 DATE AUG 27 1981

CONDITIONS OF APPROVAL, IF ANY: