
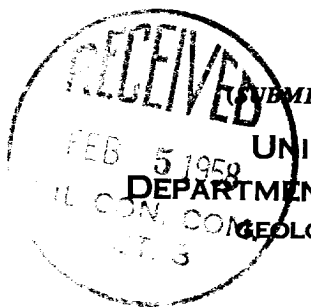


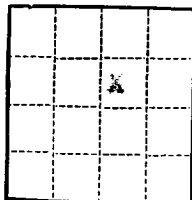

(SUBMIT IN TRIPPLICATE)

 UNITED STATES
 DEPARTMENT OF THE INTERIOR
 GEOLOGICAL SURVEY
Budget Bureau No. 42-R358.4
Approval expires 12-31-60.Land Office Santa FeLease No. 077002Unit Grubbing

SUNDRY NOTICES AND REPORTS ON WELLS

RECEIVED

FEB 4 1958

NOTICE OF INTENTION TO DRILL.....	SUBSEQUENT REPORT OF WATER SHUT-OFFS.....	
NOTICE OF INTENTION TO CHANGE PLANS.....	SUBSEQUENT REPORT OF SHOOTING OR ACIDIZING.....	
NOTICE OF INTENTION TO TEST WATER SHUT-OFF.....	SUBSEQUENT REPORT OF ALTERING CASING.....	
NOTICE OF INTENTION TO RE-DRILL OR REPAIR WELL.....	SUBSEQUENT REPORT OF RE-DRILLING OR REPAIR.....	
NOTICE OF INTENTION TO SHOOT OR ACIDIZE.....	SUBSEQUENT REPORT OF ABANDONMENT.....	
NOTICE OF INTENTION TO PULL OR ALTER CASING.....	SUPPLEMENTARY WELL HISTORY.....	
NOTICE OF INTENTION TO ABANDON WELL.....	<u>Water Frac.</u>	<u>X</u>

(INDICATE ABOVE BY CHECK MARK NATURE OF REPORT, NOTICE, OR OTHER DATA)

January 30, 1958

Well No. 2 is located 1650 ft. from (N) line and 1650 ft. from (E) line of sec. 27

NE Sec. 27

(1/4 Sec. and Sec. No.)

29N

(Twp.)

9W

(Range)

N.M.P.M.

(Meridian)

Blanco

(Field)

San Juan

(County or Subdivision)

New Mexico

(State or Territory)

The elevation of the derrick floor above sea level is 5636 ft.

DETAILS OF WORK

(State names of and expected depths to objective sands; show sizes, weights, and lengths of proposed casings; indicate mudding jobs, cementing points, and all other important proposed work)

1-17-58 Total depth 4514'. C.O.T.D. 4478'. Water fractured Point Lookout and Lower Menefee perf. int. 4262-80; 4348-98 (2 SPF) w/59,940 gallons water and 60,000# sand. Breakdown pr. 1950#, max. pr. 2900#, avg. tr. pr. 1600, 1450, 1750, 1950, 2600#. I. R. 55.4 B. P. M. Flush 6940 gallons. Injected 5 sets balls 20 balls/set.

1-17-58 Total Depth 4514'. Temp. B.P. @ 4240'. Water fraced. Menefee perf. int. 3988-4004; 4084-4108; 4168-86 (2 SPF) w/66,730 gallons water & 60,000# sand. Max. pr. 1900#, avg. tr. pr. 1650, 1750, 1800, 1900#. I. R. 61.2 B.P.M. Flush 6730 gallons. Inj. 4 sets 20 balls each.

1-18-58 Total depth 4514'. Temp. BP @ 3950'. Water fraced Cliff House perf. int. 3750-78; 3793-3818 (2 SPF) w/50,000 gallons water and 35,000# sand. Max. pr. 1550#, avg. tr. pr. 1500#. I.R. 61.4 B.P.M. Flush 6350 gals. Inj. 4 sets 17 balls each.

I understand that this plan of work must receive approval in writing by the Geological Survey before operations may be commenced.

Company El Paso Natural Gas CompanyAddress Box 997Farmington, New Mexico

Original Signed D. C. Johnston

By

Title Petroleum Engineer