

(SUBMIT IN TRIPLICATE)

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

Land Office Santa Fe
Lease No. EF 079065
Unit Regood

SUNDRY NOTICES AND REPORTS ON WELLS

NOTICE OF INTENTION TO DRILL	SUBSEQUENT REPORT OF WATER SHUT-OFF
NOTICE OF INTENTION TO CHANGE PLANS	SUBSEQUENT REPORT OF SHOOTING OR ACIDIZING
NOTICE OF INTENTION TO TEST WATER SHUT-OFF	SUBSEQUENT REPORT OF ALTERING CASING
NOTICE OF INTENTION TO RE-DRILL OR REPAIR WELL	SUBSEQUENT REPORT OF RE-DRILLING OR REPAIR
NOTICE OF INTENTION TO SHOOT OR ACIDIZE	SUBSEQUENT REPORT OF ABANDONMENT
NOTICE OF INTENTION TO PULL OR ALTER CASING	SUPPLEMENTARY WELL HISTORY
NOTICE OF INTENTION TO ABANDON WELL	

(INDICATE ABOVE BY CHECK MARK NATURE OF REPORT, NOTICE, OR OTHER DATA)


Regood March 16, 1961
Well No. 22-C is located 660 ft. from [N] line and 660 ft. from [E] line of sec. 20
SW 1/4 Section 20,
(1/4 Sec. and Sec. No.) 2-29N R-13W T.14N.R.13W.
Basin Dakota (Twp.) (Range) (Meridian)
San Juan New Mexico
(Field) (County or Subdivision) (State or Territory)

The elevation of the derrick floor above sea level is 5462 ft. G.L.

DETAILS OF WORK

(State names of and expected depths to objective sands; show sizes, weights, and lengths of proposed casings; indicate mudding jobs, cementing points, and all other important proposed work)

P.A.T.D. - 5340'
Sand-Oil Traced with 10,000' 20/40 sand, 10,000' 10/20 sand, 750 lbs. oil
Flushed with 230 lbs. oil
Breakdown pr. - 2300
5 in. shut-in pr. - 750'
Maximum - 3000'
Avg. treating pr. - 2500'
I.P. - 28.5 bps
Ran 166 lbs., 2 1/8" tubing, landed at 5272'
Perforated nipple from 5235'-41
Flowing through tubing.

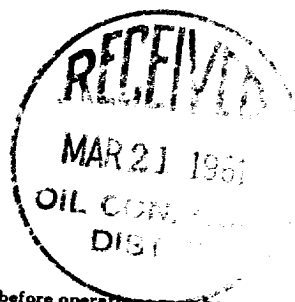

I understand that this plan of work must receive approval in writing by the Geological Survey before operations may be commenced.

Company Astec Oil and Gas Company

Address Drews # 570, Farmington, New Mex.

By ORIGINAL SIGNED BY JOE C. SALMON

Title Joe C. Salmon
District Superintendent