

NO. OF COPIES RECEIVED	3
DISTRIBUTION	
SALE TAX	1
FEE	1
U.S.G.S.	
LAND OFFICE	
OPERATOR	1

NEW MEXICO OIL CONSERVATION COMMISSION

Form C-103
Supersedes Old
C-102 and C-103
Effective 1-1-65

5a. Indicate Type of Lease
State <input checked="" type="checkbox"/> Fee <input type="checkbox"/>
5. State Oil & Gas Lease No.
NM 020502

SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR.
USE "APPLICATION FOR PERMIT -" (FORM C-101) FOR SUCH PROPOSALS.)

1. OIL WELL <input type="checkbox"/> GAS WELL <input checked="" type="checkbox"/> OTHER-	7. Unit Agreement Name
2. Name of Operator AMOCO PRODUCTION COMPANY	8. Farm or Lease Name Chavez Gas Com "B"
3. Address of Operator 501 Airport Drive, Farmington, New Mexico 87401	9. Well No. 1
4. Location of Well UNIT LETTER I , 1850 FEET FROM THE South LINE AND 1190 FEET FROM THE East LINE, SECTION 23 TOWNSHIP 29N RANGE 10W NMPM.	10. Field and Pool, or Wildcat Aztec Pictured Cliffs
15. Elevation (Show whether DF, RT, GR, etc.) 5597' GL	12. County San Juan

Check Appropriate Box To Indicate Nature of Notice, Report or Other Data
NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐
TEMPORARILY ABANDON ☐
PULL OR ALTER CASING ☐
OTHER ☐


PLUG AND ABANDON ☐
CHANGE PLANS ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐
COMMENCE DRILLING OPNS. ☐
CASING TEST AND CEMENT JOB ☐
OTHER **Repair surface water flow** ☒

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

On 11-15-74 blew well down and pulled 1-1/4" tubing. Set a retrievable packer at 1807' and loaded casing with water. Pressured 5-1/2" casing to 1000 psi. Broke circulation thru bradenhead and out surface casing. Pumped down the bradenhead 110 sacks Class "B" cement with 6% Gel and 2% CaCl. Circulated cement outside surface casing. Overdisplaced with 1/2 barrel. Shut off water flow outside 8-1/2" surface casing. WOC 13-1/2 hours. Found no water flow. Recovered packer set at 1807', reran 1-1/4" tubing and landed tubing at 1972' KB. Nippled up well and reconnected to sales line 11-18-74.

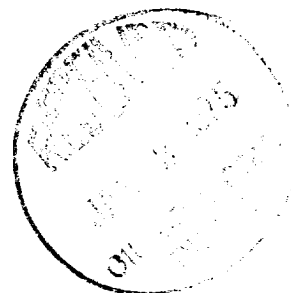

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED G. L. Hamilton

TITLE **Area Adm. Supvr.**

DATE **12-31-74**

APPROVED BY George C. Claret

TITLE **SUPERVISOR DIST. #3**

DATE **JAN 2 1974**

CONDITIONS OF APPROVAL, IF ANY: