


2-Skelly 1-International
1-Lloyd 1-File

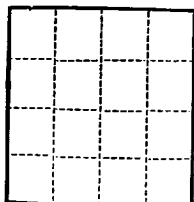

(SUBMIT IN TRIPLICATE)

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

Land Office Santa Fe
Lease No. MM 03486-A
Unit _____

SUNDRY NOTICES AND REPORTS ON WELLS

NOTICE OF INTENTION TO DRILL.....	SUBSEQUENT REPORT OF WATER SHUT-OFF.....	<input checked="" type="checkbox"/>
NOTICE OF INTENTION TO CHANGE PLANS.....	SUBSEQUENT REPORT OF SHOOTING OR ACIDIZING.....	
NOTICE OF INTENTION TO TEST WATER SHUT-OFF.....	SUBSEQUENT REPORT OF ALTERING CASING.....	
NOTICE OF INTENTION TO RE-DRILL OR REPAIR WELL.....	SUBSEQUENT REPORT OF RE-DRILLING OR REPAIR.....	
NOTICE OF INTENTION TO SHOOT OR ACIDIZE.....	SUBSEQUENT REPORT OF ABANDONMENT.....	
NOTICE OF INTENTION TO PULL OR ALTER CASING.....	SUPPLEMENTARY WELL HISTORY.....	
NOTICE OF INTENTION TO ABANDON WELL.....		

(INDICATE ABOVE BY CHECK MARK NATURE OF REPORT, NOTICE, OR OTHER DATA)


December 8, 1960

Fogelson
Well No. 1-11 is located 1650 ft. from NS line and 120 ft. from NE line of sec. 11
SW/4 NW/4 Sec 11 29N 11W NHFM
(1/4 Sec. and Sec. No.) (Twp.) (Range) (Meridian)
Basin Dakota San Juan New Mexico
(Field) (County or Subdivision) (State and Territory)

The elevation of the derrick floor above sea level is 5628 ft.

DETAILS OF WORK

(State names of and expected depths to objective sands; show sizes, weights, and lengths of proposed casing; indicate mudding jobs, cementing points, and all other important proposed work)

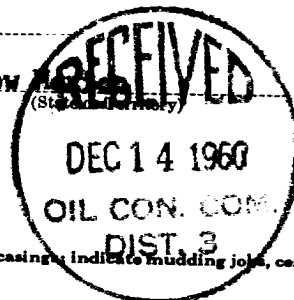

Spud 12 1/2" hole 2:00 AM 11-8-60 Drilled 12 1/2" hole to 263' - ran 8 jts 8-5/8" OD 2 1/2" J-55 SR ST&C cag set at 263' cemented w/175 sx 2 1/2" Cael. POB 12:15 PM 11-8-60 WOC - Nipped up - press tested cag - held ok.

11-25-60 TD 6670 Ran 204 jts 5 1/2" OD 15.5# J-55 SR ST&C Lone Star Cag TE 6672.21 set at 6669 RKB. Cemented first stage w/150 sx 8 1/2" gel 50 sx neat POB 9:00 AM 11-24-60 - good mud returns while cementing. Cemented second stage through Baker Stage Collar at 2092 w/100 sx 8 1/2" gel POB 11 AM 11-24-60 good mud returns while cementing.

I understand that this plan of work must receive approval in writing by the Geological Survey before operations may be commenced.

Company International Oil Corp.

Address Republic Bank Building

Dallas 1, Texas

Original signed by T. A. Dugan

By _____

Title Consulting Engineer