

(SUBMIT IN TRIPLICATE)

UNITED STATES  
DEPARTMENT OF THE INTERIOR  
GEOLOGICAL SURVEY

Land Office Santa Fe  
Lease No. 74710  
Unit                     

RECEIVED

SUNDRY NOTICES AND REPORTS ON WELLS

NOTICE OF INTENTION TO DRILL.....	SUBSEQUENT REPORT OF WATER SHUT-OFF.....
NOTICE OF INTENTION TO CHANGE PLANS.....	SUBSEQUENT REPORT OF SHOOTING OR ACIDIZING.....
NOTICE OF INTENTION TO TEST WATER SHUT-OFF.....	SUBSEQUENT REPORT OF ALTERING CASING.....
NOTICE OF INTENTION TO RE-DRILL OR REPAIR WELL.....	SUBSEQUENT REPORT OF RE-DRILLING OR REPAIR.....
NOTICE OF INTENTION TO SHOOT OR ACIDIZE.....	SUBSEQUENT REPORT OF ABANDONMENT.....
NOTICE OF INTENTION TO PULL OR ALTER CASING.....	SUPPLEMENTARY WELL HISTORY.....
NOTICE OF INTENTION TO ABANDON WELL.....	Water Frac. <u>Y</u>

(INDICATE ABOVE BY CHECK MARK NATURE OF REPORT, NOTICE, OR OTHER DATA)

August 15, 1962, 19

Well No. 3 is located 1200 ft. from N line and 897 ft. from W line of sec. 1


NW Section 1      29-N    11-W      N.M.P.M.  
(1/4 Sec. and Sec. No.)      (Twp.)      (Range)      (Meridian)  
Accion Petroleum Co.      San Juan      New Mexico  
(Field)      (County or Subdivision)      (State or Territory)

The elevation of the derrick floor above sea level is 5503 ft.

DETAILS OF WORK

(State names of and expected depths to objective sands; show sizes, weights, and lengths of proposed casings; indicate mudding jobs, cementing points, and all other important proposed work)

On 8-9-62, T.O. 2240'. C.O.T.D. 2230'.  
Perf 2120-24; 2134-38; 2154-58; (3 SPT).  
Frac w/38,000 gallons water, 38,000# sand. Flush  
w/900 gallons water. I.R. 25 BPM. Max pr 2900#,  
BDP 2300#, Tr pr 2500-2900#, 2 drops of 12 balls.

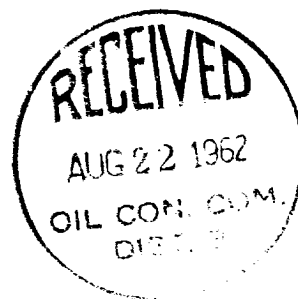

I understand that this plan of work must receive approval in writing by the Geological Survey before operations may be commenced.

Company El Paso Natural Gas Company

Address Box 990

Farmington, New Mexico

By Original Signed D. W. Meehan

Title Petroleum Engineer