

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir. Use Form 9-331-C for such proposals.)

1. oil ☐ gas ☒ other ☐
well well

2. NAME OF OPERATOR

Southland Royalty Company

3. ADDRESS OF OPERATOR

P.O. Drawer 570, Farmington, NM 87401

4. LOCATION OF WELL (REPORT LOCATION CLEARLY. See space 17 below.)

AT SURFACE: 1750' FNL & 1045' FEL

AT TOP PROD. INTERVAL:


AT TOTAL DEPTH:

16. CHECK APPROPRIATE BOX TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

REQUEST FOR APPROVAL TO:

TEST WATER SHUT-OFF ☐
FRACTURE TREAT ☐
SHOOT OR ACIDIZE ☐
REPAIR WELL ☐
PULL OR ALTER CASING ☐
MULTIPLE COMPLETE ☐
CHANGE ZONES ☐
ABANDON* ☐

SUBSEQUENT REPORT OF:

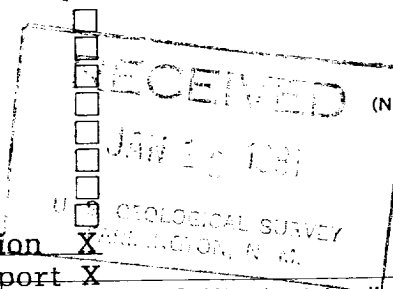

(NOTE: Report results of multiple completion or zone change on Form 9-330.)

(other) Perforation & Stimulation ☒
Production Tubing Report ☒

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

1/14/81 Perforated at 6352', 6431', 6437', 6443', 6449', 6455', 6475', 6516'.
Total of 8 holes.

Frac'd with 79,440 gallons 30# gelled 1% KCl water and 55,000# of
20/40 sand. AIR 17 BPM, ATP 2400 psi, SIP 1200 psi.

1/15/81 Landed 207 joints (6486') of 2-3/8", 4.70#, J-55, EUE tubing at 6497'.

Subsurface Safety Valve: Manu. and Type _____ Set @ _____ Ft.

18. I hereby certify that the foregoing is true and correct

SIGNED [Signature] TITLE Drilling Clerk DATE January 16, 1981

ACCEPTED FOR RECORD

(This space for Federal or State office use)

APPROVED BY JAN 21 1981 TITLE _____ DATE _____
CONDITIONS OF APPROVAL, IF ANY:

37 BLW FARMINGTON DISTRICT

NMOCC