

OIL CONSERVATION DIVISION

P. O. BOX 2088

SANTA FE, NEW MEXICO 87501

Form C-103
Revised 10-1-78

NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	
FILE	
U.S.G.S.	
LAND OFFICE	
OPERATOR	

5a. Indicate Type of Lease	
State <input checked="" type="checkbox"/>	Fee <input type="checkbox"/>
5. State Oil & Gas Lease No.	
E-6515	

SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR.
USE "APPLICATION FOR PERMIT TO DRILL" (FORM C-101) FOR SUCH PROPOSALS.)

1. OIL WELL <input checked="" type="checkbox"/> GAS WELL <input checked="" type="checkbox"/> OTHER <input type="checkbox"/>		7. Unit Agreement Name
2. Name of Operator		8. Farm or Lease Name
ARCO Oil and Gas Company, Division of Atlantic Richfield Company		State "E" Com
3. Address of Operator		9. Well No.
P. O. Box 5540, Denver, Colorado 80217		1 E
4. Location of well		10. Field and Pool, or Wildcat
UNIT LETTER <u>A</u> <u>800</u> FEET FROM THE <u>North</u> LINE AND <u>800</u> FEET FROM		Basin Dakota - Dakota
THE <u>East</u> LINE, SECTION <u>16</u> TOWNSHIP <u>29N</u> RANGE <u>10W</u> NMPM.		
15. Elevation (Show whether DF, RT, GR, etc.)		12. County
5702'		San Juan

16. Check Appropriate Box To Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐

TEMPORARILY ABANDON ☐

PULL OR ALTER CASING ☐

OTHER ☐

PLUG AND ABANDON ☐

CHANGE PLANS ☐

OTHER ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐

COMMENCE DRILLING OPNS. ☐

CASING TEST AND CEMENT JOBS ☐

OTHER N.O. SPUD & SET SURFACE CASING ☐

ALTERING CASING ☐


PLUG AND ABANDONMENT ☐

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

MI & RU Four Corners Rig #4. Spud 12-1/4" hole @ 6:45 pm 12-18-81. Drill to 412'. RU & ran 9 jts 8-5/8", 24#, K-55, ST&C casing and landed @ 412'. Cemented with 10 bbls water flush followed by 300 sx Class "B" with 2% CaCl₂ & 1/4# flocele/sx. Bumped plug @ 4:15 am 12-19-81. Had good returns.

Pressure tested pipe & BOP to 1500 psi for 30 minutes - held OK.

Drilling ahead.

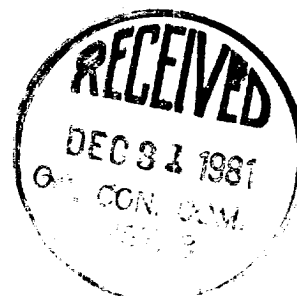

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED W.A. Walther, Jr. TITLE District Manager of Production DATE 12-28-81

APPROVED BY Original Signed by FRANK T. CHAVEZ TITLE SUPERVISOR DISTRICT #3 DATE DEC 31 1981

CONDITIONS OF APPROVAL, IF ANY: