

ILLEGIBLE

Land Office Santa Fe
Lease No. 07117
Unit 1

X		

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

2 1959

SUNDRY NOTICES AND REPORTS ON WELLS

NOTICE OF INTENTION TO DRILL	SUBSEQUENT REPORT OF WATER SHUT-OFF	X
NOTICE OF INTENTION TO CHANGE PLANS	SUBSEQUENT REPORT OF SHOOTING OR ACIDIZING	
NOTICE OF INTENTION TO TEST WATER SHUT-OFF	SUBSEQUENT REPORT OF ALTERING CASING	
NOTICE OF INTENTION TO RE-DRILL OR REPAIR WELL	SUBSEQUENT REPORT OF RE-DRILLING OR REPAIR	
NOTICE OF INTENTION TO SHOOT OR ACIDIZE	SUBSEQUENT REPORT OF ABANDONMENT	
NOTICE OF INTENTION TO PULL OR ALTER CASING	SUPPLEMENTARY WELL HISTORY	
NOTICE OF INTENTION TO ABANDON WELL		

(INDICATE ABOVE BY CHECK MARK NATURE OF REPORT, NOTICE, OR OTHER DATA)


N. M. Federal "L" September 1, 19 59
Well No. 1 is located 790 ft. from N line and 790 ft. from E line of sec. 29
1/4 Sec. 29 30N 15W T19N
(1/4 Sec. and Sec. No.) (Twp.) (Range) (Meridian)
Undesignated San Juan New Mexico
(Field) (County or Subdivision) (State or Territory)

The elevation of the derrick floor above sea level is 5324 ft.

DETAILS OF WORK

(State names of and expected depths to objective sands; show sizes, weights, and lengths of proposed casings; indicate mudding jobs, cementing points, and all other important proposed work)

A 12 1/2" hole was drilled to 412'. 8 5/8" 24# J-55 csg was set at 410' with 225 sacks - cement circulated. WOC 24 hrs. test csg to 1000 lbs for 30 minutes. A 7 7/8" hole was drilled to 4297'. Set cement plug 4243 to 4297 used 45 sacks. Drilled plug to 4310'. Set 5 1/2" 11# J-55 csg to 4310' and cemented with 100 sacks West with 25# Silconite per sack. Top of cement 3800' - Test casing to 1000# for 30 minutes.

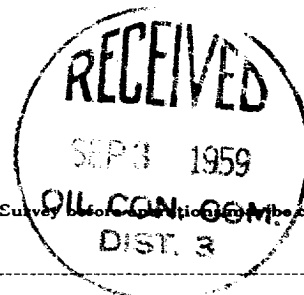

I understand that this plan of work must receive approval in writing by the Geological Survey before operations can be commenced.

Company Sunray Mid-Continent Oil Company

Address Room 166

Petroleum Center Building

Farmington, New Mexico

By Hal M. Stewart

Title Engineer