

<input checked="" type="checkbox"/>			

(SUBMIT IN TRIPLICATE)

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

Land Office Santa Fe
Lease No. 081226-B
Unit Bolack

SUNDRY NOTICES AND REPORTS ON WELLS

NOTICE OF INTENTION TO DRILL		SUBSEQUENT REPORT OF WATER SHUT-OFF	
NOTICE OF INTENTION TO CHANGE PLANS		SUBSEQUENT REPORT OF SHOOTING OR ACIDIZING	
NOTICE OF INTENTION TO TEST WATER SHUT-OFF		SUBSEQUENT REPORT OF ALTERING CASING	
NOTICE OF INTENTION TO RE-DRILL OR REPAIR WELL		SUBSEQUENT REPORT OF RE-DRILLING OR REPAIR	
NOTICE OF INTENTION TO SHOOT OR ACIDIZE		SUBSEQUENT REPORT OF ABANDONMENT	
NOTICE OF INTENTION TO PULL OR ALTER CASING		SUPPLEMENTARY WELL HISTORY	
NOTICE OF INTENTION TO ABANDON WELL		<u>Subsequent Report of Fluid-Free Treatment</u>	<input checked="" type="checkbox"/>

(INDICATE ABOVE BY CHECK MARK NATURE OF REPORT, NOTICE, OR OTHER DATA)

Well No. 6 is located 425 ft. from N line and 1680 ft. from W line of sec. 10
NE 1/4 NW 1/4 Sec. 10 (1/4 Sec. and Sec. No.) 30N 16W N.M.P.M.
Undesignated (Field) San Juan (County or Subdivision) New Mexico (State or Territory)

The elevation of the derrick floor above sea level is 5656 ft.

DETAILS OF WORK

(State names of and expected depths to objective sands; show sizes, weights, and lengths of proposed casings; indicate mudding jobs, cementing points, and all other important proposed work)

TD 1664' RKB. Perforated from 1605' to 1640' with 140 shots. In 12-hour test well swabbed at the rate of 14.1 barrels of 42 gravity oil per hour. Fluid-fraced with 100 gallons P-4 paraffin emulsifier and 250 barrels of 58 gravity drip gasoline. Flowed and swabbed at rate of 45 barrels of oil per hour on 24-hour test. Well went on vacuum two minutes after treatment.

I understand that this plan of work must receive approval in writing by the Geological Survey before operations may be commenced.


Company 10M BOLACK

Address 1010 North Dustin

Farmington, New Mexico

By

Title

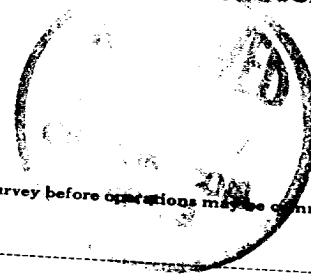

[Signature]