

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir. Use Form 9-331-C for such proposals.)

1. oil well gas well other

2. NAME OF OPERATOR
Southland Royalty Company

3. ADDRESS OF OPERATOR
P.O. Drawer 570, Farmington, New Mexico 87401

4. LOCATION OF WELL (REPORT LOCATION CLEARLY. See space 17 below.)
AT SURFACE: 1540' FNL & 1530' FEL
AT TOP PROD. INTERVAL:
AT TOTAL DEPTH:

5. LEASE
SF-078198

6. IF INDIAN, ALLOTTEE OR TRIBE NAME

7. UNIT AGREEMENT NAME

8. FARM OR LEASE NAME
Nye

9. WELL NO.
10-E

10. FIELD OR WILDCAT NAME
Basin Dakota

11. SEC., T., R., M., OR BLK. AND SURVEY OR AREA
Section 12, T30N, R11W

12. COUNTY OR PARISH
San Juan


13. STATE
New Mexico

14. API NO.

15. ELEVATIONS (SHOW DF, KDB, AND WD)
6018' GR

16. CHECK APPROPRIATE BOX TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

| | | | |
|-----------------------------------|-------------------------------------|-----------------------|-------------------------------------|
| REQUEST FOR APPROVAL TO: | | SUBSEQUENT REPORT OF: | |
| TEST WATER SHUT-OFF | <input type="checkbox"/> | | <input type="checkbox"/> |
| FRACTURE TREAT | <input type="checkbox"/> | | <input type="checkbox"/> |
| SHOOT OR ACIDIZE | <input type="checkbox"/> | | <input type="checkbox"/> |
| REPAIR WELL | <input type="checkbox"/> | | <input type="checkbox"/> |
| PULL OR ALTER CASING | <input type="checkbox"/> | | <input type="checkbox"/> |
| MULTIPLE COMPLETE | <input type="checkbox"/> | | <input type="checkbox"/> |
| CHANGE ZONES | <input type="checkbox"/> | | <input type="checkbox"/> |
| ABANDON* | <input type="checkbox"/> | | <input type="checkbox"/> |
| (other) Perforation & Stimulation | <input checked="" type="checkbox"/> | | <input checked="" type="checkbox"/> |
| Production Tubing Report | <input checked="" type="checkbox"/> | | <input checked="" type="checkbox"/> |

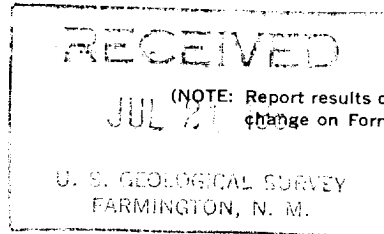

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

- 07-15-81 Perforated the Dakota at 6948', 6954', 6960', 7033', 7039', 7045', 7051', 7162', 7168', 7174', 7195'. Total of 11 holes. Frac'd with 39,400 gallons 20# gelled fluid and 26,900# 20/40 sand. ATP 2600 psi, AIR 18 BPM.
- 07-16-81 Squeezed liner hanger with 200 sacks of Class "B" Neat.
- 07-17-81 Squeezed Bradenhead with 75 sacks of Class "B" Neat. Spotted 25 sacks of Class "B" Neat from 4695'-4589'.
- 07-19-81 Ran 232 joints (7157.44') of 2-3/8", 4.7#, J-55 EUE tubing set at 7169'.

Subsurface Safety Valve: Manu. and Type _____ Set @ _____ Ft.

18. I hereby certify that the foregoing is true and correct

SIGNED Esther Guzman TITLE Drilling Clerk DATE July 20, 1981

(This space for Federal or State office use)

APPROVED BY _____ TITLE _____ DATE _____

CONDITIONS OF APPROVAL, IF ANY:

INMOCC

*See Instructions on Reverse Side

JUL 22 1981

FARMINGTON DISTRICT

BY [Signature]