

NO. OF COPIES RECEIVED	3
DISTRIBUTION	
SANTA FE	/
FILE	/
U.S.G.S.	
LAND OFFICE	
OPERATOR	/

NEW MEXICO OIL CONSERVATION COMMISSION

Form C-103
Supersedes Old
C-102 and C-103
Effective 1-1-65

5a. Indicate Type of Lease	
State <input type="checkbox"/>	Fee <input checked="" type="checkbox"/>
5. State Oil & Gas Lease No.	

SUNDRY NOTICES AND REPORTS ON WELLS	
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT -" (FORM C-101) FOR SUCH PROPOSALS.)	
1. OIL WELL <input type="checkbox"/> GAS WELL <input checked="" type="checkbox"/> OTHER <input type="checkbox"/>	7. Unit Agreement Name San Juan 32-5 Unit
2. Name of Operator El Paso Natural Gas Company	8. Farm or Lease Name San N Juan 32-5 Unit
3. Address of Operator Box 990, Farmington, New Mexico - 87401	9. Well No. 5 (P&A)
4. Location of Well UNIT LETTER M , 990 FEET FROM THE South LINE AND 790 FEET FROM THE West LINE, SECTION 24 TOWNSHIP 32N RANGE 6W NMPM.	10. Field and Pool, or Wildcat Basin Dakota
15. Elevation (Show whether DF, RT, GR, etc.)	12. County Rio Arriba

16. Check Appropriate Box To Indicate Nature of Notice, Report or Other Data	
NOTICE OF INTENTION TO:	SUBSEQUENT REPORT OF:
PERFORM REMEDIAL WORK <input type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	CASING TEST AND CEMENT JOB <input type="checkbox"/>
OTHER <input type="checkbox"/>	OTHER <input type="checkbox"/>
PLUG AND ABANDON <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
CHANGE PLANS <input type="checkbox"/>	PLUG AND ABANDONMENT <input checked="" type="checkbox"/>

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

This well has been plugged and abandoned as follows:

Cut stuck tubing off at 5580'. Spotted a 50 sack cement plug on tubing stub at 5580'.


Perforated 4 squeeze holes from 3300-3301', spotted a 50 sack cement plug over perfs and squeezed.

Spotted a 50 sack cement plug over parted casing at 1383'.

Attempted to pump 75 sacks of cement into Bradenhead, pressured to 900 psi and held.

Spotted a 10 sack cement surface plug w/a 4" x 4" P & A marker.

A Sundry notice will follow when location is cleaned up.

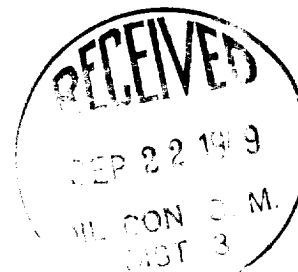

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED Original Signed F. H. WOOD TITLE Petroleum Engineer DATE 9-18-69

APPROVED BY [Signature] TITLE SUPERVISOR DIST. #3 DATE SEP 23 1969

CONDITIONS OF APPROVAL, IF ANY: