

(SUBMIT IN TRIPLICATE)

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

Indian Agency _____

Navajo - Ute Mtn. Tribal

Allottee _____

Lease No. 14-20-604-1951

SUNDRY NOTICES AND REPORTS ON WELLS

NOTICE OF INTENTION TO DRILL	SUBSEQUENT REPORT OF WATER SHUT-OFF
NOTICE OF INTENTION TO CHANGE PLANS	SUBSEQUENT REPORT OF SHOOTING OR ACIDIZING
NOTICE OF INTENTION TO TEST WATER SHUT-OFF	SUBSEQUENT REPORT OF ALTERING CASING
NOTICE OF INTENTION TO REDRILL OR REPAIR WELL	SUBSEQUENT REPORT OF REDRILLING OR REPAIR
NOTICE OF INTENTION TO SHOOT OR ACIDIZE	SUBSEQUENT REPORT OF ABANDONMENT
NOTICE OF INTENTION TO PULL OR ALTER CASING	SUPPLEMENTARY WELL HISTORY
NOTICE OF INTENTION TO ABANDON WELL	

Subsequent Report of casing ☒

(INDICATE ABOVE BY CHECK MARK NATURE OF REPORT, NOTICE, OR OTHER DATA)

February 15, 19 63

Horseshoe Gallup Unit

Well No. 158 is located 1740 ft. from N line and 590 ft. from E line of sec. 28

NW/4 SW/4 Sec. 28
(1/4 Sec. and Sec. No.)

31N
(Twp.)

16W
(Range)

NMPM
(Meridian)

Horseshoe Gallup
(Field)

San Juan
(County or Subdivision)

New Mexico
(State or Territory)


The elevation of the derrick floor above sea level is 5666 ft.

DETAILS OF WORK

(State names of and expected depths to objective sands; show sizes, weights, and lengths of proposed casings; indicate mudding jobs, cementing points, and all other important proposed work)

Drilled 7 7/8" hole to 1580' T.D. with air and filled hole with mud. Ran 4 1/2" O.D. 9.5# J-55 casing with guide shoe and float collar (1565.78') set at 1575.58. Cemented with 110 sz cement plus 2% gel. Plug down 8:20 am 12-31-62.

W.O.C. to 1-9-63 and tested 4 1/2" casing with 2100 psi for 30 min. OK

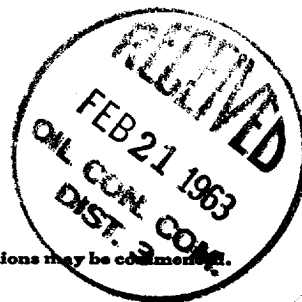

I understand that this plan of work must receive approval in writing by the Geological Survey before operations may be commenced.

Company THE ATLANTIC REFINING CO.

Address BOX 2197

Farmington, N.M.

By B. J. Sartain

Title Drilling & Prod. Supervisor

retrieved by: 001144