


(SUBMIT IN TRIPLICATE)

Indian Agency 1. none

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

Allottee _____

Lease No. 11-30-60-123

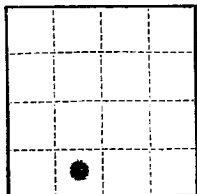

SUNDRY NOTICES AND REPORTS ON WELLS

NOTICE OF INTENTION TO DRILL	SUBSEQUENT REPORT OF WATER SHUT-OFF	
NOTICE OF INTENTION TO CHANGE PLANS	SUBSEQUENT REPORT OF SHOOTING OR ACIDIZING	<u>1959</u>
NOTICE OF INTENTION TO TEST WATER SHUT-OFF	SUBSEQUENT REPORT OF ALTERING CASING	
NOTICE OF INTENTION TO REDRILL OR REPAIR WELL	SUBSEQUENT REPORT OF REDRILLING OR REPAIR	
NOTICE OF INTENTION TO SHOOT OR ACIDIZE	SUBSEQUENT REPORT OF ABANDONMENT	
NOTICE OF INTENTION TO PULL OR ALTER CASING	SUPPLEMENTARY WELL HISTORY	<u>1959</u>
NOTICE OF INTENTION TO ABANDON WELL		

(INDICATE ABOVE BY CHECK MARK NATURE OF REPORT, NOTICE, OR OTHER DATA)

June 23, 19 59

Well No. 1 is located 500 ft. from N line and 1000 ft. from W line of sec. 30

NE/4, Section 23 T-13N R-15W N. P. M.
(1/4 Sec. and Sec. No.) (Twp.) (Range) (Meridian)

Verde Valley San Juan County New Mexico
(Field) (County or Subdivision) (State or Territory)

The elevation of the derrick floor above sea level is _____ ft.

DETAILS OF WORK

(State names of and expected depths to objective sands; show sizes, weights, and lengths of proposed casings; indicate mudding jobs, cementing points, and all other important proposed work)

Total Depth-2675'. San Juan Representative logs: Top of the Lower alluv - 2620'.

Sand: Oil fraced open hole 2565-2675, with 800 bbls. oil and 10,000# sand.
Breakdown Pressure - 500#, Fracturing Pressure - 1300#. I. P. - 31.5 bps.
Final Pressure - 500#.

Logged 52 jts., 2512', of 2 1/8" tubing at 2553'. Installed pump and rods.

I understand that this plan of work must receive approval in writing by the Geological Survey before operations may be commenced.

Company ALCO OIL & GAS COMPANY

Address Box 736

Albuquerque, New Mexico

ORIGINAL SIGNED BY JOE C. SALMON

By JOE C. SALMON

Title DISTRICT SUPERINTENDENT