


(SUBMIT IN TRIPLICATE)

Land Office Santa Fe
Lease No. 87-078051
Unit E/1 Sec. 15

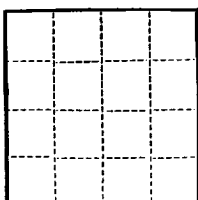

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

SUNDRY NOTICES AND REPORTS ON WELLS

NOTICE OF INTENTION TO DRILL	SUBSEQUENT REPORT OF WATER SHUT-OFF	<input checked="" type="checkbox"/>
NOTICE OF INTENTION TO CHANGE PLANS	SUBSEQUENT REPORT OF SHOOTING OR ACIDIZING	
NOTICE OF INTENTION TO TEST WATER SHUT-OFF	SUBSEQUENT REPORT OF ALTERING CASING	
NOTICE OF INTENTION TO RE-DRILL OR REPAIR WELL	SUBSEQUENT REPORT OF RE-DRILLING OR REPAIR	
NOTICE OF INTENTION TO SHOOT OR ACIDIZE	SUBSEQUENT REPORT OF ABANDONMENT	
NOTICE OF INTENTION TO PULL OR ALTER CASING	SUPPLEMENTARY WELL HISTORY	
NOTICE OF INTENTION TO ABANDON WELL		

(INDICATE ABOVE BY CHECK MARK NATURE OF REPORT, NOTICE, OR OTHER DATA)

September 2, 1960


Delhi-Wedge
Well No. 2 is located 1610 ft. from N line and 1450 ft. from E line of sec. 15
SE/4 Sec. 15 31N 11W 101PM
(1/4 Sec. and Sec. No.) (Twp.) (Range) (Meridian)
Undes. Dakota San Juan New Mexico
(Field) (County or Subdivision) (State or Territory)

The elevation of the derrick floor above sea level is 6131 ft.

DETAILS OF WORK

(State names of and expected depths to objective sands; show sizes, weights, and lengths of proposed casings; indicate mudding jobs, cementing points, and all other important proposed work)

After setting 7-5/8" cas. a 6-3/4" hole was drilled w/gas to T.D. 7497, 3-1/2" 174 J-53 casing was set @ 7482 w/150 sz. 30/50 peanix, 4% gel. and 12-1/2" oilstone per sz. followed w/50 sz. latex cement. Casing was pressured to 1000# for 1 hr. with no appreciable drop in pressure. Temperature survey indicated top at 6780'.

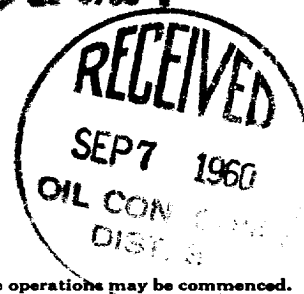

I understand that this plan of work must receive approval in writing by the Geological Survey before operations may be commenced.

Company Delhi-Taylor Oil Corporation
Address P. O. Drawer 1196
Farmington, New Mexico
By J. B. Howell
Title District Superintendent