


U. S. LAND OFFICE Santa Fe
SERIAL NUMBER 078483-A
LEASE OR PERMIT TO PROSPECT _____

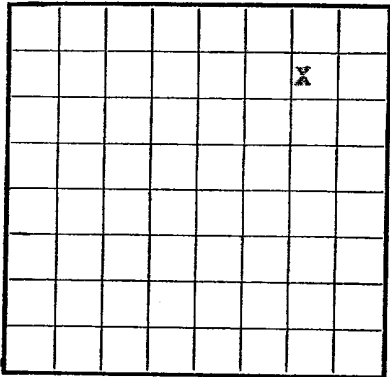

LOCATE WELL CORRECTLY

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

RECEIVED
FEB 5 1957
U. S. GEOLOGICAL SURVEY
FARMINGTON, NEW MEXICO

LOG OF OIL OR GAS WELL

Company El Paso Natural Gas Company Address Box 997, Farmington, New Mexico
Lessor or Tract Allison Unit Field Wildcat State New Mexico
Well No. 11 Sec. 23 T. 32N R. 7W Meridian MM County San Juan
Location 890 ft. 100' of N Line and 990 ft. 200' of E Line of Section 23 Elevation 6819'
(Derrick floor relative to sea level)

The information given herewith is a complete and correct record of the well and all work done thereon so far as can be determined from all available records.
Signed _____ OR G NAL SIGNED E. S. OBERLY

Date February 1, 1957 Title Petroleum Engineer

The summary on this page is for the condition of the well at above date.

Commenced drilling 10-17-56, 19____ Finished drilling 11-13-56, 19____

OIL OR GAS SANDS OR ZONES

(Denote gas by G)

No. 1, from _____ to _____ No. 4, from _____
No. 2, from _____ to _____ No. 5, from _____
No. 3, from _____ to _____ No. 6, from _____

IMPORTANT WATER SANDS

No. 1, from _____ to _____ No. 3, from _____
No. 2, from _____ to _____ No. 4, from _____

CASING RECORD

Size casing	Weight per foot	Threads per inch	Make	Amount	Kind of shoe	Cut and pulled from	Perforated		Purpose
							From—	To—	
13 3/8"	48	8 RD	J-55	198'	Howco				Surface
9 5/8"	36	8 RD	J-55	328'	Howco				Intermediate
HIS IS A COPY OF THE ORIGINAL RECORD									

MUDDING AND CEMENTING RECORD

Size casing	Where set	Number sacks of cement	Method used	Mud gravity	Amount of mud used
13 3/8"	211'	150	Circulated		
9 5/8"	3853'	250	Single Stage		

PLUGS AND ADAPTERS

Heaving plug—Material _____ Length _____ Depth set _____
Adapters—Material _____ Size _____

SHOOTING RECORD

Size	Shell used	Explosive used	Quantity	Date	Depth shot	Depth cleaned out
See Well History.						

TOOLS USED

Rotary tools were used from 0 feet to 6876 feet, and from _____ feet to _____ feet
Cable tools were used from _____ feet to _____ feet, and from _____ feet to _____ feet


DATES

Feb 12-4-56, 19____ Put to producing _____, 19____

The production for the first 24 hours was _____ barrels of fluid of which _____% was oil; _____% emulsion; _____% water; and _____% sediment. Gravity, °Bé. _____

If gas well, cu. ft. per 24 hours _____ Gallons gasoline per 1,000 cu. ft. of gas _____


Rock pressure lbs. per sq. in. _____

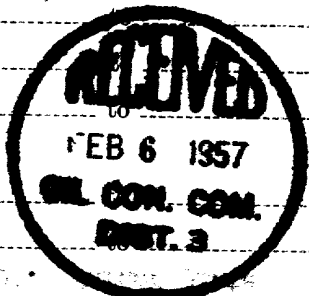

FOLD MARK

Operator El Paso Natural Gas Company				Well Name and Number Allison Unit No. 11-X (MD)			
Location of Well Unit A Sec. 23 Twp. 32 Rgc. 7				TYPE OF TEST →	Annual - (Give Year) 1969	Initial - (Give Date)	☐ NEW ☐ OWA
UPPER COMPLETION	Reservoir or Pool Mesa Verde	☒ GAS ☐ OIL	☒ FLOWING ☐ ARTIFICIAL LIFT	Production String ☒ CASING ☐ TUBING			
LOWER COMPLETION	Reservoir or Pool Dakota	☒ GAS ☐ OIL	☒ FLOWING ☐ ARTIFICIAL LIFT	Production String ☐ CASING ☒ TUBING			

DATE	UPPER ZONE					LOWER ZONE		
	SHUT-IN		FLOW			SHUT-IN	FLOW	
	CASING	TUBING	CASING	TUBING	FLOW RATE	TUBING	TUBING	FLOW RATE
6-15-69			450	0			450	
6-17-69	654	0				1265		
6-18-69	660	0				1268		
6-19-69	679	0					554	1196
6-20-69	686	0					540	
6-23-69	703	0				1252		
6-24-69			557	0		1257		
6-25-69			538	0	432	1260		

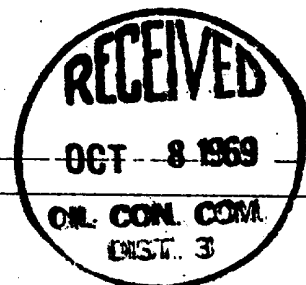

The results of this test indicate (No Packer Leakage) (~~Packer Leakage~~) in this well.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

OCT 8 1969

APPROVED _____, 19____
NEW MEXICO OIL CONSERVATION COMMISSION

Original Signed by A. R. Kendrick

BY _____

PETROLEUM ENGINEER DIST. NO. 3

OPERATOR **EL PASO NATURAL GAS COMPANY**

BY *R. E. Stauffer*
R. E. Stauffer

TITLE **Well Test Engineer**

DATE **October 6, 1969**

Annual Packer Leakage Test

6961

Alison Unit No 11-X (MB)
Unit A Sec. 23 T 32N R 7W
San Juan Co. New Mexico

