

(SUBMIT IN TRIPLICATE)

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

Indian Agency Ute Mountain Tribal
Allottee _____
Lease No. 14-20-60-86

SUNDRY NOTICES AND REPORTS ON WELLS

NOTICE OF INTENTION TO DRILL	SUBSEQUENT REPORT OF WATER SHUT-OFF	RECEIVED JAN 6 1960
NOTICE OF INTENTION TO CHANGE PLANS	SUBSEQUENT REPORT OF SHOOTING OR ACIDIZING	
NOTICE OF INTENTION TO TEST WATER SHUT-OFF	SUBSEQUENT REPORT OF ALTERING CASING	
NOTICE OF INTENTION TO REDRILL OR REPAIR WELL	SUBSEQUENT REPORT OF REDRILLING OR REPAIR	
NOTICE OF INTENTION TO SHOOT OR ACIDIZE	SUBSEQUENT REPORT OF ABANDONMENT	
NOTICE OF INTENTION TO PULL OR ALTER CASING	SUPPLEMENTARY WELL HISTORY	
NOTICE OF INTENTION TO ABANDON WELL		

(INDICATE ABOVE BY CHECK MARK NATURE OF REPORT, NOTICE, OR OTHER DATA)

January 5

U. S. GEOLOGICAL SURVEY
FARMINGTON, NEW MEXICO


Well No. 7 is located 1650 ft. from [M] line and 1900 ft. from [W] line of sec. 30
NE 34 Sec. 30 31N 14W N30E
(1/4 Sec. and Sec. No.) (Twp.) (Range) (Meridian)
Verde Gallup San Juan New Mexico
(Field) (County or Subdivision) (State or Territory)

The elevation of the derrick floor above sea level is 5957 ft.

DETAILS OF WORK

(State names of and expected depths to objective sands; show sizes, weights, and lengths of proposed casings; indicate mudding jobs, cementing points, and all other important proposed work)

Spud 8 p.m. 1-3-60. Drilling 11" hole to 140'.
Run 4 jts. 122.30' of 3-5/8" O.D. Std 24# J-55, 1-2 Spang ann. cog. set
137' F.B. w/100 ex. reg. 21 calcium chloride. Plug down 3:45 a.m. 1-4-60.
Cement circulated. W.O.C. 24 hours. Test plug w/300 psi for 30 minutes. OK.

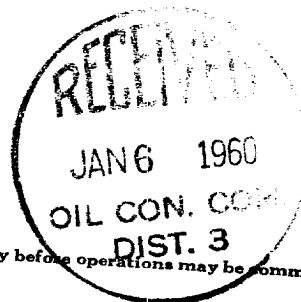

I understand that this plan of work must receive approval in writing by the Geological Survey before operations may be commenced.

Company Three States Natural Gas Company

Address Box 67

Farmington, New Mexico

By Original Signed By John Carothers

Title Assistant District Supt.

