


(SUBMIT IN TRIPLICATE)

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

Indian Agency Hava jo Tribal
Allottee Hava jo "H"
Lease No. 14-30-402-5013

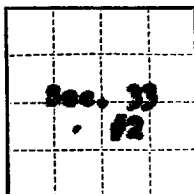

SUNDRY NOTICES AND REPORTS ON WELLS

NOTICE OF INTENTION TO DRILL	SUBSEQUENT REPORT OF WATER SHUT-OFF	
NOTICE OF INTENTION TO CHANGE PLANS	SUBSEQUENT REPORT OF SHOOTING OR ACIDIZING	
NOTICE OF INTENTION TO TEST WATER SHUT-OFF	SUBSEQUENT REPORT OF ALTERING CASING	
NOTICE OF INTENTION TO REDRILL OR REPAIR WELL	SUBSEQUENT REPORT OF REDRILLING OR REPAIR	
NOTICE OF INTENTION TO SHOOT OR ACIDIZE	SUBSEQUENT REPORT OF ABANDONMENT	
NOTICE OF INTENTION TO PULL OR ALTER CASING	SUPPLEMENTARY WELL HISTORY	
NOTICE OF INTENTION TO ABANDON WELL	<u>Convert Well to Water Injection</u>	<u>EX</u>

(INDICATE ABOVE BY CHECK MARK NATURE OF REPORT, NOTICE, OR OTHER DATA)

Hobbs, New Mexico - February 27, 1962

Hava jo "H"
Well No. 2 is located 1940 ft. from NE line and 1940 ft. from W line of sec. 33

NE 1/4 SW 1/4 Sec. 33
(1/4 Sec. and Sec. No.)

12-N
(Twp.)

17-W
(Range)

N.M.P.M.
(Meridian)

Huerfano Gallup
(Field)

San Juan
(County or Subdivision)

New Mexico
(State or Territory)

RECEIVED
MAR 1 1962

The elevation of the derrick floor above sea level is 5309 ft.

DETAILS OF WORK

(State names of and expected depths to objective sands; show sizes, weights, and lengths of proposed casings; indicate mudding jobs, cementing points, and all other important proposed work)

Drilled cement & cleaned out well to 1164'. P.B.T.D. 1164'. Perforated 5" OD casing from 1157' to 1160'; total 3' and a total of 12 holes. Ran 2-7/8" OD tubing with Baker Model "H" latch-in Production Packer set at 1155'. Acidized through 5" OD casing pore. 1157-1160' with 1000 gals. Dowell 15% Break-Down Acid and fractured through 5" OD casing pore. 1157-1160' with 27,174 gals. fresh water, 15,000# 20/40 sand & 210# J-2 additive. Shut well - Waiting on Water Flood Equipment.

Date Work Performed: January 26 through February 7, 1962.

RECEIVED
MAR 5 1962
OIL CON. COM.
DIST. 3

I understand that this plan of work must receive approval in writing by the Geological Survey before operations may be commenced.

Company Shelly Oil Company

Address P. O. Box 96

Hobbs, New Mexico

(ORIGINAL SIGNED) H. E. Aab


By

Title Dist. Supt.

1. The first part of the report is a summary of the work done during the year. It is a brief statement of the results of the work, and is intended to give a general idea of the progress made.

2. The second part of the report is a detailed account of the work done during the year. It is a full and complete statement of the results of the work, and is intended to give a detailed account of the progress made.

3. The third part of the report is a summary of the work done during the year. It is a brief statement of the results of the work, and is intended to give a general idea of the progress made.

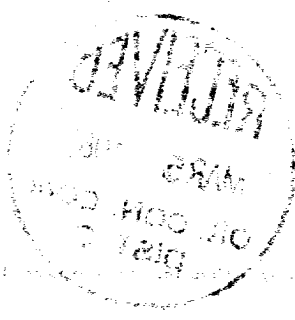

(SIGNED) H. E. A. P.