

District I
P.O. Box 1980, Hobbs, NM
District II
P.O. Drawer DD, Artesia, NM 88211
District III
1000 Rio Brazos Rd, Aztec, NM 87410

State of New Mexico
Energy, Minerals and Natural Resources Department
OIL CONSERVATION DIVISION
P.O. Box 2088
Santa Fe, New Mexico 87504-2088

Non vulnerable
BTEX
SUBMIT 1 COPY TO
APPROPRIATE
DISTRICT OFFICE
AND 1 COPY TO
SANTA FE OFFICE
(Revised 3/9/94)

PIT REMEDIATION AND CLOSURE REPORT

Operator: CONOCO INC. Telephone: 505-324-5813
Address: 3315 Bloomfield HWY. FARMINGTON N.M. 87401
Facility Or: MOORE 25 1
Well Name B
Location: Unit or qtr/qtr Sec 750 EEL Sec 27 T 36N R 12W County SAN JUAN
Pit Type: separator Dehydrator other BLOW DOWN PIT
Land Type: BLM ✓, State , Fee , other

Pit Location: Pit dimensions: length 10', width 10', depth 2'
(Attach diagram)
Reference: wellhead ✓, other
Footage from reference: 50'
Direction from reference: 300 Degrees East North
 of
 West South

Depth To Ground Water:
(Vertical distance from
contaminants to seasonal
high water elevation of
ground water)

Less than 50 feet (20 points)
50 feet to 99 feet (10 points)
Greater than 100 feet (0 points) 0


Wellhead Protection Area:
(Less than 200 feet from a private
domestic water source, or; less than
1000 feet from all other water sources)

Yes (20 points)
No (0 points) 0

Distance To Surface Water:
(Horizontal distance to perennial
lakes, ponds, rivers, streams, creeks,
irrigation canals and ditches)

Less than 200 feet (20 points)
200 feet to 1000 feet (10 points)
Greater than 1000 feet (0 points) 0

RANKING SCORE (TOTAL POINTS): 0

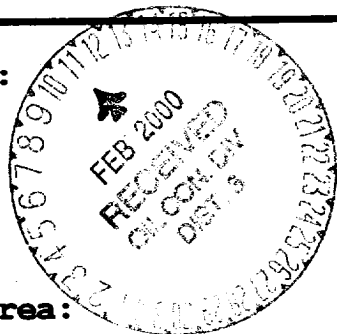

Date Remediation Started: 6-10-99 Date Completed: 6-11-99

Remediation Method: Excavation _____ Approx. cubic yards _____
(Check all appropriate sections) Landfarmed _____ Insitu Bioremediation _____
Other _____

Remediation Location: Onsite _____ Offsite _____
(ie. landfarmed onsite, name and location of offsite facility)

General Description Of Remedial Action: Sample Taker, Till Bottom of Pit
IN, BACK Fill clean soil.

Ground Water Encountered: No ☒ Yes _____ Depth _____

Final Pit: Sample location CENTER OF PIT
Closure Sampling: _____
(if multiple samples, attach sample results and diagram of sample locations and depths)

Sample depth 5

Sample date 6-9-99 Sample time 0854

Sample Results

Benzene (ppm) 4.120

Total BTEX (ppm) 86.100

Field headspace (ppm) 557

TPH 2220

Ground Water Sample: Yes _____ No ☒ (If yes, attach sample results)

I HEREBY CERTIFY THAT THE INFORMATION ABOVE IS TRUE AND COMPLETE TO THE BEST OF MY KNOWLEDGE AND BELIEF

DATE 12-2-99

SIGNATURE Judson Valdez

PRINTED NAME AND TITLE Judson Valdez P.L.

ENVIROTECH LABS

PRACTICAL SOLUTIONS FOR A BETTER TOMORROW

EPA METHOD 8015 Modified Nonhalogenated Volatile Organics Total Petroleum Hydrocarbons


Client:	Conoco Inc.	Project #:	707003-038
Sample ID:	BDP - Grab	Date Reported:	06-11-99
Laboratory Number:	F495	Date Sampled:	06-09-99
Chain of Custody No:	6965	Date Received:	06-10-99
Sample Matrix:	Soil	Date Extracted:	06-10-99
Preservative:	Cool	Date Analyzed:	06-11-99
Condition:	Cool and Intact	Analysis Requested:	8015 TPH

Parameter	Concentration (mg/Kg)	Det. Limit (mg/Kg)
Gasoline Range (C5 - C10)	2,180	0.2
Diesel Range (C10 - C28)	43.1	0.1
Total Petroleum Hydrocarbons	2,220	0.2

ND - Parameter not detected at the stated detection limit.

References: Method 8015B, Nonhalogenated Volatile Organics, Test Methods for Evaluating Solid Waste, SW-846, USEPA, December 1996.

Comments: Moore LS 1. OVM Reading 557.


Analyst


Review

ENVIROTECH LABS

PRACTICAL SOLUTIONS FOR A BETTER TOMORROW

EPA METHOD 8021 AROMATIC VOLATILE ORGANICS

Client:	Conoco Inc.	Project #:	707003-038
Sample ID:	BDP - Grab	Date Reported:	06-11-99
Laboratory Number:	F495	Date Sampled:	06-09-99
Chain of Custody:	6965	Date Received:	06-10-99
Sample Matrix:	Soil	Date Analyzed:	06-11-99
Preservative:	Cool	Date Extracted:	06-10-99
Condition:	Cool & Intact	Analysis Requested:	BTEX

Parameter	Concentration (ug/Kg)	Det. Limit (ug/Kg)
Benzene	4,120	8.8
Toluene	38,060	8.4
Ethylbenzene	5,260	7.6
p,m-Xylene	26,390	10.8
o-Xylene	12,270	5.2
Total BTEX	86,100	


ND - Parameter not detected at the stated detection limit.

Surrogate Recoveries:	Parameter	Percent Recovery
	Trifluorotoluene	96 %
	Bromofluorobenzene	96 %

References: Method 5030B, Purge-and-Trap, Test Methods for Evaluating Solid Waste, SW-846, USEPA, December 1996.

Method 8021B, Aromatic Volatile Organics, Test Methods for Evaluating Solid Waste, SW-846, USEPA, December 1996.

Comments: Moore LS 1. OVM Reading 557.


Analyst


Review

5969

[illegible]

Revised 11-18-98


Lease Name: Moore LS1

Operator: Conoco Inc.

Date: ~~10-28-98~~ 6-11-99

Site Security

(Indicate North)

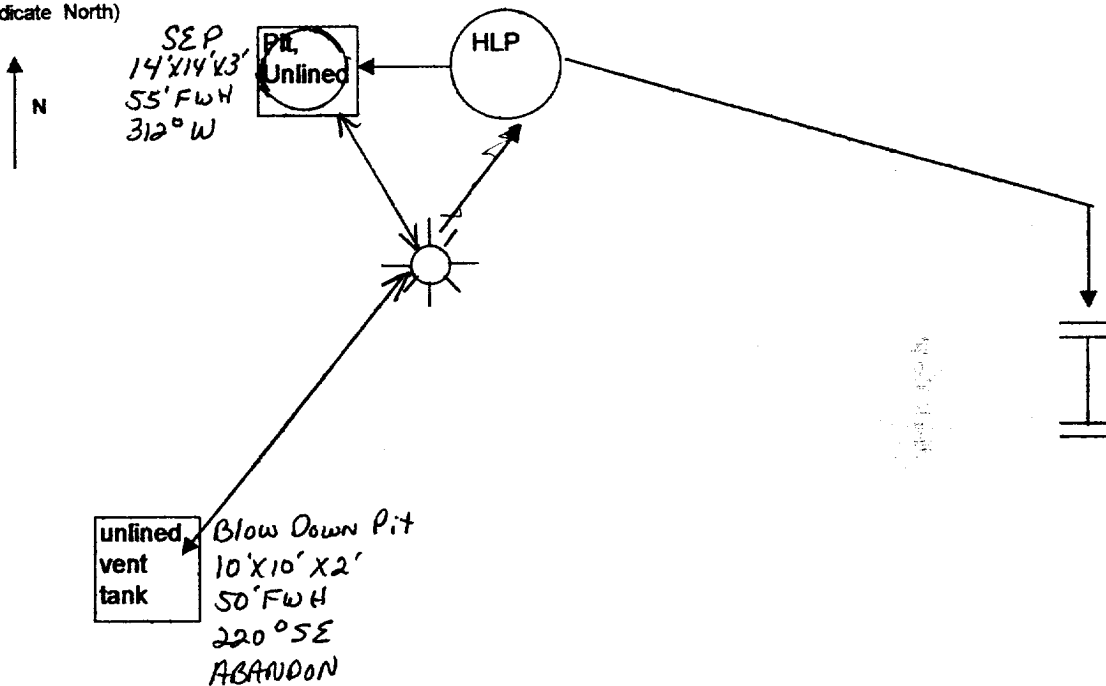

Lease Name: Moore LS1

Federal/ Indian Lease No: SF-078147

CA No.: _____

Unit: _____

Legal Description: Sec.27-T32N-R12W

County: San Juan

Load line valves :
Sealed during Production

Drain line valves :
Sealed during Production

Production Line valve:
Sealed during sales


This lease is subject to the site security plan for
San Juan Basin Operations. The plan is located at:
Conoco Inc.
3315 Bloomfield Hwy
Farmington, NM

MOORE LS 1

Sec. 27, T32-N, R12W SF D52197

990' FNL & 1750' FCL

BSP

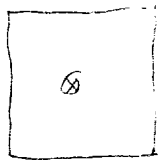

10' X 10' X 2'
315° W
50' FCL

Time: 0846 P.M. : 557
ST- 0855



CSP



10' X 10' X 2'
14' X 14' X 3'
315° W

Time: 0751 P.M. : 01
ST 0855

