


(SUBMIT IN TRIPLICATE)

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

Land Office Santa Fe
Lease No. 079269-A
Unit San Juan 28-7
14-06-001-459

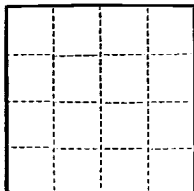

SUNDRY NOTICES AND REPORTS ON WELLS

RECEIVED
AUG 13 1957
U.S. GEOLOGICAL SURVEY
FARMINGTON, NEW MEXICO

NOTICE OF INTENTION TO DRILL	SUBSEQUENT REPORT OF WATER SHUT-OFF
NOTICE OF INTENTION TO CHANGE PLANS	SUBSEQUENT REPORT OF SHOOTING OR ACIDIZING
NOTICE OF INTENTION TO TEST WATER SHUT-OFF	SUBSEQUENT REPORT OF ALTERING OR PLUGGING
NOTICE OF INTENTION TO RE-DRILL OR REPAIR WELL	SUBSEQUENT REPORT OF RE-DRILLING OR REPAIR
NOTICE OF INTENTION TO SHOOT OR ACIDIZE	SUBSEQUENT REPORT OF ABANDONMENT
NOTICE OF INTENTION TO PULL OR ALTER CASING	SUPPLEMENTARY WELL HISTORY
NOTICE OF INTENTION TO ABANDON WELL	

(INDICATE ABOVE BY CHECK MARK NATURE OF REPORT, NOTICE, OR OTHER DATA)

August 6, 1957

Well No. 74 is located 990 ft. from DS line and 1650 ft. from EX line of sec. 11


SW Sec. 11 28N 7W N.M.P.M.
(¼ Sec. and Sec. No.) (Twp.) (Range) (Meridian)
Blanco Sio Arriba New Mexico
(Field) (County or Subdivision) (State or Territory)

The elevation of the derrick floor above sea level is 6197 ft.

DETAILS OF WORK

(State names of and expected depths to objective sands; show sizes, weights, and lengths of proposed casings; indicate mudlogging jobs, cementing points, and all other important proposed work)

7-29-57 Total Depth 5314'.
Run 125 joints 5 1/2", 15.5#, J-55 Casing (5302') set at 5312'
w/125 sacks regular cement, 125 sacks Formix, 4% Gel, 1/8# Floccs, sk.
followed by 50 sacks regular cement.
Held 1000# for 30 minutes
Top of cement by temperature survey at 2900'.

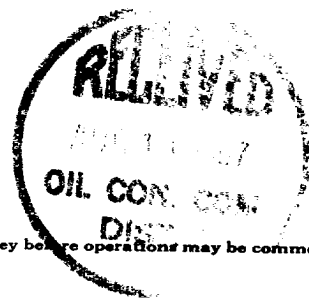

I understand that this plan of work must receive approval in writing by the Geological Survey before operations may be commenced.

Company El Paso Natural Gas Company
Address Box 997
Farmington, New Mexico
By Original Signed D. C. Johnston
Title Petroleum Engineer