

UNITED STATES  
DEPARTMENT OF THE INTERIOR  
GEOLOGICAL SURVEY

SUBMIT IN APPLICATION  
(with cover sheet on reverse side)

Form approved.  
Budget Bureau No. 42-R1424.

P. O. BOX 1980  
HOBBS, NEW MEXICO 88240 NM 15894

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.  
Use "APPLICATION FOR PERMIT—" for such proposals.)

1. OIL WELL <input checked="" type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER <input type="checkbox"/>		7. UNIT AGREEMENT NAME	
2. NAME OF OPERATOR MorOilCo, Inc.		8. FARM OR LEASE NAME Mazie Federal	
3. ADDRESS OF OPERATOR P.O. Drawer I Artesia, NM 88210		9. WELL NO. #1	
4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.* See also space 17 below.) At surface 330 FNL 1980 FWL		10. FIELD AND POOL, OR WILDCAT E. Siete	
14. PERMIT NO.		12. COUNTY OR PARISH Chaves	
15. ELEVATIONS (Show whether DF, RT, GR, etc.) 4325' GR		13. STATE NM	

16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data


NOTICE OF INTENTION TO:		SUBSEQUENT REPORT OF:	
TEST WATER SHUT-OFF <input type="checkbox"/>	PULL OR ALTER CASING <input type="checkbox"/>	WATER SHUT-OFF <input type="checkbox"/>	REPAIRING WELL <input type="checkbox"/>
FRACTURE TREAT <input type="checkbox"/>	MULTIPLE COMPLETE <input type="checkbox"/>	FRACTURE TREATMENT <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
SHOOT OR ACIDIZE <input type="checkbox"/>	ABANDON* <input type="checkbox"/>	SHOOTING OR ACIDIZING <input type="checkbox"/>	ABANDONMENT* <input type="checkbox"/>
REPAIR WELL <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>	(Other) Plug back, run 4 1/2" casing	

(NOTE: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)\*

8/05/82 TD @ 4125', found no show in San Andres. Plug back to Yates formation @ 2100'. Set 100' plug @ 3940' to 3840' 100 sx. plug @ 2250' to 2150'. Shut-down. Waiting on orders.

8/09/82 Set anchors, moved rig to location. Ran 2154' of 4 1/2", 9.5# casing. Cemented with 250 sx. 50-50 Poz, 3% Gel, 6# salt. Plug down @ 4:15 p.m., 8/09/82. Shut-down.

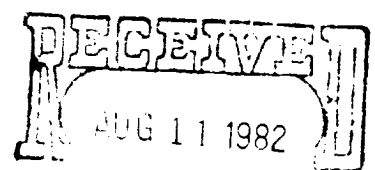

C & GAS  
U.S. GEOLOGICAL SURVEY  
ROSWELL, NEW MEXICO

I hereby certify that the foregoing is true and correct  
SIGNED Frank L. Morgan TITLE Operator DATE 8/10/82

ACCEPTED FOR RECORD  
(This space for Federal or State office use)  
(ORIG. SGD.) DAVID R. GLASS  
APPROVED BY \_\_\_\_\_ TITLE \_\_\_\_\_ DATE \_\_\_\_\_  
OCT 14 1982  
U.S. GEOLOGICAL SURVEY  
ROSWELL, NEW MEXICO

\*See Instructions on Reverse Side

Faint, illegible text at the top of the page, possibly a header or title.

RECEIVED  
OCT 15 1982  
O.C.D.  
MOBBS OFFICE