

MISCELLANEOUS REPORTS ON WELLS HOBBS OFFICE OCC

(Submit to appropriate District Office as per Commission Rule 1106)

Name of Company Toreador Royalty Corporation		Address 511 Tower Petroleum Bldg., Dallas 1, Texas				
Lease Carter "A"	Well No. 1	Unit Letter A	Section 7	Towship 18S	Range 39E	
Date Work Performed 1-20-60 to 1-27-60		Pool South Carter San Andres			County Lee	

THIS IS A REPORT OF: (Check appropriate block)

- ☐ Beginning Drilling Operations
 ☐ Casing Test and Cement Job
 ☐ Other (Explain):
- ☐ Plugging
 ☒ Remedial Work

Detailed account of work done, nature and quantity of materials used, and results obtained.

Two zones of porosity in the San Andres formation were Sandrilled and sandfraced, respectively. They were at 5166 feet and 5121 feet. Each zone was fraced with 7,500 gallons of oil with a pound of sand per gallon. The well was increased from a daily pump of approximately 18 barrels to 131 barrels of oil on a 24-hour pumping potential on open tubing.

Witnessed by Earl E. Westmoreland	Position President	Company Toreador Royalty Corporation
---	------------------------------	--

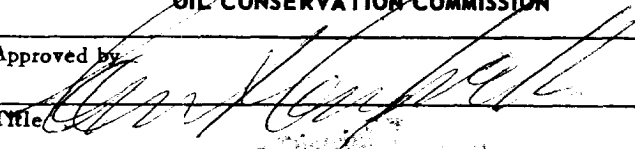
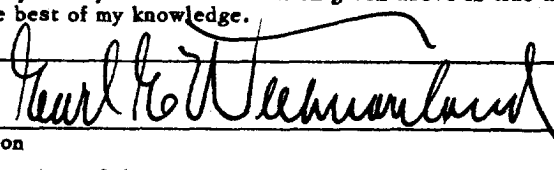
FILL IN BELOW FOR REMEDIAL WORK REPORTS ONLY

ORIGINAL WELL DATA

D F Elev. 3637'	T D 5198'	P B T D -	Producing Interval open hole 5077-5198'	Completion Date Sept. 1958
Tubing Diameter 2-3/8"	Tubing Depth 5062'	Oil String Diameter 5-1/2"	Oil String Depth 5077'	
Perforated Interval(s)				
Open Hole Interval 5077-5198'		Producing Formation(s) San Andres		

RESULTS OF WORKOVER

Test	Date of Test	Oil Production BPD	Gas Production MCFPD	Water Production BPD	GOR Cubic feet/Bbl	Gas Well Potential MCFPD
Before Workover	October, 1959	18	1.54	0.5	85	
After Workover	1-27-60	127.07	6.94	3.93	53	

OIL CONSERVATION COMMISSION		I hereby certify that the information given above is true and complete to the best of my knowledge.	
Approved by 		Name 	
Title President		Position President	
Date 1-27-60		Company Toreador Royalty Corporation	