

RICE *Operating Company*

112 West Taylor • Hobbs, New Mexico 88240

Phone: (575) 393-9174 • Fax: (575) 397-1471

REVIEWED

By Mike Buchanan at 2:57 pm, Jun 27, 2023

April 1, 2023

Nelson Velez

New Mexico Oil Conservation Division
1220 So. St. Francis Drive
Santa Fe, New Mexico 87505

Review of the 2022 Annual GW Report and Path Forward: **Content is satisfactory.**

1. Continue to gauge BS1 and MW-1 for LNAPL/DNAPL with product bailer and absorbent sock while continuing to remove any measurable product.
2. Continue to sample wells quarterly in 2023.
3. Submit 2023 Annual GW Report by April 1, 2024.

RE: 2022 Annual Groundwater Report and Path Forward**Rice Operating Company – Hobbs SWD System****Hobbs N-6, West County Road Site (1R-487): UL/N, Sec. 5&6, T19S, R38E**

Mr. Velez:

ROC was the service provider (agent) for the Hobbs SWD System and has no ownership of any portion of the pipeline, well or facility. The Hobbs SWD System was owned by a consortium of oil producers, System Parties, who provide operating capital on a percentage ownership/usage basis. The Hobbs SWD System has been abandoned.

Groundwater Sampling

All wells were sampled regularly in accordance with NMOCD guidelines. The attached tables summarize the analytical results from groundwater samples collected from the monitor wells in 2022 and depth to water, total depth of the well, volume of water in the wellbore and volume of water purged from the well.

Free Product Removal

In 1994, a leak was discovered in a buried SWD pipeline. An assessment program was completed, and a free product recovery program initiated. The free product has historically been collected from Monitor Well 1 (MW-1), initially in 1996 in conjunction with groundwater recovery, and then beginning in 2000 with product recovery only.

A biosparge well designed to maximize in-situ biodegradation and minimize volatilization of hydrocarbons was installed at the site and became operational in August 2005. Four borings were drilled on November 8th and 9th, 2006 in order to evaluate hydrocarbon occurrence in the vadose zone. Based on drilling observations, a second biosparge well was installed approximately 30 feet east of the original biosparge well. The second biosparge well became operational in March 2007. In November of 2007, an additional eight soil borings (piezometers) were drilled and a third biosparge well was installed southeast of the pump house. These soil borings were located in areas between previous sampling points, outside of the previously identified core source area, and as

close as possible to previous (2006) soil borings from which samples had been collected and tested for total petroleum hydrocarbons (TPH) and total organic compounds (TOC).

In November of 2010, the air sparge system at the site was tested by collection of soil gas samples during a cycled shut down. A similar test protocol was previously performed in May/June and September/October 2007, August/September 2008 and November 2009. The soil gas samples from these testing events were analyzed for methane, carbon dioxide, oxygen and benzene, toluene, ethylbenzene and xylenes (BTEX).

A Corrective Action Plan (CAP) was submitted to the NMOCD on April 2nd, 2012 and an Addendum was submitted April 11th, 2012. In accordance with the NMOCD approval of the CAP and subsequent Addendum, pumping of free product from Biosparge Well #1 (BS1) began on April 7th, 2012. Free product was pumped from this well on weekly basis from April 7th, 2012 through September 19th, 2012. Based on reduced product thickness and recovery volumes, the pump was removed from the well and a product recovery absorbent sock was placed in the well. The well is bailed, and sock is changed weekly. A total of 1,992.3 gallons of free product has been removed from the well since April 7th, 2012. Monitor Well #1 (MW-1) also has had a product recovery absorbent sock in the well to continually remove free product. The sock is changed weekly. A total of 201.9 gallons of product have been removed from this well since April 7th, 2012. Removed fluids were properly disposed of at a permitted SWD well.

Monitor Well Plugging

A Monitoring Well Plugging Request was submitted to the NMOCD on November 30th, 2012, and Additional Information was submitted December 3rd, 2012, which was approved by the NMOCD. According to NMOCD's approval, five monitoring wells (MW-3, MW-3R, PZ-3, PZ-4 and BS-3) were plugged using a cement grout containing 1% - 3% bentonite and a 3-foot cap of cement at the surface. A monitor well plugging report detailing the plugging activities was submitted to the NMOCD on February 22nd, 2013.

Biosparge Well Operation and Evaluation

Evaluation of the 2007 through 2010 soil gas samples and the quarterly monitoring well data indicates that the biosparge wells are effective in the remediation of free-phase hydrocarbons at the site. Biochemical results also suggest groundwater chemistry indicative of bioremediation. Pumping the free product from BS1 in 2012 and the product recovery absorbent socks in BS1 and MW-1 and bailing of BS1 has reduced the amount of free product remaining on these wells. Chloride, TDS, BTEX, and sulfate concentrations have remained at or below WQCC standards for the last eight quarters.

On October 6th, 2022, NMOCD responded to the 2021 Annual Report granting approval to stop sampling and gauge only MW-2, MW-4, MW-5, MW-6, MW-7, BS2, and IWW. NMOCD also requested historic and present free phase product thickness data, along with a path forward to initiate more aggressive removal of free phase product from BS1 and MW-1.

In 2022, BS1 and MW-1 were monitored bi-weekly using a PSH recovery sock to continue to capture the non-aqueous liquid that enters the well bore and floats on the water table. The well bore is gauged and checked for non-aqueous liquid after bailing with a product only bailer, and there was no measurable accumulation in 2022 (Arc Environmental Letter, attached). The gauging data since 2012 is attached. Based on the decreased amount of free product observed in BS1 and MW-1 pumping is not feasible at this time. ROC proposes to continue recovery utilizing the bi-weekly changing of a PSH recovery sock. If product thickness increases enough to warrant pumping, a continuous skimmer pump will be placed in BS1.

The wells will be sampled quarterly in 2023.

Thank you for your consideration concerning this summary of groundwater monitoring information. If you have any questions, please do not hesitate to contact me at (575) 393-9174.


Sincerely,

A handwritten signature in cursive script that reads "Katie Davis".

Katie Davis
Environmental Manager
RICE Operating Company (ROC)

Attachments:
Geographic Location Map
Site Map
Data Summary Table and Graph
2022 Laboratory Results

Geographic Location

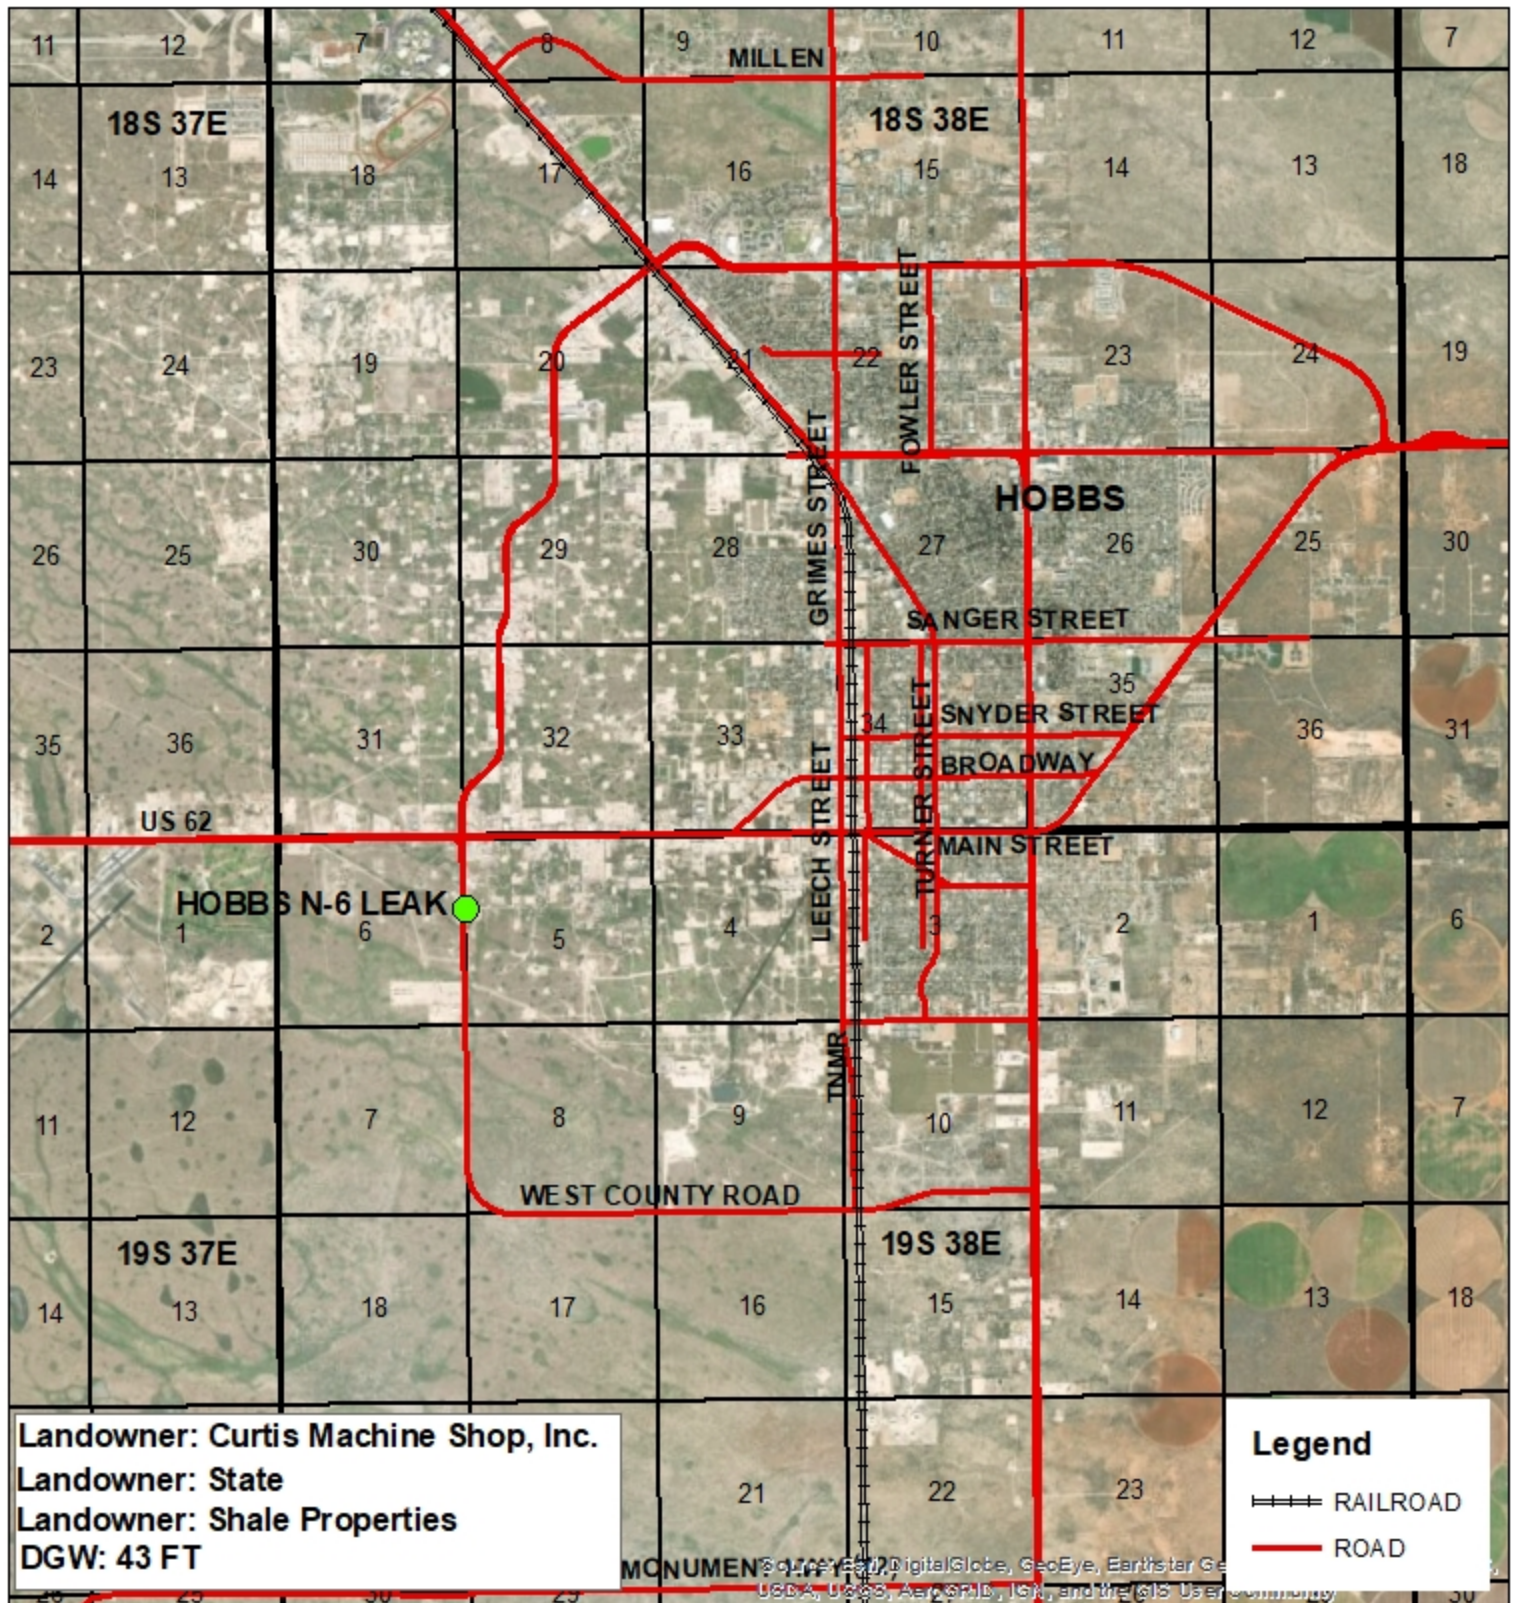


HOBBS N-6 LEAK

1R-487


UL N SECTION 5&6
 T-19-S R-38-E
 LEA COUNTY, NM

GPS: 32.691062 -103.178954
 NAD83 STATE PLANE PROJ
 NM EAST ZONE

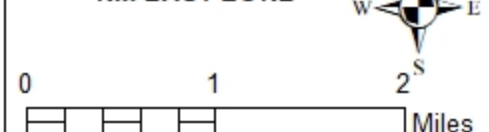

Drawing date: 2/4/20
 Drafted by: T. Grieco

Site Map

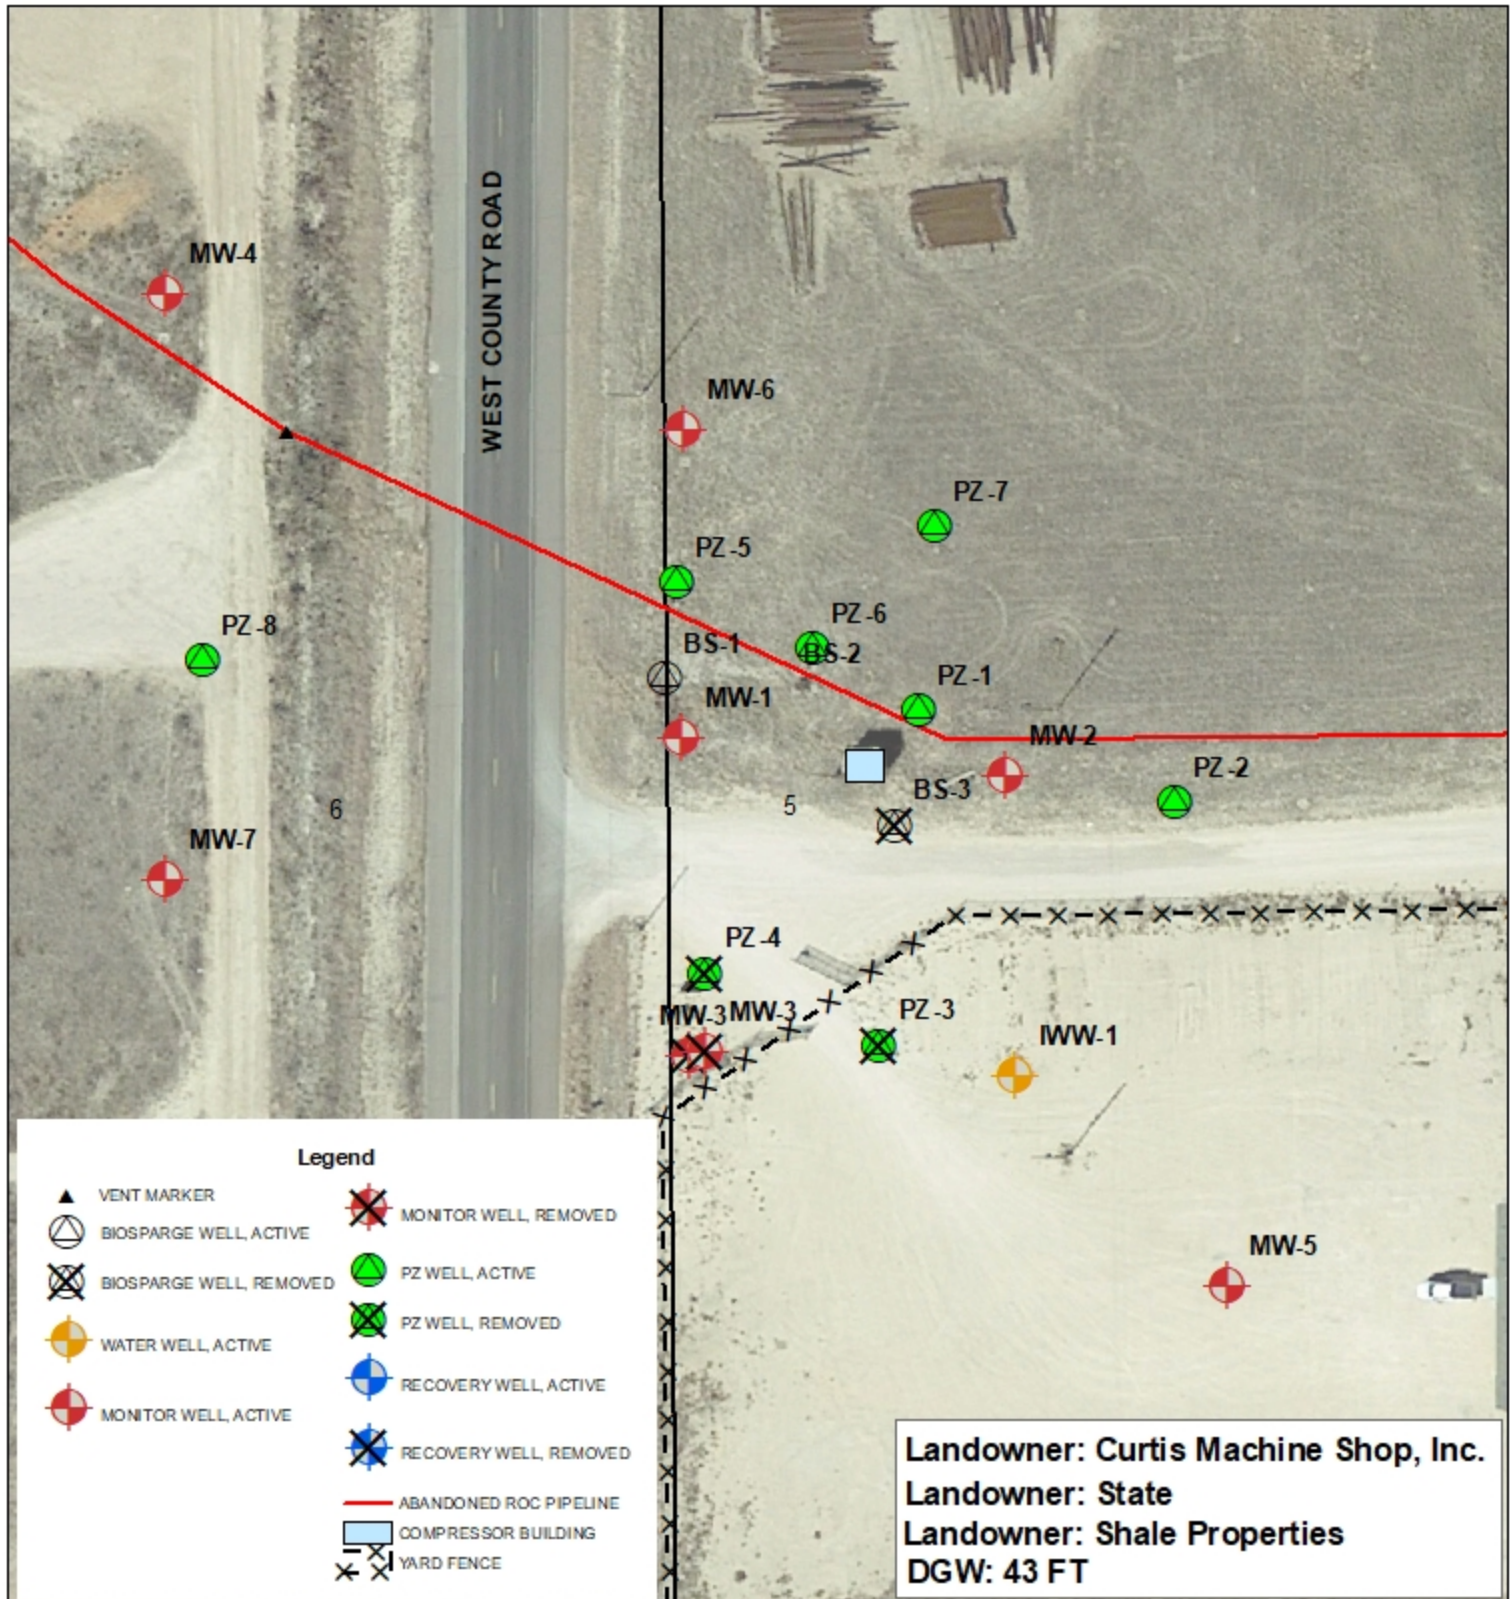


HOBBS N-6 LEAK

1R-487

UL N SECTION 5&6
T-19-S R-38-E
LEA COUNTY, NM

GPS: 32.691062 -103.178954
NAD83 STATE PLANE PROJ
NM EAST ZONE

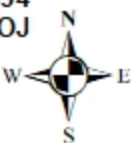

0 50 100
Feet

Drawing date: 2/4/20
Drafted by: T. Grieco

ROC - Hobbs N-6 (1R-487)
SW ¼, NW ¼, SEC. 5 & 6, T19S, R38E

MW	Depth to Water	Total Depth	Well Volume	Volume Purged	Sample Date	Cl	TDS	Benzene	Toluene	Ethyl Benzene	Total Xylenes	Sulfate	Comments
1	43.99	55.21	7.3	25	9/15/2009	232	840	XXX	XXX	XXX	XXX	XXX	Strong odor Product present
1	44.07	55.21	7.2	25	11/20/2009	200	770	XXX	XXX	XXX	XXX	XXX	Strong odor Product present
1	44.85	55.21	6.7	XXX	3/17/2010	XXX	XXX	XXX	XXX	XXX	XXX	XXX	Strong odor Product Present
1	45.05	55.21	6.6	XXX	6/7/2010	XXX	XXX	XXX	XXX	XXX	XXX	XXX	Strong odor Product present
1	44.19	55.21	7.2	XXX	9/7/2010	XXX	XXX	XXX	XXX	XXX	XXX	XXX	Strong odor Product present
1	44.74	55.21	6.8	XXX	12/8/2010	XXX	XXX	XXX	XXX	XXX	XXX	XXX	Strong odor Product present
1	45.39	55.21	6.4	XXX	3/15/2011	XXX	XXX	XXX	XXX	XXX	XXX	XXX	Strong odor Product present
1	45.73	55.21	6.2	XXX	6/23/2011	XXX	XXX	XXX	XXX	XXX	XXX	XXX	Strong odor Product present
1	45.94	55.21	6	XXX	9/22/2011	XXX	XXX	XXX	XXX	XXX	XXX	XXX	Strong odor Product present
1	46.08	55.21	5.9	XXX	12/12/2011	XXX	XXX	XXX	XXX	XXX	XXX	XXX	Strong odor Product present
1	46.25	55.21	XXX	XXX	3/21/2012	XXX	XXX	XXX	XXX	XXX	XXX	XXX	Strong odor Product present
1	46.52	55.21	XXX	XXX	6/14/2012	XXX	XXX	XXX	XXX	XXX	XXX	XXX	Strong odor Product present
1	46.12	55.21	XXX	XXX	9/11/2012	XXX	XXX	XXX	XXX	XXX	XXX	XXX	Strong odor Product present
1	46.25	55.21	XXX	XXX	12/13/2012	XXX	XXX	XXX	XXX	XXX	XXX	XXX	Strong odor Product present
1	46.11	55.21	XXX	XXX	3/6/2013	XXX	XXX	XXX	XXX	XXX	XXX	XXX	Strong odor Product present/PSH Recovery Sock Replaced

ROC - Hobbs N-6 (1R-487)**SW ¼, NW ¼, SEC. 5 & 6, T19S, R38E**

MW	Depth to Water	Total Depth	Well Volume	Volume Purged	Sample Date	Cl	TDS	Benzene	Toluene	Ethyl Benzene	Total Xylenes	Sulfate	Comments
1	46.05	55.21	XXX	XXX	6/20/2013	XXX	XXX	XXX	XXX	XXX	XXX	XXX	Strong odor/Free product present
1	46.24	55.21	XXX	XXX	9/19/2013	XXX	XXX	XXX	XXX	XXX	XXX	XXX	Strong odor/Free product present
1	46.45	55.21	XXX	XXX	12/17/2013	XXX	XXX	XXX	XXX	XXX	XXX	XXX	Strong odor/Free product present
1	46.57	55.21	XXX	XXX	3/25/2014	XXX	XXX	XXX	XXX	XXX	XXX	XXX	Strong odor/Free product present
1	46.67	55.21	XXX	XXX	6/19/2014	XXX	XXX	XXX	XXX	XXX	XXX	XXX	Strong odor/Free product present
1	46.93	55.21	XXX	XXX	9/12/2014	XXX	XXX	XXX	XXX	XXX	XXX	XXX	Strong odor/Free product present
1	47.02	55.21	XXX	XXX	12/22/2014	XXX	XXX	XXX	XXX	XXX	XXX	XXX	Strong odor/Free product present
1	46.64	55.21	XXX	XXX	3/20/2015	XXX	XXX	XXX	XXX	XXX	XXX	XXX	Strong odor/Free product present/PSH recovery sock replaced
1	46.73	55.21	XXX	XXX	6/18/2015	XXX	XXX	XXX	XXX	XXX	XXX	XXX	Strong odor/Free product present
1	46.79	55.21	XXX	XXX	9/22/2015	XXX	XXX	XXX	XXX	XXX	XXX	XXX	Strong odor/Free product present
1	46.51	55.21	XXX	XXX	12/3/2015	XXX	XXX	XXX	XXX	XXX	XXX	XXX	Strong odor/Free product present
1	46.28	55.21	XXX	XXX	3/30/2016	XXX	XXX	XXX	XXX	XXX	XXX	XXX	Strong odor/Free product present
1	47.00	55.21	XXX	XXX	6/28/2016	XXX	XXX	XXX	XXX	XXX	XXX	XXX	Strong odor/Free product present
1	46.31	55.21	XXX	XXX	9/28/2016	XXX	XXX	XXX	XXX	XXX	XXX	XXX	Strong odor/Free product present
1	45.72	55.21	XXX	XXX	12/6/2016	XXX	XXX	XXX	XXX	XXX	XXX	XXX	Strong odor/Free product present

ROC - Hobbs N-6 (1R-487)
SW ¼, NW ¼, SEC. 5 & 6, T19S, R38E

MW	Depth to Water	Total Depth	Well Volume	Volume Purged	Sample Date	Cl	TDS	Benzene	Toluene	Ethyl Benzene	Total Xylenes	Sulfate	Comments
1	45.88	55.21	XXX	XXX	3/21/2017	XXX	XXX	XXX	XXX	XXX	XXX	XXX	Strong odor Free product present
1	46.39	55.21	XXX	XXX	6/29/2017	XXX	XXX	XXX	XXX	XXX	XXX	XXX	Strong odor Free product present
1	46.28	55.21	XXX	XXX	9/26/2017	XXX	XXX	XXX	XXX	XXX	XXX	XXX	Strong odor Free product present
1	43.1	55.21	XXX	XXX	3/22/2018	XXX	XXX	XXX	XXX	XXX	XXX	XXX	Strong odor Free product present
1	46.4	55.21	XXX	XXX	6/29/2018	XXX	XXX	XXX	XXX	XXX	XXX	XXX	Strong odor Free product present
1	46.93	55.21	XXX	XXX	9/19/2018	XXX	XXX	XXX	XXX	XXX	XXX	XXX	Strong odor Free product present
1	46.87	55.21	XXX	XXX	12/22/2018	XXX	XXX	XXX	XXX	XXX	XXX	XXX	Strong odor Free product present
1	46.96	55.21	XXX	XXX	3/28/2019	XXX	XXX	XXX	XXX	XXX	XXX	XXX	Strong odor Free product present
1	46.49	55.21	XXX	XXX	6/27/2019	XXX	XXX	XXX	XXX	XXX	XXX	XXX	Strong odor Free product present
1	46.52	55.21	XXX	XXX	9/26/2019	XXX	XXX	XXX	XXX	XXX	XXX	XXX	Strong odor Free product present
1	46.58	55.21	XXX	XXX	12/12/2019	XXX	XXX	XXX	XXX	XXX	XXX	XXX	Strong odor Free product present
1	XXX	XXX	XXX	XXX	3/26/2020	XXX	XXX	XXX	XXX	XXX	XXX	XXX	XXX
1	XXX	XXX	XXX	XXX	9/30/2020	XXX	XXX	XXX	XXX	XXX	XXX	XXX	XXX
1	XXX	XXX	XXX	XXX	3/29/2021	XXX	XXX	XXX	XXX	XXX	XXX	XXX	XXX
1	XXX	XXX	XXX	XXX	6/29/2021	XXX	XXX	XXX	XXX	XXX	XXX	XXX	XXX
1	XXX	XXX	XXX	XXX	9/28/2021	XXX	XXX	XXX	XXX	XXX	XXX	XXX	XXX
1	XXX	XXX	XXX	XXX	12/2/2021	XXX	XXX	XXX	XXX	XXX	XXX	XXX	XXX
1	XXX	XXX	XXX	XXX	3/30/2022	XXX	XXX	XXX	XXX	XXX	XXX	XXX	XXX
1	XXX	XXX	XXX	XXX	6/30/2022	XXX	XXX	XXX	XXX	XXX	XXX	XXX	XXX
1	XXX	XXX	XXX	XXX	9/27/2022	XXX	XXX	XXX	XXX	XXX	XXX	XXX	XXX

ROC - Hobbs N-6 (1R-487)**SW ¼, NW ¼, SEC. 5 & 6, T19S, R38E**

MW	Depth to Water	Total Depth	Well Volume	Volume Purged	Sample Date	CI	TDS	Benzene	Toluene	Ethyl Benzene	Total Xylenes	Sulfate	Comments
1	XXX	XXX	XXX	XXX	12/15/2022	XXX	XXX	XXX	XXX	XXX	XXX	XXX	XXX

MW	Depth to Water	Total Depth	Well Volume	Volume Purged	Sample Date	CI	TDS	Benzene	Toluene	Ethyl Benzene	Total Xylenes	Sulfate	Comments
2	40.2	52.18	7.78	23.36	8/14/2002	XXX	XXX	XXX	XXX	XXX	XXX	XXX	
2	40.34	52.11	7.65	22.75	12/6/2002	XXX	XXX	XXX	XXX	XXX	XXX	XXX	
2	40.61	52.2	7.53	22.6	3/14/2003	53.2	XXX	0.003	0.001	0.006	0.004	109	
2	40.29	52.13	7.69	23.08	6/27/2003	40.8	499	<0.001	<0.001	<0.001	<0.001	112	
2	40.26	52.14	7.75	23.27	9/22/2003	31.9	504	<0.001	<0.001	<0.001	<0.001	88.8	
2	40.39	52.13	7.66	22.99	12/18/2003	44	458	<0.002	<0.002	<0.002	<0.006	37.7	
2	41.53	52.13	6.92	20.76	3/15/2004	39	484	0.00458	<0.001	0.00236	0.00193	108	
2	40.3	52.12	7.71	23.15	5/27/2004	31.9	481	0.000448	<0.001	0.000482	<0.001	89.4	
2	41.69	52.24	6.86	20.57	9/8/2004	70.9	577	0.0289	0.00219	0.0126	0.00837	91.4	
2	39.4	52.24	8.35	25.04	11/22/2004	58.1	XXX	0.0238	0.00269	0.0239	0.01051	90.2	
2	38.73	52.24	XXX	32	3/29/2005	39.1	444	0.00169	<0.001	0.00151	0.00101	93.6	
2	39.12	55	XXX	31.4	6/28/2005	42.4	515	<0.001	<0.001	<0.001	<0.001	100	
2	39.21	55	XXX	31	9/6/2005	49.5	517	<0.001	<0.001	<0.001	<0.001	69.5	
2	39.3	52.24	8.4	30	12/6/2005	58	380	0.00325	<0.001	<0.001	<0.001	107	
2	39.56	52.24	8.2	25	2/28/2006	29.5	538	<0.001	<0.001	<0.001	<0.001	56.3	
2	39.97	52.24	8	25	6/5/2006	38.5	552	<0.001	<0.001	<0.001	<0.001	76.6	
2	39.44	52.24	8.3	25	9/11/2006	31.1	428	<0.001	<0.001	<0.001	<0.001	92	
2	39.47	52.24	8.3	30	11/14/2006	33.6	442	j[0.000709]	<0.001	j[0.00609]	<0.001	91.7	test
2	39.89	52.24	8	30	3/13/2007	34.5	422	0.00134	<0.001	<0.001	<0.001	81.5	Clear No odor
2	40.26	52.24	7.8	30	6/12/2007	33.3	444	j(0.000649)	0.0016	j(0.000792)	ND	77.6	Clear
2	40.22	52.24	7.8	25	9/18/2007	36	512	0.056	0.012	0.054	0.037	100	Clear Slight odor
2	40.35	52.24	7.7	25	12/6/2007	40	454	<0.001	<0.001	<0.001	<0.003	92.7	Clear Slight odor

ROC - Hobbs N-6 (1R-487)**SW ¼, NW ¼, SEC. 5 & 6, T19S, R38E**

MW	Depth to Water	Total Depth	Well Volume	Volume Purged	Sample Date	Cl	TDS	Benzene	Toluene	Ethyl Benzene	Total Xylenes	Sulfate	Comments
2	40.71	52.24	7.5	25	3/3/2008	36	442	<0.001	<0.001	<0.001	<0.003	98.4	Clear Slight odor
2	40.29	52.24	7.8	25	5/28/2008	32	523	<0.001	<0.001	<0.001	<0.003	83.2	Clear Slight odor
2	40.56	52.24	7.6	25	9/8/2008	52	455	<0.001	<0.001	<0.001	<0.003	131	Clear Slight odor
2	41.43	52.24	7	25	12/15/2008	40	493	0.001	<0.001	0.002	<0.003	98	Clear Slight odor
2	41.61	52.55	7.1	25	3/16/2009	40	492	0.005	<0.001	0.004	<0.003	91.9	Clear Slight odor
2	41.78	52.55	7	25	6/9/2009	36	516	0.003	0.001	<0.001	<0.003	81.5	Clear Slight odor
2	41.87	52.55	6.9	25	9/14/2009	40	500	0.001	0.004	0.007	0.023	85	Clear Slight odor
2	41.96	52.55	6.9	25	11/19/2009	40	425	<0.001	<0.001	<0.001	<0.003	75.8	Clear Slight odor
2	42.08	52.55	6.8	25	3/17/2010	48	669	<0.001	<0.001	<0.001	<0.003	157	Clear Slight odor
2	42.32	52.55	6.6	25	6/7/2010	40	494	<0.001	<0.001	<0.001	<0.003	80.7	Clear Slight odor
2	41.15	52.55	7.4	25	9/1/2010	40	479	<0.001	<0.001	<0.001	<0.003	86	Clear Slight odor
2	41.36	52.55	7.3	25	12/9/2010	56	482	<0.001	<0.001	<0.001	<0.003	87.5	Clear Slight odor
2	42.01	52.55	6.9	25	3/16/2011	56	488	<0.001	<0.001	<0.001	<0.003	92	Clear Slight odor
2	42.4	52.55	6.6	25	6/22/2011	44	461	<0.001	<0.001	<0.001	<0.003	95.6	Clear Slight odor
2	42.68	52.55	6.4	25	9/21/2011	48	464	<0.001	<0.001	<0.001	<0.003	99.3	Clear Slight odor
2	42.84	52.55	6.3	25	12/13/2011	52	493	<0.001	<0.001	<0.001	<0.003	97.1	Clear Slight odor
2	43.03	52.55	6.2	25	3/20/2012	52	505	<0.001	<0.001	<0.001	<0.003	99.3	Clear Slight odor
2	43.26	52.55	6	25	6/15/2012	68	526	<0.001	<0.001	<0.001	<0.003	95.5	Clear Slight odor
2	43.37	52.55	6	25	9/11/2012	60	512	<0.001	<0.001	<0.001	<0.003	95.7	Clear Slight odor
2	43.57	52.55	5.8	25	12/12/2012	48	473	<0.001	<0.001	<0.001	<0.003	96.4	Clear Slight odor
2	43.67	52.55	5.8	25	3/6/2013	64	454	<0.001	<0.001	<0.001	<0.003	103	Clear Slight odor
2	43.96	52.55	5.6	25	6/20/2013	60	512	<0.001	<0.001	<0.001	<0.003	87	Clear Slight odor
2	44.08	52.55	5.5	25	9/19/2013	44	477	<0.001	<0.001	<0.001	<0.003	76.1	Clear Slight odor
2	44.28	52.55	5.4	25	12/16/2013	48	458	<0.001	<0.001	<0.001	<0.003	95.4	Clear Slight odor
2	44.4	52.55	5.3	25	3/24/2014	68	532	<0.001	<0.001	<0.001	<0.003	81.4	Clear Slight odor
2	44.61	52.55	5.2	25	6/18/2014	64	512	0.001	<0.001	<0.001	<0.003	80	Clear Slight odor
2	44.85	52.55	5	25	9/11/2014	60	526	<0.001	<0.001	<0.001	<0.003	91.3	Clear Slight odor
2	44.93	52.55	5	25	12/22/2014	64	432	<0.001	<0.001	<0.001	<0.003	86	Clear Slight odor

ROC - Hobbs N-6 (1R-487)
SW ¼, NW ¼, SEC. 5 & 6, T19S, R38E

MW	Depth to Water	Total Depth	Well Volume	Volume Purged	Sample Date	Cl	TDS	Benzene	Toluene	Ethyl Benzene	Total Xylenes	Sulfate	Comments
2	44.58	52.55	5.2	25	3/19/2015	52	478	<0.001	<0.001	<0.001	<0.003	83.6	Clear Slight odor
2	44.68	52.55	5.1	25	6/17/2015	100	558	<0.001	<0.001	<0.001	<0.003	75	Clear Slight odor
2	44.75	52.55	5.1	25	9/22/2015	72	550	<0.001	<0.001	<0.001	<0.003	79.6	Clear Slight odor
2	44.48	52.55	5.2	25	12/2/2015	68	558	<0.001	<0.001	<0.001	<0.003	81	Clear Slight odor
2	44.25	52.55	5.4	25	3/29/2016	68	508	<0.001	<0.001	<0.001	<0.003	84.1	Clear Slight odor
2	44.94	52.55	4.9	25	6/27/2016	48	500	<0.001	<0.001	<0.001	<0.003	112	Clear Slight odor
2	44.29	52.55	5.4	25	9/27/2016	52	500	<0.001	<0.001	<0.001	<0.003	99	Clear Slight odor
2	43.72	52.55	5.7	25	12/6/2016	72	482	<0.001	<0.001	<0.001	<0.003	89	Clear Slight odor
2	43.84	52.55	5.7	25	3/21/2017	52	510	<0.001	<0.001	<0.001	<0.003	92	Clear Slight odor
2	44.27	52.55	5.4	25	6/28/2017	84	558	<0.001	<0.001	<0.001	<0.003	79	Clear Slight odor
2	44.19	52.55	5.4	25	9/26/2017	60	580	<0.001	<0.001	<0.001	<0.003	91	Clear Slight odor
2	44.26	52.55	5.4	25	12/22/2017	80	586	<0.001	<0.001	<0.001	<0.003	98	Clear Slight odor
2	44.09	52.55	5.5	25	3/21/2018	72	538	<0.001	<0.001	<0.001	<0.003	94.4	Clear Slight odor
2	44.41	52.55	5.3	25	6/28/2018	108	540	<0.001	<0.001	<0.001	<0.003	71.4	Clear Slight odor
2	45.02	52.55	4.9	25	9/19/2018	72	552	<0.001	<0.001	<0.001	<0.003	93.6	Clear Slight odor
2	44.98	52.55	4.9	25	12/22/2018	44	515	<0.001	<0.001	<0.001	<0.003	115	Clear Slight odor
2	45.03	52.55	4.9	25	3/27/2019	124	427	<0.001	<0.001	<0.001	<0.003	79	Clear Slight odor
2	44.15	52.55	5.5	25	6/26/2019	144	597	<0.001	<0.001	<0.001	<0.003	74	Clear Slight odor
2	46.79	52.55	5.6	25	9/26/2019	128	614	<0.001	<0.001	<0.001	<0.003	83	Clear Slight odor
2	44.88	52.55	5.6	20	12/12/2019	52	521	<0.001	<0.001	<0.001	<0.003	94	Clear Slight odor
2	45.43	52.55	4.6	20	3/26/2020	52	519	<0.001	<0.001	<0.001	<0.003	85.6	Clear Slight odor
2	45.84	52.55	4.4	20	9/30/2020	76	522	<0.001	<0.001	<0.001	<0.003	70.2	Clear Slight odor
2	45.29	52.55	4.7	20	3/30/2021	72	405	<0.001	<0.001	<0.001	<0.003	78.4	Clear Slight odor
2	45.36	52.55	4.7	20	6/30/2021	72	525	<0.001	<0.001	<0.001	<0.003	83.4	Clear Slight odor
2	46.04	52.55	4.2	20	9/29/2021	80	554	<0.001	<0.001	<0.001	<0.003	75.3	Clear Slight odor
2	46.09	52.55	4.2	20	12/3/2021	96	544	<0.001	<0.001	<0.001	<0.003	101	Clear Slight odor
2	46.52	52.55	3.9	20	3/30/2022	72	531	<0.001	<0.001	<0.001	<0.003	78.9	Clear Slight odor
2	46.58	52.55	3.9	20	6/30/2022	72	545	<0.001	<0.001	<0.001	<0.003	92.5	Clear Slight odor

ROC - Hobbs N-6 (1R-487)**SW ¼, NW ¼, SEC. 5 & 6, T19S, R38E**

MW	Depth to Water	Total Depth	Well Volume	Volume Purged	Sample Date	Cl	TDS	Benzene	Toluene	Ethyl Benzene	Total Xylenes	Sulfate	Comments
2	46.7	52.55	3.8	20	9/27/2022	116	552	<0.001	<0.001	<0.001	<0.003	74.5	Clear Slight odor
2	46.68	52.55	3.8	15	12/15/2022	92	557	<0.001	<0.001	<0.001	<0.003	78.2	Clear Slight odor

MW	Depth to Water	Total Depth	Well Volume	Volume Purged	Sample Date	Cl	TDS	Benzene	Toluene	Ethyl Benzene	Total Xylenes	Sulfate	Comments
3	40.76	156	74.92	224.76	12/6/2002	XXX	XXX	XXX	XXX	XXX	XXX	XXX	
3	10.95	156	74.79	224.38	3/14/2003	5,850	XXX	0.06	0.001	0.001	0.003	888	
3	40.69	156	74.97	224.93	6/27/2003	5,320	10,700	0.013	<0.001	<0.001	0.001	1120	
3	40.68	156.1	75.34	226.02	9/22/2003	5,320	10,900	0.008	<0.001	<0.001	0.001	1050	
3	40.82	156	75.23	225.69	12/18/2003	5,398	10,512	0.018	<0.002	<0.002	<0.006	399	
3	41.82	156	74.57	223.73	3/15/2004	5,140	8,990	0.0354	<0.001	0.000821	0.00165	793	
3	40.83	156.1	75.23	225.71	5/27/2004	5,230	8,060	0.0131	0.000238	0.000248	0.00098	664	
3	41.93	156.2	74.27	222.73	9/8/2004	5,140	8,600	0.0152	<0.001	0.00184	0.00357	762	
3	39.64	156.2	75.73	227.19	11/23/2004	3,890	XXX	0.0281	0.000202	0.000775	0.00449	683	
3	38.73	156.2	XXX	235	3/29/2005	7,300	14,700	0.0805	<0.001	0.00291	0.00422	1030	
3	39.35	156.2	XXX	39.35	6/28/2005	7,280	8,930	0.00619	<0.001	<0.001	<0.001	2760	
3	39.43	155.8	XXX	40	9/6/2005	4,660	7,070	0.00566	<0.001	0.00219	0.00455	874	
3	39.52	156.2	75.8	230	12/6/2005	7,130	12,100	0.0529	0.000572	0.00312	<0.001	848	
3	39.82	156.2	75.6	230	2/28/2006	7,270	15,300	0.0315	0.00264	0.00535	<0.001	829	
3	40.19	156.2	75.4	230	6/5/2006	7,660	13,600	0.0171	j[0.000488]	0.00258	<0.001	914	Clear Septic odor
3	39.8	156.2	75.6	225	9/12/2006	7,390	13,100	0.0107	j[0.000587]	<0.001	<0.001	939	
3	39.67	156.2	75.7	230	11/14/2006	6,810	12,600	0.00697	j[0.000417]	j[0.000413]	<0.001	901	Strong septic odor
3	42.15	156.7	9.4	30	3/14/2007	7,810	13,500	0.00177	j[0.000597]	j[0.000405]	<0.001	916	
3	40.48	156.2	75.2	230	6/11/2007	9,390	16,100	0.0139	0.00168	0.00485	0.01006	1100	Clear
3	40.43	156.2	75.2	230	9/18/2007	7,298	14,814	0.028	0.001	<0.001	0.009	1010	Clear Strong septic odor

ROC - Hobbs N-6 (1R-487)**SW ¼, NW ¼, SEC. 5 & 6, T19S, R38E**

MW	Depth to Water	Total Depth	Well Volume	Volume Purged	Sample Date	Cl	TDS	Benzene	Toluene	Ethyl Benzene	Total Xylenes	Sulfate	Comments
3	40.5	156.2	75.2	320	12/5/2007	2,700	5,870	0.052	0.001	0.001	0.003	680	Clear Strong septic odor
3	40.76	156.2	75	250	3/4/2008	7,600	14,100	0.014	<0.001	<0.001	<0.003	1110	Clear Strong septic odor
3	40.97	156.2	75	250	5/29/2008	4,100	8,170	0.007	0.004	0.003	<0.003	592	Clear Strong septic odor
3	41.26	156.2	75	250	9/5/2008	7,600	15,200	0.011	<0.001	<0.001	<0.003	978	Clear Strong septic odor
3	41.42	156.2	75	250	12/16/2008	4,250	8,710	0.006	<0.001	<0.001	<0.003	600	Clear Strong septic odor
3	41.6	156.2	74	250	3/16/2009	3,730	7,570	0.004	<0.001	<0.001	<0.003	527	Clear Strong septic odor
3	41.79	156.2	74	250	6/9/2009	3,750	7,600	0.001	<0.001	<0.001	<0.003	522	Clear Strong Septic odor
3	41.91	156.2	74	250	9/15/2009	3,700	7,480	0.002	<0.001	<0.001	<0.003	492	Clear Strong septic odor
3	42.05	156.2	74	250	11/20/2009	3,250	6,560	<0.001	<0.001	<0.001	<0.003	434	Clear Strong septic odor
3	42.17	156.2	74	250	3/18/2010	7,700	14,100	0.006	<0.001	<0.001	<0.003	1030	Clear Strong septic odor
3	42.26	156.2	74	250	6/7/2010	7,600	13,700	0.002	<0.001	<0.001	<0.003	894	Clear Strong septic odor
3	41.09	156.2	75	250	9/8/2010	2,700	5,100	0.002	<0.001	<0.001	<0.003	293	Clear Strong septic odor
3	41.25	156.2	75	250	12/8/2010	4,150	6,650	0.001	<0.001	0.001	<0.003	470	Clear Strong septic odor
3	41.9	156.2	74	250	3/16/2011	7,800	17,100	0.005	<0.001	<0.001	<0.003	868	Clear Strong septic odor
3	42.39	156.2	74	250	6/23/2011	3,000	4,940	<0.001	<0.001	<0.001	<0.003	343	Clear Strong septic odor
3	42.52	156.2	74	250	9/22/2011	2,170	4,120	<0.001	<0.001	<0.001	<0.003	282	Clear Strong Septic odor

ROC - Hobbs N-6 (1R-487)**SW ¼, NW ¼, SEC. 5 & 6, T19S, R38E**

MW	Depth to Water	Total Depth	Well Volume	Volume Purged	Sample Date	Cl	TDS	Benzene	Toluene	Ethyl Benzene	Total Xylenes	Sulfate	Comments
3	42.69	156.2	74	250	12/12/2011	2,470	5,000	<0.001	<0.001	<0.001	<0.003	327	Clear Strong septic odor
3	42.84	156.2	74	250	3/21/2012	2,930	6,170	<0.001	<0.001	<0.001	<0.003	408	Clear Strong septic odor
3	43.14	156.2	73	250	6/15/2012	2,020	4,640	<0.001	<0.001	<0.001	<0.003	249	Clear Strong septic odor
3	43.23	156.2	73	250	9/12/2012	1,470	3,530	<0.001	<0.001	<0.001	<0.003	265	Clear Strong septic odor
MW-3 plugged 12/17/2012													

MW	Depth to Water	Total Depth	Well Volume	Volume Purged	Sample Date	Cl	TDS	Benzene	Toluene	Ethyl Benzene	Total Xylenes	Sulfate	Comments
3R	41.1	55.9	2.4	10	12/8/2010	184	744	<0.001	<0.001	<0.001	<0.003	80.9	Clear No odor
3R	41.89	55.9	2.2	10	3/16/2011	204	792	<0.001	<0.001	<0.001	<0.003	76.9	Clear No odor
3R	42.33	55.9	2.2	10	6/23/2011	248	817	<0.001	<0.001	<0.001	<0.003	67.4	Clear No odor
3R	42.59	55.9	2.1	10	9/21/2011	240	795	<0.001	<0.001	<0.001	<0.003	71.2	Clear No odor
3R	42.8	55.9	2.1	10	12/12/2011	200	768	<0.001	<0.001	<0.001	<0.003	82.8	Clear No odor
3R	42.97	55.9	2.1	10	3/20/2012	212	904	<0.001	<0.001	<0.001	<0.003	81.1	Clear No odor
3R	43.21	55.9	2	10	6/15/2012	220	857	<0.001	<0.001	<0.001	<0.003	72.6	Clear No odor
3R	43.28	55.9	2	10	9/11/2012	252	912	<0.001	<0.001	<0.001	<0.003	68.5	Clear No odor
MW-3R plugged 12/17/2012													

MW	Depth to Water	Total Depth	Well Volume	Volume Purged	Sample Date	Cl	TDS	Benzene	Toluene	Ethyl Benzene	Total Xylenes	Sulfate	Comments
4	42.42	56.65	9.24	27.74	8/14/2002	XXX	XXX	XXX	XXX	XXX	XXX	XXX	

ROC - Hobbs N-6 (1R-487)**SW ¼, NW ¼, SEC. 5 & 6, T19S, R38E**

MW	Depth to Water	Total Depth	Well Volume	Volume Purged	Sample Date	Cl	TDS	Benzene	Toluene	Ethyl Benzene	Total Xylenes	Sulfate	Comments
4	42.6	56.66	9.14	27.42	12/6/2002	XXX	XXX	XXX	XXX	XXX	XXX	XXX	
4	42.84	56.63	8.96	26.89	3/14/2003	84	XXX	<0.001	<0.001	<0.001	<0.001	123	
4	42.58	56.65	9.14	27.43	6/27/2003	62	520	<0.001	<0.001	<0.001	0.002	138	
4	42.66	56.7	9.16	27.5	9/22/2003	65	569	<0.001	<0.001	<0.001	<0.001	123	
4	42.69	56.67	9.12	27.38	12/18/2003	64	547	<0.002	<0.002	<0.002	<0.006	44.8	
4	43.77	56.67	8.42	25.27	3/15/2004	124	560	0.00103	<0.001	<0.001	<0.001	127	
4	42.65	56.65	9.14	27.42	5/27/2004	50	484	<0.001	<0.001	<0.001	<0.001	107	
4	43.92	56.71	8.31	24.94	9/8/2004	50	492	0.00142	<0.001	<0.001	<0.001	114	
4	41.26	56.71	10.04	30.13	11/23/2004	55	XXX	<0.001	<0.001	<0.001	<0.001	99.2	
4	40.85	56.71	XXX	32	3/29/2005	47	424	<0.001	<0.001	<0.001	<0.001	101	
4	41.32	61.65	XXX	40	6/28/2005	45	519	<0.001	<0.001	<0.001	<0.001	102	
4	41.42	61.65	XXX	40	9/6/2005	70	523	<0.001	<0.001	<0.001	<0.001	92.5	
4	41.58	56.71	9.8	30	12/6/2005	40	370	<0.001	<0.001	<0.001	<0.001	82.2	
4	41.84	56.71	9.7	30	2/28/2006	40	556	<0.001	<0.001	<0.001	<0.001	71.7	
4	42.27	56.71	9.4	30	6/5/2006	59	476	<0.001	<0.001	<0.001	<0.001	76.2	
4	41.66	56.71	9.8	30	9/11/2006	66	588	<0.001	<0.001	<0.001	<0.001	87	
4	41.63	56.71	9.8	30	11/14/2006	93	498	<0.001	<0.001	<0.001	<0.001	90.8	
4	42.15	56.68	9.4	30	3/13/2007	95	528	<0.001	<0.001	<0.001	<0.001	82.7	Clear No odor
4	42.59	56.68	9.2	30	6/11/2007	70	516	<0.001	<0.001	<0.001	<0.001	77.6	Clear
4	42.53	56.68	9.2	30	9/18/2007	84	604	<0.001	<0.001	<0.001	<0.003	93.2	Clear No odor
4	42.65	56.68	9.1	30	12/6/2007	120	588	<0.001	<0.001	<0.001	<0.003	99.7	Clear No odor
4	42.98	56.68	8.9	30	3/3/2008	128	609	<0.001	<0.001	<0.001	<0.003	115	Clear No odor
4	43.19	56.68	8.8	30	5/28/2008	84	639	<0.001	<0.001	<0.001	<0.003	98.7	Clear No odor
4	43.47	56.68	8.6	30	9/8/2008	192	768	<0.001	<0.001	<0.001	<0.003	130	Clear No odor
4	43.67	56.68	8.5	30	12/15/2008	152	683	<0.001	<0.001	<0.001	<0.003	90.6	Clear No odor
4	43.84	56.72	8.4	30	3/17/2009	152	614	<0.001	<0.001	<0.001	<0.003	89.8	Clear No odor
4	44.21	56.72	8.1	30	6/10/2009	128	646	<0.001	<0.001	<0.001	<0.003	71.1	Clear No odor
4	44.33	56.72	8.1	30	9/14/2009	136	594	<0.001	<0.001	<0.001	<0.003	72.9	Clear No odor

ROC - Hobbs N-6 (1R-487)**SW ¼, NW ¼, SEC. 5 & 6, T19S, R38E**

MW	Depth to Water	Total Depth	Well Volume	Volume Purged	Sample Date	Cl	TDS	Benzene	Toluene	Ethyl Benzene	Total Xylenes	Sulfate	Comments
4	44.28	56.72	8.1	30	11/19/2009	132	614	<0.001	<0.001	<0.001	<0.003	68.1	Clear No odor
4	44.43	56.71	8	30	3/17/2010	44	637	<0.001	<0.001	<0.001	<0.003	148	Clear No odor
4	44.56	56.71	7.9	30	6/8/2010	108	552	<0.001	<0.001	<0.001	<0.003	89	Clear No odor
4	43.12	56.71	8.8	30	9/7/2010	120	587	<0.001	<0.001	<0.001	<0.003	71.3	Clear No odor
4	43.49	56.71	8.6	30	12/9/2010	100	468	<0.001	<0.001	<0.001	<0.003	95.7	Clear No odor
4	44.26	56.71	8.1	30	3/15/2011	88	554	<0.001	<0.001	<0.001	<0.003	79.7	Clear No odor
4	44.69	56.71	7.8	30	6/22/2011	88	544	<0.001	<0.001	<0.001	<0.003	90.2	Clear No odor
4	44.96	56.71	7.6	30	9/21/2011	80	493	<0.001	<0.001	<0.001	<0.003	89	Clear No odor
4	45.16	56.71	7.5	30	12/13/2011	84	531	<0.001	<0.001	<0.001	<0.003	96.5	Clear No odor
4	45.33	56.71	7.4	30	3/20/2012	84	562	<0.001	<0.001	<0.001	<0.003	99.8	Clear No odor
4	45.53	56.71	7.3	30	6/14/2012	76	557	<0.001	<0.001	<0.001	<0.003	79.7	Clear No odor
4	45.61	56.71	7.2	30	9/11/2012	104	600	<0.001	<0.001	<0.001	<0.003	99.5	Clear No odor
4	45.78	56.71	7.1	30	12/12/2012	104	605	<0.001	<0.001	<0.001	<0.003	95	Clear No odor
4	45.98	56.71	7	30	3/5/2013	96	522	<0.001	<0.001	<0.001	<0.003	100	Clear No odor
4	46.25	56.71	6.8	30	6/20/2013	36	471	<0.001	<0.001	<0.001	<0.003	76	Clear No odor
4	46.44	56.71	6.7	30	9/18/2013	80	527	<0.001	<0.001	<0.001	<0.003	73.5	Clear No odor
4	46.58	56.71	6.6	30	12/16/2013	84	510	<0.001	<0.001	<0.001	<0.003	87.7	Clear No odor
4	46.7	56.71	6.5	30	3/24/2014	88	554	<0.001	<0.001	<0.001	<0.003	94.8	Clear No odor
4	46.92	56.71	6.4	30	6/18/2014	67	510	<0.001	<0.001	<0.001	<0.001	79	Clear No odor
4	47.16	56.71	6.2	30	9/11/2014	112	532	<0.001	<0.001	<0.001	<0.003	162	Clear No odor
4	47.24	56.71	6.2	30	12/22/2014	72	418	<0.001	<0.001	<0.001	<0.003	89	Clear No odor
4	46.85	56.71	6.4	30	3/19/2015	68	488	<0.001	<0.001	<0.001	<0.003	74	Clear No odor
4	46.95	56.71	6.3	30	6/18/2015	88	564	<0.001	<0.001	<0.001	<0.003	75	Clear No odor
4	47.01	56.71	6.3	30	9/23/2015	76	568	<0.001	<0.001	<0.001	<0.003	80.3	Clear No odor
4	46.76	56.71	6.5	25	12/3/2015	68	508	<0.001	<0.001	<0.001	<0.003	73	Clear No odor
4	46.52	56.71	6.6	25	3/20/2016	72	496	<0.001	<0.001	<0.001	<0.003	82.8	Clear No odor
4	47.28	56.71	6.1	20	6/28/2016	92	538	<0.001	<0.001	<0.001	<0.003	79.9	Clear No odor
4	46.56	56.71	6.6	25	9/28/2016	76	560	<0.001	<0.001	<0.001	<0.003	94	Clear No odor

ROC - Hobbs N-6 (1R-487)**SW ¼, NW ¼, SEC. 5 & 6, T19S, R38E**

MW	Depth to Water	Total Depth	Well Volume	Volume Purged	Sample Date	Cl	TDS	Benzene	Toluene	Ethyl Benzene	Total Xylenes	Sulfate	Comments
4	45.9	56.71	7	25	12/7/2016	76	494	<0.001	<0.001	<0.001	<0.003	81	Clear No odor
4	46.03	56.71	6.9	25	3/22/2017	84	520	<0.001	<0.001	<0.001	<0.003	86	Clear No odor
4	46.51	56.71	6.6	25	6/29/2017	96	610	<0.001	<0.001	<0.001	<0.003	106	Clear No odor
4	46.46	56.71	6.7	25	9/27/2017	80	590	<0.001	<0.001	<0.001	<0.003	96	Clear No odor
4	46.53	56.71	6.6	25	12/26/2017	80	588	<0.001	<0.001	<0.001	<0.003	195	Clear No odor
4	46.94	56.71	6.4	25	3/22/2018	96	488	<0.001	<0.001	<0.001	<0.003	82.5	Clear No odor
4	47.22	56.71	6.2	20	6/29/2018	92	440	<0.001	<0.001	<0.001	<0.003	77	Clear No odor
4	47.33	56.71	6.1	25	9/20/2018	100	436	<0.001	<0.001	<0.001	<0.003	73.8	Clear No odor
4	47.24	56.71	6.2	20	12/23/2018	80	396	<0.001	<0.001	<0.001	<0.003	92.3	Clear No odor
4	47.33	56.71	6.1	25	3/28/2019	132	385	<0.001	<0.001	<0.001	<0.003	89	Clear No odor
4	47.03	56.71	6.3	25	6/27/2019	144	596	<0.001	<0.001	<0.001	<0.003	83	Clear No odor
4	46.79	56.71	6.4	25	9/27/2019	132	597	<0.001	<0.001	<0.001	<0.003	80	Clear No odor
4	47.28	56.71	6.1	20	12/13/2019	120	573	<0.001	<0.001	<0.001	<0.003	70	Clear No odor
4	47.68	56.71	5.9	20	3/25/2020	136	640	<0.001	<0.001	<0.001	<0.003	74.7	Clear No odor
4	48.08	56.71	5.6	20	9/29/2020	136	579	<0.001	<0.001	<0.001	<0.003	61.5	Clear No odor
4	47.42	56.71	6	20	3/29/2021	148	625	<0.001	<0.001	<0.001	<0.003	79.4	Clear No odor
4	47.54	56.71	6	20	6/29/2021	196	756	<0.001	<0.001	<0.001	<0.003	97.3	Clear No odor
4	48.23	56.71	6	20	9/28/2021	140	656	<0.001	<0.001	<0.001	<0.003	80.6	Clear No odor
4	48.27	56.71	5.5	20	12/2/2021	148	619	<0.001	<0.001	<0.001	<0.003	110	Clear No odor
4	48.7	56.71	5.2	20	3/29/2022	136	593	<0.001	<0.001	<0.001	<0.003	66.2	Clear No odor
4	48.85	56.71	5.1	20	6/29/2022	184	758	<0.001	<0.001	<0.001	<0.003	112	Clear No odor

ROC - Hobbs N-6 (1R-487)**SW ¼, NW ¼, SEC. 5 & 6, T19S, R38E**

MW	Depth to Water	Total Depth	Well Volume	Volume Purged	Sample Date	Cl	TDS	Benzene	Toluene	Ethyl Benzene	Total Xylenes	Sulfate	Comments
4	48.94	56.71	5.1	20	9/26/2022	124	585	<0.001	<0.001	<0.001	<0.003	76	Clear No odor
4	48.91	56.71	5.1	20	12/14/2022	128	616	<0.001	<0.001	<0.001	<0.003	75.6	Clear No odor

MW	Depth to Water	Total Depth	Well Volume	Volume Purged	Sample Date	Cl	TDS	Benzene	Toluene	Ethyl Benzene	Total Xylenes	Sulfate	Comments
5	38.82	51.18	8.01	24.04	12/6/2002	XXX	XXX	XXX	XXX	XXX	XXX	XXX	
5	39.04	51.18	7.89	23.67	3/14/2003	39	XXX	<0.001	<0.001	<0.001	<0.001	105	
5	38.81	51.21	8.06	24.18	6/27/2003	35.4	513	<0.001	<0.001	<0.001	0.002	120	
5	51.2	38.77	8.11	24.35	9/22/2003	33.7	508	<0.001	<0.001	<0.001	<0.001	88.2	
5	38.91	51.19	8.01	24.05	12/18/2003	56	474	<0.002	<0.002	<0.002	<0.006	39.4	
5	40	51.19	7.3	21.92	3/15/2004	762	1620	0.0107	<0.001	0.000543	0.00088	216	
5	38.9	51.19	8.02	24.07	5/27/2004	33.7	473	<0.001	<0.001	<0.001	<0.001	94	
5	40.18	51.31	7.23	21.7	9/8/2004	35.4	517	<0.001	<0.001	<0.001	<0.001	79.4	
5	38.12	51.31	8.57	25.72	11/23/2004	57.3	XXX	<0.001	<0.001	<0.001	<0.001	85.4	
5	37.3	51.31	XXX	32	3/29/2005	35	449	<0.001	<0.001	<0.001	<0.001	83.1	
5	XXX	XXX	XXX	XXX	6/28/2005	38.1	504	<0.001	<0.001	<0.001	<0.001	95.8	
5	37.74	51.07	XXX	26.11	9/6/2005	66.8	488	<0.001	<0.001	<0.001	<0.001	103	
5	37.8	51.31	8.8	30	12/6/2005	29.6	442	0.00044	<0.001	<0.001	<0.001	67	
5	38.11	51.31	8.6	30	2/28/2006	27.9	504	<0.001	<0.001	<0.001	<0.001	62.8	
5	38.48	51.31	8.3	30	6/5/2006	37.8	484	<0.001	<0.001	<0.001	<0.001	69	
5	38.08	51.31	8.6	30	9/11/2006	39	596	<0.001	<0.001	<0.001	<0.001	81.2	
5	37.94	51.31	8.7	30	11/14/2006	30.2	430	<0.001	<0.001	<0.001	<0.001	85	
5	38.33	51.3	8.4	30	3/13/2007	36.2	420	<0.001	<0.001	<0.001	<0.001	78	Clear No odor
5	38.82	51.3	8.1	30	6/11/2007	35.2	454	<0.001	<0.001	<0.001	<0.001	71.8	Clear
5	38.78	51.3	8.1	30	9/18/2007	40	574	<0.001	<0.001	<0.001	<0.003	89.6	Clear No odor
5	38.85	51.3	8.1	30	12/6/2007	32	484	<0.001	<0.001	<0.001	<0.003	91.4	Clear No odor

ROC - Hobbs N-6 (1R-487)**SW ¼, NW ¼, SEC. 5 & 6, T19S, R38E**

MW	Depth to Water	Total Depth	Well Volume	Volume Purged	Sample Date	Cl	TDS	Benzene	Toluene	Ethyl Benzene	Total Xylenes	Sulfate	Comments
5	39.15	51.3	7.9	30	3/4/2008	40	472	<0.001	<0.001	<0.001	<0.003	93.6	Clear No odor
5	39.41	51.3	7.7	30	5/28/2008	40	517	<0.001	<0.001	<0.001	<0.003	90	Clear No odor
5	39.66	51.3	7.6	30	9/8/2008	60	560	<0.001	<0.001	<0.001	<0.003	157	Clear No odor
5	39.86	51.3	7.4	30	12/15/2008	40	538	<0.001	<0.001	<0.001	<0.003	92.8	Clear No odor
5	39.98	51.3	7.4	30	3/16/2009	40	508	<0.001	<0.001	<0.001	<0.003	85	Clear No odor
5	40.34	51.3	7.1	30	6/10/2009	136	607	<0.001	<0.001	<0.001	<0.003	78.3	Clear No odor
5	40.32	51.3	7.1	30	9/14/2009	40	504	<0.001	<0.001	<0.001	<0.003	75.9	Clear No odor
5	40.43	51.3	7.1	30	11/19/2009	40	455	<0.001	<0.001	<0.001	<0.003	65	Clear No odor
5	40.58	51.29	7	30	3/17/2010	192	825	<0.001	<0.001	<0.001	<0.003	111	Clear No odor
5	40.71	51.29	6.9	30	6/8/2010	40	511	<0.001	<0.001	<0.001	<0.003	91	Clear No odor
5	39.73	51.29	7.5	30	9/7/2010	40	436	<0.001	<0.001	<0.001	<0.003	70.9	Clear No odor
5	39.81	51.29	7.5	30	12/9/2010	36	486	<0.001	<0.001	<0.001	<0.003	95.2	Clear No odor
5	40.38	51.29	7.1	30	3/15/2011	40	493	<0.001	<0.001	<0.001	<0.003	81.5	Clear No odor
5	40.83	51.29	6.8	30	6/22/2011	40	439	<0.001	<0.001	<0.001	<0.003	80.6	Clear No odor
5	41.09	51.29	6.6	30	9/21/2011	40	425	<0.001	<0.001	<0.001	<0.003	84.6	Clear No odor
5	41.27	51.29	6.5	30	12/13/2011	40	517	<0.001	<0.001	<0.001	<0.003	96	Clear No odor
5	41.48	51.29	6.4	30	3/20/2012	36	490	<0.001	<0.001	<0.001	<0.003	91.1	Clear No odor
5	41.67	51.29	6.3	30	6/14/2012	36	487	<0.001	<0.001	<0.001	<0.003	90.6	Clear No odor
5	41.87	51.29	6.1	30	9/11/2012	36	485	<0.001	<0.001	<0.001	<0.003	89.8	Clear No odor
5	41.96	51.29	6.1	30	12/12/2012	40	463	<0.001	<0.001	<0.001	<0.003	85	Clear No odor
5	42.14	51.29	5.9	30	3/5/2013	44	456	<0.001	<0.001	<0.001	<0.003	94	Clear No odor
5	42.41	51.29	5.8	30	6/20/2013	32	472	<0.001	<0.001	<0.001	<0.003	80	Clear No odor
5	42.51	51.29	5.7	30	9/18/2013	48	463	<0.001	<0.001	<0.001	<0.003	97	Clear No odor
5	42.68	51.29	5.6	30	12/16/2013	40	449	<0.001	<0.001	<0.001	<0.003	99	Clear No odor
5	42.79	51.29	5.5	30	3/25/2014	72	490	<0.001	<0.001	<0.001	<0.003	84.5	Clear No odor
5	42.41	51.29	5.8	30	6/18/2014	64	540	<0.001	<0.001	<0.001	<0.003	83	Clear No odor
5	42.66	51.29	5.6	30	9/12/2014	60	498	<0.001	<0.001	<0.001	<0.003	155	Clear No odor
5	42.75	51.29	5.6	30	12/23/2014	64	536	<0.001	<0.001	<0.001	<0.003	176	Clear No odor

ROC - Hobbs N-6 (1R-487)**SW ¼, NW ¼, SEC. 5 & 6, T19S, R38E**

MW	Depth to Water	Total Depth	Well Volume	Volume Purged	Sample Date	Cl	TDS	Benzene	Toluene	Ethyl Benzene	Total Xylenes	Sulfate	Comments
5	42.38	51.29	5.8	30	3/20/2015	68	512	<0.001	<0.001	<0.001	<0.003	71	Clear No odor
5	42.41	51.29	5.8	30	6/17/2015	80	546	<0.001	<0.001	<0.001	<0.003	76	Clear No odor
5	42.49	51.29	5.7	30	9/22/2015	68	500	<0.001	<0.001	<0.001	<0.003	80.6	Clear No odor
5	42.25	51.29	5.9	30	12/2/2015	40	534	<0.001	<0.001	<0.001	<0.003	198	Clear No odor
5	42.02	51.29	6	30	3/29/2016	64	540	<0.001	<0.001	<0.001	<0.003	87.6	Clear No odor
5	42.7	51.29	5.6	20	6/27/2016	72	490	<0.001	<0.001	<0.001	<0.003	76.5	Clear No odor
5	42.07	51.29	6	25	9/27/2016	64	306	<0.001	<0.001	<0.001	<0.003	87	Clear No odor
5	41.44	51.29	6.4	25	12/6/2016	72	386	<0.001	<0.001	<0.001	<0.003	92	Clear No odor
5	41.55	51.29	6.3	25	3/21/2017	60	540	<0.001	<0.001	<0.001	<0.003	91	Clear No odor
5	42.01	51.29	6	25	6/28/2017	72	558	<0.001	<0.001	<0.001	<0.003	86	Clear No odor
5	41.93	51.29	6.1	25	9/26/2017	136	688	<0.001	<0.001	<0.001	<0.003	99	Clear No odor
5	42.06	51.29	6	25	12/22/2017	68	532	<0.001	<0.001	<0.001	<0.003	96	Clear No odor
5	42.44	51.29	5.8	25	3/21/2018	80	552	<0.001	<0.001	<0.001	<0.003	92.6	Clear No odor
5	42.65	51.29	5.6	20	6/28/2018	100	516	<0.001	<0.001	<0.001	<0.003	73.5	Clear No odor
5	43.48	51.29	5.1	25	9/19/2018	48	498	<0.001	<0.001	<0.001	<0.003	83.4	Clear No odor
5	43.42	51.29	5.1	20	12/22/2018	44	286	<0.001	<0.001	<0.001	<0.003	109	Clear No odor
5	43.42	51.29	5.1	25	12/22/2018	44	286	<0.001	<0.001	<0.001	<0.003	109	Clear No odor
5	43.49	51.29	5.1	25	3/27/2019	68	420	<0.001	<0.001	<0.001	<0.003	86	Clear No odor
5	42.07	51.29	6	25	6/25/2019	44	514	<0.001	<0.001	<0.001	<0.003	89	Clear No odor
5	42.24	51.29	5.9	25	9/26/2019	48	499	<0.001	<0.001	<0.001	<0.003	103	Clear No odor
5	43.22	51.29	5.2	20	12/12/2019	48	490	<0.001	<0.001	<0.001	<0.003	84	Clear No odor
5	43.94	51.29	4.8	20	3/26/2020	48	521	<0.001	<0.001	<0.001	<0.003	77.4	Clear No odor
5	44.36	51.29	4.5	20	9/30/2020	40	499	<0.001	<0.001	<0.001	<0.003	75.2	Clear No odor
5	43.78	51.29	4.9	20	3/30/2021	60	404	<0.001	<0.001	<0.001	<0.003	102	Clear No odor
5	44.18	51.29	4.6	20	6/30/2021	48	368	<0.001	<0.001	<0.001	<0.003	83.6	Clear No odor
5	44.18	51.29	4.6	20	9/29/2021	40	363	<0.001	<0.001	<0.001	<0.003	71.7	Clear No odor
5	44.25	51.29	4.6	20	12/3/2021	40	338	<0.001	<0.001	<0.001	<0.003	71.3	Clear No odor
5	44.67	51.29	4.3	20	3/30/2022	36	333	<0.001	<0.001	<0.001	<0.003	61.1	Clear No odor

ROC - Hobbs N-6 (1R-487)
SW ¼, NW ¼, SEC. 5 & 6, T19S, R38E

MW	Depth to Water	Total Depth	Well Volume	Volume Purged	Sample Date	Cl	TDS	Benzene	Toluene	Ethyl Benzene	Total Xylenes	Sulfate	Comments
5	44.81	51.29	4.2	20	6/30/2022	88	448	<0.001	<0.001	<0.001	<0.003	74.6	Clear No odor
5	44.9	51.29	4.2	20	9/27/2022	68	441	<0.001	<0.001	<0.001	<0.003	66.3	Clear No odor
5	44.86	51.29	4.2	15	12/15/2022	56	436	<0.001	<0.001	<0.001	<0.003	68.6	Clear No odor

MW	Depth to Water	Total Depth	Well Volume	Volume Purged	Sample Date	Cl	TDS	Benzene	Toluene	Ethyl Benzene	Total Xylenes	Sulfate	Comments
6	41.1	53	1.9	5.71	3/14/2003	42.5	XXX	<0.001	<0.001	<0.001	<0.001	96.6	
6	40.81	53.03	1.95	5.86	6/27/2003	35.4	743	<0.001	<0.001	<0.001	<0.001	97.5	
6	40.79	52.97	1.98	5.95	9/22/2003	39	484	<0.001	<0.001	<0.001	<0.001	88.4	
6	40.93	53	1.96	5.9	12/18/2003	44	452	<0.002	<0.002	<0.002	<0.006	36.8	
6	42.02	53	1.78	5.36	3/15/2004	222	692	0.0026	<0.001	<0.001	<0.001	94.2	
6	40.91	53.01	1.97	5.91	5/27/2004	31.9	443	<0.001	<0.001	<0.001	<0.001	86.6	
6	42.16	53.1	1.75	5.25	9/8/2004	53.2	488	<0.001	<0.001	<0.001	<0.001	85	
6	39.62	53.1	2.16	6.47	11/23/2004	76.1	XXX	<0.001	<0.001	<0.001	<0.001	84	
6	39.14	53.1	XXX	8	3/29/2005	97.8	473	<0.001	<0.001	<0.001	<0.001	81.1	
6	39.6	54.49	XXX	7.6	6/28/2005	122	541	<0.001	<0.001	0.000812	0.00285	103	
6	39.61	61.65	XXX	10.78	9/6/2005	40.4	442	<0.001	<0.001	<0.001	<0.001	23.4	
6	39.75	53.1	2.1	7	12/6/2005	52.7	458	<0.001	<0.001	<0.001	<0.001	58.2	
6	40.06	53.1	2.1	7	2/28/2006	59.2	552	<0.001	<0.001	<0.001	<0.001	67.6	
6	40.53	53.1	2	10	6/5/2006	67.2	512	<0.001	<0.001	<0.001	<0.001	72.2	
6	40.05	53.1	2.1	10	9/11/2006	67.6	552	<0.001	<0.001	<0.001	<0.001	101	
6	39.88	53.1	2.1	8	11/14/2006	53.9	464	<0.001	<0.001	<0.001	<0.001	95.4	
6	40.34	53.1	2	8	3/13/2007	57.7	466	<0.001	<0.001	<0.001	<0.001	90.3	Clear No odor
6	40.78	53.1	2	8	6/11/2007	61.8	528	<0.001	<0.001	<0.001	<0.001	85.4	Clear
6	40.64	53.1	2	8	9/18/2007	72	566	<0.001	<0.001	<0.001	<0.002	105	Clear No odor
6	40.85	53.1	2	8	12/6/2007	76	525	<0.001	<0.001	<0.001	<0.003	111	Clear No odor

ROC - Hobbs N-6 (1R-487)**SW ¼, NW ¼, SEC. 5 & 6, T19S, R38E**

MW	Depth to Water	Total Depth	Well Volume	Volume Purged	Sample Date	Cl	TDS	Benzene	Toluene	Ethyl Benzene	Total Xylenes	Sulfate	Comments
6	41.22	53.1	1.9	8	3/3/2008	76	536	<0.001	<0.001	<0.001	<0.003	110	Clear No odor
6	41.47	53.1	1.9	8	5/28/2008	72	559	<0.001	<0.001	<0.001	<0.003	87.3	Clear No odor
6	41.73	53.1	1.8	8	9/8/2008	124	668	<0.001	<0.001	<0.001	<0.003	128	Clear No odor
6	41.91	53.1	1.8	8	12/15/2008	84	568	<0.001	<0.001	<0.001	<0.003	105	Clear No odor
6	42.06	53.1	1.8	8	3/16/2009	76	550	<0.001	<0.001	<0.001	<0.003	98	Clear No odor
6	42.26	53.1	1.7	8	6/9/2009	84	566	<0.001	<0.001	<0.001	<0.003	94.1	Clear No odor
6	42.36	53.1	1.7	8	9/14/2009	72	546	<0.001	<0.001	<0.001	<0.003	81.5	Clear No odor
6	42.49	53.1	1.7	8	11/19/2009	76	535	<0.001	<0.001	<0.001	<0.003	178	Clear No odor
6	42.65	53.1	1.7	8	3/17/2010	48	693	<0.001	<0.001	<0.001	<0.003	160	Clear No odor
6	42.93	55.21	2	XXX	6/8/2010	XXX	XXX	XXX	XXX	XXX	XXX	XXX	Product present No sample taken
6	41.56	55.21	2.2	XXX	9/7/2010	XXX	XXX	XXX	XXX	XXX	XXX	XXX	Product present No sample taken
6	41.82	53.1	1.8	6	12/9/2010	100	549	<0.001	<0.001	<0.001	<0.003	95.2	Slight odor
6	42.49	53.1	1.7	6	3/15/2011	100	538	<0.001	<0.001	<0.001	<0.003	89.2	Heavy sheen Slight odor
6	42.93	53.1	1.6	6	6/22/2011	104	585	<0.001	<0.001	<0.001	<0.003	86.5	Heavy sheen Slight odor
6	43.19	53.1	1.6	6	9/22/2011	108	474	<0.001	<0.001	<0.001	<0.003	96.6	Slight odor
6	43.38	53.1	1.6	6	12/13/2011	80	528	<0.001	<0.001	<0.001	<0.003	97.1	Slight odor
6	43.55	53.1	1.5	6	3/20/2012	76	520	<0.001	<0.001	<0.001	<0.003	96.8	Slight odor
6	43.74	53.1	1.5	6	6/14/2012	84	529	<0.001	<0.001	<0.001	<0.003	106	Slight odor
6	43.91	53.1	1.5	6	9/11/2012	96	614	<0.001	<0.001	<0.001	<0.003	83	Slight odor
6	44.07	53.1	1.4	6	12/12/2012	88	592	<0.001	<0.001	<0.001	<0.003	105	Slight odor
6	44.23	53.1	1.4	6	3/6/2013	100	562	<0.001	<0.001	<0.001	<0.003	114	Slight odor
6	44.52	53.1	1.4	6	6/20/2013	92	564	<0.001	<0.001	<0.001	<0.003	108	Slight odor
6	44.59	53.1	1.4	6	9/19/2013	76	533	<0.001	<0.001	<0.001	<0.003	87	Slight odor
6	44.78	53.1	1.3	6	12/16/2013	80	516	<0.001	<0.001	<0.001	<0.003	89.3	Slight odor
6	44.9	53.1	1.3	6	3/24/2014	60	504	<0.001	<0.001	<0.001	<0.003	85.9	Slight odor

ROC - Hobbs N-6 (1R-487)**SW ¼, NW ¼, SEC. 5 & 6, T19S, R38E**

MW	Depth to Water	Total Depth	Well Volume	Volume Purged	Sample Date	Cl	TDS	Benzene	Toluene	Ethyl Benzene	Total Xylenes	Sulfate	Comments
6	45.12	53.1	1.3	6	6/19/2014	84	546	<0.001	<0.001	<0.001	<0.003	95.2	Slight odor
6	45.35	53.1	1.2	6	9/11/2014	84	524	<0.001	<0.001	<0.001	<0.003	90.7	Slight odor
6	45.44	53.1	1.2	6	12/22/2014	64	470	<0.001	<0.001	<0.001	<0.003	97	Slight odor
6	45.06	53.1	1.3	6	3/19/2015	76	520	<0.001	<0.001	<0.001	<0.003	74.4	Slight odor
6	45.15	53.1	1.3	6	6/18/2015	100	468	<0.001	<0.001	<0.001	<0.003	98	Slight odor
6	45.22	53.1	1.3	6	9/22/2015	68	562	<0.001	<0.001	<0.001	<0.003	84	Slight odor
6	44.98	53.1	1.3	6	12/2/2015	64	546	<0.001	<0.001	<0.001	<0.003	71	Slight odor
6	44.75	53.1	1.3	6	3/29/2016	68	538	<0.001	<0.001	<0.001	<0.003	82.7	Clear Slight odor
6	45.43	53.1	1.2	6	6/27/2016	68	538	<0.001	<0.001	<0.001	<0.003	79.7	Clear Slight odor
6	44.8	53.1	1.3	6	9/27/2016	72	560	<0.001	<0.001	<0.001	<0.003	93	Clear Slight odor
6	44.19	53.1	1.4	6	12/6/2016	68	568	<0.001	<0.001	<0.001	<0.003	22	Clear Slight odor
6	44.33	53.1	1.4	6	3/21/2017	84	532	<0.001	<0.001	<0.001	<0.003	84	Slight odor
6	44.84	53.1	1.3	6	6/28/2017	76	540	<0.001	<0.001	<0.001	<0.003	88	Slight odor
6	44.72	53.1	1.3	6	9/26/2017	96	620	<0.001	<0.001	<0.001	<0.003	97	Slight odor
6	44.83	53.1	1.3	6	12/22/2017	68	562	<0.001	<0.001	<0.001	<0.003	99	Slight odor
6	45.2	53.1	1.3	6	3/21/2018	76	552	<0.001	<0.001	<0.001	<0.003	100	Slight odor
6	45.4	53.1	1.2	6	6/28/2018	100	406	<0.001	<0.001	<0.001	<0.003	75.2	Slight odor
6	45.49	53.1	1.2	6	9/19/2018	76	568	<0.001	<0.001	<0.001	<0.003	89.4	Slight odor
6	45.44	53.1	1.2	6	12/22/2018	64	486	<0.001	<0.001	<0.001	<0.003	119	Slight odor
6	45.48	53.1	1.2	6	3/27/2019	64	360	<0.001	<0.001	<0.001	<0.003	93	Slight odor
6	45.16	53.1	1.3	6	6/27/2019	72	556	<0.001	<0.001	<0.001	<0.003	90	Slight odor
6	46.21	53.1	1.1	6	9/27/2019	48	500	<0.001	<0.001	<0.001	<0.003	96	Slight odor
6	45.38	53.1	1.2	6	12/13/2019	48	484	<0.001	<0.001	<0.001	<0.003	85	Slight odor
6	45.91	53.1	1.2	6	3/25/2020	48	555	<0.001	<0.001	<0.001	<0.003	86	Slight odor
6	46.3	53.1	1.1	6	9/29/2020	48	499	<0.001	<0.001	<0.001	<0.003	76.5	Slight odor
6	45.73	53.1	1.2	6	3/29/2021	224	754	<0.001	<0.001	<0.001	<0.003	100	Slight odor
6	45.9	53.1	1.2	6	6/29/2021	76	545	<0.001	<0.001	<0.001	<0.003	92.8	Slight odor
6	46.22	53.1	1.1	6	9/28/2021	76	550	<0.001	<0.001	<0.001	<0.003	75.9	Slight odor

ROC - Hobbs N-6 (1R-487)**SW ¼, NW ¼, SEC. 5 & 6, T19S, R38E**

MW	Depth to Water	Total Depth	Well Volume	Volume Purged	Sample Date	Cl	TDS	Benzene	Toluene	Ethyl Benzene	Total Xylenes	Sulfate	Comments
6	46.27	53.1	1.1	6	12/2/2021	76	524	<0.001	<0.001	<0.001	<0.003	107	Slight odor
6	47.01	53.1	1	3	3/29/2022	80	487	<0.001	<0.001	<0.001	<0.003	71.3	Slight odor
6	47.08	53.1	1	3	6/29/2022	76	552	<0.001	<0.001	<0.001	<0.003	95.9	Slight odor
6	47.28	53.1	1	3	9/26/2022	80	569	<0.001	<0.001	<0.001	<0.003	79	Slight odor
6	47.12	53.1	1	3	12/14/2022	96	576	<0.001	<0.001	<0.001	<0.003	76.7	Slight odor

MW	Depth to Water	Total Depth	Well Volume	Volume Purged	Sample Date	Cl	TDS	Benzene	Toluene	Ethyl Benzene	Total Xylenes	Sulfate	Comments
7	40.94	47.17	0.99	2.98	12/6/2002	XXX	XXX	XXX	XXX	XXX	XXX	XXX	
7	41.22	47.18	0.95	2.86	3/14/2003	266	XXX	0.001	<0.001	<0.001	<0.001	XXX	
7	40.88	47.15	1	3	6/27/2003	222	802	<0.001	<0.001	<0.001	<0.001	122	
7	40.86	47.11	1.01	3.05	9/22/2003	222	861	<0.001	<0.001	<0.001	<0.001	133	
7	41.03	47.18	1	3	12/18/2003	208	827	<0.002	<0.002	<0.002	<0.006	110	
7	42.17	47.18	0.81	2.44	3/15/2004	1,080	2,220	0.0131	<0.001	<0.001	<0.001	44.4	
7	41	47.15	1	3	5/27/2004	213	986	<0.001	<0.001	<0.001	<0.001	220	
7	42.34	47.25	0.79	2.36	9/8/2004	230	731	<0.001	<0.001	<0.001	<0.001	105	
7	39.82	47.25	1.19	178.98	11/23/2004	188	XXX	<0.001	<0.001	<0.001	<0.001	111	purge vol was likely an error
7	39.33	47.25	XXX	4	3/29/2005	234	791	<0.001	<0.001	<0.001	<0.001	96.1	
7	39.6	47	XXX	3.7	6/28/2005	216	783	<0.001	<0.001	0.00114	0.0038	96.9	
7	39.86	47	XXX	3.5	9/6/2005	187	802	<0.001	<0.001	<0.001	<0.001	76.9	
7	39.93	47.25	1.2	4	12/6/2005	201	670	<0.001	<0.001	<0.001	<0.0001	85.2	
7	40.27	47.25	1.1	4	2/28/2006	202	876	<0.001	<0.001	<0.001	<0.001	72.4	
7	40.63	47.25	1.1	10	6/5/2006	225	794	<0.001	<0.001	<0.001	<0.001	74	
7	40.17	47.25	1.1	10	9/11/2006	202	710	<0.001	<0.001	<0.001	<0.001	77.9	
7	40.01	47.25	1.2	7	11/14/2006	223	764	<0.001	<0.001	<0.001	<0.001	86.5	Clear No odor

ROC - Hobbs N-6 (1R-487)**SW ¼, NW ¼, SEC. 5 & 6, T19S, R38E**

MW	Depth to Water	Total Depth	Well Volume	Volume Purged	Sample Date	Cl	TDS	Benzene	Toluene	Ethyl Benzene	Total Xylenes	Sulfate	Comments
7	40.53	47.31	1.1	5	3/13/2007	206	724	<0.001	<0.001	<0.001	<0.001	79.9	Clear No odor
7	40.92	47.31	1	5	6/11/2007	228	846	<0.001	<0.001	<0.001	<0.001	75.9	Clear
7	40.92	47.31	1	5	9/18/2007	252	868	<0.001	<0.001	<0.001	<0.003	97.7	Clear No odor
7	41.03	47.31	1	5	12/6/2007	256	882	<0.001	<0.001	<0.001	<0.003	105	Clear No odor
7	41.3	47.31	1	5	3/3/2008	260	876	<0.001	<0.001	<0.001	<0.003	111	Clear No odor
7	41.56	47.31	0.9	5	5/28/2008	268	962	<0.001	<0.001	<0.001	<0.003	100	Clear No odor
7	41.85	47.31	0.9	5	9/8/2008	260	894	<0.001	<0.001	<0.001	<0.003	100	Clear No odor
7	41.99	47.31	0.9	5	12/15/2008	260	921	<0.001	<0.001	<0.001	<0.003	96.3	Clear No odor
7	42.18	47.35	0.8	5	3/17/2009	256	886	<0.001	<0.001	<0.001	<0.003	87.2	Clear No odor
7	42.35	47.35	0.8	5	6/10/2009	260	885	<0.001	<0.001	<0.001	<0.003	81.1	Clear No odor
7	42.49	47.35	0.8	5	9/14/2009	260	908	<0.001	<0.001	<0.001	<0.003	73.7	Clear No odor
7	42.61	47.35	0.8	5	11/19/2009	252	842	<0.001	<0.001	<0.001	<0.003	70.1	Clear No odor
7	42.77	47.35	0.7	5	3/17/2010	268	862	<0.001	<0.001	<0.001	<0.003	100	Clear No odor
7	42.84	47.35	0.7	5	6/8/2010	248	788	<0.001	<0.001	<0.001	<0.003	54.8	Clear No odor
7	41.42	47.35	0.9	5	9/7/2010	272	886	<0.001	<0.001	<0.001	<0.003	77.4	Clear No odor
7	41.76	47.35	0.9	5	12/9/2010	272	899	<0.001	<0.001	<0.001	<0.003	169	Clear No odor
7	42.52	47.35	0.8	5	3/15/2011	268	864	<0.001	<0.001	<0.001	<0.003	94.3	Clear No odor
7	42.98	47.35	0.7	5	6/22/2011	260	854	<0.001	<0.001	<0.001	<0.003	85.1	Clear No odor
7	43.26	47.35	0.7	5	9/21/2011	260	872	<0.001	<0.001	<0.001	<0.003	80.2	Clear No odor
7	43.41	47.35	0.6	5	12/13/2011	272	919	0.003	<0.001	<0.001	<0.003	89.3	Clear No odor
7	43.65	47.35	0.6	5	3/20/2012	268	883	<0.001	<0.001	<0.001	<0.003	95.2	Clear No odor
7	43.83	47.35	0.6	5	6/14/2012	260	863	<0.001	<0.001	<0.001	<0.003	116	Clear No odor
7	43.9	47.35	0.6	5	9/11/2012	256	985	<0.001	<0.001	<0.001	<0.001	74.4	Clear No odor
7	44.08	47.35	0.5	5	12/12/2012	272	877	<0.001	<0.001	<0.001	<0.003	86	Clear No odor
7	44.22	47.35	0.5	5	3/5/2013	272	848	<0.001	<0.001	<0.001	<0.003	105	Clear No odor
7	44.56	47.35	0.4	5	6/20/2013	200	809	<0.001	<0.001	<0.001	<0.003	130	Clear No odor
7	44.63	47.35	0.4	5	9/18/2013	264	849	<0.001	<0.001	<0.001	<0.003	74.2	Clear No odor
7	44.84	47.35	0.4	5	12/16/2013	244	859	<0.001	<0.001	<0.001	<0.003	75.9	Clear No odor

ROC - Hobbs N-6 (1R-487)**SW ¼, NW ¼, SEC. 5 & 6, T19S, R38E**

MW	Depth to Water	Total Depth	Well Volume	Volume Purged	Sample Date	Cl	TDS	Benzene	Toluene	Ethyl Benzene	Total Xylenes	Sulfate	Comments
7	44.96	47.35	0.4	5	3/24/2014	164	660	<0.001	<0.001	<0.001	<0.003	107	Clear No odor
7	45.17	47.35	0.3	5	6/18/2014	200	830	<0.001	<0.001	<0.001	<0.003	155	Clear No odor
7	45.44	47.35	0.3	4	9/11/2014	216	868	<0.001	<0.001	<0.001	<0.003	168	Clear No odor
7	45.54	47.35	0.3	4	12/22/2014	252	748	<0.001	<0.001	<0.001	<0.003	77	Clear No odor
7	45.12	47.35	0.4	4	3/19/2015	208	788	<0.001	<0.001	<0.001	<0.003	145	Clear No odor
7	45.23	47.35	0.3	5	6/18/2015	276	924	<0.001	<0.001	<0.001	<0.003	80	Clear No odor
7	45.3	47.35	0.3	4	9/23/2015	88	560	<0.001	<0.001	<0.001	<0.003	90	Clear No odor
7	45.07	47.35	0.4	4	12/3/2015	252	876	<0.001	<0.001	<0.001	<0.003	65	Clear No odor
7	44.85	47.35	0.4	4	3/30/2016	308	978	<0.001	<0.001	<0.001	<0.003	67.4	Clear No odor
7	44.59	47.35	0.3	4	6/28/2016	248	826	<0.001	<0.001	<0.001	<0.003	77.9	Clear No odor
7	44.9	47.35	0.4	4	9/28/2016	212	826	<0.001	<0.001	<0.001	<0.003	162	Clear No odor
7	44.28	47.35	0.5	4	12/7/2016	264	876	<0.001	<0.001	<0.001	<0.003	83	Clear No odor
7	44.44	47.35	0.5	4	3/22/2017	288	904	<0.001	<0.001	<0.001	<0.003	75	Clear No odor
7	44.93	47.35	0.4	4	6/29/2017	284	1080	<0.001	<0.001	<0.001	<0.003	183	Clear No odor
7	44.83	47.35	0.4	4	9/27/2017	188	790	<0.001	<0.001	<0.001	<0.003	100	Clear No odor
7	44.98	47.35	0.4	4	12/26/2017	256	900	<0.001	<0.001	<0.001	<0.003	167	Clear No odor
7	45.34	47.35	0.3	4	3/22/2018	268	842	<0.001	<0.001	<0.001	<0.003	85.2	Clear No odor
7	45.55	47.35	0.3	4	6/29/2018	240	830	<0.001	<0.001	<0.001	<0.003	101	Clear No odor
7	45.64	47.35	0.3	4	9/20/2018	232	844	<0.001	<0.001	<0.001	<0.003	79.2	Clear No odor
7	45.58	47.35	0.3	4	12/23/2018	80	457	<0.001	<0.001	<0.001	<0.003	100	Clear No odor
7	45.63	47.35	0.3	4	3/28/2019	232	652	<0.001	<0.001	<0.001	<0.003	85	Clear No odor
7	45.32	47.35	0.3	4	6/27/2019	220	821	<0.001	<0.001	<0.001	<0.003	88	Clear No odor
7	46.43	47.35	0.1	3	9/27/2019	208	781	<0.001	<0.001	<0.001	<0.003	74	Clear No odor
7	45.54	47.35	0.3	3	12/13/2019	236	661	<0.001	<0.001	<0.001	<0.003	76	Clear No odor
7	45.98	47.35	0.2	4	3/25/2020	204	802	<0.001	<0.001	<0.001	<0.003	70.6	Clear No odor
7	46.38	47.35	0.2	3	9/29/2020	236	842	<0.001	<0.001	<0.001	<0.003	70.8	Clear No odor
7	46.68	47.35	0.2	3	3/29/2021	240	632	<0.001	<0.001	<0.001	<0.003	159	Clear No odor
7	46.82	47.35	0.1	3	6/29/2021	248	834	<0.001	<0.001	<0.001	<0.003	87.2	Clear No odor

ROC - Hobbs N-6 (1R-487)**SW ¼, NW ¼, SEC. 5 & 6, T19S, R38E**

MW	Depth to Water	Total Depth	Well Volume	Volume Purged	Sample Date	Cl	TDS	Benzene	Toluene	Ethyl Benzene	Total Xylenes	Sulfate	Comments
7	47	47.35	0.1	1	9/28/2021	256	953	<0.001	<0.001	<0.001	<0.003	109	Clear No odor
7	47.05	47.35	0.1	1	12/2/2021	300	856	<0.001	<0.001	<0.001	<0.003	83.1	Clear No odor
7	47.05	47.35	0.1	1	3/29/2022	260	854	<0.001	<0.001	<0.001	<0.003	61.9	Clear No odor
7	47.12	47.35	0.1	1	6/29/2022	180	755	<0.001	<0.001	<0.001	<0.003	96.2	Clear No odor
7	47.28	47.35	0.1	1	9/26/2022	128	604	<0.001	<0.001	<0.001	<0.003	80.7	Clear No odor
7	47.26	47.35	0.1	1	12/14/2022	148	638	<0.001	<0.001	<0.001	<0.003	77.6	Clear No odor

MW	Depth to Water	Total Depth	Well Volume	Volume Purged	Sample Date	Cl	TDS	Benzene	Toluene	Ethyl Benzene	Total Xylenes	Sulfate	Comments
BS1	40.9	65.7	16.1	25	12/6/2005	93	608	0.0323	0.0209	0.107	0.0825	54.4	
BS1	43.33	65.7	14.5	45	3/1/2006	105	912	0.44	0.0357	0.168	0.1195		
BS1	41.08	65.7	16	50	6/5/2006	171	858	0.544	0.0125	1.142	0.03479	45	Dark Gray with Strong Pet. Odor/ Heavy skim of Oil
BS1	39.9	65.7	16.8	70	9/12/2006	142	1,010	1.15	0.0283	0.207	0.04044	z	Clear Strong Petroleum Odor
BS1	39.92	63.75	15.5	50	11/15/2006	283	1,450	1.06	0.0298	0.159	0.0772	28.6	Clear Strong Petroleum Odor
BS1	40.47	63.74	15.1	50	3/14/2007	427	2,040	1.19	0.0402	0.323	0.0958	24.2	
BS1	42.59	63.74	13.7	50	6/12/2007	346	1,580	0.569	0.00923	0.146	0.0891	24.7	Clear
BS1	42.45	63.74	13.8	45	9/18/2007	428	1,804	1.88	0.026	0.394	0.202	13.2	Clear Strong petroleum odor
BS1	44.18	63.74	12.7	45	12/6/2007	500	1,997	1.31	0.001	0.255	0.11	66.1	Clear Strong petroleum odor

ROC - Hobbs N-6 (1R-487)
SW ¼, NW ¼, SEC. 5 & 6, T19S, R38E

MW	Depth to Water	Total Depth	Well Volume	Volume Purged	Sample Date	Cl	TDS	Benzene	Toluene	Ethyl Benzene	Total Xylenes	Sulfate	Comments
BS1	XXX	63.74	XXX	XXX	3/4/2008	550	2,070	<0.001	<0.001	<0.001	<0.003	105	Hydrocarbon present Strong odor Hydrocarbon emulsion make it impossible to measure water column
BS1	43.29	63.74	13.3	45	5/29/2008	810	2,590	0.025	0.124	0.318	0.197	99.2	Hydrocarbons present Clear Strong odor
BS1	43.4	63.74	13.2	45	9/5/2008	710	2,270	0.736	0.004	0.238	0.117	58	Clear Strong petroleum odor
BS1	43.1	63.74	13.4	45	12/15/2008	580	2,070	0.347	0.004	0.188	0.09	76.8	Clear Strong petroleum odor
BS1	43.21	63.74	13.3	XXX	3/16/2009	XXX	XXX	XXX	XXX	XXX	XXX	XXX	Product is present and emulsion was so thick the well could not be pumped or bailed
BS1	47.34	63.74	10.7	XXX	6/9/2009	XXX	XXX	XXX	XXX	XXX	XXX	XXX	Hydrocarbon Present Strong Odor Emulsion/Strong Petroleum Odor. Well could not be pumped or bailed
BS1	48.2	63.74	10.1	XXX	9/15/2009	XXX	XXX	XXX	XXX	XXX	XXX	XXX	Hydrocarbon present Strong odor Emulsion/Strong petroleum odor Could not be sampled

ROC - Hobbs N-6 (1R-487)**SW ¼, NW ¼, SEC. 5 & 6, T19S, R38E**

MW	Depth to Water	Total Depth	Well Volume	Volume Purged	Sample Date	Cl	TDS	Benzene	Toluene	Ethyl Benzene	Total Xylenes	Sulfate	Comments
BS1	48.36	63.74	10	XXX	11/20/2009	XXX	XXX	XXX	XXX	XXX	XXX	XXX	Hydrocarbon present Strong odor Emulsion/Strong petroleum odor Could not be sampled
BS1	48.47	63.74	9.9	XXX	3/18/2010	XXX	XXX	XXX	XXX	XXX	XXX	XXX	Hydrocarbon Present with Strong odor
BS1	48.83	63.74	9.7	XXX	6/7/2010	XXX	XXX	XXX	XXX	XXX	XXX	XXX	Hydrocarbon present Strong odor Emulsion Strong petroleum odor
BS1	47.38	63.74	10.6	XXX	9/8/2010	XXX	XXX	XXX	XXX	XXX	XXX	XXX	Hydrocarbon present Strong odor Emulsion Strong petroleum odor
BS1	47.49	63.74	10.6	XXX	12/8/2010	XXX	XXX	XXX	XXX	XXX	XXX	XXX	Hydrocarbon present Emulsion present Strong petroleum odor
BS1	47.93	63.74	10.3	XXX	3/16/2011	XXX	XXX	XXX	XXX	XXX	XXX	XXX	Hydrocarbon present Emulsion present Strong petroleum odor
BS1	48.22	63.74	10.1	XXX	6/23/2011	XXX	XXX	XXX	XXX	XXX	XXX	XXX	Hydrocarbon present Emulsion present Strong petroleum odor
BS1	48.51	63.74	9.9	XXX	9/22/2011	XXX	XXX	XXX	XXX	XXX	XXX	XXX	Hydrocarbon present Emulsion present Strong petroleum odor

ROC - Hobbs N-6 (1R-487)**SW ¼, NW ¼, SEC. 5 & 6, T19S, R38E**

MW	Depth to Water	Total Depth	Well Volume	Volume Purged	Sample Date	Cl	TDS	Benzene	Toluene	Ethyl Benzene	Total Xylenes	Sulfate	Comments
BS1	48.63	63.74	9.8	XXX	12/12/2011	XXX	XXX	XXX	XXX	XXX	XXX	XXX	Hydrocarbon present Emulsion present Strong petroleum odor
BS1	48.79	63.74	9.7	XXX	3/21/2012	XXX	XXX	XXX	XXX	XXX	XXX	XXX	Hydrocarbon present Emulsion present Strong petroleum odor
BS1	48.96	63.74	9.6	XXX	6/14/2012	XXX	XXX	XXX	XXX	XXX	XXX	XXX	Hydrocarbon present Emulsion present Strong petroleum odor
BS1	46.03	63.74	11.5	XXX	9/12/2012	XXX	XXX	XXX	XXX	XXX	XXX	XXX	Hydrocarbon Present with Strong Petroleum odor
BS1	45.67	63.74	11.7	XXX	12/13/2012	XXX	XXX	XXX	XXX	XXX	XXX	XXX	Hydrocarbon Present with Strong odor, Product is present, well was not sampled
BS1	46.11	63.74	11.5	XXX	3/6/2013	XXX	XXX	XXX	XXX	XXX	XXX	XXX	Hydrocarbon Present with Strong odor, Product is present, well was not sampled
BS1	46.31	63.74	11.3	XXX	6/20/2013	XXX	XXX	XXX	XXX	XXX	XXX	XXX	Hydrocarbon Present with Strong odor, Product is present, well was not sampled

ROC - Hobbs N-6 (1R-487)**SW ¼, NW ¼, SEC. 5 & 6, T19S, R38E**

MW	Depth to Water	Total Depth	Well Volume	Volume Purged	Sample Date	Cl	TDS	Benzene	Toluene	Ethyl Benzene	Total Xylenes	Sulfate	Comments
BS1	46.79	63.74	11	XXX	9/19/2013	XXX	XXX	XXX	XXX	XXX	XXX	XXX	Hydrocarbon present with Strong odor; Product present well was not sampled.
BS1	47.02	63.74	10.9	XXX	12/17/2013	XXX	XXX	XXX	XXX	XXX	XXX	XXX	Hydrocarbon present with Strong odor; Product present well was not sampled
BS1	47.14	63.74	10.8	XXX	3/25/2014	XXX	XXX	XXX	XXX	XXX	XXX	XXX	Hydrocarbon present Strong odor
BS1	47.36	63.74	10.6	XXX	6/19/2014	XXX	XXX	XXX	XXX	XXX	XXX	XXX	Hydrocarbon present Strong odor
BS1	47.62	63.74	10.5	XXX	9/12/2014	XXX	XXX	XXX	XXX	XXX	XXX	XXX	Hydrocarbon present Strong odor Well not sampled
BS1	47.7	63.74	10.4	XXX	12/22/2014	XXX	XXX	XXX	XXX	XXX	XXX	XXX	Hydrocarbon present Strong odor Well not sampled
BS1	47.7	63.74	10.4	XXX	3/20/2015	XXX	XXX	XXX	XXX	XXX	XXX	XXX	Hydrocarbon present Strong odor Well not sampled
BS1	47.44	63.74	10.6	XXX	6/18/2015	XXX	XXX	XXX	XXX	XXX	XXX	XXX	Hydrocarbon present Strong odor Well not sampled
BS1	47.51	63.74	10.5	XXX	9/22/2015	XXX	XXX	XXX	XXX	XXX	XXX	XXX	Hydrocarbon present Strong odor Well not sampled
BS1	47.23	63.74	10.7	XXX	12/3/2015	XXX	XXX	XXX	XXX	XXX	XXX	XXX	Hydrocarbon present Strong odor Well not sampled

ROC - Hobbs N-6 (1R-487)**SW ¼, NW ¼, SEC. 5 & 6, T19S, R38E**

MW	Depth to Water	Total Depth	Well Volume	Volume Purged	Sample Date	Cl	TDS	Benzene	Toluene	Ethyl Benzene	Total Xylenes	Sulfate	Comments
BS1	47.01	63.74	10.9	XXX	3/30/2016	XXX	XXX	XXX	XXX	XXX	XXX	XXX	Hydrocarbon present Strong odor Well not sampled
BS1	47.72	63.74	10.4	XXX	6/28/2016	XXX	XXX	XXX	XXX	XXX	XXX	XXX	Hydrocarbon present Strong odor Well not sampled
BS1	47.06	63.74	10.8	XXX	9/28/2016	XXX	XXX	XXX	XXX	XXX	XXX	XXX	Hydrocarbon present Strong odor Well not sampled
BS1	46.38	63.74	11.3	XXX	12/6/2016	XXX	XXX	XXX	XXX	XXX	XXX	XXX	Hydrocarbon present Strong odor Well not sampled
BS1	46.51	63.74	11.2	XXX	3/21/2017	XXX	XXX	XXX	XXX	XXX	XXX	XXX	Hydrocarbon present Strong odor Well not sampled
BS1	46.89	63.74	11	XXX	6/29/2017	XXX	XXX	XXX	XXX	XXX	XXX	XXX	Hydrocarbon present Strong odor Well not sampled
BS1	46.76	63.74	11	XXX	9/26/2017	XXX	XXX	XXX	XXX	XXX	XXX	XXX	Hydrocarbon present Strong odor Well not sampled
BS1	46.93	63.74	10.9	XXX	12/22/2017	XXX	XXX	XXX	XXX	XXX	XXX	XXX	Hydrocarbon present Strong odor Well not sampled
BS1	47.38	63.74	10.6	XXX	3/22/2018	XXX	XXX	XXX	XXX	XXX	XXX	XXX	Hydrocarbon present Strong odor Well not sampled
BS1	47.5	63.74	10.5	XXX	6/29/2018	XXX	XXX	XXX	XXX	XXX	XXX	XXX	Hydrocarbon present Strong odor Well not sampled
BS1	47.65	63.74	10.4	XXX	9/20/2018	XXX	XXX	XXX	XXX	XXX	XXX	XXX	Hydrocarbon present Strong odor Well not sampled

ROC - Hobbs N-6 (1R-487)**SW ¼, NW ¼, SEC. 5 & 6, T19S, R38E**

MW	Depth to Water	Total Depth	Well Volume	Volume Purged	Sample Date	Cl	TDS	Benzene	Toluene	Ethyl Benzene	Total Xylenes	Sulfate	Comments
BS1	47.5	63.74	10.5	XXX	12/23/2018	XXX	XXX	XXX	XXX	XXX	XXX	XXX	Hydrocarbon present Strong odor Well not sampled
BS1	47.66	63.74	10.5	XXX	3/28/2019	XXX	XXX	XXX	XXX	XXX	XXX	XXX	Hydrocarbon present Strong odor Well not sampled
BS1	47.36	63.74	10.6	XXX	6/27/2019	XXX	XXX	XXX	XXX	XXX	XXX	XXX	Hydrocarbon present Strong odor Well not sampled
BS1	47.82	63.74	10.3	XXX	9/27/2019	XXX	XXX	XXX	XXX	XXX	XXX	XXX	Hydrocarbon present Strong odor Well not sampled
BS1	47.56	63.74	10.5	XXX	12/12/2019	XXX	XXX	XXX	XXX	XXX	XXX	XXX	Hydrocarbon present Strong odor Well not sampled
BS1	XXX	XXX	XXX	XXX	3/25/2020	XXX	XXX	XXX	XXX	XXX	XXX	XXX	XXX
BS1	XXX	XXX	XXX	XXX	9/29/2020	XXX	XXX	XXX	XXX	XXX	XXX	XXX	XXX
BS1	XXX	XXX	XXX	XXX	3/29/2021	XXX	XXX	XXX	XXX	XXX	XXX	XXX	XXX
BS1	XXX	XXX	XXX	XXX	6/29/2021	XXX	XXX	XXX	XXX	XXX	XXX	XXX	XXX
BS1	XXX	XXX	XXX	XXX	9/28/2021	XXX	XXX	XXX	XXX	XXX	XXX	XXX	XXX
BS1	XXX	XXX	XXX	XXX	12/2/2021	XXX	XXX	XXX	XXX	XXX	XXX	XXX	XXX
BS1	XXX	XXX	XXX	XXX	3/29/2022	XXX	XXX	XXX	XXX	XXX	XXX	XXX	XXX
BS1	XXX	XXX	XXX	XXX	6/30/2022	XXX	XXX	XXX	XXX	XXX	XXX	XXX	XXX

ROC - Hobbs N-6 (1R-487)**SW ¼, NW ¼, SEC. 5 & 6, T19S, R38E**

MW	Depth to Water	Total Depth	Well Volume	Volume Purged	Sample Date	Cl	TDS	Benzene	Toluene	Ethyl Benzene	Total Xylenes	Sulfate	Comments
BS1	XXX	XXX	XXX	XXX	9/26/2022	XXX	XXX	XXX	XXX	XXX	XXX	XXX	XXX
BS1	XXX	XXX	XXX	XXX	12/14/2022	XXX	XXX	XXX	XXX	XXX	XXX	XXX	XXX

MW	Depth to Water	Total Depth	Well Volume	Volume Purged	Sample Date	Cl	TDS	Benzene	Toluene	Ethyl Benzene	Total Xylenes	Sulfate	Comments
BS2	42.59	73.32	20	60	11/15/2006	81.8	522	0.0373	0.00314	0.0404	0.0994	107	Clear Strong petroleum odor
BS2	41.4	71.59	19.6	60	3/14/2007	64.5	444	0.00274	j[0.000935]	0.00225	0.00282	74.4	
BS2	41.8	71.59	19.4	60	6/12/2007	83.8	546	0.00179	0.00119	0.002	0.0011	75.9	Clear
BS2	41.65	71.59	19.5	60	9/18/2007	108	588	<0.001	<0.001	<0.001	<0.003	111	Clear Strong petroleum odor
BS2	41.5	71.59	19.6	60	12/6/2007	108	571	0.001	<0.001	0.002	<0.003	97.5	Clear Strong petroleum odor
BS2	41.78	71.08	19	60	3/4/2008	100	553	0.002	<0.001	0.004	<0.003	113	Clear Strong petroleum odor
BS2	42.06	71.08	18.9	60	5/29/2008	100	605	0.002	<0.001	0.002	<0.003	99.6	Clear Strong petroleum odor
BS2	42.35	71.08	18.7	60	9/5/2008	88	511	0.008	<0.001	0.002	<0.003	101	Clear Strong petroleum odor
BS2	42.46	71.08	18.6	60	12/15/2008	92	568	0.005	<0.001	0.001	<0.003	96.3	Clear Strong petroleum odor
BS2	42.81	70.83	18.2	60	3/16/2009	88	497	<0.001	<0.001	<0.001	<0.003	85.9	Clear Strong petroleum odor
BS2	42.92	70.83	18.1	60	6/9/2009	88	530	<0.001	<0.001	<0.001	<0.003	79.8	Clear Strong Petroleum Odor
BS2	43.41	70.83	17.8	60	9/15/2009	92	533	<0.001	<0.001	<0.001	<0.003	83.7	Clear Strong petroleum odor
BS2	43.61	70.83	17.7	60	11/19/2009	92	568	<0.001	<0.001	<0.001	<0.003	76.2	Clear Strong petroleum odor

ROC - Hobbs N-6 (1R-487)
SW ¼, NW ¼, SEC. 5 & 6, T19S, R38E

MW	Depth to Water	Total Depth	Well Volume	Volume Purged	Sample Date	Cl	TDS	Benzene	Toluene	Ethyl Benzene	Total Xylenes	Sulfate	Comments
BS2	43.85	70.83	17.5	60	3/18/2010	92	555	<0.001	<0.001	<0.001	<0.003	112	Clear Strong Petroleum odor
BS2	43.48	70.83	17.8	60	6/7/2010	84	553	<0.001	<0.001	<0.001	<0.003	94.6	Clear Strong petroleum odor
BS2	42.38	70.83	18.5	60	9/8/2010	92	554	<0.001	<0.001	<0.001	<0.003	83.5	Clear Strong petroleum odor
BS2	42.59	70.83	18.4	60	12/8/2010	104	496	<0.001	<0.001	<0.001	<0.003	93.6	Clear Strong petroleum odor
BS2	42.86	70.83	18.2	60	3/16/2011	80	525	<0.001	<0.001	<0.001	<0.003	89.7	Clear Strong petroleum odor
BS2	43.33	70.83	17.9	60	6/23/2011	140	649	<0.001	<0.001	<0.001	<0.003	92.4	Clear Strong petroleum odor
BS2	43.56	70.83	17.7	60	9/22/2011	156	688	<0.001	<0.001	<0.001	<0.003	112	Clear Strong petroleum odor
BS2	43.75	70.83	17.6	60	12/12/2011	144	665	0.001	<0.001	<0.001	<0.003	118	Clear Strong petroleum odor
BS2	43.89	70.83	17.5	60	3/21/2012	84	569	<0.001	<0.001	<0.001	<0.003	131	Clear Strong petroleum odor
BS2	44.13	70.83	17.4	60	6/15/2012	80	548	<0.001	<0.001	<0.001	<0.003	116	Clear Strong petroleum odor
BS2	44.2	70.83	17.3	60	9/12/2012	72	511	<0.001	<0.001	<0.001	<0.003	101	Clear Strong petroleum odor
BS2	44.32	70.83	17.2	60	12/13/2012	48	477	<0.001	<0.001	<0.001	<0.003	84.3	Clear Strong petroleum odor
BS2	44.85	70.83	16.9	60	3/6/2013	64	482	<0.001	<0.001	<0.001	<0.003	100	Began Pumping/Clear Strong petroleum odor
BS2	45.06	70.83	16.8	60	6/21/2013	76	537	<0.001	<0.001	<0.001	<0.003	97	Began Pumping/Clear Strong Petroleum Odor

ROC - Hobbs N-6 (1R-487)
SW ¼, NW ¼, SEC. 5 & 6, T19S, R38E

MW	Depth to Water	Total Depth	Well Volume	Volume Purged	Sample Date	Cl	TDS	Benzene	Toluene	Ethyl Benzene	Total Xylenes	Sulfate	Comments
BS2	45.25	70.83	16.6	60	9/19/2013	56	515	<0.001	<0.001	<0.001	<0.003	79.4	Began Pumping/Clear Strong petroleum odor
BS2	45.61	70.83	16.4	60	12/16/2013	68	509	<0.001	<0.001	<0.001	<0.003	82.3	Began pumping/Clear Strong petroleum odor
BS2	45.73	70.83	16.3	60	3/24/2014	104	588	<0.001	<0.001	<0.001	<0.003	102	Began pumping/Clear Strong petroleum odor
BS2	45.95	70.83	16.2	60	6/19/2014	76	546	<0.001	<0.001	<0.001	<0.003	81.9	Began pumping/Clear Strong petroleum odor
BS2	46.21	70.83	16	60	9/11/2014	140	714	<0.001	<0.001	<0.001	<0.003	127	Began pumping/Clear Strong petroleum odor
BS2	46.31	70.83	15.9	60	12/22/2014	200	688	<0.001	<0.001	<0.001	<0.003	165	Began Pumping/Clear Strong petroleum odor
BS2	45.91	70.83	16.2	60	3/19/2015	52	502	<0.001	<0.001	<0.001	<0.003	125	Began pumping/Clear Strong petroleum odor
BS2	46.01	70.83	16.1	60	6/17/2015	128	626	<0.001	<0.001	<0.001	<0.003	94	Began pumping/Clear Strong petroleum odor

ROC - Hobbs N-6 (1R-487)**SW ¼, NW ¼, SEC. 5 & 6, T19S, R38E**

MW	Depth to Water	Total Depth	Well Volume	Volume Purged	Sample Date	Cl	TDS	Benzene	Toluene	Ethyl Benzene	Total Xylenes	Sulfate	Comments
BS2	46.07	70.83	16.1	60	9/22/2015	68	550	<0.001	<0.001	<0.001	<0.003	68	Began pumping/Clear Strong petroleum odor
BS2	45.58	70.83	16.4	60	12/3/2015	80	522	<0.001	<0.001	<0.001	<0.003	71	Began pumping/Clear Strong petroleum odor
BS2	45.35	70.83	16.6	60	3/30/2016	96	552	<0.001	<0.001	<0.001	<0.003	81	Clear Slight odor
BS2	46.28	70.83	16	50	6/28/2016	120	560	<0.001	<0.001	<0.001	<0.003	91.3	Clear Slight odor
BS2	45.54	70.83	16	60	9/28/2016	84	586	<0.001	<0.001	<0.001	<0.003	97	Clear Slight odor
BS2	44.92	70.83	17	60	12/6/2016	124	570	<0.001	<0.001	<0.001	<0.003	89	Clear Slight odor
BS2	45.14	70.83	17	60	3/22/2017	160	688	<0.001	<0.001	<0.001	<0.003	86	Clear Strong odor
BS2	45.68	70.83	17	60	6/29/2017	108	594	<0.001	<0.001	<0.001	<0.003	101	Clear Strong odor
BS2	45.59	70.83	16	60	9/27/2017	76	538	<0.001	<0.001	<0.001	<0.003	91	Clear Strong odor
BS2	45.74	70.83	16	60	12/26/2017	88	564	<0.001	<0.001	<0.001	<0.003	106	Clear Strong odor
BS2	46.02	70.83	16.1	60	3/22/2018	128	602	<0.001	<0.001	<0.001	<0.003	86.9	Clear Strong odor
BS2	46.26	70.83	16	50	6/29/2018	112	502	<0.001	<0.001	<0.001	<0.003	83.5	Clear Strong odor
BS2	45.27	70.83	16.6	60	9/19/2018	92	516	<0.001	<0.001	<0.001	<0.003	22.3	Clear Strong odor
BS2	45.21	70.83	16.7	50	12/23/2018	120	562	<0.001	<0.001	<0.001	<0.003	105	Clear Strong odor
BS2	45.26	70.83	17	60	3/28/2019	192	564	<0.001	<0.001	<0.001	<0.003	101	Clear Strong odor
BS2	45.06	70.83	17	60	6/27/2019	240	839	<0.001	<0.001	<0.001	<0.003	84	Clear Strong odor
BS2	45.23	70.83	16	50	9/27/2019	56	483	<0.001	<0.001	<0.001	<0.003	102	Clear Strong odor
BS2	45.68	70.83	16	50	12/13/2019	44	482	<0.001	<0.001	<0.001	<0.003	97	Clear Strong odor
BS2	46.11	70.83	16.1	45	3/25/2020	48	518	<0.001	<0.001	<0.001	<0.003	92.6	Clear Strong odor
BS2	46.53	70.83	15.8	45	9/29/2020	72	559	<0.001	<0.001	<0.001	<0.003	68.1	Clear Strong odor
BS2	46.03	70.83	16	45	3/29/2021	76	517	<0.001	<0.001	<0.001	<0.003	84.7	Clear Strong odor
BS2	46.22	70.83	16	45	6/29/2021	104	514	<0.001	<0.001	<0.001	<0.003	78	Clear Strong odor
BS2	46.96	70.83	16	45	9/28/2021	52	526	<0.001	<0.001	<0.001	<0.003	82.8	Clear Strong odor

ROC - Hobbs N-6 (1R-487)**SW ¼, NW ¼, SEC. 5 & 6, T19S, R38E**

MW	Depth to Water	Total Depth	Well Volume	Volume Purged	Sample Date	Cl	TDS	Benzene	Toluene	Ethyl Benzene	Total Xylenes	Sulfate	Comments
BS2	47.06	70.83	16	45	12/2/2021	76	509	<0.001	<0.001	<0.001	<0.003	103	Clear Strong odor
BS2	47.2	70.83	15.4	45	3/29/2022	76	507	<0.001	<0.001	<0.001	<0.003	74.2	Clear Strong odor
BS2	47.28	70.83	15.3	45	6/29/2022	72	547	<0.001	<0.001	<0.001	<0.003	90.2	Clear Strong odor
BS2	47.41	70.83	15.3	45	9/26/2022	68	532	<0.001	<0.001	<0.001	<0.003	66.2	Clear Strong odor
BS2	47.38	70.83	15.2	45	12/14/2022	80	508	<0.001	<0.001	<0.001	<0.003	74.4	Clear Strong odor

MW	Depth to Water	Total Depth	Well Volume	Volume Purged	Sample Date	Cl	TDS	Benzene	Toluene	Ethyl Benzene	Total Xylenes	Sulfate	Comments
BS3	41.53	70.8	19	65	3/4/2008	500	1,410	0.037	0.001	0.115	0.032	68.3	Clear Strong petroleum odor
BS3	41.82	70.8	18.8	65	5/29/2008	384	1,074	0.006	<0.001	0.005	<0.003	79.4	Clear Strong petroleum odor
BS3	42.09	70.8	18.7	65	9/5/2008	580	1,480	0.01	<0.001	0.051	<0.003	106	Clear Strong petroleum odor
BS3	42.19	70.8	18.6	65	12/15/2008	540	1,440	0.007	0.001	0.014	<0.003	69.5	Clear Strong petroleum odor
BS3	42.45	69.58	17.6	60	3/16/2009	480	1,320	0.021	<0.001	0.024	<0.003	67	Clear Strong petroleum odor
BS3	42.64	69.58	17.5	60	6/9/2009	420	1,340	0.013	<0.001	0.023	<0.003	63.3	Clear Strong petroleum odor
BS3	42.76	69.58	17.4	60	9/15/2009	352	1,160	0.02	<0.001	<0.001	<0.003	63.8	Clear Strong petroleum odor
BS3	42.89	69.58	17.3	60	11/19/2009	400	1,160	0.038	<0.001	<0.001	<0.003	61	Clear Strong odor
BS3	43.08	69.58	17.2	60	3/18/2010	316	1,030	0.023	<0.001	0.014	<0.003	86.6	Clear Strong petroleum odor
BS3	43.24	69.58	17.1	60	6/7/2010	276	972	0.008	<0.001	0.007	<0.003	90	Clear Strong petroleum odor
BS3	42.01	69.58	17.9	60	9/8/2010	100	514	0.001	<0.001	0.001	<0.003	85.5	Clear Strong petroleum odor

ROC - Hobbs N-6 (1R-487)**SW ¼, NW ¼, SEC. 5 & 6, T19S, R38E**

MW	Depth to Water	Total Depth	Well Volume	Volume Purged	Sample Date	Cl	TDS	Benzene	Toluene	Ethyl Benzene	Total Xylenes	Sulfate	Comments
BS3	42.23	69.58	17.8	60	12/8/2010	88	458	<0.001	<0.001	<0.001	<0.003	94.6	Clear Strong petroleum odor
BS3	43.19	69.58	17.2	60	3/16/2011	80	511	<0.001	<0.001	<0.001	<0.003	87	Clear Strong petroleum odor
BS3	43.68	69.58	16.8	60	6/23/2011	84	530	<0.001	<0.001	<0.001	<0.003	94.3	Clear Strong petroleum odor
BS3	43.93	69.58	16.7	60	9/22/2011	90	503	<0.001	<0.001	<0.001	<0.003	105	Clear Strong petroleum odor
BS3	44.14	69.58	16.5	60	12/12/2011	76	545	<0.001	<0.001	<0.001	<0.003	107	Clear Strong petroleum odor
BS3	44.21	69.58	16.5	60	3/21/2012	68	405	<0.001	<0.001	<0.001	<0.003	118	Clear Strong petroleum odor
BS3	44.38	69.58	16.4	60	6/15/2012	72	520	<0.001	<0.001	<0.001	<0.003	88	Clear Strong petroleum odor
BS3	44.45	69.58	16.3	60	9/12/2012	80	557	<0.001	<0.001	<0.001	<0.003	98	Clear Strong petroleum odor
BS3 plugged 12/17/2012													

MW	Depth to Water	Total Depth	Well Volume	Volume Purged	Sample Date	Cl	TDS	Benzene	Toluene	Ethyl Benzene	Total Xylenes	Sulfate	Comments
IWW	40.42	98.25	58.98	176.95	8/14/2002	XXX	XXX	XXX	XXX	XXX	XXX	XXX	
IWW	40.79	98.18	37.3	111.91	3/14/2003	239	XXX	0.004	<0.001	<0.001	<0.001	110	
IWW	40.45	98.24	37.56	112.69	6/27/2003	40.7	465	<0.001	<0.001	<0.001	<0.001	102	
IWW	40.43	98.2	37.78	113.34	9/22/2003	42.5	493	<0.001	<0.001	<0.001	<0.001	79.6	
IWW	40.33	98.23	37.8	113.42	12/18/2003	52	485	<0.002	<0.002	<0.002	<0.006	38.6	
IWW	41.75	98.23	82.96	248.9	3/15/2004	487	1,130	0.00619	<0.001	<0.001	<0.001	130	
IWW	40.12	98.22	37.93	113.81	5/27/2004	40.8	474	<0.001	<0.001	<0.001	<0.001	100	
IWW	41.93	98.2	57.4	172.19	9/8/2004	78	583	<0.001	<0.001	<0.001	<0.001	89.6	

ROC - Hobbs N-6 (1R-487)**SW ¼, NW ¼, SEC. 5 & 6, T19S, R38E**


MW	Depth to Water	Total Depth	Well Volume	Volume Purged	Sample Date	Cl	TDS	Benzene	Toluene	Ethyl Benzene	Total Xylenes	Sulfate	Comments
IWW	39.71	98.2	59.66	178.98	11/23/2004	88.3	XXX	<0.001	<0.001	<0.001	<0.001	82.5	
IWW	39.01	98.2	XXX	250	3/29/2005	419	1,010	<0.001	<0.001	<0.001	<0.001	81	
IWW	39.39	50	XXX	21	6/28/2005	85.3	510	<0.001	<0.001	<0.001	<0.001	73.5	
IWW	39.6	98.2	59.8	185	12/6/2005	49	498	<0.001	<0.001	<0.001	<0.001	64.2	
IWW	39.83	98.2	59.5	180	2/28/2006	41.9	532	<0.001	<0.001	<0.001	<0.001	60.3	
IWW	40.2	98.2	59.2	180	6/5/2006	44.5	494	<0.001	<0.001	<0.001	<0.001	61.1	
IWW	39.76	98.2	59.6	180	9/12/2006	38.8	528	<0.001	<0.001	<0.001	<0.001	80.7	
IWW	39.61	98.2	59.8	180	11/14/2006	43.7	434	<0.001	<0.001	<0.001	<0.001	78.1	Clear No odor pH increased
IWW	40.13	97.9	58.9	180	3/14/2007	35.2	538	<0.001	<0.001	<0.001	<0.001	66.7	Clear
IWW	40.5	97.9	58.5	180	6/11/2007	40.1	490	<0.001	<0.001	<0.011	<0.001	74.7	Clear
IWW	40.49	97.9	58.6	180	9/18/2007	48	606	0.006	<0.001	<0.001	<0.003	91.9	Clear No odor
IWW	40.58	97.9	58.5	200	12/5/2007	44	505	<0.001	<0.001	<0.001	<0.003	87.5	Clear No odor
IWW	40.93	97.9	58.1	200	3/4/2008	40	526	<0.001	<0.001	<0.001	<0.003	90.1	Clear No odor
IWW	41.16	97.9	57.9	200	5/29/2008	44	556	<0.001	<0.001	<0.001	<0.003	82.6	Clear No odor
IWW	41.38	97.9	57.7	200	9/5/2008	44	534	<0.001	<0.001	<0.001	<0.003	85	Clear No odor
IWW	41.61	97.9	57.4	200	12/16/2008	48	574	<0.001	<0.001	<0.001	<0.003	74	Clear No odor
IWW	41.76	97.9	57.3	200	3/16/2009	40	480	<0.001	<0.001	<0.001	<0.003	82.8	Clear No odor
IWW	41.96	97.9	57.1	200	6/9/2009	40	505	<0.001	<0.001	<0.001	<0.003	73.2	Clear No odor
IWW	42.06	97.9	57	200	9/15/2009	88	554	<0.001	<0.001	<0.001	<0.003	75.8	Clear No odor
IWW	42.21	97.9	56.8	200	11/20/2009	44	447	<0.001	<0.001	<0.001	<0.003	68.5	Clear No odor
IWW	42.36	97.9	56.7	200	3/18/2010	108	577	<0.001	<0.001	<0.001	<0.003	95.1	Clear No odor
IWW	42.49	97.9	56.5	200	6/7/2010	48	510	<0.001	<0.001	<0.001	<0.003	93.1	Clear No odor
IWW	41.39	97.9	57.6	200	9/8/2010	40	499	<0.001	<0.001	<0.001	<0.003	73.3	Clear No odor
IWW	41.52	97.9	57.5	200	12/8/2010	68	481	<0.001	<0.001	<0.001	<0.003	81.9	Clear No odor
IWW	42.15	97.9	56.9	200	3/16/2011	68	534	<0.001	<0.001	<0.001	<0.003	74.2	Clear No odor
IWW	42.63	97.9	56.4	200	6/23/2011	84	512	<0.001	<0.001	<0.001	<0.003	73.3	Clear No odor
IWW	42.88	97.9	56.1	200	9/22/2011	84	493	<0.001	<0.001	<0.001	<0.003	81.8	Clear No odor

ROC - Hobbs N-6 (1R-487)**SW ¼, NW ¼, SEC. 5 & 6, T19S, R38E**

MW	Depth to Water	Total Depth	Well Volume	Volume Purged	Sample Date	Cl	TDS	Benzene	Toluene	Ethyl Benzene	Total Xylenes	Sulfate	Comments
IWW	42.98	97.9	56	200	12/12/2011	92	521	<0.001	<0.001	<0.001	<0.003	84.5	Clear No odor
IWW	43.18	97.9	55.8	200	3/21/2012	88	567	<0.001	<0.001	<0.001	<0.003	84.5	Clear No odor
IWW	43.46	97.9	55.5	200	6/15/2012	92	493	<0.001	<0.001	<0.001	<0.003	77	Clear No odor
IWW	43.57	97.9	55.4	200	9/12/2012	72	573	<0.001	<0.001	<0.001	<0.003	97.4	Clear No odor
IWW	43.69	97.9	55.3	200	12/13/2012	124	627	<0.001	<0.001	<0.001	<0.003	78	Clear No odor
IWW	43.8	97.9	55.2	200	3/5/2013	136	607	<0.001	<0.001	<0.001	<0.003	78	Clear No odor
IWW	44.1	97.9	54.9	200	6/21/2013	128	618	<0.001	<0.001	<0.001	<0.003	74	Clear No odor
IWW	44.19	97.9	54.8	200	9/18/2013	168	641	<0.001	<0.001	<0.001	<0.003	79.9	Clear No odor
IWW	44.49	97.9	54.5	200	12/17/2013	132	620	<0.001	<0.001	<0.001	<0.003	72.6	Clear No odor
IWW	44.6	97.9	54.4	200	3/25/2014	140	610	<0.001	<0.001	<0.001	<0.003	123	Clear No odor
IWW	44.81	97.9	54.2	200	6/18/2014	160	680	<0.001	<0.001	<0.001	<0.003	100	Clear No odor
IWW	45.07	97.9	53.9	175	9/12/2014	124	630	<0.001	<0.001	<0.001	<0.003	111	Clear No odor
IWW	45.18	97.9	53.8	175	12/23/2014	84	582	<0.001	<0.001	<0.001	<0.003	173	Clear No odor
IWW	44.8	97.9	54.2	175	3/20/2015	68	586	<0.001	<0.001	<0.001	<0.003	180	Clear No odor
IWW	44.82	97.9	54.1	200	6/17/2015	136	690	<0.001	<0.001	<0.001	<0.003	95	Clear No odor
IWW	44.87	97.9	54.1	175	9/22/2015	88	586	<0.001	<0.001	<0.001	<0.003	94	Clear No odor
IWW	44.69	97.9	54.3	175	12/2/2015	76	564	<0.001	<0.001	<0.001	<0.003	100	Clear No odor
IWW	44.46	97.9	54.5	175	3/29/2016	128	622	<0.001	<0.001	<0.001	<0.003	81	Clear No odor
IWW	45.11	97.9	53.8	200	6/27/2016	152	592	<0.001	<0.001	<0.001	<0.003	78.4	Clear No odor
IWW	44.6	97.9	54	175	9/27/2016	184	698	<0.001	<0.001	<0.001	<0.003	87	Clear No odor
IWW	43.98	97.9	55	175	12/6/2016	68	514	<0.001	<0.001	<0.001	<0.003	23	Clear No odor
IWW	44.05	97.9	55	175	3/21/2017	128	680	<0.001	<0.001	<0.001	<0.003	93	Clear No odor
IWW	44.45	97.9	55	175	6/28/2017	184	814	<0.001	<0.001	<0.001	<0.003	129	Clear No odor
IWW	44.36	97.9	54	90	9/26/2017	76	588	<0.001	<0.001	<0.001	<0.003	96	Clear No odor
IWW	44.45	97.9	54	90	12/22/2017	120	652	<0.001	<0.001	<0.001	<0.003	103	Clear No odor
IWW	44.95	97.9	54	175	3/21/2018	88	538	<0.001	<0.001	<0.001	<0.003	74.1	Clear No odor
IWW	45.22	97.9	53.7	200	6/28/2018	72	546	<0.001	<0.001	<0.001	<0.003	76	Clear No odor
IWW	45.21	97.9	53.7	175	9/19/2018	92	594	<0.001	<0.001	<0.001	<0.003	13.4	Clear No odor

ROC - Hobbs N-6 (1R-487)**SW ¼, NW ¼, SEC. 5 & 6, T19S, R38E**

MW	Depth to Water	Total Depth	Well Volume	Volume Purged	Sample Date	Cl	TDS	Benzene	Toluene	Ethyl Benzene	Total Xylenes	Sulfate	Comments
IWW	45.14	97.9	52.76	200	12/22/2018	140	618	<0.001	<0.001	<0.001	<0.003	108	Clear No odor
IWW	45.21	97.9	54	150	3/27/2019	72	490	<0.001	<0.001	<0.001	<0.003	93	Clear No odor
IWW	45.02	97.9	54	175	6/26/2019	68	538	<0.001	<0.001	<0.001	<0.003	89	Clear No odor
IWW	44.17	97.9	55	125	9/26/2019	132	609	<0.001	<0.001	<0.001	<0.003	77	Clear No odor
IWW	44.98	97.9	54	150	12/12/2019	76	511	<0.001	<0.001	<0.001	<0.003	80	Clear No odor
IWW	45.63	97.9	53.3	150	3/26/2020	76	584	<0.001	<0.001	<0.001	<0.003	78.3	Clear No odor
IWW	45.98	97.9	53	150	9/30/2020	68	522	<0.001	<0.001	<0.001	<0.003	69.4	Clear No odor
IWW	45.5	97.9	53	150	3/30/2021	124	620	<0.001	<0.001	<0.001	<0.003	83	Clear No odor
IWW	45.69	97.9	53	150	6/30/2021	156	646	<0.001	<0.001	<0.001	<0.003	79.3	Clear No odor
IWW	46.11	97.9	53	150	9/29/2021	144	642	<0.001	<0.001	<0.001	<0.003	80.8	Clear No odor
IWW	46.19	97.9	53	150	12/3/2021	132	591	<0.001	<0.001	<0.001	<0.003	43.9	Clear No odor
IWW	46.23	97.9	53	100	3/30/2022	120	633	<0.001	<0.001	<0.001	<0.003	58.6	Clear No odor
IWW	46.31	97.9	53	100	6/30/2022	104	628	<0.001	<0.001	<0.001	<0.003	88.6	Clear No odor
IWW	46.31	97.9	53	100	9/27/2022	140	641	<0.001	<0.001	<0.001	<0.003	71.8	Clear No odor
IWW	46.39	97.9	53	100	12/15/2022	120	568	<0.001	<0.001	<0.001	<0.003	68.2	Clear No odor

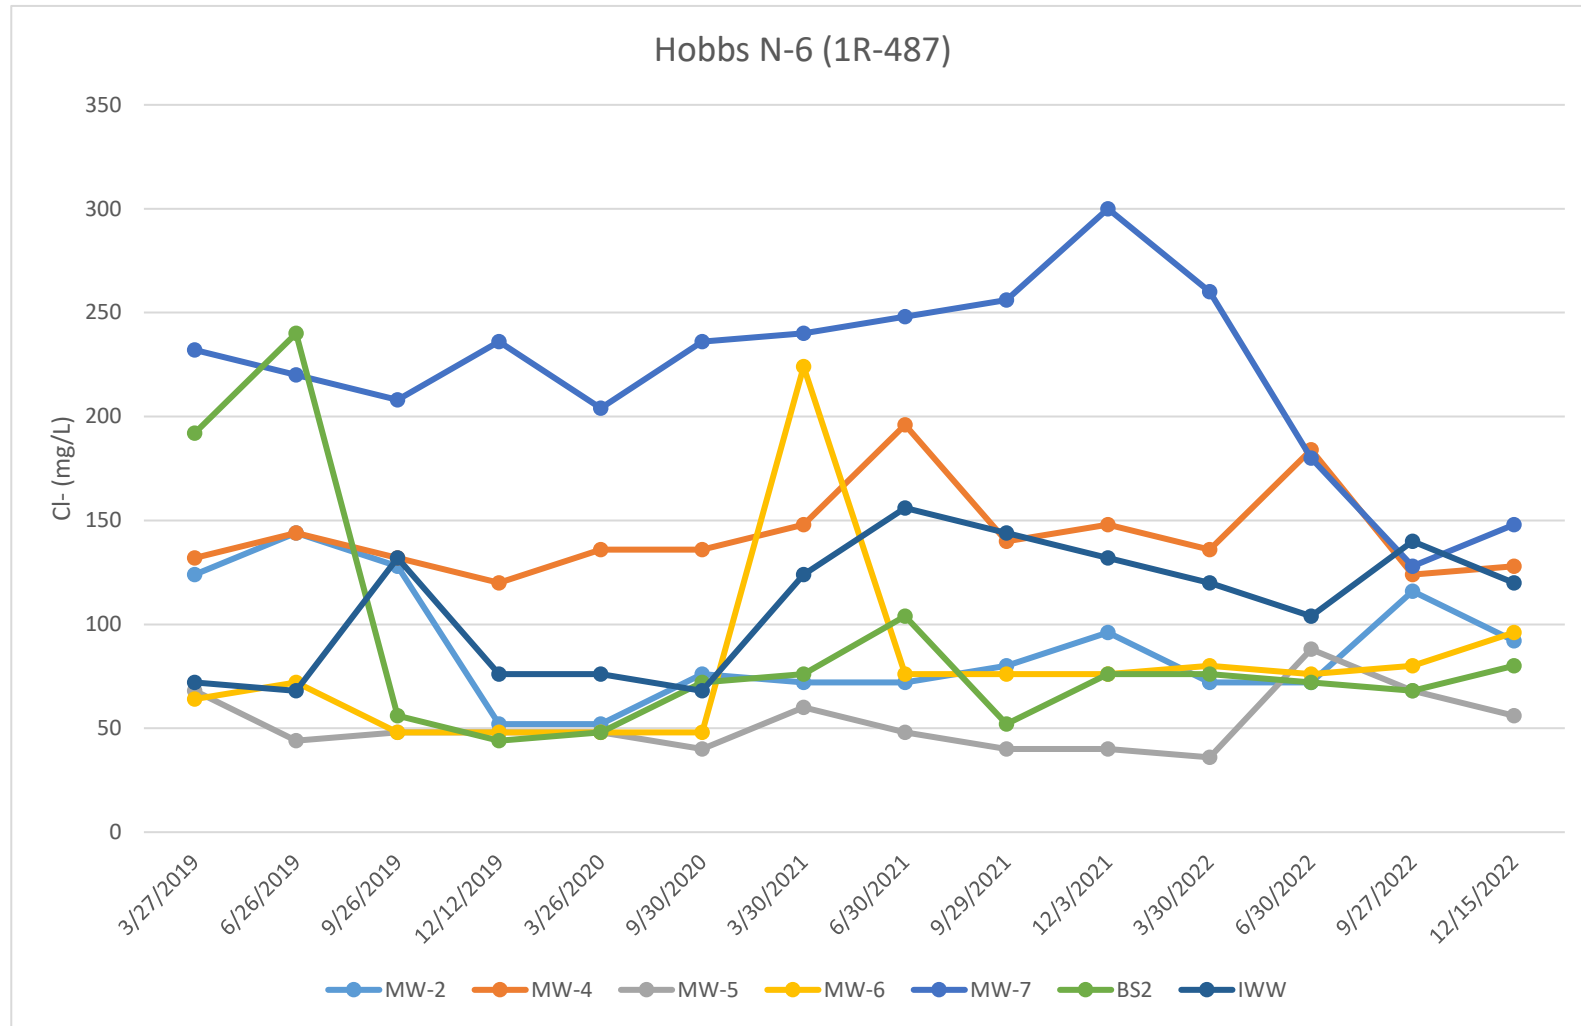

From: OCDOnline@state.nm.us
To: [Katie Jones](#)
Subject: The Oil Conservation Division (OCD) has approved the application, Application ID: 90555
Date: Thursday, October 6, 2022 8:30:31 AM

To whom it may concern (c/o Katie Davis for RICE OPERATING COMPANY),

The OCD has approved the submitted *Ground Water Abatement* (GROUND WATER ABATEMENT), for incident ID (n#) nAPP2110254010, with the following conditions:

- **Review of 2021 Annual Groundwater Report: Content satisfactory** 1. Continue sampling on a bi-annual schedule at a minimum. 2. OCD pre-approves sampling termination and gauging only from MW #2, #4, #5, #6, #7, BS-2, and IWW. 3. OCD requires historic and present free phase product thickness data in any of the site wells, but namely, the MW #1 and BS-1. 4. Submit summarized activities completed and their results in a 2022 Annual Report. Submittal to OCD expected no later than March 31, 2023. 5. OCD requires an abatement option(s) be submitted no later than March 31, 2023 to initiate more aggressive removal of free phase product from BS-1 & MW #1. OCD suggest arranging a meeting to discuss alternative methods in order to mitigate the free phase products.

The signed GROUND WATER ABATEMENT can be found in the OCD Online: Imaging under the incident ID (n#).

If you have any questions regarding this application, please contact me.

Thank you,
Nelson Velez
Environmental Specialist - Advanced
505-469-6146
Nelson.Velez@emnrd.nm.gov

New Mexico Energy, Minerals and Natural Resources Department
1220 South St. Francis Drive
Santa Fe, NM 87505

Arc Environmental, LLC

P. O. Box 1772
Lovington, New Mexico 88260
(575) 631-9310
Rozanne Johnson ~ rozanne@sdacres.com

March 7, 2023

Ms. Katie Jones
RICE Operating Company
122 W Taylor
Hobbs, New Mexico 88240

Re: Hobbs N-6 Field Notes

Ms. Jones,

The wells at the Hobbs N-6 have been monitored bi-weekly using a PSH recovery sock to continue to capture the non-aqueous liquid that enters the well bore and floats on the water table. The field data continues to support the decision to use the PSH recovery socks and not pump the wells. During each well check the wells are bailed with a product only bailer, then checked for measurable non-aqueous liquid entering the well bore. There has been no measurable accumulation this past year. The water table continues to decrease due to the lack of recharge of the aquifer and additional water usage in the area.

Bio Sparge Well #1 has had a PSH recovery sock in the well to continually capture the non-aqueous liquid that enters the well bore. The PSH sock is changed bi-weekly.

Monitor Well #1 has had a PSH recovery sock in the well to continually capture the non-aqueous liquid that enters the well bore. The PSH sock is changed bi-weekly.

Sincerely,
Arc Environmental

Rozanne Johnson
Rozanne Johnson

Arc Environmental							FIELD MEASUREMENT/OBSERVATION LOG							
P. O. Box 1772 ~ Lovington, NM 88260 (575) 631-9310							PROJECT NAME: RICE - Hobbs N-6			PROJECT LOCATION: Hobbs, New Mexico			DATE: As Listed	
PROJECT: RICE Operating							FIELD TECHNICIAN: Rozanne Johnson					Notes: Water disposed of at an approved water disposal facility.		
WELL # SAMPLE LOCATION	TOTAL WELL DEPTH (feet)	DEPTH TO PRODUCT (feet)	DEPTH TO WATER (feet)	HEIGHT WATER COLUMN (feet)	WELL FACTOR 2"=.16 4"=.65 6"=1.5	WELL VOLUME IN GALLONS	Purge Removed (gallons)	WELL VOLUMES REMOVED	PSH THICKNESS (feet)	PSH REMOVED (gallons)	WATER REMOVED (gallons)	DATE: As Listed	Comments	
BS1	63.74								0.0	1.4	0	1/5/2022	Product Present Bailed With Product Bailer PSH Sock replaced	
BS1	63.74								0.0	1.2	0	1/20/2022	Product Present Bailed With Product Bailer PSH Sock replaced	
BS1	63.74								0.0	1.1	0	2/3/2022	Product Present Bailed With Product Bailer PSH Sock replaced	
BS1	63.74								0.0	0.8	0	2/15/2022	Product Present Bailed With Product Bailer PSH Sock replaced	
BS1	63.74								0.0	0.6	0	3/1/2022	Product Present Bailed With Product Bailer PSH Sock replaced	
BS1	63.74								0.0	0.8	0	3/14/2022	Product Present Bailed With Product Bailer PSH Sock replaced	
BS1	63.74								0.0	0.5	0	3/30/2022	Product Present Bailed With Product Bailer PSH Sock replaced	
BS1	63.74								0.0	0.7	0	4/12/2022	Product Present Bailed With Product Bailer PSH Sock replaced	
BS1	63.74								0.0	0.5	0	4/27/2022	Product Present Bailed With Product Bailer PSH Sock replaced	
BS1	63.74								0.0	0.7	0	5/12/2022	Product Present Bailed With Product Bailer PSH Sock replaced	
BS1	63.74								0.0	0.6	0	5/25/2022	Product Present Bailed With Product Bailer PSH Sock replaced	
BS1	63.74								0.0	0.6	0	6/9/2022	Product Present Bailed With Product Bailer PSH Sock replaced	
BS1	63.74								0.0	0.6	0	6/22/2022	Product Present Bailed With Product Bailer PSH Sock replaced	
BS1	63.74								0.0	0.9	0	7/7/2022	Product Present Bailed With Product Bailer PSH Sock replaced	
BS1	63.74								0.0	1.0	0	7/20/2022	Product Present Bailed With Product Bailer PSH Sock replaced	
BS1	63.74								0.0	0.5	0	8/4/2022	Product Present Bailed With Product Bailer PSH Sock replaced	

[illegible]

Arc Environmental							FIELD MEASUREMENT/OBSERVATION LOG							
P. O. Box 1772 ~ Lovington, NM 88260 (575) 631-9310							PROJECT NAME: RICE - Hobbs N-6			PROJECT LOCATION: Hobbs, New Mexico			DATE: As Listed	
PROJECT: RICE Operating							FIELD TECHNICIAN: Rozanne Johnson					Notes: Water disposed of at an approved water disposal facility.		
WELL # SAMPLE LOCATION	TOTAL WELL DEPTH (feet)	DEPTH TO PRODUCT (feet)	DEPTH TO WATER (feet)	HEIGHT WATER COLUMN (feet)	WELL FACTOR 2"=.16 4"=.65 6"=1.5	WELL VOLUME IN GALLONS	Purge Removed (gallons)	WELL VOLUMES REMOVED	PSH THICKNESS (feet)	PSH REMOVED (gallons)	WATER REMOVED (gallons)	DATE: As Listed	Comments	
BS1	63.74									1.9	0	1/6/2021	Product Present Bailed With Product Bailer PSH Sock replaced	
BS1	63.74									1.2	0	1/19/2021	Product Present Bailed With Product Bailer PSH Sock replaced	
BS1	63.74									1.2	0	2/3/2021	Product Present Bailed With Product Bailer PSH Sock replaced	
BS1	63.74									1.0	0	2/18/2021	Product Present Bailed With Product Bailer PSH Sock replaced	
BS1	63.74									1.0	0	3/3/2021	Product Present Bailed With Product Bailer PSH Sock replaced	
BS1	63.74									1.3	0	3/16/2021	Product Present Bailed With Product Bailer PSH Sock replaced	
BS1	63.74									1.2	0	3/30/2021	Product Present Bailed With Product Bailer PSH Sock replaced	
BS1	63.74									1.1	0	4/13/2021	Product Present Bailed With Product Bailer PSH Sock replaced	
BS1	63.74									1.3	0	4/28/2021	Product Present Bailed With Product Bailer PSH Sock replaced	
BS1	63.74									1.3	0	5/11/2021	Product Present Bailed With Product Bailer PSH Sock replaced	
BS1	63.74									1.2	0	5/26/2021	Product Present Bailed With Product Bailer PSH Sock replaced	
BS1	63.74									1.6	0	6/10/2021	Product Present Bailed With Product Bailer PSH Sock replaced	
BS1	63.74									1.2	0	5/25/2021	Product Present Bailed With Product Bailer PSH Sock replaced	
BS1	63.74									1.5	0	7/7/2021	Product Present Bailed With Product Bailer PSH Sock replaced	
BS1	63.74									1.9	0	7/22/2021	Product Present Bailed With Product Bailer PSH Sock replaced	
BS1	63.74									1.2	0	8/3/2021	Product Present Bailed With Product Bailer PSH Sock replaced	

[illegible]

Arc Environmental							FIELD MEASUREMENT/OBSERVATION LOG							
P. O. Box 1772 ~ Lovington, NM 88260 (575) 631-9310							PROJECT NAME: RICE - Hobbs N-6			PROJECT LOCATION: Hobbs, New Mexico			DATE: As Listed	
PROJECT: RICE Operating							FIELD TECHNICIAN: Rozanne Johnson					Notes: Water disposed of at an approved water disposal facility.		
WELL # SAMPLE LOCATION	TOTAL WELL DEPTH (feet)	DEPTH TO PRODUCT (feet)	DEPTH TO WATER (feet)	HEIGHT WATER COLUMN (feet)	WELL FACTOR 2"=.16 4"=.65 6"=1.5	WELL VOLUME IN GALLONS	Purge Removed (gallons)	WELL VOLUMES REMOVED	PSH THICKNESS (feet)	PSH REMOVED (gallons)	WATER REMOVED (gallons)	DATE: As Listed	Comments	
BS1	63.74									1.6	0	1/7/2020	Product Present Bailed With Product Bailer PSH Sock replaced	
BS1	63.74									1.2	0	1/22/2020	Product Present Bailed With Product Bailer PSH Sock replaced	
BS1	63.74									1.0	0	2/6/2020	Product Present Bailed With Product Bailer PSH Sock replaced	
BS1	63.74									1.8	0	2/19/2020	Product Present Bailed With Product Bailer PSH Sock replaced	
BS1	63.74									1.1	0	3/5/2020	Product Present Bailed With Product Bailer PSH Sock replaced	
BS1	63.74									1.1	0	3/17/2020	Product Present Bailed With Product Bailer PSH Sock replaced	
BS1	63.74									1.4	0	3/31/2020	Product Present Bailed With Product Bailer PSH Sock replaced	
BS1	63.74									1.2	0	4/9/2020	Product Present Bailed With Product Bailer PSH Sock replaced	
BS1	63.74									1.0	0	4/22/2020	Product Present Bailed With Product Bailer PSH Sock replaced	
BS1	63.74									1.6	0	5/4/2020	Product Present Bailed With Product Bailer PSH Sock replaced	
BS1	63.74									1.8	0	5/20/2020	Product Present Bailed With Product Bailer PSH Sock replaced	
BS1	63.74									1.9	0	6/2/2020	Product Present Bailed With Product Bailer PSH Sock replaced	
BS1	63.74									1.9	0	6/18/2020	Product Present Bailed With Product Bailer PSH Sock replaced	
BS1	63.74									1.2	0	6/30/2020	Product Present Bailed With Product Bailer PSH Sock replaced	
BS1	63.74									1.0	0	7/7/2020	Product Present Bailed With Product Bailer PSH Sock replaced	
BS1	63.74									1.3	0	7/22/2020	Product Present Bailed With Product Bailer PSH Sock replaced	

[illegible]

Arc Environmental							FIELD MEASUREMENT/OBSERVATION LOG							
P. O. Box 1772 ~ Lovington, NM 88260 (575) 631-9310							PROJECT NAME: RICE - Hobbs N-6			PROJECT LOCATION: Hobbs, New Mexico			DATE: As Listed	
PROJECT: RICE Operating							FIELD TECHNICIAN: Rozanne Johnson					Notes: Water disposed of at an approved water disposal facility.		
WELL # SAMPLE LOCATION	TOTAL WELL DEPTH (feet)	DEPTH TO PRODUCT (feet)	DEPTH TO WATER (feet)	HEIGHT WATER COLUMN (feet)	WELL FACTOR 2"=.16 4"=.65 6"=1.5	WELL VOLUME IN GALLONS	Purge Removed (gallons)	WELL VOLUMES REMOVED	PSH THICKNESS (feet)	PSH REMOVED (gallons)	WATER REMOVED (gallons)	DATE: As Listed	Comments	
BS1	63.74									1.1	0	1/10/2019	Product Present Bailed With Product Bailer PSH Sock replaced	
BS1	63.74									1.0	0	1/18/2019	Product Present Bailed With Product Bailer PSH Sock replaced	
BS1	63.74									1.5	0	1/31/2019	Product Present Bailed With Product Bailer PSH Sock replaced	
BS1	63.74									1.2	0	2/5/2019	Product Present Bailed With Product Bailer PSH Sock replaced	
BS1	63.74									1.0	0	2/15/2019	Product Present Bailed With Product Bailer PSH Sock replaced	
BS1	63.74									1.0	0	2/26/2019	Product Present Bailed With Product Bailer PSH Sock replaced	
BS1	63.74									1.4	0	3/8/2019	Product Present Bailed With Product Bailer PSH Sock replaced	
BS1	63.74									0.8	0	3/20/2019	Product Present Bailed With Product Bailer PSH Sock replaced	
BS1	63.74									0.9	0	4/4/2019	Product Present Bailed With Product Bailer PSH Sock replaced	
BS1	63.74									1.5	0	4/15/2019	Product Present Bailed With Product Bailer PSH Sock replaced	
BS1	63.74									0.9	0	4/23/2019	Product Present Bailed With Product Bailer PSH Sock replaced	
BS1	63.74									2.2	0	5/7/2019	Product Present Bailed With Product Bailer PSH Sock replaced	
BS1	63.74									1.4	0	5/17/2019	Product Present Bailed With Product Bailer PSH Sock replaced	
BS1	63.74									1.2	0	5/28/2019	Product Present Bailed With Product Bailer PSH Sock replaced	
BS1	63.74									1.0	0	6/7/2019	Product Present Bailed With Product Bailer PSH Sock replaced	
BS1	63.74									1.3	0	6/18/2019	Product Present Bailed With Product Bailer PSH Sock replaced	

BS1	63.74									1.0	0	6/28/2019	Product Present Bailed With Product Bailer PSH Sock replaced
BS1	63.74									1.6	0	7/9/2019	Product Present Bailed With Product Bailer PSH Sock replaced
BS1	63.74									1.3	0	7/25/2019	Product Present Bailed With Product Bailer PSH Sock replaced
BS1	63.74									1.1	0	8/7/2019	Product Present Bailed With Product Bailer PSH Sock replaced
BS1	63.74									1.2	0	8/13/2019	Product Present Bailed With Product Bailer PSH Sock replaced
BS1	63.74									1.3	0	8/30/2019	Product Present Bailed With Product Bailer PSH Sock replaced
BS1	63.74									1.0	0	9/12/2019	Product Present Bailed With Product Bailer PSH Sock replaced
BS1	63.74									1.0	0	9/24/2019	Product Present Bailed With Product Bailer PSH Sock replaced
BS1	63.74									1.6	0	10/2/2019	Product Present Bailed With Product Bailer PSH Sock replaced
BS1	63.74									1.5	0	10/17/2019	Product Present Bailed With Product Bailer PSH Sock replaced
BS1	63.74									1.2	0	10/25/2019	Product Present Bailed With Product Bailer PSH Sock replaced
BS1	63.74									1.0	0	11/7/2019	Product Present Bailed With Product Bailer PSH Sock replaced
BS1	63.74									1.3	0	11/20/2019	Product Present Bailed With Product Bailer PSH Sock replaced
BS1	63.74									0.5	0	12/5/2019	Product Present Bailed With Product Bailer PSH Sock replaced
BS1	63.74									1.3	0	12/17/2019	Product Present Bailed With Product Bailer PSH Sock replaced
BS1	63.74									0.9	0	12/30/2019	Product Present Bailed With Product Bailer PSH Sock replaced
										38.2	0		

Arc Environmental							FIELD MEASUREMENT/OBSERVATION LOG							
P. O. Box 1772 ~ Lovington, NM 88260 (575) 631-9310							PROJECT NAME: RICE - Hobbs N-6			PROJECT LOCATION: Hobbs, New Mexico			DATE: As Listed	
PROJECT: RICE Operating							FIELD TECHNICIAN: Rozanne Johnson					Notes: Water disposed of at an approved water disposal facility.		
WELL # SAMPLE LOCATION	TOTAL WELL DEPTH (feet)	DEPTH TO PRODUCT (feet)	DEPTH TO WATER (feet)	HEIGHT WATER COLUMN (feet)	WELL FACTOR 2"=.16 4"=.65 6"=1.5	WELL VOLUME IN GALLONS	Purge Removed (gallons)	WELL VOLUMES REMOVED	PSH THICKNESS (feet)	PSH REMOVED (gallons)	WATER REMOVED (gallons)	DATE: As Listed	Comments	
BS1	63.74									1.5	0	1/9/2018	Product Present Bailed With Product Bailer PSH Sock replaced	
BS1	63.74									0.9	0	1/17/2018	Product Present Bailed With Product Bailer PSH Sock replaced	
BS1	63.74									1.6	0	1/30/2018	Product Present Bailed With Product Bailer PSH Sock replaced	
BS1	63.74									1.4	0	2/13/2018	Product Present Bailed With Product Bailer PSH Sock replaced	
BS1	63.74									1.3	0	2/27/2018	Product Present Bailed With Product Bailer PSH Sock replaced	
BS1	63.74									1.3	0	3/9/2018	Product Present Bailed With Product Bailer PSH Sock replaced	
BS1	63.74									1.8	0	3/22/2018	Product Present Bailed With Product Bailer PSH Sock replaced	
BS1	63.74									1.1	0	4/4/2018	Product Present Bailed With Product Bailer PSH Sock replaced	
BS1	63.74									1.1	0	4/16/2018	Product Present Bailed With Product Bailer PSH Sock replaced	
BS1	63.74									1.2	0	4/27/2018	Product Present Bailed With Product Bailer PSH Sock replaced	
BS1	63.74									1.6	0	5/10/2018	Product Present Bailed With Product Bailer PSH Sock replaced	
BS1	63.74									1.9	0	5/25/2018	Product Present Bailed With Product Bailer PSH Sock replaced	
BS1	63.74									1.9	0	6/1/2018	Product Present Bailed With Product Bailer PSH Sock replaced	
BS1	63.74									1.0	0	6/15/2018	Product Present Bailed With Product Bailer PSH Sock replaced	
BS1	63.74									0.8	0	6/29/2018	Product Present Bailed With Product Bailer PSH Sock replaced	
BS1	63.74									0.8	0	7/10/2018	Product Present Bailed With Product Bailer PSH Sock replaced	

BS1	63.74									0.6	0	7/20/2018	Product Present Bailed With Product Bailer PSH Sock replaced
BS1	63.74									1.2	0	8/3/2018	Product Present Bailed With Product Bailer PSH Sock replaced
BS1	63.74									1.3	0	8/16/2018	Product Present Bailed With Product Bailer PSH Sock replaced
BS1	63.74									1.1	0	8/30/2018	Product Present Bailed With Product Bailer PSH Sock replaced
BS1	63.74									1.6	0	9/7/2018	Product Present Bailed With Product Bailer PSH Sock replaced
BS1	63.74									0.8	0	9/21/2018	Product Present Bailed With Product Bailer PSH Sock replaced
BS1	63.74									1.2	0	10/5/2018	Product Present Bailed With Product Bailer PSH Sock replaced
BS1	63.74									1.1	0	10/19/2018	Product Present Bailed With Product Bailer PSH Sock replaced
BS1	63.74									1.6	0	11/2/2018	Product Present Bailed With Product Bailer PSH Sock replaced
BS1	63.74									1.2	0	11/16/2018	Product Present Bailed With Product Bailer PSH Sock replaced
BS1	63.74									0.9	0	11/30/2018	Product Present Bailed With Product Bailer PSH Sock replaced
BS1	63.74									0.8	0	12/14/2018	Product Present Bailed With Product Bailer PSH Sock replaced
BS1	63.74									1.0	0	12/28/2018	Product Present Bailed With Product Bailer PSH Sock replaced
				Total Removed			0	0		35.6	0		

Arc Environmental							FIELD MEASUREMENT/OBSERVATION LOG							
P. O. Box 1772 ~ Lovington, NM 88260 (575) 631-9310							PROJECT NAME: RICE - Hobbs N-6			PROJECT LOCATION: Hobbs, New Mexico			DATE: As Listed	
PROJECT: RICE Operating							FIELD TECHNICIAN: Rozanne Johnson					Notes: Water disposed of at an approved water disposal facility.		
WELL # SAMPLE LOCATION	TOTAL WELL DEPTH (feet)	DEPTH TO PRODUCT (feet)	DEPTH TO WATER (feet)	HEIGHT WATER COLUMN (feet)	WELL FACTOR 2"=.16 4"=.65 6"=1.5	WELL VOLUME IN GALLONS	Purge Removed (gallons)	WELL VOLUMES REMOVED	PSH THICKNESS (feet)	PSH REMOVED (gallons)	WATER REMOVED (gallons)	DATE: As Listed	Comments	
BS1	63.74									1.6	0	1/10/2017	Product Present Bailed With Product Bailer PSH Sock replaced	
BS1	63.74									1.0	0	1/18/2017	Product Present Bailed With Product Bailer PSH Sock replaced	
BS1	63.74									1.3	0	1/27/2017	Product Present Bailed With Product Bailer PSH Sock replaced	
BS1	63.74									1.4	0	2/1/2017	Product Present Bailed With Product Bailer PSH Sock replaced	
BS1	63.74									1.2	0	2/15/2017	Product Present Bailed With Product Bailer PSH Sock replaced	
BS1	63.74									1.5	0	2/28/2017	Product Present Bailed With Product Bailer PSH Sock replaced	
BS1	63.74									1.2	0	3/10/2017	Product Present Bailed With Product Bailer PSH Sock replaced	
BS1	63.74									1.0	0	3/21/2017	Product Present Bailed With Product Bailer PSH Sock replaced	
BS1	63.74									1.1	0	3/31/2017	Product Present Bailed With Product Bailer PSH Sock replaced	
BS1	63.74									1.1	0	4/3/2017	Product Present Bailed With Product Bailer PSH Sock replaced	
BS1	63.74									1.3	0	4/14/2017	Product Present Bailed With Product Bailer PSH Sock replaced	
BS1	63.74									1.1	0	4/28/2017	Product Present Bailed With Product Bailer PSH Sock replaced	
BS1	63.74									1.0	0	5/9/2017	Product Present Bailed With Product Bailer PSH Sock replaced	
BS1	63.74									0.8	0	5/19/2017	Product Present Bailed With Product Bailer PSH Sock replaced	
BS1	63.74									0.6	0	6/9/2017	Product Present Bailed With Product Bailer PSH Sock replaced	
BS1	63.74									1.0	0	6/22/2017	Product Present Bailed With Product Bailer PSH Sock replaced	

BS1	63.74									1.2	0	7/5/2017	Product Present Bailed With Product Bailer PSH Sock replaced
BS1	63.74									1.2	0	7/14/2017	Product Present Bailed With Product Bailer PSH Sock replaced
BS1	63.74									1.2	0	7/27/2017	Product Present Bailed With Product Bailer PSH Sock replaced
BS1	63.74									1.2	0	8/4/2017	Product Present Bailed With Product Bailer PSH Sock replaced
BS1	63.74									1.2	0	8/18/2017	Product Present Bailed With Product Bailer PSH Sock replaced
BS1	63.74									1.2	0	9/15/2017	Product Present Bailed With Product Bailer PSH Sock replaced
BS1	63.74									1.2	0	9/27/2017	Product Present Bailed With Product Bailer PSH Sock replaced
BS1	63.74									1.4	0	10/7/2017	Product Present Bailed With Product Bailer PSH Sock replaced
BS1	63.74									1.5	0	10/16/2017	Product Present Bailed With Product Bailer PSH Sock replaced
BS1	63.74									1.2	0	11/3/2017	Product Present Bailed With Product Bailer PSH Sock replaced
BS1	63.74									0.9	0	11/10/2017	Product Present Bailed With Product Bailer PSH Sock replaced
BS1	63.74									1.2	0	11/21/2017	Product Present Bailed With Product Bailer PSH Sock replaced
BS1	63.74									1.1	0	12/1/2017	Product Present Bailed With Product Bailer PSH Sock replaced
BS1	63.74									1.0	0	12/15/2017	Product Present Bailed With Product Bailer PSH Sock replaced
BS1	63.74									1.1	0	12/29/2017	Product Present Bailed With Product Bailer PSH Sock replaced
										36.0	0		

Arc Environmental							FIELD MEASUREMENT/OBSERVATION LOG							
P. O. Box 1772 ~ Lovington, NM 88260 (575) 631-9310							PROJECT NAME:			PROJECT LOCATION:			DATE: As Listed	
							RICE - Hobbs N-6			Hobbs, New Mexico				
PROJECT: RICE Operating							FIELD TECHNICIAN: Rozanne Johnson					Notes: Water disposed of at an approved water disposal facility.		
WELL # SAMPLE LOCATION	TOTAL WELL DEPTH (feet)	DEPTH TO PRODUCT (feet)	DEPTH TO WATER (feet)	HEIGHT WATER COLUMN (feet)	WELL FACTOR 2"=.16 4"=.65 6"=1.5	WELL VOLUME IN GALLONS	Purge Removed (gallons)	WELL VOLUMES REMOVED	PSH THICKNESS (feet)	PSH REMOVED (gallons)	WATER REMOVED (gallons)	DATE: As Listed	Comments	
BS1	63.74									1.1	0	10/7/2016	Product Present Bailed With Product Bailer PSH Sock replaced	
BS1	63.74									1.0	0	10/13/2016	Product Present Bailed With Product Bailer PSH Sock replaced	
BS1	63.74									1.0	0	10/21/2016	Product Present Bailed With Product Bailer PSH Sock replaced	
BS1	63.74									1.2	0	10/28/2016	Product Present Bailed With Product Bailer PSH Sock replaced	
BS1	63.74									1.3	0	11/3/2016	Product Present Bailed With Product Bailer PSH Sock replaced	
BS1	63.74									1.5	0	11/11/2016	Product Present Bailed With Product Bailer PSH Sock replaced	
BS1	63.74									1.2	0	11/17/2016	Product Present Bailed With Product Bailer PSH Sock replaced	
BS1	63.74									1.2	0	11/30/2016	Product Present Bailed With Product Bailer PSH Sock replaced	
BS1	63.74		44.92							1.4	0	12/7/2016	Product Present Bailed With Product Bailer PSH Sock replaced	
BS1	63.74									1.6	0	12/15/2016	Product Present Bailed With Product Bailer PSH Sock replaced	
BS1	63.74									1.2	0	12/21/2016	Product Present Bailed With Product Bailer PSH Sock replaced	
BS1	63.74									1.1	0	12/30/2016	Product Present Bailed With Product Bailer PSH Sock replaced	
					Total Removed		0	0		14.8	0			

Arc Environmental						FIELD MEASUREMENT/OBSERVATION LOG							
P. O. Box 1772 ~ Lovington, NM 88260 (575) 631-9310						PROJECT NAME: RICE - Hobbs N-6			PROJECT LOCATION: Hobbs, New Mexico			DATE: As Listed	
PROJECT: RICE Operating						FIELD TECHNICIAN: Rozanne Johnson			Notes: Water disposed of at an approved water disposal facility.				
WELL # SAMPLE LOCATION	TOTAL WELL DEPTH (feet)	DEPTH TO PRODUCT (feet)	DEPTH TO WATER (feet)	HEIGHT WATER COLUMN (feet)	WELL FACTOR 2"=.16 4"=.65 6"=1.5	WELL VOLUME IN GALLONS	Purge Removed (gallons)	WELL VOLUMES REMOVED	PSH THICKNESS (feet)	PSH REMOVED (gallons)	WATER REMOVED (gallons)	DATE: As Listed	Comments
BS1	63.74									1.4	0	7/8/2016	Product Present Bailed With Product Bailer PSH Sock replaced
BS1	63.74									1.1	0	7/15/2016	Product Present Bailed With Product Bailer PSH Sock replaced
BS1	63.74									1.2	0	7/21/2016	Product Present Bailed With Product Bailer PSH Sock replaced
BS1	63.74									1.1	0	7/28/2016	Product Present Bailed With Product Bailer PSH Sock replaced
BS1	63.74									1.1	0	8/4/2016	Product Present Bailed With Product Bailer PSH Sock replaced
BS1	63.74									1.3	0	8/15/2016	Product Present Bailed With Product Bailer PSH Sock replaced
BS1	63.74									1.2	0	8/26/2016	Product Present Bailed With Product Bailer PSH Sock replaced
BS1	63.74									1.5	0	9/2/2016	Product Present Bailed With Product Bailer PSH Sock replaced
BS1	63.74									1.1	0	9/9/2016	Product Present Bailed With Product Bailer PSH Sock replaced
BS1	63.74									1.6	0	9/15/2016	Product Present Bailed With Product Bailer PSH Sock replaced
BS1	63.74									1.1	0	9/22/2016	Product Present Bailed With Product Bailer PSH Sock replaced
BS1	63.74		45.54							1.4	0	9/28/2016	Product Present Bailed With Product Bailer PSH Sock replaced
						Total Removed	0	0		15.1	0		

Arc Environmental						FIELD MEASUREMENT/OBSERVATION LOG							
P. O. Box 1772 ~ Lovington, NM 88260 (575) 631-9310						PROJECT NAME: RICE - Hobbs N-6			PROJECT LOCATION: Hobbs, New Mexico			DATE: As Listed	
PROJECT: RICE Operating						FIELD TECHNICIAN: Rozanne Johnson			Notes: Water disposed of at an approved water disposal facility.				
WELL # SAMPLE LOCATION	TOTAL WELL DEPTH (feet)	DEPTH TO PRODUCT (feet)	DEPTH TO WATER (feet)	HEIGHT WATER COLUMN (feet)	WELL FACTOR 2"=.16 4"=.65 6"=1.5	WELL VOLUME IN GALLONS	Purge Removed (gallons)	WELL VOLUMES REMOVED	PSH THICKNESS (feet)	PSH REMOVED (gallons)	WATER REMOVED (gallons)	DATE: As Listed	Comments
BS1	63.74									1.0	0	4/7/2016	Product Present Bailed With Product Bailer PSH Sock replaced
BS1	63.74									1.7	0	4/15/2016	Product Present Bailed With Product Bailer PSH Sock replaced
BS1	63.74									1.2	0	4/22/2016	Product Present Bailed With Product Bailer PSH Sock replaced
BS1	63.74									1.5	0	4/29/2016	Product Present Bailed With Product Bailer PSH Sock replaced
BS1	63.74									1.0	0	5/5/2016	Product Present Bailed With Product Bailer PSH Sock replaced
BS1	63.74									1.2	0	5/10/2016	Product Present Bailed With Product Bailer PSH Sock replaced
BS1	63.74									1.4	0	5/20/2016	Product Present Bailed With Product Bailer PSH Sock replaced
BS1	63.74									0.9	0	5/26/2016	Product Present Bailed With Product Bailer PSH Sock replaced
BS1	63.74									1.0	0	6/9/2016	Product Present Bailed With Product Bailer PSH Sock replaced
BS1	63.74									1.2	0	6/17/2016	Product Present Bailed With Product Bailer PSH Sock replaced
BS1	63.74									1.1	0	6/24/2016	Product Present Bailed With Product Bailer PSH Sock replaced
BS1	63.74		46.28							1.3	0	6/28/2016	Product Present Bailed With Product Bailer PSH Sock replaced
						Total Removed	0	0		14.5	0		

Arc Environmental						FIELD MEASUREMENT/OBSERVATION LOG							
P. O. Box 1772 ~ Lovington, NM 88260 (575) 631-9310						PROJECT NAME: RICE - Hobbs N-6			PROJECT LOCATION: Hobbs, New Mexico			DATE: As Listed	
PROJECT: RICE Operating						FIELD TECHNICIAN: Rozanne Johnson						Notes: Water disposed of at an approved water disposal facility.	
WELL # SAMPLE LOCATION	TOTAL WELL DEPTH (feet)	DEPTH TO PRODUCT (feet)	DEPTH TO WATER (feet)	HEIGHT WATER COLUMN (feet)	WELL FACTOR 2"=.16 4"=.65 6"=1.5	WELL VOLUME IN GALLONS	Purge Removed (gallons)	WELL VOLUMES REMOVED	PSH THICKNESS (feet)	PSH REMOVED (gallons)	WATER REMOVED (gallons)	DATE: As Listed	Comments
BS1	63.74									1.0	0	1/8/2016	Product Present Bailed With Product Bailer PSH Sock replaced
BS1	63.74									0.9	0	1/14/2016	Product Present Bailed With Product Bailer PSH Sock replaced
BS1	63.74									1.2	0	1/21/2016	Product Present Bailed With Product Bailer PSH Sock replaced
BS1	63.74									1.3	0	1/29/2016	Product Present Bailed With Product Bailer PSH Sock replaced
BS1	63.74									1.0	0	2/8/2016	Product Present Bailed With Product Bailer PSH Sock replaced
BS1	63.74									1.2	0	2/17/2016	Product Present Bailed With Product Bailer PSH Sock replaced
BS1	63.74									1.4	0	2/26/2016	Product Present Bailed With Product Bailer PSH Sock replaced
BS1	63.74									1.2	0	3/4/2016	Product Present Bailed With Product Bailer PSH Sock replaced
BS1	63.74									1.1	0	3/11/2016	Product Present Bailed With Product Bailer PSH Sock replaced
BS1	63.74									1.2	0	3/18/2016	Product Present Bailed With Product Bailer PSH Sock replaced
BS1	63.74		45.35							1.6	0	3/30/2016	Product Present Bailed With Product Bailer PSH Sock replaced
						Total Removed	0	0		13.1	0		

Arc EnvironmentalP. O. Box 1772 ~ Lovington, NM 88260
(575) 631-9310**FIELD MEASUREMENT/OBSERVATION LOG**PROJECT NAME:
RICE - Hobbs N-6PROJECT LOCATION:
Hobbs, New Mexico

DATE: As Listed

PROJECT: RICE Operating

FIELD TECHNICIAN: Rozanne Johnson

Notes: Water disposed of at an approved water disposal facility.

WELL # SAMPLE LOCATION	TOTAL WELL DEPTH (feet)	DEPTH TO PRODUCT (feet)	DEPTH TO WATER (feet)	HEIGHT WATER COLUMN (feet)	WELL FACTOR 2"=.16 4"=.65 6"=1.5	WELL VOLUME IN GALLONS	Purge Removed (gallons)	WELL VOLUMES REMOVED	PSH THICKNESS (feet)	PSH REMOVED (gallons)	WATER REMOVED (gallons)	DATE: As Listed	Comments
BS1	63.74									1.3	0	10/1/2015	Product Present Bailed With Product Bailer PSH Sock replaced
BS1	63.74									1.2	0	10/8/2015	Product Present Bailed With Product Bailer PSH Sock replaced
BS1	63.74									1.2	0	10/16/2015	Product Present Bailed With Product Bailer PSH Sock replaced
BS1	63.74									1.0	0	10/23/2015	Product Present Bailed With Product Bailer PSH Sock replaced
BS1	63.74									1.0	0	10/29/2015	Product Present Bailed With Product Bailer PSH Sock replaced
BS1	63.74									1.4	0	11/5/2015	Product Present Bailed With Product Bailer PSH Sock replaced
BS1	63.74									1.5	0	11/12/2015	Product Present Bailed With Product Bailer PSH Sock replaced
BS1	63.74									1.3	0	11/18/2015	Product Present Bailed With Product Bailer PSH Sock replaced
BS1	63.74									1.1	0	11/24/2015	Product Present Bailed With Product Bailer PSH Sock replaced
BS1	63.74	47.05	47.23							1.2	0	12/3/2015	Product Present Bailed With Product Bailer PSH Sock replaced
BS1	63.74									1.0	0	12/11/2015	Product Present Bailed With Product Bailer PSH Sock replaced
BS1	63.74									1.5	0	12/18/2015	Product Present Bailed With Product Bailer PSH Sock replaced
BS1	63.74									1.9	0	12/29/2015	Product Present Bailed With Product Bailer PSH Sock replaced
						Total Removed	0	0		16.6	0		

Arc Environmental						FIELD MEASUREMENT/OBSERVATION LOG							
P. O. Box 1772 ~ Lovington, NM 88260 (575) 631-9310						PROJECT NAME: RICE - Hobbs N-6			PROJECT LOCATION: Hobbs, New Mexico			DATE: As Listed	
PROJECT: RICE Operating						FIELD TECHNICIAN: Rozanne Johnson						Notes: Water disposed of at an approved water disposal facility.	
WELL # SAMPLE LOCATION	TOTAL WELL DEPTH (feet)	DEPTH TO PRODUCT (feet)	DEPTH TO WATER (feet)	HEIGHT WATER COLUMN (feet)	WELL FACTOR 2"=.16 4"=.65 6"=1.5	WELL VOLUME IN GALLONS	Purge Removed (gallons)	WELL VOLUMES REMOVED	PSH THICKNESS (feet)	PSH REMOVED (gallons)	WATER REMOVED (gallons)	DATE: As Listed	Comments
BS1	63.74									1.4	0	7/9/2015	Product Present Bailed With Product Bailer PSH Sock replaced
BS1	63.74									1.1	0	7/17/2015	Product Present Bailed With Product Bailer PSH Sock replaced
BS1	63.74									1.0	0	7/23/2015	Product Present Bailed With Product Bailer PSH Sock replaced
BS1	63.74									0.8	0	7/31/2015	Product Present Bailed With Product Bailer PSH Sock replaced
BS1	63.74									0.8	0	8/5/2015	Product Present Bailed With Product Bailer PSH Sock replaced
BS1	63.74									1.1	0	8/14/2015	Product Present Bailed With Product Bailer PSH Sock replaced
BS1	63.74									1.1	0	8/20/2015	Product Present Bailed With Product Bailer PSH Sock replaced
BS1	63.74									1.0	0	8/27/2015	Product Present Bailed With Product Bailer PSH Sock replaced
BS1	63.74									0.7	0	9/4/2015	Product Present Bailed With Product Bailer PSH Sock replaced
BS1	63.74									1.6	0	9/15/2015	Product Present Bailed With Product Bailer PSH Sock replaced
BS1	63.74	47.43	47.51							1.1	0	9/22/2015	Product Present Bailed With Product Bailer PSH Sock replaced
						Total Removed	0	0		11.7	0		

Arc Environmental							FIELD MEASUREMENT/OBSERVATION LOG							
P. O. Box 1772 ~ Lovington, NM 88260 (575) 631-9310							PROJECT NAME: RICE - Hobbs N-6			PROJECT LOCATION: Hobbs, New Mexico			DATE: As Listed	
PROJECT: RICE Operating							FIELD TECHNICIAN: Rozanne Johnson					Notes: Water disposed of at an approved water disposal facility.		
WELL # SAMPLE LOCATION	TOTAL WELL DEPTH (feet)	DEPTH TO PRODUCT (feet)	DEPTH TO WATER (feet)	HEIGHT WATER COLUMN (feet)	WELL FACTOR 2"=.16 4"=.65 6"=1.5	WELL VOLUME IN GALLONS	Purge Removed (gallons)	WELL VOLUMES REMOVED	PSH THICKNESS (feet)	PSH REMOVED (gallons)	WATER REMOVED (gallons)	DATE: As Listed	Comments	
BS1	63.74									1.0	0	4/2/2015	Product Present Bailed With Product Bailer PSH Sock replaced	
BS1	63.74									1.0	0	4/10/2015	Product Present Bailed With Product Bailer PSH Sock replaced	
BS1	63.74									1.2	0	4/16/2015	Product Present Bailed With Product Bailer PSH Sock replaced	
BS1	63.74									1.0	0	4/24/2015	Product Present Bailed With Product Bailer PSH Sock replaced	
BS1	63.74									0.9	0	4/29/2015	Product Present Bailed With Product Bailer PSH Sock replaced	
BS1	63.74									1.0	0	5/8/2015	Product Present Bailed With Product Bailer PSH Sock replaced	
BS1	63.74									1.4	0	5/14/2015	Product Present Bailed With Product Bailer PSH Sock replaced	
BS1	63.74									1.0	0	5/21/2015	Product Present Bailed With Product Bailer PSH Sock replaced	
BS1	63.74									1.3	0	5/29/2015	Product Present Bailed With Product Bailer PSH Sock replaced	
BS1	63.74									1.4	0	6/4/2015	Product Present Bailed With Product Bailer PSH Sock replaced	
BS1	63.74									1.2	0	6/11/2015	Product Present Bailed With Product Bailer PSH Sock replaced	
BS1	63.74	47.32	47.44							1.1	0	6/18/2015	Product Present Bailed With Product Bailer PSH Sock replaced	
BS1	63.74									1.4	0	6/26/2015	Product Present Bailed With Product Bailer PSH Sock replaced	
						Total Removed	0	0		14.9	0			

Arc Environmental							FIELD MEASUREMENT/OBSERVATION LOG							
P. O. Box 1772 ~ Lovington, NM 88260 (575) 631-9310							PROJECT NAME: RICE - Hobbs N-6			PROJECT LOCATION: Hobbs, New Mexico			DATE: As Listed	
PROJECT: RICE Operating							FIELD TECHNICIAN: Rozanne Johnson					Notes: Water disposed of at an approved water disposal facility.		
WELL # SAMPLE LOCATION	TOTAL WELL DEPTH (feet)	DEPTH TO PRODUCT (feet)	DEPTH TO WATER (feet)	HEIGHT WATER COLUMN (feet)	WELL FACTOR 2"=.16 4"=.65 6"=1.5	WELL VOLUME IN GALLONS	Purge Removed (gallons)	WELL VOLUMES REMOVED	PSH THICKNESS (feet)	PSH REMOVED (gallons)	WATER REMOVED (gallons)	DATE: As Listed	Comments	
BS1	63.74									1.2	0	1/2/2015	Product Present Bailed With Product Bailer PSH Sock replaced	
BS1	63.74									1.1	0	1/8/2015	Product Present Bailed With Product Bailer PSH Sock replaced	
BS1	63.74									1.1	0	1/16/2015	Product Present Bailed With Product Bailer PSH Sock replaced	
BS1	63.74									0.9	0	1/21/2015	Product Present Bailed With Product Bailer PSH Sock replaced	
BS1	63.74									1.2	0	1/30/2015	Product Present Bailed With Product Bailer PSH Sock replaced	
BS1	63.74									1.0	0	2/5/2015	Product Present Bailed With Product Bailer PSH Sock replaced	
BS1	63.74									1.9	0	2/16/2015	Product Present Bailed With Product Bailer PSH Sock replaced	
BS1	63.74									1.1	0	2/26/2015	Product Present Bailed With Product Bailer PSH Sock replaced	
BS1	63.74									0.8	0	3/4/2015	Product Present Bailed With Product Bailer PSH Sock replaced	
BS1	63.74									1.1	0	3/12/2015	Product Present Bailed With Product Bailer PSH Sock replaced	
BS1	63.74	47.11	47.33							1.2	0	3/20/2015	Product Present Bailed With Product Bailer PSH Sock replaced	
BS1	63.74									1.2	0	3/27/2015	Product Present Bailed With Product Bailer PSH Sock replaced	
						Total Removed	0	0		13.8	0			

Arc Environmental						FIELD MEASUREMENT/OBSERVATION LOG							
P. O. Box 1772 ~ Lovington, NM 88260 (575) 631-9310						PROJECT NAME: RICE - Hobbs N-6			PROJECT LOCATION: Hobbs, New Mexico			DATE: As Listed	
PROJECT: RICE Operating						FIELD TECHNICIAN: Rozanne Johnson						Notes: Water disposed of at an approved water disposal facility.	
WELL # SAMPLE LOCATION	TOTAL WELL DEPTH (feet)	DEPTH TO PRODUCT (feet)	DEPTH TO WATER (feet)	HEIGHT WATER COLUMN (feet)	WELL FACTOR 2"=.16 4"=.65 6"=1.5	WELL VOLUME IN GALLONS	Purge Removed (gallons)	WELL VOLUMES REMOVED	PSH THICKNESS (feet)	PSH REMOVED (gallons)	WATER REMOVED (gallons)	DATE: As Listed	Comments
BS1	63.74									0.9	0	10/2/2014	Product Present Bailed With Product Bailer PSH Sock replaced
BS1	63.74									1.2	0	10/8/2014	Product Present Bailed With Product Bailer PSH Sock replaced
BS1	63.74									1.0	0	10/23/2014	Product Present Bailed With Product Bailer PSH Sock replaced
BS1	63.74									1.0	0	10/30/2014	Product Present Bailed With Product Bailer PSH Sock replaced
BS1	63.74									0.8	0	11/6/2014	Product Present Bailed With Product Bailer PSH Sock replaced
BS1	63.74									0.7	0	11/12/2014	Product Present Bailed With Product Bailer PSH Sock replaced
BS1	63.74									0.5	0	11/19/2014	Product Present Bailed With Product Bailer PSH Sock replaced
BS1	63.74									1.4	0	12/4/2014	Product Present Bailed With Product Bailer PSH Sock replaced
BS1	63.74									0.9	0	12/10/2014	Product Present Bailed With Product Bailer PSH Sock replaced
BS1	63.74									1.0	0	12/18/2014	Product Present Bailed With Product Bailer PSH Sock replaced
BS1	63.74	47.22	47.70							1.3	0	12/22/2014	Product Present Bailed With Product Bailer PSH Sock replaced
Total Removed						0	0			10.7	0		

Arc Environmental						FIELD MEASUREMENT/OBSERVATION LOG							
P. O. Box 1772 ~ Lovington, NM 88260 (575) 631-9310						PROJECT NAME: RICE - Hobbs N-6			PROJECT LOCATION: Hobbs, New Mexico			DATE: As Listed	
PROJECT: RICE Operating						FIELD TECHNICIAN: Rozanne Johnson						Notes: Water disposed of at an approved water disposal facility.	
WELL # SAMPLE LOCATION	TOTAL WELL DEPTH (feet)	DEPTH TO PRODUCT (feet)	DEPTH TO WATER (feet)	HEIGHT WATER COLUMN (feet)	WELL FACTOR 2"=.16 4"=.65 6"=1.5	WELL VOLUME IN GALLONS	Purge Removed (gallons)	WELL VOLUMES REMOVED	PSH THICKNESS (feet)	PSH REMOVED (gallons)	WATER REMOVED (gallons)	DATE: As Listed	Comments
BS1	63.74									0.7	0	7/9/2014	Product Present Bailed With Product Bailer PSH Sock replaced
BS1	63.74									0.7	0	7/17/2014	Product Present Bailed With Product Bailer PSH Sock replaced
BS1	63.74									0.9	0	7/23/2014	Product Present Bailed With Product Bailer PSH Sock replaced
BS1	63.74									0.8	0	7/28/2014	Product Present Bailed With Product Bailer PSH Sock replaced
BS1	63.74									1.2	0	8/7/2014	Product Present Bailed With Product Bailer PSH Sock replaced
BS1	63.74									1.5	0	8/13/2014	Product Present Bailed With Product Bailer PSH Sock replaced
BS1	63.74									0.9	0	8/20/2014	Product Present Bailed With Product Bailer PSH Sock replaced
BS1	63.74									0.8	0	8/28/2014	Product Present Bailed With Product Bailer PSH Sock replaced
BS1	63.74	47.41	47.62							1.2	0	9/12/2014	Product Present Bailed With Product Bailer PSH Sock replaced
BS1	63.74									1.0	0	9/17/2014	Product Present Bailed With Product Bailer PSH Sock replaced
BS1	63.74									0.8	0	9/24/2014	Product Present Bailed With Product Bailer PSH Sock replaced
						Total Removed	0	0		10.5	0		

Arc Environmental						FIELD MEASUREMENT/OBSERVATION LOG							
P. O. Box 1772 ~ Lovington, NM 88260 (575) 631-9310						PROJECT NAME: RICE - Hobbs N-6			PROJECT LOCATION: Hobbs, New Mexico			DATE: As Listed	
PROJECT: RICE Operating						FIELD TECHNICIAN: Rozanne Johnson			Notes: Water disposed of at an approved water disposal facility.				
WELL # SAMPLE LOCATION	TOTAL WELL DEPTH (feet)	DEPTH TO PRODUCT (feet)	DEPTH TO WATER (feet)	HEIGHT WATER COLUMN (feet)	WELL FACTOR 2"=.16 4"=.65 6"=1.5	WELL VOLUME IN GALLONS	Purge Removed (gallons)	WELL VOLUMES REMOVED	PSH THICKNESS (feet)	PSH REMOVED (gallons)	WATER REMOVED (gallons)	DATE: As Listed	Comments
BS1	63.74									0.9	0	4/4/2014	Product Present Bailed With Product Bailer PSH Sock replaced
BS1	63.74									0.7	0	4/10/2014	Product Present Bailed With Product Bailer PSH Sock replaced
BS1	63.74									0.7	0	4/17/2014	Product Present Bailed With Product Bailer PSH Sock replaced
BS1	63.74									0.7	0	4/24/2014	Product Present Bailed With Product Bailer PSH Sock replaced
BS1	63.74									0.5	0	5/1/2014	Product Present Bailed With Product Bailer PSH Sock replaced
BS1	63.74	47.09	47.29							1.0	0	5/12/2014	Product Present Bailed With Product Bailer PSH Sock replaced
BS1	63.74									0.8	0	5/21/2014	Product Present Bailed With Product Bailer PSH Sock replaced
BS1	63.74									0.8	0	5/29/2014	Product Present Bailed With Product Bailer PSH Sock replaced
BS1	63.74									0.7	0	6/3/2014	Product Present Bailed With Product Bailer PSH Sock replaced
BS1	63.74									0.8	0	6/11/2014	Product Present Bailed With Product Bailer PSH Sock replaced
BS1	63.74	47.28	47.36							0.5	0	6/19/2014	Product Present Bailed With Product Bailer PSH Sock replaced
BS1	63.74									0.5	0	6/25/2014	Product Present Bailed With Product Bailer PSH Sock replaced
						Total Removed	0	0		8.6	0		

Arc Environmental						FIELD MEASUREMENT/OBSERVATION LOG							
P. O. Box 1772 ~ Lovington, NM 88260 (575) 631-9310						PROJECT NAME: RICE - Hobbs N-6			PROJECT LOCATION: Hobbs, New Mexico			DATE: As Listed	
PROJECT: RICE Operating						FIELD TECHNICIAN: Rozanne Johnson			Notes: Water disposed of at an approved water disposal facility.				
WELL # SAMPLE LOCATION	TOTAL WELL DEPTH (feet)	DEPTH TO PRODUCT (feet)	DEPTH TO WATER (feet)	HEIGHT WATER COLUMN (feet)	WELL FACTOR 2"=.16 4"=.65 6"=1.5	WELL VOLUME IN GALLONS	Purge Removed (gallons)	WELL VOLUMES REMOVED	PSH THICKNESS (feet)	PSH REMOVED (gallons)	WATER REMOVED (gallons)	DATE: As Listed	Comments
BS1	63.74									0.8	0	1/7/2014	Product Present Bailed With Product Bailer PSH Sock replaced
BS1	63.74									0.8	0	1/15/2014	Product Present Bailed With Product Bailer PSH Sock replaced
BS1	63.74									0.5	0	1/21/2014	Product Present Bailed With Product Bailer PSH Sock replaced
BS1	63.74									0.8	0	1/30/2014	Product Present Bailed With Product Bailer PSH Sock replaced
BS1	63.74									0.5	0	2/6/2014	Product Present Bailed With Product Bailer PSH Sock replaced
BS1	63.74									0.5	0	2/13/2014	Product Present Bailed With Product Bailer PSH Sock replaced
BS1	63.74									0.5	0	2/19/2014	Product Present Bailed With Product Bailer PSH Sock replaced
BS1	63.74									0.5	0	2/27/2014	Product Present Bailed With Product Bailer PSH Sock replaced
BS1	63.74									0.5	0	3/6/2014	Product Present Bailed With Product Bailer PSH Sock replaced
BS1	63.74									0.7	0	3/14/2014	Product Present Bailed With Product Bailer PSH Sock replaced
BS1	63.74									0.6	0	3/20/2014	Product Present Bailed With Product Bailer PSH Sock replaced
BS1	63.74	46.92	47.14							0.7	0	3/25/2014	Product Present Bailed With Product Bailer PSH Sock replaced
						Total Removed	0	0		7.4	0		

Arc EnvironmentalP. O. Box 1772 ~ Lovington, NM 88260
(575) 631-9310**FIELD MEASUREMENT/OBSERVATION LOG****PROJECT NAME:**
RICE - Hobbs N-6**PROJECT LOCATION:**
Hobbs, New Mexico**DATE:** As Listed**PROJECT:** RICE Operating**FIELD TECHNICIAN:** Rozanne Johnson**Notes:** Water disposed of at an approved water disposal facility.

WELL # SAMPLE LOCATION	TOTAL WELL DEPTH (feet)	DEPTH TO PRODUCT (feet)	DEPTH TO WATER (feet)	HEIGHT WATER COLUMN (feet)	WELL FACTOR 2"=.16 4"=.65 6"=1.5	WELL VOLUME IN GALLONS	Purge Removed (gallons)	WELL VOLUMES REMOVED	PSH THICKNESS (feet)	PSH REMOVED (gallons)	WATER REMOVED (gallons)	DATE: As Listed	Comments
BS1	63.74				0.65					0.5	0	10/3/2013	Product Present Bailed With Product Bailer PSH Sock replaced
BS1	63.74				0.65					1.0	0	10/8/2013	Product Present Bailed With Product Bailer PSH Sock replaced
BS1	63.74				0.65					0.5	0	10/16/2013	Product Present Bailed With Product Bailer PSH Sock replaced
BS1	63.74				0.65					1.0	0	10/23/2013	Product Present Bailed With Product Bailer PSH Sock replaced
BS1	63.74				0.65					0.5	0	10/30/2013	Product Present Bailed With Product Bailer PSH Sock replaced
BS1	63.74				0.65					0.3	0	11/5/2013	Product Present Bailed With Product Bailer PSH Sock replaced
BS1	63.74				0.65					0.5	0	11/14/2013	Product Present Bailed With Product Bailer PSH Sock replaced
BS1	63.74				0.65					1.0	0	11/20/2013	Product Present Bailed With Product Bailer PSH Sock replaced
BS1	63.74				0.65					1.0	0	11/25/2013	Product Present Bailed With Product Bailer PSH Sock replaced
BS1	63.74				0.65					1.0	0	12/12/2013	Product Present Bailed With Product Bailer PSH Sock replaced
BS1	63.74				0.65					0.7	0	12/17/2013	Product Present Bailed With Product Bailer PSH Sock replaced
BS1	63.74				0.65					0.5	0	12/30/2013	Product Present Bailed With Product Bailer PSH Sock replaced
						Total Removed	0	0		8.5	0		

Arc Environmental

P. O. Box 1772 ~ Lovington, NM 88260
(575) 631-9310

FIELD MEASUREMENT/OBSERVATION LOG

Page 71 of 117

PROJECT NAME:

RICE - Hobbs N-6

PROJECT LOCATION:

Hobbs, New Mexico

DATE: As Listed

PROJECT: RICE Operating

FIELD TECHNICIAN: Rozanne Johnson

Notes: Water disposed of at an approved water disposal facility.

WELL # SAMPLE LOCATION	TOTAL WELL DEPTH (feet)	DEPTH TO PRODUCT (feet)	DEPTH TO WATER (feet)	HEIGHT WATER COLUMN (feet)	WELL FACTOR 2"=.16 4"=.65 6"=1.5	WELL VOLUME IN GALLONS	Purge Removed (gallons)	WELL VOLUMES REMOVED	PSH THICKNESS (feet)	PSH REMOVED (gallons)	WATER REMOVED (gallons)	DATE: As Listed	Comments
BS1	63.74				0.65					0.5	0	7/1/2013	Product Present Bailed With Product Bailer PSH Sock Placed in Well
BS1	63.74	46.43	46.43	17.3	0.65	11.3	0	0	0.0	1.0	0	7/9/2013	Product Present Bailed With Product Bailer PSH Sock replaced
BS1	63.74				0.65					0.5	0	7/16/2013	Product Present Bailed With Product Bailer PSH Sock replaced
BS1	63.74	46.41	46.41	17.3	0.65	11.3	0	0	0.0	1.0	0	7/23/2013	Product Present Bailed With Product Bailer PSH Sock replaced
BS1	63.74				0.65					0.5	0	7/30/2013	Product Present Bailed With Product Bailer PSH Sock replaced
BS1	63.74	46.47	46.47	17.3	0.65	11.2	0	0	0.0	0.3	0	8/5/2013	Product Present Bailed With Product Bailer PSH Sock replaced
BS1	63.74				0.65					0.5	0	8/13/2013	Product Present Bailed With Product Bailer PSH Sock replaced
BS1	63.74	46.51	46.51	17.2	0.65	11.2	0	0	0.0	1.0	0	8/20/2013	Product Present Bailed With Product Bailer PSH Sock replaced
BS1	63.74				0.65					0.7	0	8/27/2013	Product Present Bailed With Product Bailer PSH Sock replaced
BS1	63.74				0.65					0.7	0	9/5/2013	Product Present Bailed With Product Bailer PSH Sock replaced
BS1	63.74				0.65					1.0	0	9/11/2013	Product Present Bailed With Product Bailer PSH Sock replaced
BS1	63.74				0.65					0.7	0	9/18/2013	Product Present Bailed With Product Bailer PSH Sock replaced
BS1	63.74				0.65					0.5	0	9/25/2013	Product Present Bailed With Product Bailer PSH Sock replaced
				Total Removed			0	0		8.9	0		

FIELD MEASUREMENT/OBSERVATION LOG

DATE: As Listed

Notes: Water disposed of at an approved water disposal facility.

WELL # SAMPLE LOCATION	TOTAL WELL DEPTH (feet)	DEPTH TO PRODUCT (feet)	DEPTH TO WATER (feet)	HEIGHT WATER COLUMN (feet)	WELL FACTOR 2"=.16 4"=.65 6"=1.5	WELL VOLUME IN GALLONS	Purge Removed (gallons)	WELL VOLUMES REMOVED	PSH THICKNESS (feet)	PSH REMOVED (gallons)	WATER REMOVED (gallons)	DATE: As Listed	Comments
BS1	63.74	46.21	46.21	17.5	0.65	11.4	0	0	0.0	0.5	0	4/2/2013	Product Present Bailed With Product Bailer PSH Sock Placed in Well
BS1	63.74				0.65					1.0	0	4/17/2013	Product Present Bailed With Product Bailer PSH Sock replaced
BS1	63.74	46.17	46.17	17.6	0.65	11.4	0	0	0.0	0.8	0	4/23/2013	Product Present Bailed With Product Bailer PSH Sock replaced
BS1	63.74				0.65					0.3	0	4/29/2013	Product Present Bailed With Product Bailer PSH Sock replaced
BS1	63.74	46.23	46.23	17.5	0.65	11.4	0	0	0.0	1.0	0	5/7/2013	Product Present Bailed With Product Bailer PSH Sock replaced
BS1	63.74				0.65					0.5	0	5/14/2013	Product Present Bailed With Product Bailer PSH Sock replaced
BS1	63.74	46.33	46.33	17.4	0.65	11.3	0	0	0.0	1.0	0	5/28/2013	Product Present Bailed With Product Bailer PSH Sock replaced
BS1	63.74				0.65					0.5	0	6/7/2013	Product Present Bailed With Product Bailer PSH Sock replaced
BS1	63.74	46.32	46.32	17.4	0.65	11.3	0	0	0.0	1.0	0	6/13/2013	Product Present Bailed With Product Bailer PSH Sock replaced
BS1	63.74				0.65					0.5	0	6/18/2013	Product Present Bailed With Product Bailer PSH Sock replaced
BS1	63.74	46.34	46.34	17.4	0.65	11.3	0	0	0.0	1.0	0	6/25/2013	Product Present Bailed With Product Bailer PSH Sock replaced
				Total Removed			0	0		8.0	0		

Hobbs N-6 2013

Arc EnvironmentalP. O. Box 1772 ~ Lovington, NM 88260
(575) 631-9310**FIELD MEASUREMENT/OBSERVATION LOG**PROJECT NAME:
RICE - Hobbs N-6PROJECT LOCATION:
Hobbs, New Mexico

DATE: As Listed

PROJECT: RICE Operating

FIELD TECHNICIAN: Rozanne Johnson

Notes: Water disposed of at an approved water disposal facility.

WELL # SAMPLE LOCATION	TOTAL WELL DEPTH (feet)	DEPTH TO PRODUCT (feet)	DEPTH TO WATER (feet)	HEIGHT WATER COLUMN (feet)	WELL FACTOR 2"=.16 4"=.65 6"=1.5	WELL VOLUME IN GALLONS	Purge Removed (gallons)	WELL VOLUMES REMOVED	PSH THICKNESS (feet)	PSH REMOVED (gallons)	WATER REMOVED (gallons)	DATE: As Listed	Comments
BS1	63.74	45.75	46.52	17.2	0.65	11.2	0	0	0.8	1.0	0	9/26/2012	Product Present Bailed With Product Bailer PSH Sock Placed in Well
BS1	63.74	45.80	45.92	17.8	0.65	11.6	0	0	0.1	1.0	0	10/2/2012	Product Present Bailed With Product Bailer PSH Sock replaced
BS1	63.74	45.78	45.83	17.9	0.65	11.6	0	0	0.05	0.8	0	10/9/2012	Product Present Bailed With Product Bailer PSH Sock replaced
BS1	63.74	45.80	45.80	17.9	0.65	11.7	0	0	0.0	0.3	0	10/16/2012	Product Present Bailed With Product Bailer PSH Sock replaced
BS1	63.74	45.80	45.8	17.9	0.65	11.7	0	0	0.0	0.5	0	10/24/2012	Product Present Bailed With Product Bailer PSH Sock replaced
BS1	63.74	45.81	45.81	17.9	0.65	11.7	0	0	0.0	0.3	0	10/29/2012	Product Present Bailed With Product Bailer PSH Sock replaced
BS1	63.74	45.81	45.81	17.9	0.65	11.7	0	0	0.0	0.3	0	11/6/2012	Product Present Bailed With Product Bailer PSH Sock replaced
BS1	63.74	45.83	45.83	17.9	0.65	11.6	0	0	0.0	0.3	0	11/13/2012	Product Present Bailed With Product Bailer PSH Sock replaced
BS1	63.74	45.88	45.88	17.9	0.65	11.6	0	0	0.0	0.8	0	11/27/2012	Product Present Bailed With Product Bailer PSH Sock replaced
BS1	63.74	45.86	45.86	17.9	0.65	11.6	0	0	0.0	0.5	0	12/3/2012	Product Present Bailed With Product Bailer PSH Sock replaced
BS1	63.74	46.01	46.01	17.7	0.65	11.5	0	0	0.0	1.0	0	12/11/2012	Product Present Bailed With Product Bailer PSH Sock replaced
BS1	63.74	45.98	45.98	17.8	0.65	11.5	0	0	0.0	0.5	0	12/18/2012	Product Present Bailed With Product Bailer PSH Sock replaced
						Total Removed	0	0		7.0	0		

Arc Environmental						FIELD MEASUREMENT/OBSERVATION LOG							
P. O. Box 1772 ~ Lovington, NM 88260 (575) 631-9310						PROJECT NAME:			PROJECT LOCATION:			DATE: As Listed	
						RICE - Hobbs N-6			Hobbs, New Mexico				
PROJECT: RICE Operating						FIELD TECHNICIAN: Rozanne Johnson						Notes: Water disposed of at an approved water disposal facility.	
WELL # SAMPLE LOCATION	TOTAL WELL DEPTH (feet)	DEPTH TO PRODUCT (feet)	DEPTH TO WATER (feet)	HEIGHT WATER COLUMN (feet)	WELL FACTOR 2"=.16 4"=.65 6"=1.5	WELL VOLUME IN GALLONS	Purge Removed (gallons)	WELL VOLUMES REMOVED	PSH THICKNESS (feet)	PSH REMOVED (gallons)	WATER REMOVED (gallons)	DATE: As Listed	Comments
BS1	63.74	45.56	47.62	16.1	0.65	10.5	125	12	2.1	90	35	7/2/2012	Heavy Product Present
BS1	63.74				0.65		125	12		85	40	7/10/2012	Heavy Product Present
BS1	63.74				0.65		125	12		40	85	7/17/2012	Product Present
BS1	63.74				0.65		125	12		40	85	7/25/2012	Product Present
BS1	63.74	45.51	46.11	17.6	0.65	11.5	125	12	0.6	25	100	8/3/2012	Product Present
BS1	63.74	45.55	46.28	17.5	0.65	11.3	125	11	0.7	20	105	8/10/2012	Product Present
BS1	63.74				0.65		125	11		15	110	8/16/2012	Product Present
BS1	63.74				0.65		125	11		10	115	8/22/2012	Product Present
BS1	63.74	45.56	46.48	17.3	0.65	11.2	125	11	0.9	10	115	8/29/2012	Product Present
BS1	63.74				0.65		125	11		5	120	9/4/2012	Product Present
BS1	63.74	45.54	46.03	17.7	0.65	11.5	125	11	0.5	5	120	9/12/2012	Product Present
BS1	63.74				0.65		2	11		2		9/19/2012	Product Present Pump Pulled Bailed With Product Bailer PSH Sock Placed in Well
						Total Removed	1377	137		347.0	1030		

Arc Environmental						FIELD MEASUREMENT/OBSERVATION LOG								
						PROJECT NAME: RICE - Hobbs N-6				PROJECT LOCATION: Hobbs, New Mexico			DATE: As Listed	
P. O. Box 1772 ~ Lovington, NM 88260 631-9310						(575)								
PROJECT: RICE Operating							FIELD TECHNICIAN: Rozanne Johnson					Notes: Water disposed of at an approved water disposal facility.		
WELL # SAMPLE LOCATION	TOTAL WELL DEPTH (feet)	DEPTH TO PRODUCT (feet)	DEPTH TO WATER (feet)	HEIGHT WATER COLUMN (feet)	WELL FACTOR 2"=.16 4"=.65 6"=1.5	WELL VOLUME IN GALLONS	Purge Removed (gallons)	WELL VOLUMES REMOVED	PSH THICKNESS (feet)	PSH REMOVED (gallons)	WATER REMOVED (gallons)	DATE: As Listed	Comments	
BS1	63.74				0.65		125	13		125	0	4/7/2012	Heavy Product Present	
BS1	63.74				0.65		125	13		125	0	4/21/2012	Heavy Product Present	
BS1	63.74	45.11	48.72	15.0	0.65	9.8	125	13	3.6	125	0	5/8/2012	Heavy Product Present	
BS1	63.74				0.65		125	13		125	0	5/15/2012	Heavy Product Present	
BS1	63.74				0.65		125	13		125	0	5/24/2012	Heavy Product Present	
BS1	63.74				0.65		125	13		125	0	6/7/2012	Heavy Product Present	
BS1	63.74				0.65		125	13		125	0	6/12/2012	Heavy Product Present	
BS1	63.74	45.62	48.96	14.8	0.65	9.6	125	13	3.3	125	0	6/14/2012	Heavy Product Present	
BS1	63.74				0.65		125	13		125	0	6/21/2012	Heavy Product Present	
BS1	63.74				0.65		125	13		125	0	6/26/2012	Heavy Product Present	
				Total Removed			1250	130		1250.0	0			



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

December 22, 2022

KATIE JONES

Rice Operating Company

112 W. Taylor

Hobbs, NM 88240

RE: HOBBS N-6

Enclosed are the results of analyses for samples received by the laboratory on 12/19/22 15:20.

Cardinal Laboratories is accredited through Texas NELAP under certificate number T104704398-22-15. Accreditation applies to drinking water, non-potable water and solid and chemical materials. All accredited analytes are denoted by an asterisk (*). For a complete list of accredited analytes and matrices visit the TCEQ website at www.tceq.texas.gov/field/qa/lab_accred_certif.html.

Cardinal Laboratories is accredited through the State of Colorado Department of Public Health and Environment for:

Method EPA 552.2	Haloacetic Acids (HAA-5)
Method EPA 524.2	Total Trihalomethanes (TTHM)
Method EPA 524.4	Regulated VOCs (V1, V2, V3)

Accreditation applies to public drinking water matrices.

This report meets NELAP requirements and is made up of a cover page, analytical results, and a copy of the original chain-of-custody. If you have any questions concerning this report, please feel free to contact me.

Sincerely,

A handwritten signature in black ink that reads "Celey D. Keene". The signature is written in a cursive style with a large, stylized 'C' and 'K'.

Celey D. Keene

Lab Director/Quality Manager



PHONE (575) 393-2326 • 101 E. MARLAND • HOBBS, NM 88240

Analytical Results For:

Rice Operating Company
 KATIE JONES
 112 W. Taylor
 Hobbs NM, 88240
 Fax To: (575) 397-1471

Received:	12/19/2022	Sampling Date:	12/15/2022
Reported:	12/22/2022	Sampling Type:	Water
Project Name:	HOBBS N-6	Sampling Condition:	Cool & Intact
Project Number:	NONE GIVEN	Sample Received By:	Tamara Oldaker
Project Location:	T19S-R38E-SEC5&6 E/H ~LEA CO - NM		

Sample ID: MONITOR WELL # 2 (H226000-01)

BTEX 8021B		mg/L		Analyzed By: JH					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Benzene*	<0.001	0.001	12/21/2022	ND	0.019	94.1	0.0200	0.852	
Toluene*	<0.001	0.001	12/21/2022	ND	0.020	97.9	0.0200	0.265	
Ethylbenzene*	<0.001	0.001	12/21/2022	ND	0.021	103	0.0200	4.58	
Total Xylenes*	<0.003	0.003	12/21/2022	ND	0.065	108	0.0600	5.27	
Total BTEX	<0.006	0.006	12/21/2022	ND					

Surrogate: 4-Bromofluorobenzene (PID) 111 % 77.1-124

Chloride, SM4500Cl-B		mg/L		Analyzed By: AC					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Chloride*	92.0	4.00	12/20/2022	ND	108	108	100	3.77	

Sulfate 375.4		mg/L		Analyzed By: AC					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Sulfate*	78.2	25.0	12/21/2022	ND	21.8	109	20.0	2.65	

TDS 160.1		mg/L		Analyzed By: AC					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
TDS*	557	5.00	12/21/2022	ND	494	99.8	495	0.521	

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

Rice Operating Company
 KATIE JONES
 112 W. Taylor
 Hobbs NM, 88240
 Fax To: (575) 397-1471

Received:	12/19/2022	Sampling Date:	12/14/2022
Reported:	12/22/2022	Sampling Type:	Water
Project Name:	HOBBS N-6	Sampling Condition:	Cool & Intact
Project Number:	NONE GIVEN	Sample Received By:	Tamara Oldaker
Project Location:	T19S-R38E-SEC5&6 E/H ~LEA CO - NM		

Sample ID: MONITOR WELL # 4 (H226000-02)

BTX 8021B		mg/L		Analyzed By: JH					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Benzene*	<0.001	0.001	12/21/2022	ND	0.019	94.1	0.0200	0.852	
Toluene*	<0.001	0.001	12/21/2022	ND	0.020	97.9	0.0200	0.265	
Ethylbenzene*	<0.001	0.001	12/21/2022	ND	0.021	103	0.0200	4.58	
Total Xylenes*	<0.003	0.003	12/21/2022	ND	0.065	108	0.0600	5.27	
Total BTX	<0.006	0.006	12/21/2022	ND					

Surrogate: 4-Bromofluorobenzene (PID) 109 % 77.1-124

Chloride, SM4500Cl-B		mg/L		Analyzed By: AC						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Chloride*	128	4.00	12/20/2022	ND	108	108	100	3.77		

Sulfate 375.4		mg/L		Analyzed By: AC						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Sulfate*	75.6	25.0	12/21/2022	ND	21.8	109	20.0	2.65		

TDS 160.1		mg/L		Analyzed By: AC						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
TDS*	616	5.00	12/21/2022	ND	494	99.8	495	0.521		

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 • 101 E. MARLAND • HOBBS, NM 88240

Analytical Results For:

Rice Operating Company
 KATIE JONES
 112 W. Taylor
 Hobbs NM, 88240
 Fax To: (575) 397-1471

Received:	12/19/2022	Sampling Date:	12/15/2022
Reported:	12/22/2022	Sampling Type:	Water
Project Name:	HOBBS N-6	Sampling Condition:	Cool & Intact
Project Number:	NONE GIVEN	Sample Received By:	Tamara Oldaker
Project Location:	T19S-R38E-SEC5&6 E/H ~LEA CO - NM		

Sample ID: MONITOR WELL # 5 (H226000-03)

BTX 8021B		mg/L		Analyzed By: JH					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Benzene*	<0.001	0.001	12/21/2022	ND	0.019	94.1	0.0200	0.852	
Toluene*	<0.001	0.001	12/21/2022	ND	0.020	97.9	0.0200	0.265	
Ethylbenzene*	<0.001	0.001	12/21/2022	ND	0.021	103	0.0200	4.58	
Total Xylenes*	<0.003	0.003	12/21/2022	ND	0.065	108	0.0600	5.27	
Total BTX	<0.006	0.006	12/21/2022	ND					

Surrogate: 4-Bromofluorobenzene (PID) 108 % 77.1-124

Chloride, SM4500Cl-B		mg/L		Analyzed By: AC					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Chloride*	56.0	4.00	12/20/2022	ND	108	108	100	3.77	

Sulfate 375.4		mg/L		Analyzed By: AC						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Sulfate*	68.6	25.0	12/21/2022	ND	21.8	109	20.0	2.65		

TDS 160.1		mg/L		Analyzed By: AC					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
TDS*	436	5.00	12/21/2022	ND	494	99.8	495	0.521	

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 • 101 E. MARLAND • HOBBS, NM 88240

Analytical Results For:

Rice Operating Company
 KATIE JONES
 112 W. Taylor
 Hobbs NM, 88240
 Fax To: (575) 397-1471

Received:	12/19/2022	Sampling Date:	12/14/2022
Reported:	12/22/2022	Sampling Type:	Water
Project Name:	HOBBS N-6	Sampling Condition:	Cool & Intact
Project Number:	NONE GIVEN	Sample Received By:	Tamara Oldaker
Project Location:	T19S-R38E-SEC5&6 E/H ~LEA CO - NM		

Sample ID: MONITOR WELL # 6 (H226000-04)

BTX 8021B		mg/L		Analyzed By: JH						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Benzene*	<0.001	0.001	12/21/2022	ND	0.019	94.1	0.0200	0.852		
Toluene*	<0.001	0.001	12/21/2022	ND	0.020	97.9	0.0200	0.265		
Ethylbenzene*	<0.001	0.001	12/21/2022	ND	0.021	103	0.0200	4.58		
Total Xylenes*	<0.003	0.003	12/21/2022	ND	0.065	108	0.0600	5.27		
Total BTX	<0.006	0.006	12/21/2022	ND						

Surrogate: 4-Bromofluorobenzene (PID) 109 % 77.1-124

Chloride, SM4500Cl-B		mg/L		Analyzed By: AC					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Chloride*	96.0	4.00	12/20/2022	ND	108	108	100	3.77	

Sulfate 375.4		mg/L		Analyzed By: AC						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Sulfate*	76.7	25.0	12/21/2022	ND	21.8	109	20.0	2.65		

TDS 160.1		mg/L		Analyzed By: AC						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
TDS*	576	5.00	12/21/2022	ND	494	99.8	495	0.521		

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

Rice Operating Company
 KATIE JONES
 112 W. Taylor
 Hobbs NM, 88240
 Fax To: (575) 397-1471

Received:	12/19/2022	Sampling Date:	12/14/2022
Reported:	12/22/2022	Sampling Type:	Water
Project Name:	HOBBS N-6	Sampling Condition:	Cool & Intact
Project Number:	NONE GIVEN	Sample Received By:	Tamara Oldaker
Project Location:	T19S-R38E-SEC5&6 E/H ~LEA CO - NM		

Sample ID: MONITOR WELL # 7 (H226000-05)

BTEX 8021B		mg/L		Analyzed By: JH						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Benzene*	<0.001	0.001	12/21/2022	ND	0.019	94.1	0.0200	0.852		
Toluene*	<0.001	0.001	12/21/2022	ND	0.020	97.9	0.0200	0.265		
Ethylbenzene*	<0.001	0.001	12/21/2022	ND	0.021	103	0.0200	4.58		
Total Xylenes*	<0.003	0.003	12/21/2022	ND	0.065	108	0.0600	5.27		
Total BTEX	<0.006	0.006	12/21/2022	ND						

Surrogate: 4-Bromofluorobenzene (PID) 109 % 77.1-124

Chloride, SM4500CI-B		mg/L		Analyzed By: AC						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Chloride*	148	4.00	12/20/2022	ND	108	108	100	3.77		

Sulfate 375.4		mg/L		Analyzed By: AC						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Sulfate*	77.6	25.0	12/21/2022	ND	21.8	109	20.0	2.65		

TDS 160.1		mg/L		Analyzed By: AC						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
TDS*	638	5.00	12/21/2022	ND	494	99.8	495	0.521		

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

Rice Operating Company
 KATIE JONES
 112 W. Taylor
 Hobbs NM, 88240
 Fax To: (575) 397-1471

Received:	12/19/2022	Sampling Date:	12/15/2022
Reported:	12/22/2022	Sampling Type:	Water
Project Name:	HOBBS N-6	Sampling Condition:	Cool & Intact
Project Number:	NONE GIVEN	Sample Received By:	Tamara Oldaker
Project Location:	T19S-R38E-SEC5&6 E/H ~LEA CO - NM		

Sample ID: IWW (H226000-06)

BTEx 8021B		mg/L		Analyzed By: JH						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Benzene*	<0.001	0.001	12/21/2022	ND	0.019	94.1	0.0200	0.852		
Toluene*	<0.001	0.001	12/21/2022	ND	0.020	97.9	0.0200	0.265		
Ethylbenzene*	<0.001	0.001	12/21/2022	ND	0.021	103	0.0200	4.58		
Total Xylenes*	<0.003	0.003	12/21/2022	ND	0.065	108	0.0600	5.27		
Total BTEX	<0.006	0.006	12/21/2022	ND						

Surrogate: 4-Bromofluorobenzene (PID) 109 % 77.1-124

Chloride, SM4500Cl-B		mg/L		Analyzed By: AC						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Chloride*	120	4.00	12/20/2022	ND	108	108	100	3.77		

Sulfate 375.4		mg/L		Analyzed By: AC						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Sulfate*	68.2	25.0	12/21/2022	ND	21.8	109	20.0	2.65		

TDS 160.1		mg/L		Analyzed By: AC						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
TDS*	568	5.00	12/21/2022	ND	494	99.8	495	0.521		

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

Rice Operating Company
 KATIE JONES
 112 W. Taylor
 Hobbs NM, 88240
 Fax To: (575) 397-1471

Received:	12/19/2022	Sampling Date:	12/14/2022
Reported:	12/22/2022	Sampling Type:	Water
Project Name:	HOBBS N-6	Sampling Condition:	Cool & Intact
Project Number:	NONE GIVEN	Sample Received By:	Tamara Oldaker
Project Location:	T19S-R38E-SEC5&6 E/H ~LEA CO - NM		

Sample ID: BIO SPARGE #2 (H226000-07)

BTEX 8021B		mg/L		Analyzed By: JH						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Benzene*	<0.001	0.001	12/21/2022	ND	0.019	94.1	0.0200	0.852		
Toluene*	<0.001	0.001	12/21/2022	ND	0.020	97.9	0.0200	0.265		
Ethylbenzene*	<0.001	0.001	12/21/2022	ND	0.021	103	0.0200	4.58		
Total Xylenes*	<0.003	0.003	12/21/2022	ND	0.065	108	0.0600	5.27		
Total BTEX	<0.006	0.006	12/21/2022	ND						

Surrogate: 4-Bromofluorobenzene (PID) 109 % 77.1-124

Chloride, SM4500CI-B		mg/L		Analyzed By: AC						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Chloride*	80.0	4.00	12/20/2022	ND	108	108	100	3.77		

Sulfate 375.4		mg/L		Analyzed By: AC						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Sulfate*	74.4	25.0	12/21/2022	ND	21.8	109	20.0	2.65		

TDS 160.1		mg/L		Analyzed By: AC						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
TDS*	508	5.00	12/21/2022	ND	494	99.8	495	0.521		

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Notes and Definitions

QR-04	The RPD for the BS/BSD was outside of historical limits.
BS-3	Blank spike recovery outside of lab established statistical limits, but still within method limits. Data is not adversely affected.
ND	Analyte NOT DETECTED at or above the reporting limit
RPD	Relative Percent Difference
**	Samples not received at proper temperature of 6°C or below.
***	Insufficient time to reach temperature.
-	Chloride by SM4500Cl-B does not require samples be received at or below 6°C Samples reported on an as received basis (wet) unless otherwise noted on report

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

A handwritten signature in black ink, appearing to read "Celey D. Keene", written over a horizontal line.

Celey D. Keene, Lab Director/Quality Manager

Cardinal Laboratories, Inc.

101 East Marland - Hobbs, NM 88240
Tel (575) 393-2326
Fax (575) 393-2476

Company Name: RICE Operating Company		BILL TO Company: RICE Operating Company		PO#	
Project Manager: Katie Jones		Address: (Street, City, Zip) 122 W Taylor Street ~ Hobbs, New Mexico 88240			
Address: (Street, City, Zip) 122 W Taylor Street ~ Hobbs, New Mexico 88240		Phone#: (575) 393-9174		Fax#: (575) 397-1471	
Phone #: (575) 393-9174		Fax #: (575) 397-1471			
Project #:		Project Name: Hobbs N-6			
Project Location: T19S-R38E-Sec5&6 E/H ~ Lea County - New Mexico		Sampler Signature: <i>Rozanne Johnson</i> (575) 631-9310			

CHAIN-OF-CUSTODY AND ANALYSIS REQUEST

LAB Order ID # _____

ANALYSIS REQUEST

(Circle or Specify Method No.)

LAB # (LAB USE ONLY)	FIELD CODE	(G)rab or (C)omp	# CONTAINERS	MATRIX				PRESERVATIVE METHOD				SAMPLING		MTBE 8021B/602	BTEX 8021B/602	TPH 418.1/TX1005 / TX1005 Extended (C35)	PAH 8270C	Total Metals Ag As Ba Cd Cr Pb Se Hg 6010B/200.7	TCLP Metals Ag As Ba Cd Cr Pb Se Hg	TCLP Volatiles	TCLP Semi Volatiles	TCLP Pesticides	RCI	GC/MS Vol. 8260B/624	GC/MS Semi. Vol. 8270C/625	PCB's 8082/608	Pesticides 8081A/608	BOD, TSS, pH	Moisture Content	Cations (Ca, Mg, Na, K)	Anions (Cl, SO4, CO3, HCO3)	Sulfates	Total Dissolved Solids	Chlorides	Turn Around Time ~ 24 Hours	
				WATER	SOIL	AIR	SLUDGE	HCL (4 40ml VOA)	HNO3	NaHSO4	H2SO4	ICE (1-1 Liter HDPE)	NONE																							DATE (2022)
H226000																																				
1	Monitor Well #2	G	5	X				4				1	12/15	13:30	X																			X	X	X
2	Monitor Well #4	G	5	X				4				1	12/14	10:30	X																			X	X	X
3	Monitor Well #5	G	5	X				4				1	12/15	9:05	X																			X	X	X
4	Monitor Well #6	G	5	X				4				1	12/14	13:05	X																			X	X	X
5	Monitor Well #7	G	5	X				4				1	12/14	9:00	X																			X	X	X
6	IWW	G	5	X				4				1	12/15	11:50	X																			X	X	X
7	Bio Sparge #2	G	5	X				4				1	12/14	16:40	X																			X	X	X

Relinquished by: <i>Rozanne Johnson</i>	Date: <i>12/19/2022</i>	Time: <i>15:20</i>	Received by: <i>Rozanne Johnson</i>	Date: <i>12-19-22</i>	Time: <i>1520</i>
Relinquished by:	Date:	Time:	Received By: (Laboratory Staff)	Date:	Time:

Phone Results	Yes	No
Fax Results	Yes	No

Additional Fax Number: _____

REMARKS:

Email Results: kjones@riceswd.com
rozanne@sdacres.com

Delivered By: (Circle One)

Sample Condition

Cool	Intact
Yes <input checked="" type="checkbox"/>	Yes <input checked="" type="checkbox"/>
No <input type="checkbox"/>	No <input type="checkbox"/>

CHECKED BY:

(Initials)

Sampler - UPS - Bus - Other:



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

October 11, 2022

KATIE JONES

Rice Operating Company

112 W. Taylor

Hobbs, NM 88240

RE: HOBBS N-6

Enclosed are the results of analyses for samples received by the laboratory on 09/28/22 13:25.

Cardinal Laboratories is accredited through Texas NELAP under certificate number T104704398-22-15. Accreditation applies to drinking water, non-potable water and solid and chemical materials. All accredited analytes are denoted by an asterisk (*). For a complete list of accredited analytes and matrices visit the TCEQ website at www.tceq.texas.gov/field/qa/lab_accred_certif.html.

Cardinal Laboratories is accredited through the State of Colorado Department of Public Health and Environment for:

Method EPA 552.2	Haloacetic Acids (HAA-5)
Method EPA 524.2	Total Trihalomethanes (TTHM)
Method EPA 524.4	Regulated VOCs (V1, V2, V3)

Accreditation applies to public drinking water matrices.

This report meets NELAP requirements and is made up of a cover page, analytical results, and a copy of the original chain-of-custody. If you have any questions concerning this report, please feel free to contact me.

Sincerely,

A handwritten signature in black ink that reads "Celey D. Keene". The signature is written in a cursive style with a large, stylized 'C' and 'K'.

Celey D. Keene

Lab Director/Quality Manager



PHONE (575) 393-2326 • 101 E. MARLAND • HOBBS, NM 88240

Analytical Results For:

Rice Operating Company
 KATIE JONES
 112 W. Taylor
 Hobbs NM, 88240
 Fax To: (575) 397-1471

Received:	09/28/2022	Sampling Date:	09/27/2022
Reported:	10/11/2022	Sampling Type:	Water
Project Name:	HOBBS N-6	Sampling Condition:	Cool & Intact
Project Number:	NONE GIVEN	Sample Received By:	Tamara Oldaker
Project Location:	T19S-R38E-SEC5&6 E/H ~LEA CO - NM		

Sample ID: MONITOR WELL # 2 (H224512-01)

BTEX 8021B		mg/L		Analyzed By: JH					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Benzene*	<0.001	0.001	10/09/2022	ND	0.021	106	0.0200	2.28	
Toluene*	<0.001	0.001	10/09/2022	ND	0.020	99.5	0.0200	3.11	
Ethylbenzene*	<0.001	0.001	10/09/2022	ND	0.019	97.0	0.0200	2.44	
Total Xylenes*	<0.003	0.003	10/09/2022	ND	0.060	99.7	0.0600	2.32	
Total BTEX	<0.006	0.006	10/09/2022	ND					

Surrogate: 4-Bromofluorobenzene (PID) 93.5 % 77.1-124

Chloride, SM4500Cl-B		mg/L		Analyzed By: AC					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Chloride*	116	4.00	09/29/2022	ND	104	104	100	0.00	

Sulfate 375.4		mg/L		Analyzed By: AC					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Sulfate*	74.5	25.0	09/30/2022	ND	21.5	108	20.0	1.84	

TDS 160.1		mg/L		Analyzed By: AC					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
TDS*	552	5.00	09/30/2022	ND	525	105	500	3.42	

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

Rice Operating Company
 KATIE JONES
 112 W. Taylor
 Hobbs NM, 88240
 Fax To: (575) 397-1471

Received:	09/28/2022	Sampling Date:	09/26/2022
Reported:	10/11/2022	Sampling Type:	Water
Project Name:	HOBBS N-6	Sampling Condition:	Cool & Intact
Project Number:	NONE GIVEN	Sample Received By:	Tamara Oldaker
Project Location:	T19S-R38E-SEC5&6 E/H ~LEA CO - NM		

Sample ID: MONITOR WELL # 4 (H224512-02)

BTEx 8021B		mg/L		Analyzed By: JH						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Benzene*	<0.001	0.001	10/09/2022	ND	0.021	106	0.0200	2.28		
Toluene*	<0.001	0.001	10/09/2022	ND	0.020	99.5	0.0200	3.11		
Ethylbenzene*	<0.001	0.001	10/09/2022	ND	0.019	97.0	0.0200	2.44		
Total Xylenes*	<0.003	0.003	10/09/2022	ND	0.060	99.7	0.0600	2.32		
Total BTEx	<0.006	0.006	10/09/2022	ND						

Surrogate: 4-Bromofluorobenzene (PID) 94.8 % 77.1-124

Chloride, SM4500Cl-B		mg/L		Analyzed By: AC					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Chloride*	124	4.00	09/29/2022	ND	104	104	100	0.00	

Sulfate 375.4		mg/L		Analyzed By: AC						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Sulfate*	76.0	25.0	09/30/2022	ND	21.5	108	20.0	1.84		

TDS 160.1		mg/L		Analyzed By: AC						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
TDS*	585	5.00	09/30/2022	ND	525	105	500	3.42		

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

Rice Operating Company
 KATIE JONES
 112 W. Taylor
 Hobbs NM, 88240
 Fax To: (575) 397-1471

Received:	09/28/2022	Sampling Date:	09/27/2022
Reported:	10/11/2022	Sampling Type:	Water
Project Name:	HOBBS N-6	Sampling Condition:	Cool & Intact
Project Number:	NONE GIVEN	Sample Received By:	Tamara Oldaker
Project Location:	T19S-R38E-SEC5&6 E/H ~LEA CO - NM		

Sample ID: MONITOR WELL # 5 (H224512-03)

BTEX 8021B		mg/L		Analyzed By: JH					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Benzene*	<0.001	0.001	10/09/2022	ND	0.021	106	0.0200	2.28	
Toluene*	<0.001	0.001	10/09/2022	ND	0.020	99.5	0.0200	3.11	
Ethylbenzene*	<0.001	0.001	10/09/2022	ND	0.019	97.0	0.0200	2.44	
Total Xylenes*	<0.003	0.003	10/09/2022	ND	0.060	99.7	0.0600	2.32	
Total BTEX	<0.006	0.006	10/09/2022	ND					

Surrogate: 4-Bromofluorobenzene (PID) 95.9 % 77.1-124

Chloride, SM4500CI-B		mg/L		Analyzed By: AC					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Chloride*	68.0	4.00	09/29/2022	ND	104	104	100	0.00	

Sulfate 375.4		mg/L		Analyzed By: AC						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Sulfate*	66.3	25.0	09/30/2022	ND	21.5	108	20.0	1.84		

TDS 160.1		mg/L		Analyzed By: AC					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
TDS*	441	5.00	09/30/2022	ND	525	105	500	3.42	

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

Rice Operating Company
 KATIE JONES
 112 W. Taylor
 Hobbs NM, 88240
 Fax To: (575) 397-1471

Received:	09/28/2022	Sampling Date:	09/26/2022
Reported:	10/11/2022	Sampling Type:	Water
Project Name:	HOBBS N-6	Sampling Condition:	Cool & Intact
Project Number:	NONE GIVEN	Sample Received By:	Tamara Oldaker
Project Location:	T19S-R38E-SEC5&6 E/H ~LEA CO - NM		

Sample ID: MONITOR WELL # 6 (H224512-04)

BTEX 8021B		mg/L		Analyzed By: JH						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Benzene*	<0.001	0.001	10/09/2022	ND	0.021	106	0.0200	2.28		
Toluene*	<0.001	0.001	10/09/2022	ND	0.020	99.5	0.0200	3.11		
Ethylbenzene*	<0.001	0.001	10/09/2022	ND	0.019	97.0	0.0200	2.44		
Total Xylenes*	<0.003	0.003	10/09/2022	ND	0.060	99.7	0.0600	2.32		
Total BTEX	<0.006	0.006	10/09/2022	ND						

Surrogate: 4-Bromofluorobenzene (PID) 95.2 % 77.1-124

Chloride, SM4500CI-B		mg/L		Analyzed By: AC						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Chloride*	80.0	4.00	09/29/2022	ND	104	104	100	0.00		

Sulfate 375.4		mg/L		Analyzed By: AC						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Sulfate*	79.0	25.0	09/30/2022	ND	21.5	108	20.0	1.84		

TDS 160.1		mg/L		Analyzed By: AC						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
TDS*	569	5.00	10/04/2022	ND	492	98.4	500	2.60		

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 • 101 E. MARLAND • HOBBS, NM 88240

Analytical Results For:

Rice Operating Company
 KATIE JONES
 112 W. Taylor
 Hobbs NM, 88240
 Fax To: (575) 397-1471

Received:	09/28/2022	Sampling Date:	09/26/2022
Reported:	10/11/2022	Sampling Type:	Water
Project Name:	HOBBS N-6	Sampling Condition:	Cool & Intact
Project Number:	NONE GIVEN	Sample Received By:	Tamara Oldaker
Project Location:	T19S-R38E-SEC5&6 E/H ~LEA CO - NM		

Sample ID: MONITOR WELL # 7 (H224512-05)

BTX 8021B		mg/L		Analyzed By: JH					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Benzene*	<0.001	0.001	10/09/2022	ND	0.021	106	0.0200	2.28	
Toluene*	<0.001	0.001	10/09/2022	ND	0.020	99.5	0.0200	3.11	
Ethylbenzene*	<0.001	0.001	10/09/2022	ND	0.019	97.0	0.0200	2.44	
Total Xylenes*	<0.003	0.003	10/09/2022	ND	0.060	99.7	0.0600	2.32	
Total BTX	<0.006	0.006	10/09/2022	ND					

Surrogate: 4-Bromofluorobenzene (PID) 96.4 % 77.1-124

Chloride, SM4500CI-B		mg/L		Analyzed By: AC					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Chloride*	128	4.00	09/29/2022	ND	104	104	100	0.00	

Sulfate 375.4		mg/L		Analyzed By: AC						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Sulfate*	80.7	25.0	09/30/2022	ND	21.5	108	20.0	1.84		

TDS 160.1		mg/L		Analyzed By: AC						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
TDS*	604	5.00	10/03/2022	ND	492	98.4	500	2.60		

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

Rice Operating Company
 KATIE JONES
 112 W. Taylor
 Hobbs NM, 88240
 Fax To: (575) 397-1471

Received:	09/28/2022	Sampling Date:	09/27/2022
Reported:	10/11/2022	Sampling Type:	Water
Project Name:	HOBBS N-6	Sampling Condition:	Cool & Intact
Project Number:	NONE GIVEN	Sample Received By:	Tamara Oldaker
Project Location:	T19S-R38E-SEC5&6 E/H ~LEA CO - NM		

Sample ID: IWW (H224512-06)

BTEx 8021B		mg/L		Analyzed By: JH					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Benzene*	<0.001	0.001	10/09/2022	ND	0.021	106	0.0200	2.28	
Toluene*	<0.001	0.001	10/09/2022	ND	0.020	99.5	0.0200	3.11	
Ethylbenzene*	<0.001	0.001	10/09/2022	ND	0.019	97.0	0.0200	2.44	
Total Xylenes*	<0.003	0.003	10/09/2022	ND	0.060	99.7	0.0600	2.32	
Total BTEX	<0.006	0.006	10/09/2022	ND					

Surrogate: 4-Bromofluorobenzene (PID) 95.8 % 77.1-124

Chloride, SM4500Cl-B		mg/L		Analyzed By: AC					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Chloride*	140	4.00	09/29/2022	ND	104	104	100	0.00	

Sulfate 375.4		mg/L		Analyzed By: AC						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Sulfate*	71.8	25.0	09/30/2022	ND	21.5	108	20.0	1.84		

TDS 160.1		mg/L		Analyzed By: AC						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
TDS*	641	5.00	10/03/2022	ND	492	98.4	500	2.60		

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

Rice Operating Company
 KATIE JONES
 112 W. Taylor
 Hobbs NM, 88240
 Fax To: (575) 397-1471

Received:	09/28/2022	Sampling Date:	09/26/2022
Reported:	10/11/2022	Sampling Type:	Water
Project Name:	HOBBS N-6	Sampling Condition:	Cool & Intact
Project Number:	NONE GIVEN	Sample Received By:	Tamara Oldaker
Project Location:	T19S-R38E-SEC5&6 E/H ~LEA CO - NM		

Sample ID: BIO SPARGE #2 (H224512-07)

BTEX 8021B		mg/L		Analyzed By: JH						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Benzene*	<0.001	0.001	10/09/2022	ND	0.021	106	0.0200	2.28		
Toluene*	<0.001	0.001	10/09/2022	ND	0.020	99.5	0.0200	3.11		
Ethylbenzene*	<0.001	0.001	10/09/2022	ND	0.019	97.0	0.0200	2.44		
Total Xylenes*	<0.003	0.003	10/09/2022	ND	0.060	99.7	0.0600	2.32		
Total BTEX	<0.006	0.006	10/09/2022	ND						

Surrogate: 4-Bromofluorobenzene (PID) 95.7 % 77.1-124

Chloride, SM4500CI-B		mg/L		Analyzed By: AC						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Chloride*	68.0	4.00	09/29/2022	ND	104	104	100	0.00		

Sulfate 375.4		mg/L		Analyzed By: AC						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Sulfate*	66.2	25.0	09/30/2022	ND	21.5	108	20.0	1.84		

TDS 160.1		mg/L		Analyzed By: AC						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
TDS*	532	5.00	10/03/2022	ND	492	98.4	500	2.60		

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Notes and Definitions

BS-3	Blank spike recovery outside of lab established statistical limits, but still within method limits. Data is not adversely affected.
ND	Analyte NOT DETECTED at or above the reporting limit
RPD	Relative Percent Difference
**	Samples not received at proper temperature of 6°C or below.
***	Insufficient time to reach temperature.
-	Chloride by SM4500Cl-B does not require samples be received at or below 6°C Samples reported on an as received basis (wet) unless otherwise noted on report

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

A handwritten signature in black ink, appearing to read "Celey D. Keene".

Celey D. Keene, Lab Director/Quality Manager

Cardinal Laboratories, Inc.

Company Name: RICE Operating Company		BILL TO Company: RICE Operating Company	PO#
Project Manager: Katie Jones		Address: (Street, City, Zip) 122 W Taylor Street ~ Hobbs, New Mexico 88240	
Address: (Street, City, Zip) 122 W Taylor Street ~ Hobbs, New Mexico 88240		Phone#: (575) 393-9174	Fax#: (575)397-1471
Phone #: (575) 393-9174		Fax #: (575) 397-1471	
Project #:		Project Name: Hobbs N-6	
Project Location: T19S-R38E-Sec5&6 E/H ~ Lea County - New Mexico		Sampler Signature: Rozanne Johnson (575)631-9310	

[illegible]

Relinquished by: <u>Bozanne Johnson</u> Date: <u>9/28/2022</u> Time: <u>13:25</u>	Received by: <u>Lawrence M. Kelly</u> Date: <u>9-28-22</u> Time: <u>1325</u>							
Relinquished by: _____ Date: _____ Time: _____	Received By: (Laboratory Staff) _____ Date: _____ Time: _____							
Delivered By: (Circle One) Sampler - UPS - Bus - Other: _____	<table border="1" style="width: 100%; border-collapse: collapse;"> <tr> <td colspan="2" style="text-align: center;">Sample Condition</td> <td rowspan="3" style="text-align: center; vertical-align: middle;"> CHECKED BY: (Initials) <u>JK</u> </td> </tr> <tr> <td style="text-align: center;">Cool</td> <td style="text-align: center;">Intact</td> </tr> <tr> <td style="text-align: center;"> Yes <input checked="" type="checkbox"/> No <input type="checkbox"/> </td> <td style="text-align: center;"> Yes <input checked="" type="checkbox"/> No <input type="checkbox"/> </td> </tr> </table>	Sample Condition		CHECKED BY: (Initials) <u>JK</u>	Cool	Intact	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>
Sample Condition		CHECKED BY: (Initials) <u>JK</u>						
Cool	Intact							
Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>							

CHAIN-OF-CUSTODY AND ANALYSIS REQUEST

LAB Order ID # _____

ANALYSIS REQUEST

(Circle or Specify Method No.)

[illegible]

Phone Results	Yes	No	
Fax Results	Yes	No	Additional Fax Number: _____
REMARKS:			
Email Results:	kjones@riceswd.com rozanne@sdacres.com		

Page 10 of 10

Released to Imaging: 6/27/2023 3:36:01 PM



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

July 07, 2022

KATIE JONES

Rice Operating Company

112 W. Taylor

Hobbs, NM 88240

RE: HOBBS N-6

Enclosed are the results of analyses for samples received by the laboratory on 07/01/22 13:30.

Cardinal Laboratories is accredited through Texas NELAP under certificate number T104704398-22-15. Accreditation applies to drinking water, non-potable water and solid and chemical materials. All accredited analytes are denoted by an asterisk (*). For a complete list of accredited analytes and matrices visit the TCEQ website at www.tceq.texas.gov/field/qa/lab_accred_certif.html.

Cardinal Laboratories is accredited through the State of Colorado Department of Public Health and Environment for:

Method EPA 552.2	Haloacetic Acids (HAA-5)
Method EPA 524.2	Total Trihalomethanes (TTHM)
Method EPA 524.4	Regulated VOCs (V1, V2, V3)

Accreditation applies to public drinking water matrices.

This report meets NELAP requirements and is made up of a cover page, analytical results, and a copy of the original chain-of-custody. If you have any questions concerning this report, please feel free to contact me.

Sincerely,

A handwritten signature in black ink that reads "Celey D. Keene". The signature is written in a cursive, flowing style.

Celey D. Keene

Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

Rice Operating Company
 KATIE JONES
 112 W. Taylor
 Hobbs NM, 88240
 Fax To: (575) 397-1471

Received:	07/01/2022	Sampling Date:	06/30/2022
Reported:	07/07/2022	Sampling Type:	Water
Project Name:	HOBBS N-6	Sampling Condition:	Cool & Intact
Project Number:	NOT GIVEN	Sample Received By:	Shalyn Rodriguez
Project Location:	T19S-R38E-SEC5&6 E/H ~LEA CO - NM		

Sample ID: MONITOR WELL # 2 (H222842-01)

BTEX 8021B		mg/L		Analyzed By: JH					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Benzene*	<0.001	0.001	07/05/2022	ND	0.021	104	0.0200	3.60	
Toluene*	<0.001	0.001	07/05/2022	ND	0.020	100	0.0200	2.38	
Ethylbenzene*	<0.001	0.001	07/05/2022	ND	0.021	103	0.0200	1.10	
Total Xylenes*	<0.003	0.003	07/05/2022	ND	0.063	105	0.0600	1.51	
Total BTEX	<0.006	0.006	07/05/2022	ND					

Surrogate: 4-Bromofluorobenzene (PID) 97.7 % 77.1-124

Chloride, SM4500Cl-B		mg/L		Analyzed By: GM					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Chloride*	72.0	4.00	07/06/2022	ND	100	100	100	0.00	

Sulfate 375.4		mg/L		Analyzed By: GM					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Sulfate*	92.5	25.0	07/06/2022	ND	20.4	102	20.0	3.74	

TDS 160.1		mg/L		Analyzed By: GM					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
TDS*	545	5.00	07/07/2022	ND	851	85.1	1000	1.88	

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

Rice Operating Company
 KATIE JONES
 112 W. Taylor
 Hobbs NM, 88240
 Fax To: (575) 397-1471

Received:	07/01/2022	Sampling Date:	06/29/2022
Reported:	07/07/2022	Sampling Type:	Water
Project Name:	HOBBS N-6	Sampling Condition:	Cool & Intact
Project Number:	NOT GIVEN	Sample Received By:	Shalyn Rodriguez
Project Location:	T19S-R38E-SEC5&6 E/H ~LEA CO - NM		

Sample ID: MONITOR WELL # 4 (H222842-02)

BTX 8021B		mg/L		Analyzed By: JH					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Benzene*	<0.001	0.001	07/05/2022	ND	0.021	104	0.0200	3.60	
Toluene*	<0.001	0.001	07/05/2022	ND	0.020	100	0.0200	2.38	
Ethylbenzene*	<0.001	0.001	07/05/2022	ND	0.021	103	0.0200	1.10	
Total Xylenes*	<0.003	0.003	07/05/2022	ND	0.063	105	0.0600	1.51	
Total BTX	<0.006	0.006	07/05/2022	ND					

Surrogate: 4-Bromofluorobenzene (PID) 98.7 % 77.1-124

Chloride, SM4500Cl-B		mg/L		Analyzed By: GM					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Chloride*	184	4.00	07/06/2022	ND	100	100	100	0.00	

Sulfate 375.4		mg/L		Analyzed By: GM					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Sulfate*	112	25.0	07/06/2022	ND	20.4	102	20.0	3.74	

TDS 160.1		mg/L		Analyzed By: GM						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
TDS*	758	5.00	07/06/2022	ND	851	85.1	1000	1.88		

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

Rice Operating Company
 KATIE JONES
 112 W. Taylor
 Hobbs NM, 88240
 Fax To: (575) 397-1471

Received:	07/01/2022	Sampling Date:	06/30/2022
Reported:	07/07/2022	Sampling Type:	Water
Project Name:	HOBBS N-6	Sampling Condition:	Cool & Intact
Project Number:	NOT GIVEN	Sample Received By:	Shalyn Rodriguez
Project Location:	T19S-R38E-SEC5&6 E/H ~LEA CO - NM		

Sample ID: MONITOR WELL # 5 (H222842-03)

BTX 8021B		mg/L		Analyzed By: JH						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Benzene*	<0.001	0.001	07/05/2022	ND	0.021	104	0.0200	3.60		
Toluene*	<0.001	0.001	07/05/2022	ND	0.020	100	0.0200	2.38		
Ethylbenzene*	<0.001	0.001	07/05/2022	ND	0.021	103	0.0200	1.10		
Total Xylenes*	<0.003	0.003	07/05/2022	ND	0.063	105	0.0600	1.51		
Total BTX	<0.006	0.006	07/05/2022	ND						

Surrogate: 4-Bromofluorobenzene (PID) 98.1 % 77.1-124

Chloride, SM4500Cl-B		mg/L		Analyzed By: GM						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Chloride*	88.0	4.00	07/06/2022	ND	100	100	100	0.00		

Sulfate 375.4		mg/L		Analyzed By: GM					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Sulfate*	74.6	25.0	07/06/2022	ND	20.4	102	20.0	3.74	

TDS 160.1		mg/L		Analyzed By: GM						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
TDS*	448	5.00	07/07/2022	ND	851	85.1	1000	1.88		

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

Rice Operating Company
 KATIE JONES
 112 W. Taylor
 Hobbs NM, 88240
 Fax To: (575) 397-1471

Received:	07/01/2022	Sampling Date:	06/29/2022
Reported:	07/07/2022	Sampling Type:	Water
Project Name:	HOBBS N-6	Sampling Condition:	Cool & Intact
Project Number:	NOT GIVEN	Sample Received By:	Shalyn Rodriguez
Project Location:	T19S-R38E-SEC5&6 E/H ~LEA CO - NM		

Sample ID: MONITOR WELL # 6 (H222842-04)

BTX 8021B		mg/L		Analyzed By: JH					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Benzene*	<0.001	0.001	07/05/2022	ND	0.021	104	0.0200	3.60	
Toluene*	<0.001	0.001	07/05/2022	ND	0.020	100	0.0200	2.38	
Ethylbenzene*	<0.001	0.001	07/05/2022	ND	0.021	103	0.0200	1.10	
Total Xylenes*	<0.003	0.003	07/05/2022	ND	0.063	105	0.0600	1.51	
Total BTX	<0.006	0.006	07/05/2022	ND					

Surrogate: 4-Bromofluorobenzene (PID) 99.2 % 77.1-124

Chloride, SM4500CI-B		mg/L		Analyzed By: GM					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Chloride*	76.0	4.00	07/06/2022	ND	100	100	100	0.00	

Sulfate 375.4		mg/L		Analyzed By: GM						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Sulfate*	95.9	25.0	07/06/2022	ND	20.4	102	20.0	3.74		

TDS 160.1		mg/L		Analyzed By: GM						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
TDS*	552	5.00	07/07/2022	ND	851	85.1	1000	1.88		

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

Rice Operating Company
 KATIE JONES
 112 W. Taylor
 Hobbs NM, 88240
 Fax To: (575) 397-1471

Received:	07/01/2022	Sampling Date:	06/29/2022
Reported:	07/07/2022	Sampling Type:	Water
Project Name:	HOBBS N-6	Sampling Condition:	Cool & Intact
Project Number:	NOT GIVEN	Sample Received By:	Shalyn Rodriguez
Project Location:	T19S-R38E-SEC5&6 E/H ~LEA CO - NM		

Sample ID: MONITOR WELL # 7 (H222842-05)

BTX 8021B		mg/L		Analyzed By: JH						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Benzene*	<0.001	0.001	07/05/2022	ND	0.021	104	0.0200	3.60		
Toluene*	<0.001	0.001	07/05/2022	ND	0.020	100	0.0200	2.38		
Ethylbenzene*	<0.001	0.001	07/05/2022	ND	0.021	103	0.0200	1.10		
Total Xylenes*	<0.003	0.003	07/05/2022	ND	0.063	105	0.0600	1.51		
Total BTX	<0.006	0.006	07/05/2022	ND						

Surrogate: 4-Bromofluorobenzene (PID) 96.6 % 77.1-124

Chloride, SM4500Cl-B		mg/L		Analyzed By: GM					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Chloride*	180	4.00	07/06/2022	ND	100	100	100	0.00	

Sulfate 375.4		mg/L		Analyzed By: GM					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Sulfate*	96.2	25.0	07/06/2022	ND	20.4	102	20.0	3.74	

TDS 160.1		mg/L		Analyzed By: GM					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
TDS*	755	5.00	07/06/2022	ND	851	85.1	1000	1.88	

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

Rice Operating Company
 KATIE JONES
 112 W. Taylor
 Hobbs NM, 88240
 Fax To: (575) 397-1471

Received:	07/01/2022	Sampling Date:	06/30/2022
Reported:	07/07/2022	Sampling Type:	Water
Project Name:	HOBBS N-6	Sampling Condition:	Cool & Intact
Project Number:	NOT GIVEN	Sample Received By:	Shalyn Rodriguez
Project Location:	T19S-R38E-SEC5&6 E/H ~LEA CO - NM		

Sample ID: IWW (H222842-06)

BTX 8021B		mg/L		Analyzed By: JH					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Benzene*	<0.001	0.001	07/05/2022	ND	0.021	104	0.0200	3.60	
Toluene*	<0.001	0.001	07/05/2022	ND	0.020	100	0.0200	2.38	
Ethylbenzene*	<0.001	0.001	07/05/2022	ND	0.021	103	0.0200	1.10	
Total Xylenes*	<0.003	0.003	07/05/2022	ND	0.063	105	0.0600	1.51	
Total BTX	<0.006	0.006	07/05/2022	ND					

Surrogate: 4-Bromofluorobenzene (PID) 95.8 % 77.1-124

Chloride, SM4500Cl-B		mg/L		Analyzed By: GM					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Chloride*	104	4.00	07/06/2022	ND	100	100	100	0.00	

Sulfate 375.4		mg/L		Analyzed By: GM						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Sulfate*	88.6	25.0	07/06/2022	ND	20.4	102	20.0	3.74		

TDS 160.1		mg/L		Analyzed By: GM						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
TDS*	628	5.00	07/07/2022	ND	851	85.1	1000	1.88		

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

Rice Operating Company
 KATIE JONES
 112 W. Taylor
 Hobbs NM, 88240
 Fax To: (575) 397-1471

Received:	07/01/2022	Sampling Date:	06/29/2022
Reported:	07/07/2022	Sampling Type:	Water
Project Name:	HOBBS N-6	Sampling Condition:	Cool & Intact
Project Number:	NOT GIVEN	Sample Received By:	Shalyn Rodriguez
Project Location:	T19S-R38E-SEC5&6 E/H ~LEA CO - NM		

Sample ID: BIO SPARGE #2 (H222842-07)

BTEx 8021B		mg/L		Analyzed By: JH						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Benzene*	<0.001	0.001	07/05/2022	ND	0.021	104	0.0200	3.60		
Toluene*	<0.001	0.001	07/05/2022	ND	0.020	100	0.0200	2.38		
Ethylbenzene*	<0.001	0.001	07/05/2022	ND	0.021	103	0.0200	1.10		
Total Xylenes*	<0.003	0.003	07/05/2022	ND	0.063	105	0.0600	1.51		
Total BTEX	<0.006	0.006	07/05/2022	ND						

Surrogate: 4-Bromofluorobenzene (PID) 96.6 % 77.1-124

Chloride, SM4500Cl-B		mg/L		Analyzed By: GM					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Chloride*	72.0	4.00	07/06/2022	ND	100	100	100	0.00	

Sulfate 375.4		mg/L		Analyzed By: GM						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Sulfate*	90.2	25.0	07/06/2022	ND	20.0	99.9	20.0	5.77	QM-07	

TDS 160.1		mg/L		Analyzed By: GM						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
TDS*	547	5.00	07/06/2022	ND	851	85.1	1000	1.88		

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 • 101 E. MARLAND • HOBBS, NM 88240

Notes and Definitions

QM-07	The spike recovery was outside acceptance limits for the MS and/or MSD. The batch was accepted based on acceptable LCS recovery.
ND	Analyte NOT DETECTED at or above the reporting limit
RPD	Relative Percent Difference
**	Samples not received at proper temperature of 6°C or below.
***	Insufficient time to reach temperature.
-	Chloride by SM4500Cl-B does not require samples be received at or below 6°C Samples reported on an as received basis (wet) unless otherwise noted on report

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

A handwritten signature in black ink, appearing to read "Celey D. Keene", is written over a horizontal line.

Celey D. Keene, Lab Director/Quality Manager

101 East Marland - Hobbs, NM 88240
Tel (575) 393-2326
Fax (575) 393-2476

Cardinal Laboratories, Inc.

CHAIN-OF-CUSTODY AND ANALYSIS REQUEST

LAB Order ID # 1222842

Company Name: **RICE Operating Company**
Project Manager: **Katie Jones**
Address: (Street, City, Zip)
122 W Taylor Street ~ Hobbs, New Mexico 88240
Phone #: (575) 393-9174
Fax #: (575) 397-1471

BILL TO Company: **RICE Operating Company**
PO#
Address: (Street, City, Zip)
122 W Taylor Street ~ Hobbs, New Mexico 88240
Phone#: (575) 393-9174
Fax#: (575) 397-1471

Project #: **Hobbs N-6**
Project Name: **Hobbs N-6**
Project Location: **T19S-R38E-Sec5&6 E/H ~ Lea County - New Mexico**
Sampler Signature: **Rozanne Johnson (575) 631-9310**

LAB # (LAB USE ONLY)	FIELD CODE	(G)rab or (C)omp	# CONTAINERS	MATRIX				PRESERVATIVE METHOD					SAMPLING		
				WATER	SOIL	AIR	SLUDGE	HCL (4 40ml VOA)	HNO ₃	NaHSO ₄	H ₂ SO ₄	ICE (1-1 Liter HDPE)	NONE	DATE (2022)	TIME
1	Monitor Well #2	G	5	X				4				1		6/30	13:30
2	Monitor Well #4	G	5	X				4				1		6/29	10:55
3	Monitor Well #5	G	5	X				4				1		6/30	9:20
4	Monitor Well #6	G	5	X				4				1		6/29	13:20
5	Monitor Well #7	G	5	X				4				1		6/29	9:15
6	IWW	G	5	X				4				1		6/30	12:30
7	Bio Sparge #2	G	5	X				4				1		6/29	16:40

MTBE 8021B/602	BTX 8021B/602	TPH 418.1/TX1005 / TX1005 Extended (C35)	PAH 8270C	Total Metals Ag As Ba Cd Cr Pb Se Hg 6010B/200.7	TCLP Metals Ag As Ba Cd Cr Pb Se Hg	TCLP Volatiles	TCLP Semi Volatiles	TCLP Pesticides	RCI	GC/MS Vol. 8260B/624	GC/MS Semi. Vol. 8270C/625	PCB's 8082/608	Pesticides 8081A/608	BOD, TSS, pH	Moisture Content	Cations (Ca, Mg, Na, K)	Anions (Cl, SO ₄ , CO ₃ , HCO ₃)	Sulfates	Total Dissolved Solids	Chlorides	Turn Around Time ~ 24 Hours
X	X																	X	X	X	
																		X	X	X	
																		X	X	X	
																		X	X	X	
																		X	X	X	
																		X	X	X	
																		X	X	X	

Relinquished by: **Rozanne Johnson** Date: **7/1/2022** Time: **13:30**
Received by: **Shodkiney** Date: **7-1-22** Time: **1330**
Relinquished by: _____ Date: _____ Time: _____
Received By: (Laboratory Staff) _____ Date: _____ Time: _____

Phone Results: Yes ☐ No ☐
Fax Results: Yes ☐ No ☐ Additional Fax Number: _____

REMARKS:

Email Results: kjones@riceswd.com
rozanne@sdacres.com

Delivered By: (Circle One)

Sample Condition

Cool ☒ Intact ☒
Yes ☒ No ☐

CHECKED BY:

(Initials) **SR**

Sampler - UPS - Bus - Other:



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

April 06, 2022

KATIE JONES

Rice Operating Company

112 W. Taylor

Hobbs, NM 88240

RE: HOBBS N-6

Enclosed are the results of analyses for samples received by the laboratory on 03/31/22 16:10.

Cardinal Laboratories is accredited through Texas NELAP under certificate number T104704398-21-14. Accreditation applies to drinking water, non-potable water and solid and chemical materials. All accredited analytes are denoted by an asterisk (*). For a complete list of accredited analytes and matrices visit the TCEQ website at www.tceq.texas.gov/field/qa/lab_accred_certif.html.

Cardinal Laboratories is accredited through the State of Colorado Department of Public Health and Environment for:

Method EPA 552.2	Haloacetic Acids (HAA-5)
Method EPA 524.2	Total Trihalomethanes (TTHM)
Method EPA 524.4	Regulated VOCs (V1, V2, V3)

Accreditation applies to public drinking water matrices.

This report meets NELAP requirements and is made up of a cover page, analytical results, and a copy of the original chain-of-custody. If you have any questions concerning this report, please feel free to contact me.

Sincerely,

A handwritten signature in black ink that reads "Celey D. Keene". The signature is written in a cursive style with a large, stylized 'C' and 'K'.

Celey D. Keene

Lab Director/Quality Manager



PHONE (575) 393-2326 • 101 E. MARLAND • HOBBS, NM 88240

Analytical Results For:

Rice Operating Company
 KATIE JONES
 112 W. Taylor
 Hobbs NM, 88240
 Fax To: (575) 397-1471

Received:	03/31/2022	Sampling Date:	03/30/2022
Reported:	04/06/2022	Sampling Type:	Water
Project Name:	HOBBS N-6	Sampling Condition:	Cool & Intact
Project Number:	NONE GIVEN	Sample Received By:	Tamara Oldaker
Project Location:	T19S-R38E-SEC5&6 E/H ~LEA CO - NM		

Sample ID: MONITOR WELL # 2 (H221302-01)

BTEX 8021B		mg/L		Analyzed By: MS\					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Benzene*	<0.001	0.001	04/01/2022	ND	0.020	102	0.0200	0.142	
Toluene*	<0.001	0.001	04/01/2022	ND	0.020	99.0	0.0200	0.890	
Ethylbenzene*	<0.001	0.001	04/01/2022	ND	0.020	99.0	0.0200	1.65	
Total Xylenes*	<0.003	0.003	04/01/2022	ND	0.062	104	0.0600	1.65	
Total BTEX	<0.006	0.006	04/01/2022	ND					

Surrogate: 4-Bromofluorobenzene (PID) 102 % 77.1-124

Chloride, SM4500Cl-B		mg/L		Analyzed By: AC					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Chloride*	72.0	4.00	04/01/2022	ND	104	104	100	0.00	

Sulfate 375.4		mg/L		Analyzed By: AC					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Sulfate*	78.9	25.0	04/01/2022	ND	19.8	99.0	20.0	3.33	

TDS 160.1		mg/L		Analyzed By: GM					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
TDS*	531	5.00	04/04/2022	ND	532	106	500	5.81	

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

Rice Operating Company
 KATIE JONES
 112 W. Taylor
 Hobbs NM, 88240
 Fax To: (575) 397-1471

Received:	03/31/2022	Sampling Date:	03/29/2022
Reported:	04/06/2022	Sampling Type:	Water
Project Name:	HOBBS N-6	Sampling Condition:	Cool & Intact
Project Number:	NONE GIVEN	Sample Received By:	Tamara Oldaker
Project Location:	T19S-R38E-SEC5&6 E/H ~LEA CO - NM		

Sample ID: MONITOR WELL # 4 (H221302-02)

BTEx 8021B		mg/L		Analyzed By: MS\						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Benzene*	<0.001	0.001	04/01/2022	ND	0.020	102	0.0200	0.142		
Toluene*	<0.001	0.001	04/01/2022	ND	0.020	99.0	0.0200	0.890		
Ethylbenzene*	<0.001	0.001	04/01/2022	ND	0.020	99.0	0.0200	1.65		
Total Xylenes*	<0.003	0.003	04/01/2022	ND	0.062	104	0.0600	1.65		
Total BTEx	<0.006	0.006	04/01/2022	ND						

Surrogate: 4-Bromofluorobenzene (PID) 103 % 77.1-124

Chloride, SM4500Cl-B		mg/L		Analyzed By: AC					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Chloride*	136	4.00	04/01/2022	ND	104	104	100	0.00	

Sulfate 375.4		mg/L		Analyzed By: AC					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Sulfate*	66.2	25.0	04/01/2022	ND	19.8	99.0	20.0	3.33	

TDS 160.1		mg/L		Analyzed By: GM						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
TDS*	593	5.00	04/05/2022	ND	532	106	500	5.81		

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

Rice Operating Company
 KATIE JONES
 112 W. Taylor
 Hobbs NM, 88240
 Fax To: (575) 397-1471

Received:	03/31/2022	Sampling Date:	03/30/2022
Reported:	04/06/2022	Sampling Type:	Water
Project Name:	HOBBS N-6	Sampling Condition:	Cool & Intact
Project Number:	NONE GIVEN	Sample Received By:	Tamara Oldaker
Project Location:	T19S-R38E-SEC5&6 E/H ~LEA CO - NM		

Sample ID: MONITOR WELL # 5 (H221302-03)

BTX 8021B		mg/L		Analyzed By: MS\					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Benzene*	<0.001	0.001	04/01/2022	ND	0.020	102	0.0200	0.142	
Toluene*	<0.001	0.001	04/01/2022	ND	0.020	99.0	0.0200	0.890	
Ethylbenzene*	<0.001	0.001	04/01/2022	ND	0.020	99.0	0.0200	1.65	
Total Xylenes*	<0.003	0.003	04/01/2022	ND	0.062	104	0.0600	1.65	
Total BTX	<0.006	0.006	04/01/2022	ND					

Surrogate: 4-Bromofluorobenzene (PID) 102 % 77.1-124

Chloride, SM4500CI-B		mg/L		Analyzed By: AC					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Chloride*	36.0	4.00	04/01/2022	ND	104	104	100	0.00	

Sulfate 375.4		mg/L		Analyzed By: AC					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Sulfate*	61.1	25.0	04/01/2022	ND	19.8	99.0	20.0	3.33	

TDS 160.1		mg/L		Analyzed By: GM						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
TDS*	333	5.00	04/04/2022	ND	532	106	500	5.81		

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

Rice Operating Company
 KATIE JONES
 112 W. Taylor
 Hobbs NM, 88240
 Fax To: (575) 397-1471

Received:	03/31/2022	Sampling Date:	03/29/2022
Reported:	04/06/2022	Sampling Type:	Water
Project Name:	HOBBS N-6	Sampling Condition:	Cool & Intact
Project Number:	NONE GIVEN	Sample Received By:	Tamara Oldaker
Project Location:	T19S-R38E-SEC5&6 E/H ~LEA CO - NM		

Sample ID: MONITOR WELL # 6 (H221302-04)

BTX 8021B		mg/L		Analyzed By: MS\						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Benzene*	<0.001	0.001	04/01/2022	ND	0.020	102	0.0200	0.142		
Toluene*	<0.001	0.001	04/01/2022	ND	0.020	99.0	0.0200	0.890		
Ethylbenzene*	<0.001	0.001	04/01/2022	ND	0.020	99.0	0.0200	1.65		
Total Xylenes*	<0.003	0.003	04/01/2022	ND	0.062	104	0.0600	1.65		
Total BTX	<0.006	0.006	04/01/2022	ND						

Surrogate: 4-Bromofluorobenzene (PID) 101 % 77.1-124

Chloride, SM4500Cl-B		mg/L		Analyzed By: AC					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Chloride*	80.0	4.00	04/01/2022	ND	104	104	100	0.00	

Sulfate 375.4		mg/L		Analyzed By: AC					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Sulfate*	71.3	25.0	04/01/2022	ND	19.8	99.0	20.0	3.33	

TDS 160.1		mg/L		Analyzed By: GM						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
TDS*	487	5.00	04/04/2022	ND	532	106	500	5.81		

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

Rice Operating Company
 KATIE JONES
 112 W. Taylor
 Hobbs NM, 88240
 Fax To: (575) 397-1471

Received:	03/31/2022	Sampling Date:	03/29/2022
Reported:	04/06/2022	Sampling Type:	Water
Project Name:	HOBBS N-6	Sampling Condition:	Cool & Intact
Project Number:	NONE GIVEN	Sample Received By:	Tamara Oldaker
Project Location:	T19S-R38E-SEC5&6 E/H ~LEA CO - NM		

Sample ID: MONITOR WELL # 7 (H221302-05)

BTX 8021B		mg/L		Analyzed By: MS\					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Benzene*	<0.001	0.001	04/01/2022	ND	0.020	102	0.0200	0.142	
Toluene*	<0.001	0.001	04/01/2022	ND	0.020	99.0	0.0200	0.890	
Ethylbenzene*	<0.001	0.001	04/01/2022	ND	0.020	99.0	0.0200	1.65	
Total Xylenes*	<0.003	0.003	04/01/2022	ND	0.062	104	0.0600	1.65	
Total BTX	<0.006	0.006	04/01/2022	ND					

Surrogate: 4-Bromofluorobenzene (PID) 102 % 77.1-124

Chloride, SM4500CI-B		mg/L		Analyzed By: AC					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Chloride*	260	4.00	04/01/2022	ND	104	104	100	0.00	

Sulfate 375.4		mg/L		Analyzed By: AC						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Sulfate*	61.9	25.0	04/01/2022	ND	19.8	99.0	20.0	3.33		

TDS 160.1		mg/L		Analyzed By: GM						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
TDS*	854	5.00	04/05/2022	ND	532	106	500	5.81		

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

Rice Operating Company
 KATIE JONES
 112 W. Taylor
 Hobbs NM, 88240
 Fax To: (575) 397-1471

Received:	03/31/2022	Sampling Date:	03/30/2022
Reported:	04/06/2022	Sampling Type:	Water
Project Name:	HOBBS N-6	Sampling Condition:	Cool & Intact
Project Number:	NONE GIVEN	Sample Received By:	Tamara Oldaker
Project Location:	T19S-R38E-SEC5&6 E/H ~LEA CO - NM		

Sample ID: IWW (H221302-06)

BTEx 8021B		mg/L		Analyzed By: MS\					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Benzene*	<0.001	0.001	04/01/2022	ND	0.020	102	0.0200	0.142	
Toluene*	<0.001	0.001	04/01/2022	ND	0.020	99.0	0.0200	0.890	
Ethylbenzene*	<0.001	0.001	04/01/2022	ND	0.020	99.0	0.0200	1.65	
Total Xylenes*	<0.003	0.003	04/01/2022	ND	0.062	104	0.0600	1.65	
Total BTEX	<0.006	0.006	04/01/2022	ND					

Surrogate: 4-Bromofluorobenzene (PID) 101 % 77.1-124

Chloride, SM4500Cl-B		mg/L		Analyzed By: AC					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Chloride*	120	4.00	04/01/2022	ND	104	104	100	0.00	

Sulfate 375.4		mg/L		Analyzed By: AC					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Sulfate*	58.6	25.0	04/01/2022	ND	19.8	99.0	20.0	3.33	

TDS 160.1		mg/L		Analyzed By: GM					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
TDS*	633	5.00	04/05/2022	ND	532	106	500	5.81	

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

Rice Operating Company
 KATIE JONES
 112 W. Taylor
 Hobbs NM, 88240
 Fax To: (575) 397-1471

Received:	03/31/2022	Sampling Date:	03/29/2022
Reported:	04/06/2022	Sampling Type:	Water
Project Name:	HOBBS N-6	Sampling Condition:	Cool & Intact
Project Number:	NONE GIVEN	Sample Received By:	Tamara Oldaker
Project Location:	T19S-R38E-SEC5&6 E/H ~LEA CO - NM		

Sample ID: BIO SPARGE #2 (H221302-07)

BTX 8021B		mg/L		Analyzed By: MS\					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Benzene*	<0.001	0.001	04/01/2022	ND	0.020	102	0.0200	0.142	
Toluene*	<0.001	0.001	04/01/2022	ND	0.020	99.0	0.0200	0.890	
Ethylbenzene*	<0.001	0.001	04/01/2022	ND	0.020	99.0	0.0200	1.65	
Total Xylenes*	<0.003	0.003	04/01/2022	ND	0.062	104	0.0600	1.65	
Total BTX	<0.006	0.006	04/01/2022	ND					

Surrogate: 4-Bromofluorobenzene (PID) 102 % 77.1-124

Chloride, SM4500Cl-B		mg/L		Analyzed By: AC						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Chloride*	76.0	4.00	04/01/2022	ND	104	104	100	0.00		

Sulfate 375.4		mg/L		Analyzed By: AC						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Sulfate*	74.2	25.0	04/01/2022	ND	19.8	99.0	20.0	3.33		

TDS 160.1		mg/L		Analyzed By: GM						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
TDS*	507	5.00	04/05/2022	ND	532	106	500	5.81		

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Notes and Definitions

ND	Analyte NOT DETECTED at or above the reporting limit
RPD	Relative Percent Difference
**	Samples not received at proper temperature of 6°C or below.
***	Insufficient time to reach temperature.
-	Chloride by SM4500Cl-B does not require samples be received at or below 6°C Samples reported on an as received basis (wet) unless otherwise noted on report

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

A handwritten signature in black ink, appearing to read "Celey D. Keene".

Celey D. Keene, Lab Director/Quality Manager

Cardinal Laboratories, Inc.

LAB Order ID # _____

BILL TO	Company:	PO#
---------	----------	-----

RICE Operating Company

Address: _____ (Street, City, Zip)

122 W Taylor Street ~ Hobbs, New Mexico 88240

Phone#: Fax#:

(575) 393-9174 (575) 397-1471

Fax #:
(575) 397-1471

Project #:	Project Name:
	Hobbs N-6

Project Location:
T19S-R38E-Sec5&6 E/H ~ Lea County - New Mexico

Sampler Signature: Rozanne Johnson (575)631-9310

(Circle or Specify Method No.)

[illegible]

District I
1625 N. French Dr., Hobbs, NM 88240
Phone:(575) 393-6161 Fax:(575) 393-0720
District II
811 S. First St., Artesia, NM 88210
Phone:(575) 748-1283 Fax:(575) 748-9720
District III
1000 Rio Brazos Rd., Aztec, NM 87410
Phone:(505) 334-6178 Fax:(505) 334-6170
District IV
1220 S. St Francis Dr., Santa Fe, NM 87505
Phone:(505) 476-3470 Fax:(505) 476-3462

State of New Mexico
Energy, Minerals and Natural Resources
Oil Conservation Division
1220 S. St Francis Dr.
Santa Fe, NM 87505

CONDITIONS

Action 202268

CONDITIONS

Operator: RICE OPERATING COMPANY 122 W Taylor Hobbs, NM 88240	OGRID:
	19174
	Action Number: 202268
	Action Type: [UF-GWA] Ground Water Abatement (GROUND WATER ABATEMENT)

CONDITIONS

Created By	Condition	Condition Date
michael.buchanan	Review of the 2022 Annual GW Report and Path Forward: Content is satisfactory. 1. Continue to gauge BS1 and MW-1 for LNAPL/DNAPL with product bailer and absorbent sock while continuing to remove any measurable product. 2. Continue to sample wells quarterly in 2023. 3. Submit 2023 Annual GW Report by April 1, 2024.	6/27/2023