



1. Continue O&M & sampling schedule as stated in report.
2. Submit next quarterly report by October 15, 2024.

July 11, 2024

New Mexico Oil Conservation Division

New Mexico Energy, Mineral, and Natural Resources Department
1220 South St. Francis Drive
Santa Fe, New Mexico 87505

Subject: 2024 Second Quarter – Solar SVE System Update
Trunk L Tank Battery
Harvest Four Corners, LLC
Incident Number NVF1900731813
Remediation Permit Number 3RP-13665
Rio Arriba County, New Mexico

To Whom It May Concern:

Ensolum, LLC (Ensolum), on behalf of Harvest Four Corners, LLC (Harvest), presents the following *2024 Second Quarter – Solar SVE System Update* report summarizing the soil vapor extraction (SVE) system performance at the Trunk L Tank Battery (Site), located in Unit A of Section 28, Township 28 North, Range 05 West, in Rio Arriba County, New Mexico (Figure 1).

BACKGROUND

The solar SVE system was installed on September 18, 2019, to remediate subsurface soil impacts following a release on December 14, 2018. Excessive liquids were released onto the Site during a pigging event. Additionally, the volume of fluid in the slug catcher was elevated due to a stuck float valve, causing a release of approximately 22 barrels (bbls) into the lined secondary containment. Harvest reported the release to the New Mexico Oil Conservation Division (NMOCD) on a release Notification and Corrective Action Form C-141 on December 28, 2018, and the event was assigned Incident Number NVF1900731813. A solar SVE system was installed to remediate impacts resulting from the release. Reports summarizing remediation system operation for previous quarters of system operation have been submitted to the NMOCD.

SOLAR SVE SYSTEM OPERATION AND MONITORING

The solar SVE system consists of three shallow wells (SVE01, SVE03, and SVE05) with depths ranging from 15 feet to 20 feet below ground surface (bgs) with 10-foot screened intervals, and three deep wells (SVE02, SVE04, and SVE06) with depths ranging from 35 feet to 40 feet bgs with 10-foot screened intervals. The solar SVE system is comprised of a 2.75 horsepower, three-phase blower capable of extracting 105 cubic feet per minute (cfm) at 50 inches of water column (IWC) vacuum, with a maximum vacuum capability of 84 IWC. Each SVE well has a dedicated leg with an adjustable valve and vacuum gauge to control the individual flow rates and vacuum prior to manifolding together before the water knockout tank and blower. Harvest utilized a solar-powered SVE system due to the remote location and the lack of electrical grid power at the Site. The direct-drive blower motor is connected to the solar panels via a motor controller that automatically starts the system as sunlight is available and throttles the blower up as sun power increases throughout the day to maximize efficiency. Seasonally, there are approximately 10 hours in the winter and 12 hours in the summer of available solar power in Farmington, New

Harvest Four Corners, LLC
Trunk L Tank Battery

Mexico. The complete solar SVE system is constructed as one unit designed for utilization at off-grid locations and operates autonomously. The layout of the solar SVE system is depicted on Figure 2.

Between startup of the solar SVE system on September 18, 2019, and the last quarterly Site visit on June 13, 2024, there have been 1,730 days of operation, with an estimated 20,213 total hours of nominal daylight available for solar SVE system operations. A photographic log of the hours meter reading is included as Appendix A. Since installation, the system has had an actual runtime of 20,727 hours, for an overall uptime of 102.5 percent (%) of the available runtime hours. Below is a table showing SVE system runtime in comparison with nominal available daylight hours per month, according to the National Renewable Energy Laboratory (NREL).

SVE System Runtime

Time Period	Start up on September 18, 2019 to March 28, 2024	March 29, 2024 to March 31, 2024	April 1, 2024 to April 30, 2024	May 1, 2024 to May 31, 2024	June 1, 2024 to June 13, 2024
Days	1,653	3	30	31	13
Avg. Nominal Daylight Hours	11.6	31	12	13	14
Available Runtime Hours	19,175	93	360	403	182

Total Available Daylight Runtime Hours	20,213
Actual Runtime Hours	20,727
Cumulative % Runtime	102.5%
Quarterly Available Daylight Runtime Hours	1,038
Quarterly Runtime Hours	1,049
Quarterly % Runtime	101.1%


AIR EMISSIONS MONITORING

An initial air sample was collected on September 18, 2019, from the influent side of the blower on the SVE system. Subsequent air samples were collected quarterly with the most recent sample collected June 13, 2024 (Table 1). Samples were collected in 1-Liter Tedlar® bags via a high vacuum air sampler and submitted to Eurofins (formerly Hall Environmental Analysis Laboratory) in Albuquerque, New Mexico, for analyses of benzene, toluene, ethylbenzene, and total xylenes (BTEX) following United States Environmental Protection Agency (EPA) Method 8021B and total volatile petroleum hydrocarbons (TVPH) following EPA Method 8015D. The laboratory analytical report from the June 2024 sampling event is included as Appendix B.

Estimated air emissions were calculated using air sample data collected to date (Table 2). The impacted mass source removal via the solar SVE system to-date is estimated to be 77,777 pounds (lbs) (or 38.89 tons) of TVPH. An increase in TVPH mass removal was observed in May 2020 as a result of system optimization, through focusing system operation on the four SVE wells that were recovering vapor with the highest photoionization detector (PID) measurements (SVE03, SVE04, SVE05, and SVE06). After the reconfiguration in May 2020, there was a peak TVPH inlet concentration in March 2021 of 120,000 micrograms per liter (µg/L). Concentrations have since decreased and have generally ranged between 10,000 to 20,000 µg/L since 2022. Total mass removal has continued at a steady rate, as seen in the graph below, due to system repairs and optimization.

Since December 2023, operation was adjusted to focus on all SVE wells (SVE02, SVE03, SVE04, SVE05 and SVE06) except SVE01, due to decreased headspace PID readings.

Harvest Four Corners, LLC
Trunk L Tank Battery

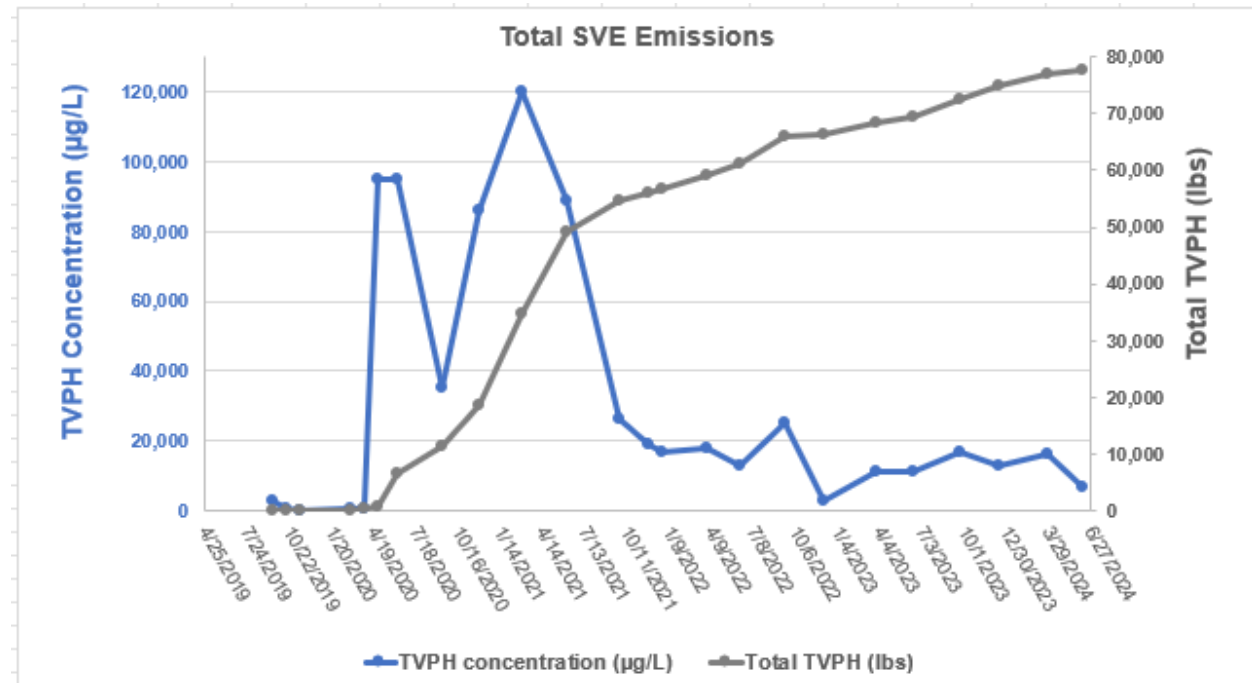

Notes:

TVPH – total volatile petroleum hydrocarbons
µg/L – micrograms per liter
lbs – pounds

The June 2024 TVPH emissions rate decreased slightly from the first quarter 2024 rate, with a rate of approximately 0.7826 pounds per hour (lbs/hr) or approximately 10.9 pounds per day, based on the average nominal daylight hours available, indicating the SVE system is still effectively remediating the Site. The mass removal rate will continue to be monitored to evaluate system effectiveness.

PLAN FOR NEXT QUARTER OF OPERATION

During the upcoming third quarter 2024 operations, Ensolum will continue to visit the Site monthly to ensure a minimum of 90% runtime efficiency continues and any maintenance issues are addressed in a timely manner. An air sample will be collected in the third quarter 2024 and analyzed for BTEX and TVPH. An updated quarterly report with sample results, runtime, and mass source removal will be submitted by October 15, 2024.

Quarterly air sampling and reporting will continue until the mass removal rate declines to an asymptotic level and indicates hydrocarbon impacts have been reduced at the Site to the maximum extent practicable. At that time, Ensolum will conduct additional soil sampling to investigate potential residual impacts and request closure if concentrations of BTEX and TPH are below the applicable Table I Closure Criteria as detailed in the approved *Remediation Work Plan*, dated May 28, 2019.

If the final delineation samples indicate hydrocarbon impacts have been remediated with chemicals of concern concentrations in compliance with the Table I Closure Criteria, Ensolum will present the confirmation laboratory analysis data in a report and request closure of the release. Should the results indicate analytes in the soil exceed the Table I Closure Criteria, Ensolum will either make operational adjustments and restart the SVE system based on the results of the investigation or develop an alternative remedial approach to reach Site closure.

Harvest Four Corners, LLC
Trunk L Tank Battery

Ensolum appreciates the opportunity to provide this report to the NMOCD. If you have any questions or comments regarding this update, do not hesitate to contact Brooke Herb at (970) 403-6824 or via email at bherb@ensolum.com or Jennifer Deal at (505) 324-5128 or at jdeal@harvestmidstream.com.

Sincerely,

ENSOLUM, LLC




Reece Hanson
Project Geologist



Eric Carroll
Project Geologist

APPENDICES

Figure 1 – Site Location Map
Figure 2 – SVE System Layout
Table 1 – SVE System Emissions Analytical Results
Table 2 – SVE Mass Removal & Emissions Summary
Appendix A – Photographic Log
Appendix B – Laboratory Analytical Report

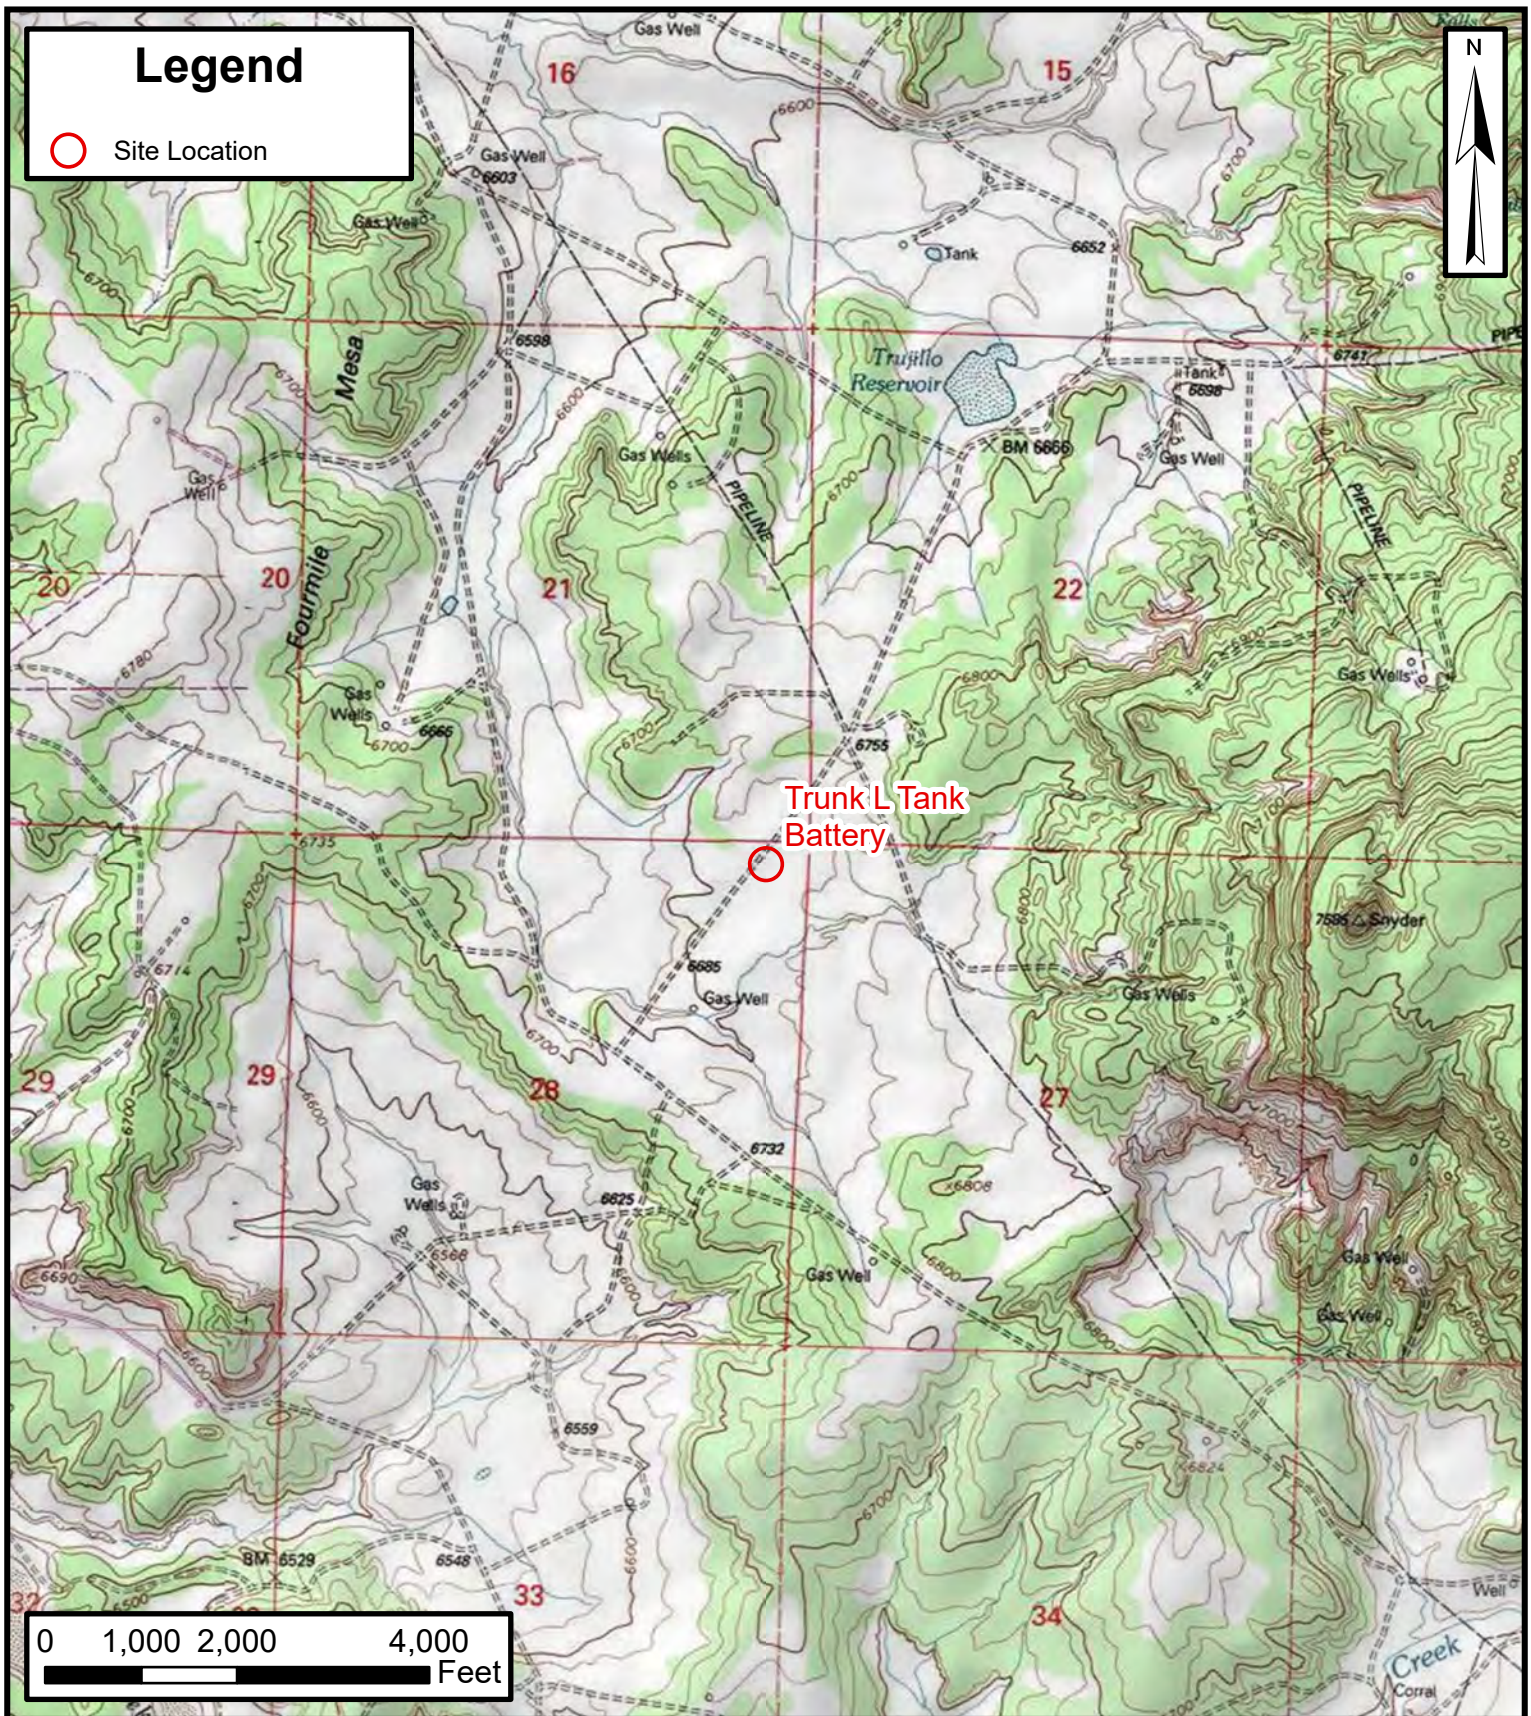


Site Location Map

Trunk L Tank Battery
Harvest Four Corners, LLC
36.638705, -107.357047
San Juan County, New Mexico

FIGURE

1

ENSOLUM
Environmental, Engineering and
Hydrogeologic Consultants

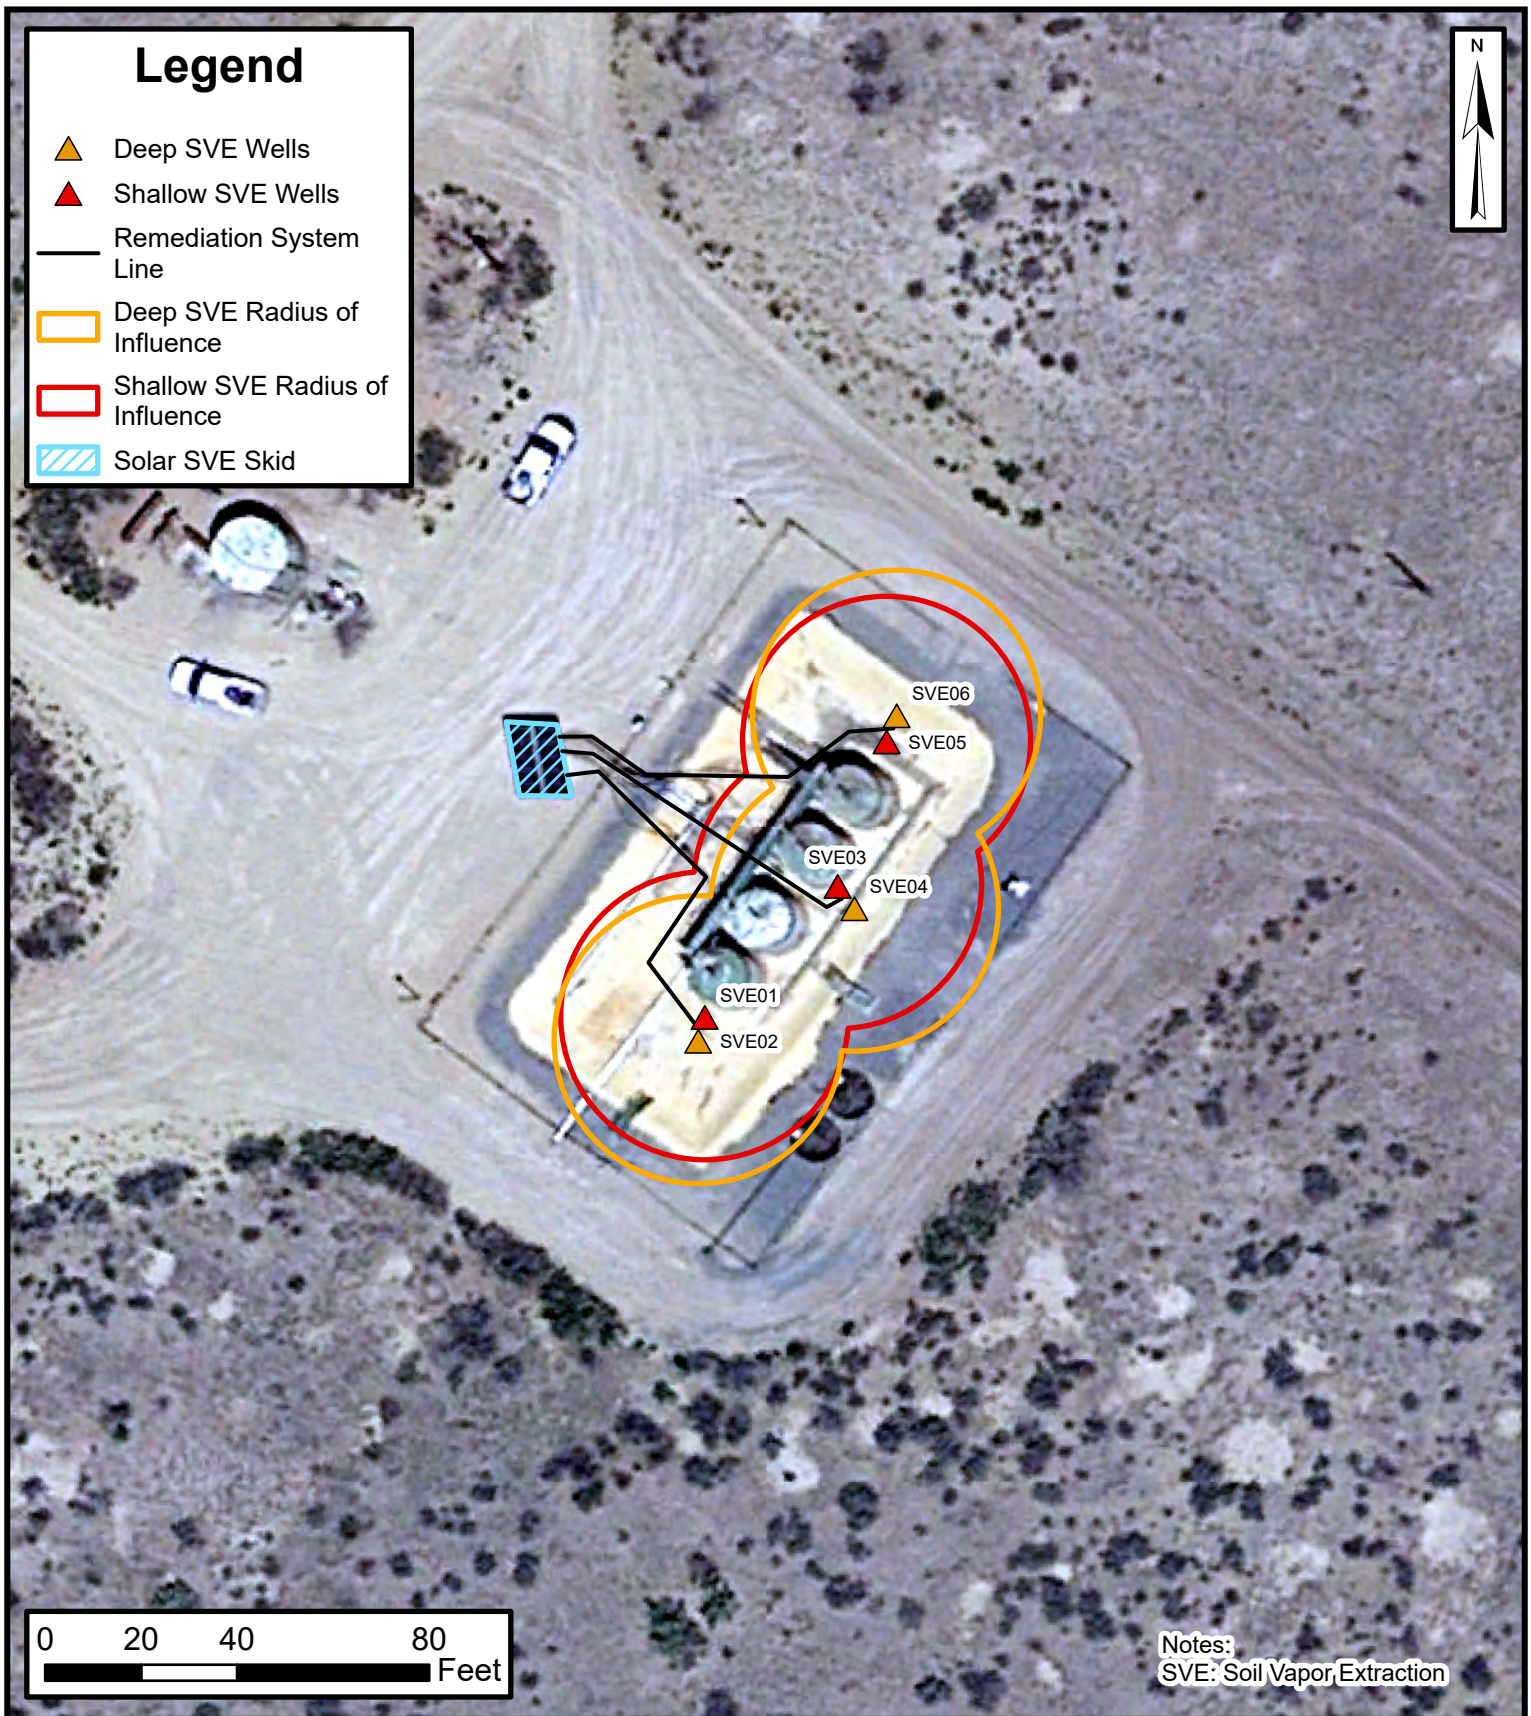

SVE System Layout

Trunk L Tank Battery
Harvest Four Corners, LLC
36.638705, -107.357047
San Juan County, New Mexico

FIGURE
2



TABLE 1
SOIL VAPOR EXTRACTION SYSTEM EMISSIONS ANALYTICAL RESULTS
 Trunk L Tank Battery
 Harvest Four Corners, LLC
 Rio Arriba County, New Mexico

Date	PID (ppm)	Benzene (µg/L)	Toluene (µg/L)	Ethylbenzene (µg/L)	Total Xylenes (µg/L)	TVPH/GRO (µg/L)
9/18/2019	946	1,000	1,500	50	550	NA
10/18/2019	931	250	410	6.5	74	NA
11/14/2019	578	1.8	4.3	0.19	1.7	250
3/3/2020	868	3.9	22	1.3	13	760
5/1/2020	913	610	1,500	58	570	95,000
6/10/2020	1,527	640	1,600	56	530	95,000
9/15/2020	1,077	180	840	24	230	35,000
12/2/2020	1,320	380	1,100	23	270	86,000
3/1/2021	1,469	440	2,100	110	1,100	120,000
6/8/2021	1,380	300	1,200	42	380	89,000
9/28/2021	916	150	230	<10	49	26,000
11/29/2021	573	78	280	9.1	84	19,000
12/27/2021	NA	120	240	<5.0	47	17,000
3/31/2022	406	76	210	5.5	47	18,000
6/13/2022	736	65	190	<5.0	51	13,000
9/13/2022	1,640	62	170	<5.0	33	25,000
12/5/2022	4,561	15	54	<5.0	13	2,900
3/28/2023	1,296	27	89	5.8	57	11,000
6/16/2023	1,263	22	63	<5.0	39	11,000
9/22/2023	1,238	47	160	5.1	110	17,000
12/15/2023	1,387	36	100	7.1	61	13,000
3/28/2024	1,085	40	120	7.8	86	16,000
6/13/2024	502	18	29	1.7	9	6,900

Notes:

NA: Not analyzed

µg/L: microgram per liter

PID: photoionization detector

ppm: parts per million

GRO: gasoline range organics

TVPH: total volatile petroleum hydrocarbons

Italics denote that the laboratory method detection limit was reported



TABLE 2
SOIL VAPOR EXTRACTION MASS REMOVAL AND EMISSIONS
 Trunk L Tank Battery
 Harvest Four Corners, LLC
 Rio Arriba County, New Mexico

Flow and Laboratory Analysis

Date	PID (ppm)	Benzene (µg/L)	Toluene (µg/L)	Ethylbenzene (µg/L)	Total Xylenes (µg/L)	TVPH (µg/L)
9/18/2019*	1,435	1,000	1,500	50	550	3,013
10/18/2019*	931	250	410	6.5	74	744
11/14/2019	578	1.8	4.3	0.19	1.7	250
3/3/2020	868	3.9	22	1.3	13	760
4/1/2020**	838	3.7	21	1.2	12	733
5/1/2020	913	610	1,500	58	570	95,000
6/10/2020	1,527	640	1,600	56	530	95,000
9/15/2020	1,077	180	840	24	230	35,000
12/2/2020	1,320	380	1,100	23	270	86,000
3/1/2021	1,469	440	2,100	110	1,100	120,000
6/8/2021	1,380	300	1,200	42	380	89,000
9/28/2021	916	150	230	10	49	26,000
11/29/2021	573	78	280	9.1	84	19,000
12/27/2021	--	120	240	5.0	47	17,000
3/31/2022	406	76	210	5.5	47	18,000
6/13/2022	736	65	190	5.0	51	13,000
9/13/2022	1,640	62	170	5.0	33	25,000
12/5/2022	4,561	15	54	5.0	13	2,900
3/28/2023	1,296	27	89	5.8	57	11,000
6/16/2023	1,263	22	63	5.0	39	11,000
9/22/2023	1,238	47	160	5.1	110	17,000
12/15/2023	1,387	36	100	7.1	61	13,000
3/28/2024	1,085	40	120	7.8	86	16,000
6/13/2024	502	18	29	1.7	9	6,900
Average	1,215	190	510	19	184	30,054



TABLE 2
SOIL VAPOR EXTRACTION MASS REMOVAL AND EMISSIONS
 Trunk L Tank Battery
 Harvest Four Corners, LLC
 Rio Arriba County, New Mexico

Vapor Extraction Summary

Date	Flow Rate (cfm)	Total System Flow (cf)	Delta Flow (cf)	Benzene (lb/hr)	Toluene (lb/hr)	Ethylbenzene (lb/hr)	Total Xylenes (lb/hr)	TVPH (lb/hr)
9/18/2019	33.7	3,033	3,033	0.1262	0.1892	0.0063	0.0694	0.3801
10/18/2019	37.8	723,303	720,270	0.0353	0.0579	0.0009	0.0105	0.1051
11/14/2019	38.0	1,334,343	611,040	0.0003	0.0006	0.0000	0.0002	0.0356
3/3/2020	21.3	2,898,866	1,564,523	0.0003	0.0018	0.0001	0.0010	0.0605
4/1/2020	21.3	3,795,613	896,747	0.0003	0.0017	0.0001	0.0010	0.0583
5/1/2020	39.2	3,882,637	87,024	0.0895	0.2201	0.0085	0.0836	13.9404
6/10/2020	29.3	4,869,885	987,248	0.0703	0.1757	0.0061	0.0582	10.4304
9/15/2020	27.8	7,089,263	2,219,378	0.0187	0.0873	0.0025	0.0239	3.6384
12/2/2020	26.6	8,447,393	1,358,130	0.0379	0.1097	0.0023	0.0269	8.5730
3/1/2021	40.0	10,571,393	2,124,000	0.0659	0.3144	0.0165	0.1647	17.9683
6/8/2021	34.2	13,226,681	2,655,288	0.0384	0.1536	0.0054	0.0486	11.3941
9/28/2021	37.0	16,596,641	3,369,960	0.0208	0.0319	0.0014	0.0068	3.6011
11/29/2021	28.7	17,746,416	1,149,775	0.0084	0.0301	0.0010	0.0090	2.0434
12/27/2021	30.4	18,233,905	487,489	0.0137	0.0273	0.0006	0.0054	1.9365
3/31/2022	36.0	20,402,545	2,168,640	0.0102	0.0283	0.0007	0.0063	2.4257
6/13/2022	46.0	23,209,465	2,806,920	0.0112	0.0327	0.0009	0.0088	2.2385
9/13/2022	40.0	26,214,265	3,004,800	0.0093	0.0255	0.0007	0.0049	3.7434
12/5/2022	31.0	27,901,285	1,687,020	0.0017	0.0063	0.0006	0.0015	0.3365
3/28/2023	42.0	30,864,805	2,963,520	0.0042	0.0140	0.0009	0.0090	1.7294
6/16/2023	27.0	32,607,925	1,743,120	0.0022	0.0064	0.0005	0.0039	1.1118
9/22/2023	35.0	35,415,625	2,807,700	0.0062	0.0210	0.0007	0.0144	2.2273
12/15/2023	56.0	38,429,545	3,013,920	0.0075	0.0210	0.0015	0.0128	2.7252
3/28/2024	30.0	40,380,745	1,951,200	0.0045	0.0135	0.0009	0.0097	1.7968
6/13/2024	30.3	42,287,827	1,907,082	0.0020	0.0033	0.0002	0.0010	0.7826
Average				0.02	0.07	0.002	0.02	3.89



TABLE 2
SOIL VAPOR EXTRACTION MASS REMOVAL AND EMISSIONS
 Trunk L Tank Battery
 Harvest Four Corners, LLC
 Rio Arriba County, New Mexico

Flow and Laboratory Analysis

Date	Total SVE System Hours	Delta Hours	Benzene (pounds)	Toluene (pounds)	Ethylbenzene (pounds)	Total Xylenes (pounds)	TVPH (pounds)	TVPH (tons)
9/18/2019	1.5	1.5	0.2	0.3	0.0	0.1	0.6	0.000
10/18/2019	319.5	318	11.2	18.4	0.3	3.3	33.4	0.017
11/14/2019	587.5	268	0.1	0.2	0.0	0.1	9.5	0.005
3/3/2020	1,814	1,226.5	0.4	2.1	0.1	1.3	74.2	0.037
4/1/2020	2,517	703	0.2	1.2	0.1	0.7	41.0	0.021
5/1/2020	2,554	37	3.3	8.1	0.3	3.1	515.8	0.258
6/10/2020	3,115	561	39.4	98.6	3.4	32.6	5,851	2.926
9/15/2020	4,447	1,332	24.9	116.3	3.3	31.8	4,846	2.423
12/2/2020	5,297	850	32.2	93.2	1.9	22.9	7,287	3.644
3/1/2021	6,182	885	58.3	278.3	14.6	145.8	15,902	7.951
6/8/2021	7,476	1,294	49.7	198.8	7.0	63.0	14,744	7.372
9/28/2021	8,994	1,518	31.5	48.4	2.1	10.3	5,467	2.733
11/29/2021	9,661	667	5.6	20.1	0.7	6.0	1,363	0.681
12/27/2021	9,928	267	3.6	7.3	0.2	1.4	517.0	0.259
3/31/2022	10,932	1,004	10.3	28.4	0.7	6.4	2,435	1.218
6/13/2022	11,949	1,017	11.4	33.3	0.9	8.9	2,277	1.138
9/13/2022	13,201	1,252	11.6	31.9	0.9	6.2	4,687	2.343
12/5/2022	14,108	907	1.6	5.7	0.5	1.4	305	0.153
3/28/2023	15,284	1,176	5.0	16.5	1.1	10.5	2,034	1.017
6/16/2023	16,360	1,076	2.4	6.9	0.5	4.2	1,196	0.598
9/22/2023	17,697	1,337	8.2	28.0	0.9	19.3	2,978	1.489
12/15/2023	18,594	897	6.8	18.8	1.3	11.5	2,444	1.222
3/28/2024	19,678	1,084	4.9	14.6	0.9	10.5	1,948	0.974
6/13/2024	20,727	1,049	2.1	3.5	0.2	1.1	821	0.410
Total Mass Recovery to Date			325.0	1,078.7	42.1	402.3	77,777.0	38.89

Notes:

* - TVPH data extrapolated from PID values

** - Analytical data extrapolated from PID values

BTEX - benzene, toluene, ethylbenzene, total xylenes

cf - cubic feet

cfm - cubic feet per minute

lbs - pounds

lb/hr - pounds per hour

µg/L - microgram per liter

PID - photoionization detector

ppm - parts per million

TVPH - total volatile petroleum hydrocarbons

VOC - volatile organic compounds


VOC Mass Removed (lbs) = Influent VOCs (mg/m³) * Air Flow Rates (cfm) * (1 m³/35.3147 ft³) * (1 lb/453,592 mg) * Time Period (min)

Italics denote that the laboratory method detection limit was used for calculations for a non-detected result



Photographic Log
Trunk L Tank
Battery
Harvest Four Corners,
LLC
Rio Arriba County,
New Mexico

Photo #1
SVE Hours Reading 6/13/2024

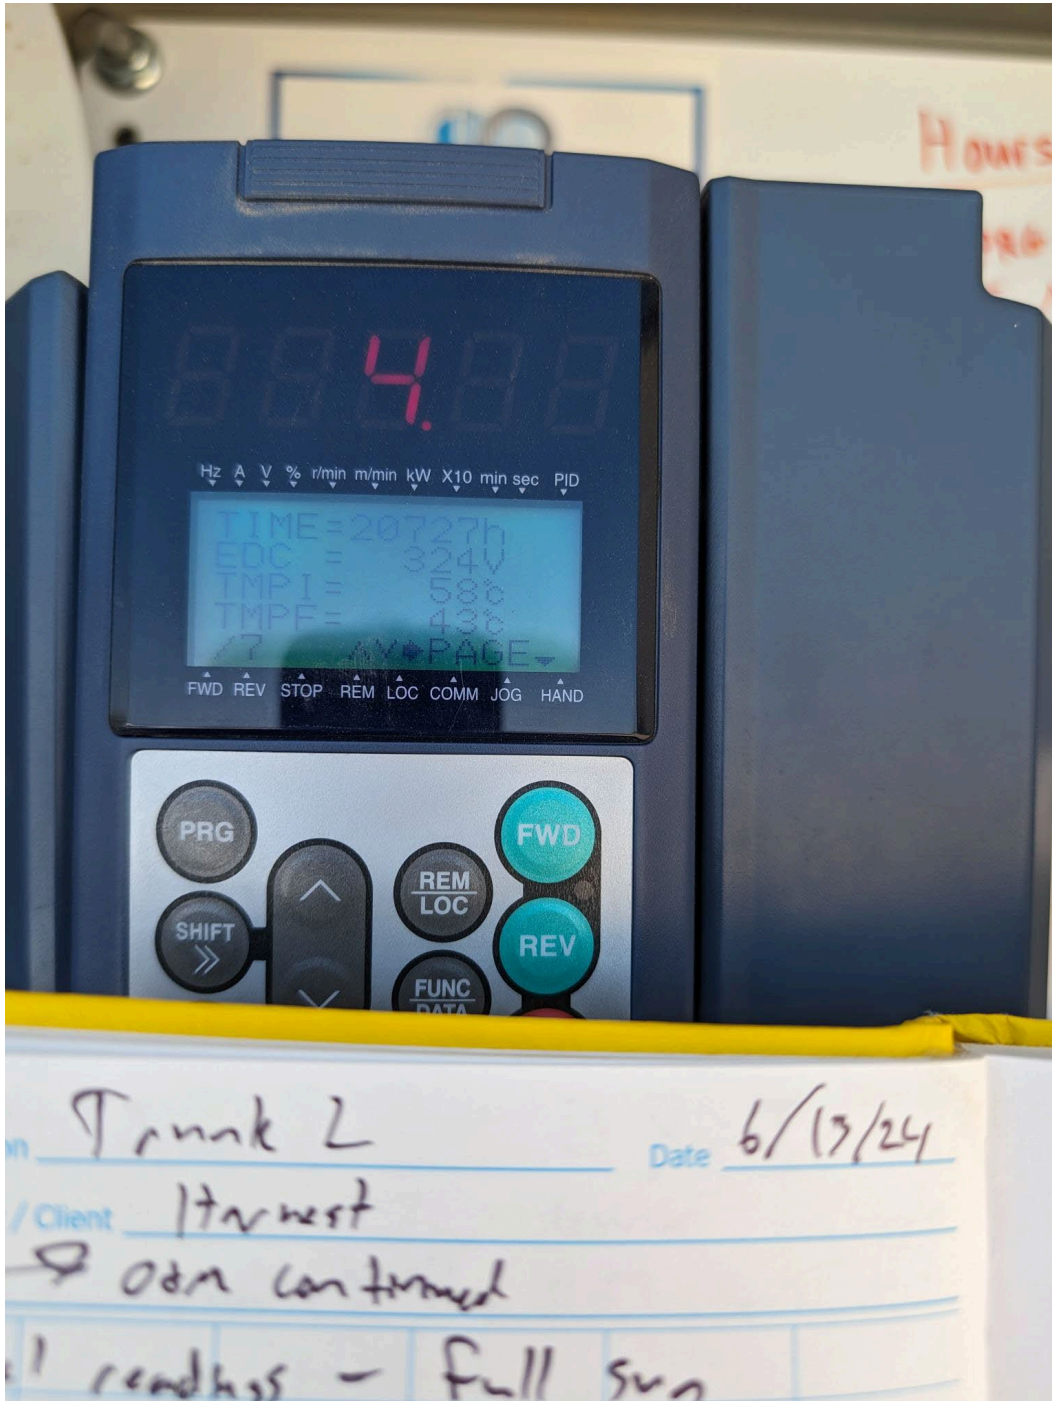



Environment Testing

- 1
- 2
- 3
- 4
- 5
- 6
- 7
- 8
- 9
- 10
- 11

ANALYTICAL REPORT

PREPARED FOR

Attn: Jennifer Deal
Harvest
1755 Arroyo Dr.
Bloomfield, New Mexico 87413

Generated 7/3/2024 5:34:29 PM

JOB DESCRIPTION

Trunk L

JOB NUMBER

885-6348-1

Eurofins Albuquerque
4901 Hawkins NE
Albuquerque NM 87109

See page two for job notes and contact information.
Released to Imaging: 8/5/2024 11:40:22 AM

Eurofins Albuquerque

Job Notes

The test results in this report relate only to the samples as received by the laboratory and will meet all requirements of the methodology, with any exceptions noted. This report shall not be reproduced except in full, without the express written approval of the laboratory. All questions should be directed to the Eurofins Environment Testing South Central, LLC Project Manager.

Authorization



Generated
7/3/2024 5:34:29 PM

Authorized for release by
Andy Freeman, Business Unit Manager
andy.freeman@et.eurofinsus.com
(505)345-3975

Client: Harvest
Project/Site: Trunk L

Laboratory Job ID: 885-6348-1

- 1
- 2
- 3
- 4
- 5
- 6
- 7
- 8
- 9
- 10
- 11

Table of Contents

Cover Page 1

Table of Contents 3

Definitions/Glossary 4

Case Narrative 5

Client Sample Results 6

QC Sample Results 7

QC Association Summary 8

Lab Chronicle 9

Certification Summary 10

Chain of Custody 11

Receipt Checklists 12

Definitions/Glossary

Client: Harvest
Project/Site: Trunk L

Job ID: 885-6348-1

Glossary

Abbreviation	These commonly used abbreviations may or may not be present in this report.
▫	Listed under the "D" column to designate that the result is reported on a dry weight basis
%R	Percent Recovery
CFL	Contains Free Liquid
CFU	Colony Forming Unit
CNF	Contains No Free Liquid
DER	Duplicate Error Ratio (normalized absolute difference)
Dil Fac	Dilution Factor
DL	Detection Limit (DoD/DOE)
DL, RA, RE, IN	Indicates a Dilution, Re-analysis, Re-extraction, or additional Initial metals/anion analysis of the sample
DLC	Decision Level Concentration (Radiochemistry)
EDL	Estimated Detection Limit (Dioxin)
LOD	Limit of Detection (DoD/DOE)
LOQ	Limit of Quantitation (DoD/DOE)
MCL	EPA recommended "Maximum Contaminant Level"
MDA	Minimum Detectable Activity (Radiochemistry)
MDC	Minimum Detectable Concentration (Radiochemistry)
MDL	Method Detection Limit
ML	Minimum Level (Dioxin)
MPN	Most Probable Number
MQL	Method Quantitation Limit
NC	Not Calculated
ND	Not Detected at the reporting limit (or MDL or EDL if shown)
NEG	Negative / Absent
POS	Positive / Present
PQL	Practical Quantitation Limit
PRES	Presumptive
QC	Quality Control
RER	Relative Error Ratio (Radiochemistry)
RL	Reporting Limit or Requested Limit (Radiochemistry)
RPD	Relative Percent Difference, a measure of the relative difference between two points
TEF	Toxicity Equivalent Factor (Dioxin)
TEQ	Toxicity Equivalent Quotient (Dioxin)
TNTC	Too Numerous To Count

Case Narrative

Client: Harvest
Project: Trunk L

Job ID: 885-6348-1

Job ID: 885-6348-1Eurofins Albuquerque

Job Narrative
885-6348-1

Analytical test results meet all requirements of the associated regulatory program listed on the Accreditation/Certification Summary Page unless otherwise noted under the individual analysis. Data qualifiers are applied to indicate exceptions. Noncompliant quality control (QC) is further explained in narrative comments.

- Matrix QC may not be reported if insufficient sample or site-specific QC samples were not submitted. In these situations, to demonstrate precision and accuracy at a batch level, a LCS/LCSD may be performed, unless otherwise specified in the method.
- Surrogate and/or isotope dilution analyte recoveries (if applicable) which are outside of the QC window are confirmed unless attributed to a dilution or otherwise noted in the narrative.

Regulated compliance samples (e.g. SDWA, NPDES) must comply with the associated agency requirements/permits.

Receipt

The sample was received on 6/15/2024 1:00 PM. Unless otherwise noted below, the sample arrived in good condition, and, where required, properly preserved and on ice. The temperature of the cooler at receipt time was 26.3°C.

Gasoline Range Organics

No additional analytical or quality issues were noted, other than those described above or in the Definitions/ Glossary page.

GC VOA

No additional analytical or quality issues were noted, other than those described above or in the Definitions/ Glossary page.

Eurofins Albuquerque

Client Sample Results

Client: Harvest
Project/Site: Trunk L

Job ID: 885-6348-1

Client Sample ID: Influent
Date Collected: 06/13/24 12:15
Date Received: 06/15/24 13:00
Sample Container: Tedlar Bag 1L

Lab Sample ID: 885-6348-1
Matrix: Air

Method: SW846 8015M/D - Gasoline Range Organics (GRO) (GC)									
Analyte	Result	Qualifier	RL	Unit	D	Prepared	Analyzed	Dil Fac	
Gasoline Range Organics [C6 - C10]	6900		50	ug/L			06/26/24 15:39	10	
Surrogate	%Recovery	Qualifier	Limits			Prepared	Analyzed	Dil Fac	
4-Bromofluorobenzene (Surr)	164		15 - 412				06/26/24 15:39	10	
Method: SW846 8021B - Volatile Organic Compounds (GC)									
Analyte	Result	Qualifier	RL	Unit	D	Prepared	Analyzed	Dil Fac	
Benzene	18		1.0	ug/L			06/26/24 15:39	10	
Ethylbenzene	1.7		1.0	ug/L			06/26/24 15:39	10	
Toluene	29		1.0	ug/L			06/26/24 15:39	10	
Xylenes, Total	9.2		2.0	ug/L			06/26/24 15:39	10	
Surrogate	%Recovery	Qualifier	Limits			Prepared	Analyzed	Dil Fac	
4-Bromofluorobenzene (Surr)	87		70 - 130				06/26/24 15:39	10	

QC Sample Results

Client: Harvest
Project/Site: Trunk L

Job ID: 885-6348-1

Method: 8015M/D - Gasoline Range Organics (GRO) (GC)

Lab Sample ID: MB 885-7463/10
Matrix: Air
Analysis Batch: 7463

Client Sample ID: Method Blank
Prep Type: Total/NA

Analyte	MB Result	MB Qualifier	RL	Unit	D	Prepared	Analyzed	Dil Fac
Gasoline Range Organics [C6 - C10]	ND		5.0	ug/L			06/26/24 10:32	1
Surrogate	MB %Recovery	MB Qualifier	Limits			Prepared	Analyzed	Dil Fac
4-Bromofluorobenzene (Surr)	97		15 - 412				06/26/24 10:32	1

Lab Sample ID: LCS 885-7463/9
Matrix: Air
Analysis Batch: 7463

Client Sample ID: Lab Control Sample
Prep Type: Total/NA

Analyte	Spike Added	LCS Result	LCS Qualifier	Unit	D	%Rec	%Rec Limits	
Gasoline Range Organics [C6 - C10]	50.0	47.1		ug/L		94	70 - 130	
Surrogate	LCS %Recovery	LCS Qualifier	Limits					
4-Bromofluorobenzene (Surr)	205		15 - 412					

Method: 8021B - Volatile Organic Compounds (GC)

Lab Sample ID: MB 885-7464/10
Matrix: Air
Analysis Batch: 7464

Client Sample ID: Method Blank
Prep Type: Total/NA

Analyte	MB Result	MB Qualifier	RL	Unit	D	Prepared	Analyzed	Dil Fac
Benzene	ND		0.10	ug/L			06/26/24 10:32	1
Ethylbenzene	ND		0.10	ug/L			06/26/24 10:32	1
Toluene	ND		0.10	ug/L			06/26/24 10:32	1
Xylenes, Total	ND		0.20	ug/L			06/26/24 10:32	1
Surrogate	MB %Recovery	MB Qualifier	Limits			Prepared	Analyzed	Dil Fac
4-Bromofluorobenzene (Surr)	90		70 - 130				06/26/24 10:32	1

Lab Sample ID: LCS 885-7464/9
Matrix: Air
Analysis Batch: 7464

Client Sample ID: Lab Control Sample
Prep Type: Total/NA

Analyte	Spike Added	LCS Result	LCS Qualifier	Unit	D	%Rec	%Rec Limits	
Benzene	2.00	1.79		ug/L		89	70 - 130	
Ethylbenzene	2.00	1.68		ug/L		84	70 - 130	
m&p-Xylene	4.00	3.40		ug/L		85	70 - 130	
o-Xylene	2.00	1.66		ug/L		83	70 - 130	
Toluene	2.00	1.67		ug/L		84	70 - 130	
Xylenes, Total	6.00	5.06		ug/L		84	70 - 130	
Surrogate	LCS %Recovery	LCS Qualifier	Limits					
4-Bromofluorobenzene (Surr)	94		70 - 130					

QC Association Summary

Client: Harvest
Project/Site: Trunk L

Job ID: 885-6348-1

GC VOA

Analysis Batch: 7463

Lab Sample ID	Client Sample ID	Prep Type	Matrix	Method	Prep Batch
885-6348-1	Influent	Total/NA	Air	8015M/D	
MB 885-7463/10	Method Blank	Total/NA	Air	8015M/D	
LCS 885-7463/9	Lab Control Sample	Total/NA	Air	8015M/D	

Analysis Batch: 7464

Lab Sample ID	Client Sample ID	Prep Type	Matrix	Method	Prep Batch
885-6348-1	Influent	Total/NA	Air	8021B	
MB 885-7464/10	Method Blank	Total/NA	Air	8021B	
LCS 885-7464/9	Lab Control Sample	Total/NA	Air	8021B	

Lab Chronicle

Client: Harvest
Project/Site: Trunk L

Job ID: 885-6348-1

Client Sample ID: Influent
Date Collected: 06/13/24 12:15
Date Received: 06/15/24 13:00

Lab Sample ID: 885-6348-1
Matrix: Air

Prep Type	Batch Type	Batch Method	Run	Dilution Factor	Batch Number	Analyst	Lab	Prepared or Analyzed
Total/NA	Analysis	8015M/D		10	7463	JP	EET ALB	06/26/24 15:39
Total/NA	Analysis	8021B		10	7464	JP	EET ALB	06/26/24 15:39

Laboratory References:
EET ALB = Eurofins Albuquerque, 4901 Hawkins NE, Albuquerque, NM 87109, TEL (505)345-3975

- 1
- 2
- 3
- 4
- 5
- 6
- 7
- 8
- 9
- 10
- 11

Accreditation/Certification Summary

Client: Harvest
Project/Site: Trunk L

Job ID: 885-6348-1

Laboratory: Eurofins Albuquerque

Unless otherwise noted, all analytes for this laboratory were covered under each accreditation/certification below.

Authority	Program	Identification Number	Expiration Date
New Mexico	State	NM9425, NM0901	02-26-25
The following analytes are included in this report, but the laboratory is not certified by the governing authority. This list may include analytes for which the agency does not offer certification.			
Analysis Method	Prep Method	Matrix	Analyte
8015M/D		Air	Gasoline Range Organics [C6 - C10]
8021B		Air	Benzene
8021B		Air	Ethylbenzene
8021B		Air	Toluene
8021B		Air	Xylenes, Total
Oregon	NELAP	NM100001	02-26-25
The following analytes are included in this report, but the laboratory is not certified by the governing authority. This list may include analytes for which the agency does not offer certification.			
Analysis Method	Prep Method	Matrix	Analyte
8015M/D		Air	Gasoline Range Organics [C6 - C10]
8021B		Air	Benzene
8021B		Air	Ethylbenzene
8021B		Air	Toluene
8021B		Air	Xylenes, Total

Chain-of-Custody Record

Client:	Harvest	<input checked="" type="checkbox"/> Standard	<input type="checkbox"/> Rush
Attn:	Jennifer Deal	Project Name: Trench L	
Mailing Address:			

Tel. 505-345-3975 Fax 505-345-4107

Analysis Request

email or Fax#: jdelaeharvest@skyman.com	Project Manager: <i>Reece Hansen</i>	(221)	(PRO)	s	S	SO ₄	(sent)
---	--------------------------------------	-------	-------	---	---	-----------------	--------

☐ Standard
 ☐ Level 4 (Full Validation)



Accreditation: <input type="checkbox"/> Az Compliance	Sampler: <i>Reece Hanson</i>	FMBS / DR / 0082 (1.1) 8270	NO ₂	essen
---	------------------------------	-----------------------------	-----------------	-------

<input type="checkbox"/> NELAC	<input type="checkbox"/> Other _____	On Ice: <input type="checkbox"/> Yes <input checked="" type="checkbox"/> No	Yog
<input type="checkbox"/> EDD (Type)		# of Coolers: 1	

	Cooler Temp(Including cpi):	$26.3 \pm 0 = 26.3 (^{\circ}\text{C})$
--	-----------------------------	--

Date	Time	Matrix	Sample Name	Container Type and #	Preservative Type	HEAL No.
						<div> <div>TPH:80</div> <div>BTEX</div> </div>
						8081 P
						EDB (M
						PAHs b
						RCRA 8
						Cl, F, E
						8260 (V
						8270 (S
						Total C

[illegible][illegible][illegible][illegible][illegible][illegible][illegible][illegible][illegible][illegible][illegible]

Date:	Time:	Relinquished by:	Received by:	Via:	Date	Time	Remarks:
6/11					11		Chase

Date: 1/14/24	Time: 1100	Relinquished by: [Signature]	Received by: [Signature]	Via: [Signature]	Date/Time: 1/14/24 1100
---------------	------------	------------------------------	--------------------------	------------------	-------------------------

Date: 6/1/92
 Time: 1718
 Reminquired by: [Signature]
 Received by: [Signature] via. CASHIER
 Date: 6/1/92
 Time: 13:00

if necessary, samples submitted to Hall Environmental may be subcontracted to other accredited laboratories. This serves as notice of this possibility. Any sub-contracted data will be clearly notated on the analytical report.

- 2
- 3
- 4
- 5
- 6
- 7
- 8
- 9
- 10
- 11

Login Sample Receipt Checklist

Client: Harvest

Job Number: 885-6348-1

Login Number: 6348

List Source: Eurofins Albuquerque

List Number: 1

Creator: McQuiston, Steven

Question	Answer	Comment
Radioactivity wasn't checked or is </= background as measured by a survey meter.	True	
The cooler's custody seal, if present, is intact.	True	
Sample custody seals, if present, are intact.	True	
The cooler or samples do not appear to have been compromised or tampered with.	True	
Samples were received on ice.	False	Thermal preservation not required.
Cooler Temperature is acceptable.	True	
Cooler Temperature is recorded.	True	
COC is present.	True	
COC is filled out in ink and legible.	True	
COC is filled out with all pertinent information.	True	
Is the Field Sampler's name present on COC?	True	
There are no discrepancies between the containers received and the COC.	True	
Samples are received within Holding Time (excluding tests with immediate HTs)	True	
Sample containers have legible labels.	True	
Containers are not broken or leaking.	True	
Sample collection date/times are provided.	True	
Appropriate sample containers are used.	True	
Sample bottles are completely filled.	True	
Sample Preservation Verified.	N/A	
There is sufficient vol. for all requested analyses, incl. any requested MS/MSDs	True	
Containers requiring zero headspace have no headspace or bubble is <6mm (1/4").	True	
Multiphasic samples are not present.	True	
Samples do not require splitting or compositing.	True	
Residual Chlorine Checked.	N/A	

District I
1625 N. French Dr., Hobbs, NM 88240
Phone:(575) 393-6161 Fax:(575) 393-0720
District II
811 S. First St., Artesia, NM 88210
Phone:(575) 748-1283 Fax:(575) 748-9720
District III
1000 Rio Brazos Rd., Aztec, NM 87410
Phone:(505) 334-6178 Fax:(505) 334-6170
District IV
1220 S. St Francis Dr., Santa Fe, NM 87505
Phone:(505) 476-3470 Fax:(505) 476-3462

State of New Mexico
Energy, Minerals and Natural Resources
Oil Conservation Division
1220 S. St Francis Dr.
Santa Fe, NM 87505

CONDITIONS

Action 364158

CONDITIONS

Operator: Harvest Four Corners, LLC 1755 Arroyo Dr Bloomfield, NM 87413	OGRID: 373888
	Action Number: 364158
	Action Type: [REPORT] Alternative Remediation Report (C-141AR)

CONDITIONS

Created By	Condition	Condition Date
nvelez	1. Continue O&M & sampling schedule as stated in report. 2. Submit next quarterly report by October 15, 2024.	8/5/2024