



Remediation Summary & Soil Closure Request

Prepared For:

Goodnight Midstream Permian, LLC
5910 N Central Expy, Suite 800
Dallas, TX 75206

Site Information:

Serrano Roll-Off Overflow
Lea County, New Mexico
Unit Letter "C", Section 28, Township 23S, Range 35E
Latitude 32.27997° North, Longitude 103.37313° West
NMOCD Reference No. nAPP2609314382

Etech Environmental & Safety Solutions, Inc.
6309 Indiana Ave., Ste. D
Lubbock, Texas 79413

June 18, 2026

A stylized, handwritten signature in blue ink, appearing to read "Ben J. Arguijo".

Ben J. Arguijo

A handwritten signature in blue ink, appearing to read "Joel Lowry".

Joel Lowry

Carlsbad • Hobbs • Houston • Lafayette • Lubbock • Midland

Table of Contents

1.0	PROJECT INFORMATION.....	1
2.0	SITE CHARACTERIZATION.....	2
3.0	CLOSURE CRITERIA FOR SOILS IMPACTED BY A RELEASE.....	3
4.0	REMEDATION ACTIVITIES SUMMARY.....	3
5.0	SOIL CLOSURE REQUEST.....	6
6.0	RESTORATION, RECLAMATION & RE-VEGETATION PLAN.....	6
7.0	LIMITATIONS.....	7
8.0	DISTRIBUTION.....	8

FIGURES

Figure 1 – Site Location Map
Figure 2A – Site Characterization Map (0.5-Mile Radius)
Figure 2B – Site Characterization Map (5-Mile Radius)
Figure 3 – Inferred Depth to Groundwater Map
Figure 4 – Sample Location Map

TABLES

Table 1 – Concentrations of BTEX, TPH & Chloride in Soil

APPENDICES

Appendix A – Depth to Groundwater Information
Appendix B – Photographic Log
Appendix C – Field Data
Appendix D – Laboratory Analytical Reports
Appendix E – Regulatory Correspondence

Remediation Summary & Soil Closure Request

Serrano Roll-Off Overflow • nAPP2609314382

1.0 PROJECT INFORMATION

Etech Environmental & Safety Solutions (Etech), on behalf of Goodnight Midstream Permian, LLC (Goodnight), has prepared this *Remediation Summary & Soil Closure Request* for the release site known as the Serrano Roll-Off Overflow (Site). Details of the release are summarized below:

Location of Release Source			
Latitude:	32.27997°	Longitude:	-103.37313°

Provided GPS are in WGS84 format.

Site Name:	Serrano Roll-Off Overflow	Site Type:	Tank Battery
Date Release Discovered:	4/1/2026	API #:	N/A

Unit Letter	Section	Township	Range	County
C	28	23S	35E	Lea

Surface Owner: ☐ State ☐ Federal ☐ Tribal ☒ Private (Name: Limestone Basin Prop Ranch, LLC)

Nature and Volume of Release		
☐ Crude Oil	Volume Released (bbls):	Volume Recovered (bbls):
☒ Produced Water	Volume Released (bbls): 50	Volume Recovered (bbls): 30
Is the concentration of dissolved chloride in the produced water >10,000 mg/L?		☒ Yes ☐ No ☐ N/A
☐ Condensate	Volume Released (bbls):	Volume Recovered (bbls):
☐ Natural Gas	Volume Released (Mcf):	Volume Recovered (Mcf):
☐ Other (describe):	Volume/Weight Released:	Volume/Weight Recovered:
Cause of Release:	Human Error (Valve)	

Initial Response
☒ The source of the release has been stopped.
☒ The impacted area has been secured to protect human health and the environment.
☒ Release materials have been contained via the use of berms or dikes, absorbent pad, or other containment devices.
☒ All free liquids and recoverable materials have been removed and managed appropriately.

Previously submitted portions of the New Mexico Oil Conservation Division (NMOCD) Form C-141 are available in the NMOCD Permitting system.

2.0 SITE CHARACTERIZATION

Depth to Groundwater:	
What is the shallowest depth to groundwater beneath the area affected by the release in feet below ground surface (bgs)?	Between 100 and 500 (ft.)
What method was used to determine the depth to groundwater?	NM OSE iWaters Database Search
Did the release impact groundwater or surface water?	☐ Yes ☒ No
What is the minimum distance between the closest lateral extents of the release and the following surface areas?	
A continuously flowing watercourse or any other significant watercourse?	Between 1 and 5 (mi.)
Any lakebed, sinkhole, or playa lake (measured from the ordinary high-water mark)?	Between 1 and 5 (mi.)
An occupied permanent residence, school, hospital, institution or church?	Greater than 5 (mi.)
A spring or a private domestic fresh water well used by less than five households for domestic or stock watering purposes?	Between 500 and 1,000 (ft.)
Any other fresh water well or spring?	Between 500 and 1,000 (ft.)
Incorporated municipal boundaries or a defined municipal fresh water well field?	Greater than 5 (mi.)
A wetland?	Between 1 and 5 (mi.)
A subsurface mine?	Greater than 5 (mi.)
A (non-karst) unstable area?	Between 1 and 5 (mi.)
Categorize the risk of this well/site being in a karst geology.	Low
A 100-year floodplain?	Greater than 5 (mi.)
Did the release impact areas not on an exploration, development, production or storage site?	☐ Yes ☒ No

A search of groundwater databases maintained by the New Mexico Office of the State Engineer (NMOSE) and United States Geological Survey (USGS) was conducted in an effort to determine the horizontal distance to known water sources within a half-mile radius of the Site. Probable groundwater depth was determined using data generated by numeric models based on available water well data and published information.

Additional NMOCD Siting Criteria data was gathered from available resources including Bureau of Land Management (BLM) and Fish and Wildlife Service (FWS) shapefiles; topographic maps; NMOSE and USGS databases; and aerial imagery. The results are depicted in Figures 1, 2A, 2B, and 3.

Remediation Summary & Soil Closure Request

Serrano Roll-Off Overflow • nAPP2609314382

3.0 CLOSURE CRITERIA FOR SOILS IMPACTED BY A RELEASE

Based on the volume and nature of the release, inferred depth to groundwater, and NMOCD Siting Criteria, the Closure Criteria and Reclamation Standards for the Site are as follows:

Probable Depth to Groundwater	Constituent	Laboratory Analytical Method	Closure Criteria*†	Reclamation Standards*‡
Between 100 and 500 (ft.)	Chloride (Cl ⁻)	EPA** 300.0 or SM4500 Cl B	20,000	600
	Total Petroleum Hydrocarbons (TPH)	EPA SW-846 Method 8015M Ext	2,500	100
	Gas Range Organics + Diesel Range Organics (GRO+DRO)	EPA SW-846 Method 8015M	1,000	N/A
	Benzene	EPA SW-846 Methods 8021b or 8260b	10	10
	Benzene, Toluene, Ethylbenzene, Total Xylenes (BTEX)	EPA SW-846 Methods 8021b or 8260b	50	50

* Measured in milligrams per kilogram (mg/kg)

** Environmental Protection Agency

† Table I, Section 19.15.29.12 of the New Mexico Administrative Code (NMAC).

‡ The NMOCD Reclamation Standard applies only to the top 4" of soil in non-production areas. Section 19.15.29.13 D.(1) NMAC.

4.0 REMEDIATION ACTIVITIES SUMMARY

Remediation Plan	
Requesting a remediation plan approval with this submission?	☒ Yes ☐ No
Have the lateral and vertical extents of contamination been fully delineated?	☒ Yes ☐ No
Was this release entirely contained within a lined containment area?	☐ Yes ☒ No
On what estimated date will (or did) the remediation commence?	4/14/2026
On what date will (or did) the final sampling or liner inspection occur?	4/23/2026
On what date will (or was) the remediation complete(d)?	4/29/2026
What is the total surface area (sq. ft.) in need of or that will eventually be reclaimed?	13,145
What is the total volume (cy) in need of or that will eventually be reclaimed?	1,948
What was the total surface area (sq. ft.) that has or will be remediated?	8,653
What was the total volume (cy) that has or will be remediated?	180

Remediation Summary & Soil Closure Request

Serrano Roll-Off Overflow • nAPP2609314382

This remediation utilized the following processes to remediate/reduce contaminants:	
(Ex Situ) Excavation and off-site disposal (i.e., dig and haul, hydrovac, etc.)	☒ Yes ☐ No
(Ex Situ) Excavation and on-site remediation (i.e., On-Site Land Farms)	☐ Yes ☒ No
(In Situ) Soil Vapor Extraction	☐ Yes ☒ No
(In Situ) Chemical processing (i.e., Soil Shredding, Potassium Permanganate, etc.)	☐ Yes ☒ No
(In Situ) Biological processing (i.e., Microbes/Fertilizer, etc.)	☐ Yes ☒ No
(In Situ) Physical processing (i.e., Soil Washing, Gypsum, Disking, etc.)	☐ Yes ☒ No
Ground Water Abatement pursuant to 19.15.30 NMAC	☐ Yes ☒ No
Other (Non-listed remedial process)	☐ Yes ☒ No
Which OCD approved facility was or will be used for off-site disposal?	OWL Landfill Jal
NMOCD Disposal Facility ID?	fJEG1635837366
Summarize any additional remediation activities not included by answers above.	See below

On April 14, 2026, Etech commenced remediation activities at the Site. In accordance with NMOCD regulatory guidelines, impacted soil affected above the Closure Criteria was excavated and stockpiled on-site, pending transfer to an NMOCD-permitted surface waste facility for disposal. Olfactory/visual senses and/or a chloride test kit were utilized to field-screen the horizontal and vertical extent of impacted soil and to guide the excavation. The sidewalls and floor of the excavation were advanced until field tests and field observations suggested that BTEX, TPH, and chloride concentrations were below the applicable Closure Criteria. Representative five-point composite confirmation soil samples representing no more than 200 square feet were collected from the sidewalls and floor of the excavated area to be submitted for laboratory analysis. A summary of soil sampling events is provided below:

Constituent	Highest Observed Concentration (mg/kg)	Sample ID	Sample Date	Sample Depth (ft bgs)	Soil Status
Chloride	19,400	EW 1	4/17/2026	0–0.25	In-Situ
TPH	5,950	FL 36 @ 6"	4/16/2026	0.5	Excavated
GRO+DRO	4,970	FL 36 @ 6"	4/16/2026	0.5	Excavated
BTEX	5.78	FL 17 @ 6"	4/16/2026	0.5	Excavated
Benzene	<0.050	All submitted samples	Various (See Table 1)	0–1	Excavated & In-Situ

Please refer to Table 1 for additional information.

On April 16, 2026, Etech collected 49 confirmation soil samples (FL 1 @ 3" through FL 49 @ 6") from the floor of the excavated area. The soil samples were submitted to a certified commercial laboratory ("the laboratory") for analysis of BTEX, TPH, and chloride. Laboratory analytical results indicated that BTEX concentrations were below the applicable Closure Criteria and/or laboratory reporting limit (RL) in each of the submitted soil samples. GRO+DRO concentrations were below the Closure Criterion in a majority of the submitted soil samples and ranged from less than the laboratory RL in samples FL 3 @ 3", FL 4 @ 6", FL 24 @ 6", FL 25 @ 6", FL 31 @ 6", FL 32 @ 6", FL 33 @ 6", and FL 39 @ 6" through FL 49 @ 6" to 4,970 mg/kg in sample FL 36 @ 6". GRO+DRO concentrations in samples FL 17 @ 6", FL 21 @ 6", FL 26 @ 6", FL 27 @ 6", FL 34 @ 6", FL 36 @ 6", and FL 37 @ 6" exceeded the Closure Criterion. TPH

Remediation Summary & Soil Closure Request

Serrano Roll-Off Overflow • nAPP2609314382

concentrations were below the Closure Criterion in a majority of the submitted soil samples and ranged from less than the laboratory RL in soil samples FL 3 @ 3", FL 4 @ 6", FL 24 @ 6", FL 25 @ 6", FL 31 @ 6", FL 32 @ 6", FL 33 @ 6", and FL 39 @ 6" through FL 49 @ 6" to 5,950 mg/kg in soil sample FL 36 @ 6". TPH concentrations in soil samples FL 17 @ 6", FL 34 @ 6", and FL 36 @ 6" exceeded the Closure Criterion. Chloride concentrations were below the Closure Criterion in each of the submitted soil samples and ranged from less than the laboratory RL in soil samples FL 45 @ 6", FL 47 @ 6", FL 48 @ 6", and FL 49 @ 6" to 11,100 mg/kg in soil sample FL 5 @ 3".

Based on laboratory analytical results, the excavation was subsequently further advanced in the areas characterized by soil samples FL 17 @ 6", FL 21 @ 6", FL 26 @ 6", FL 27 @ 6", FL 34 @ 6", FL 36 @ 6", and FL 37 @ 6".

On April 17, 2026, Etech collected nine (9) confirmation soil samples (NW 1, NW 2, EW 1, EW 2, EW 3, SW 1, SW 2, SW 3, and WW 1) from the sidewalls of the excavated area. The soil samples were submitted to the laboratory for analysis of BTEX, TPH, and chloride. Laboratory analytical results indicated that BTEX, TPH, and chloride concentrations were below the applicable Closure Criteria in each of the submitted soil samples. BTEX and TPH concentrations were also less than the applicable laboratory RL. Chloride concentrations ranged from 10,800 mg/kg in soil sample SW 2 to 19,400 mg/kg in soil sample EW 1.

Etech also collected four (4) delineation soil samples (NH 1 @ 1', EH 1 @ 1', SH 1 @ 1', and WH 1 @ 1') outside the inferred margins of the affected area to ensure that horizontal delineation to the Reclamation Standards of 100 mg/kg TPH and 600 mg/kg chloride had been achieved. The soil samples were submitted to the laboratory for analysis of BTEX, TPH, and chloride. Laboratory analytical results indicated that BTEX, TPH, and chloride concentrations were below the applicable Closure Criteria and Reclamation Standards in each of the submitted soil samples. BTEX and TPH concentrations were also less than the applicable laboratory RL. Chloride concentrations ranged from less than the laboratory RL in soil sample WH 1 @ 1' to 112 mg/kg in soil samples NH 1 @ 1' and SH 1 @ 1'. Based on these laboratory analytical results, the horizontal extent of impacted soil was defined in all cardinal directions.

On April 23, 2026, Etech collected seven (7) confirmation soil samples (FL 17 @ 1', FL 21 @ 1', FL 26 @ 1', FL 27 @ 1', FL 34 @ 1', FL 36 @ 1', and FL 37 @ 1') from the floor of the excavated area. The soil samples were submitted to the laboratory for analysis of BTEX, TPH, and chloride. Laboratory analytical results indicated that BTEX, TPH, and chloride concentrations were below the applicable Closure Criteria in each of the submitted soil samples. BTEX and TPH concentrations were also less than the applicable laboratory RL. Chloride concentrations ranged from 64.0 mg/kg in soil sample FL 36 @ 1' to 336 mg/kg in soil sample FL 34 @ 1'.

The final dimensions of the excavated area were approximately 168 feet in length, 12 to 65 feet in width, and ranged from three inches to one foot in depth. During the course of remediation activities, Etech transported approximately 180 cubic yards of impacted soil to an NMOCD-permitted surface waste facility for disposal and imported a commensurate volume of locally sourced, non-impacted material to the Site for use as backfill.

Soil sample locations and the extent of the excavated area are depicted in Figure 4, "Sample Location Map." Soil chemistry data is summarized in Table 1. General photographs of the Site are provided in Appendix B. Field data is provided in Appendix C. Laboratory analytical reports are provided in Appendix D. Copies of all regulatory correspondence are provided in Appendix E.

5.0 SOIL CLOSURE REQUEST

Soil Closure Request	
Requesting a deferral of remediation closure due date with the approval of this submission?	☐ Yes ☒ No
Requesting a remediation closure approval with this submission?	☒ Yes ☐ No
Have the lateral and vertical extents of contamination been fully delineated?	☒ Yes ☐ No
Was this release entirely contained within a lined containment area?	☐ Yes ☒ No
All areas reasonably needed for production or subsequent drilling operations have been stabilized, returned to the site's existing grade, and have a soil cover that prevents ponding of water, minimizing dust and erosion.	☒ Yes ☐ No
What was the total surface area (sq. ft.) remediated?	8,653
What was the total volume (cy) remediated?	180

Remediation activities were conducted in accordance with NMOCD regulatory guidelines. Impacted soil affected above the Closure Criteria was excavated and transported to an NMOCD-permitted disposal facility. Laboratory analytical results from confirmation soil samples indicate that in-situ concentrations of BTEX, TPH, and chloride are below the applicable Closure Criteria.

Based on laboratory analytical results and field activities conducted to date, Etech recommends that Goodnight provide copies of this *Remediation Summary & Soil Closure Request* to the appropriate agencies and request remediation closure approval for the Site.

6.0 RESTORATION, RECLAMATION & RE-VEGETATION PLAN

Reclamation Report	
All areas not reasonably needed for production or subsequent drilling operations have been reclaimed to contain a minimum of four feet of non-waste containing earthen material with concentrations of less than 600 mg/kg chloride, 100 mg/kg TPH, 50 mg/kg BTEX, and 10 mg/kg benzene?	☐ Yes ☒ No
Requesting a reclamation approval with this submission?	☐ Yes ☒ No
Requesting a restoration complete approval with this submission?	☐ Yes ☒ No
What was the total surface area (in square feet) reclaimed?	1,416
What was the total volume (in cubic yards) reclaimed?	47

Upon receiving laboratory analytical results from confirmation soil samples, the excavated area was backfilled with non-impacted "like" material sourced from the Northern Delaware Basin Landfill (a.k.a., OWL Landfill; NMOCD permit #NM1-63) and emplaced at or near original relative positions. The affected areas were contoured and compacted to achieve erosion control, stability and preservation of surface water flow to the extent practicable.

On June 17, 2026, a 5-point composite soil sample (Delaware Basin Backfill) was collected at the Northern Delaware Basin Landfill to ensure that material obtained from therein was suitable for use as backfill at remediation/reclamation sites in the area. The soil sample was submitted to the laboratory for analysis of BTEX, TPH, and chloride. Laboratory analytical results indicated that BTEX, TPH, and chloride concentrations were below the established Closure Criteria and Reclamation Standards, confirming that material obtained from the landfill was acceptable for use as backfill.

The release was limited to the production pad of an active tank battery and did not impact the adjacent pasture. Final reclamation and revegetation will be conducted upon decommissioning and abandonment of the facility. The reclaimed area will be revegetated with an agency and/or landowner-approved seed mix during the first favorable growing season following closure of the location. The seed mix will be certified as weed-free and installed at the prescribed rate utilizing either a seed drill or a broadcaster and harrow.

7.0 LIMITATIONS

Etech Environmental & Safety Solutions, Inc., has prepared this *Remediation Summary & Soil Closure Request* to the best of its ability. No other warranty, expressed or implied, is made or intended. Etech has examined and relied upon documents referenced in the report and on oral statements made by certain individuals. Etech has not conducted an independent examination of the facts contained in referenced materials and statements. Etech has presumed the genuineness of these documents and statements and that the information provided therein is true and accurate. Etech has prepared the report in a professional manner, using the degree of skill and care exercised by similar environmental consultants. Etech notes that the facts and conditions referenced in this report may change over time, and the conclusions and recommendations set forth herein are applicable only to the facts and conditions as described at the time of this report.

This report has been prepared for the benefit of Goodnight Midstream Permian, LLC. Use of the information contained in this report is prohibited without the consent of Etech and/or Goodnight Midstream Permian, LLC.

8.0 DISTRIBUTION

Goodnight Midstream Permian, LLC


5910 N Central Expy, Suite 800
Dallas, TX 75206

New Mexico Energy, Minerals and Natural Resources Department

Oil Conservation Division, District 1
1220 South St. Francis Drive
Santa Fe, NM 87505

(Electronic Submission)

Figures

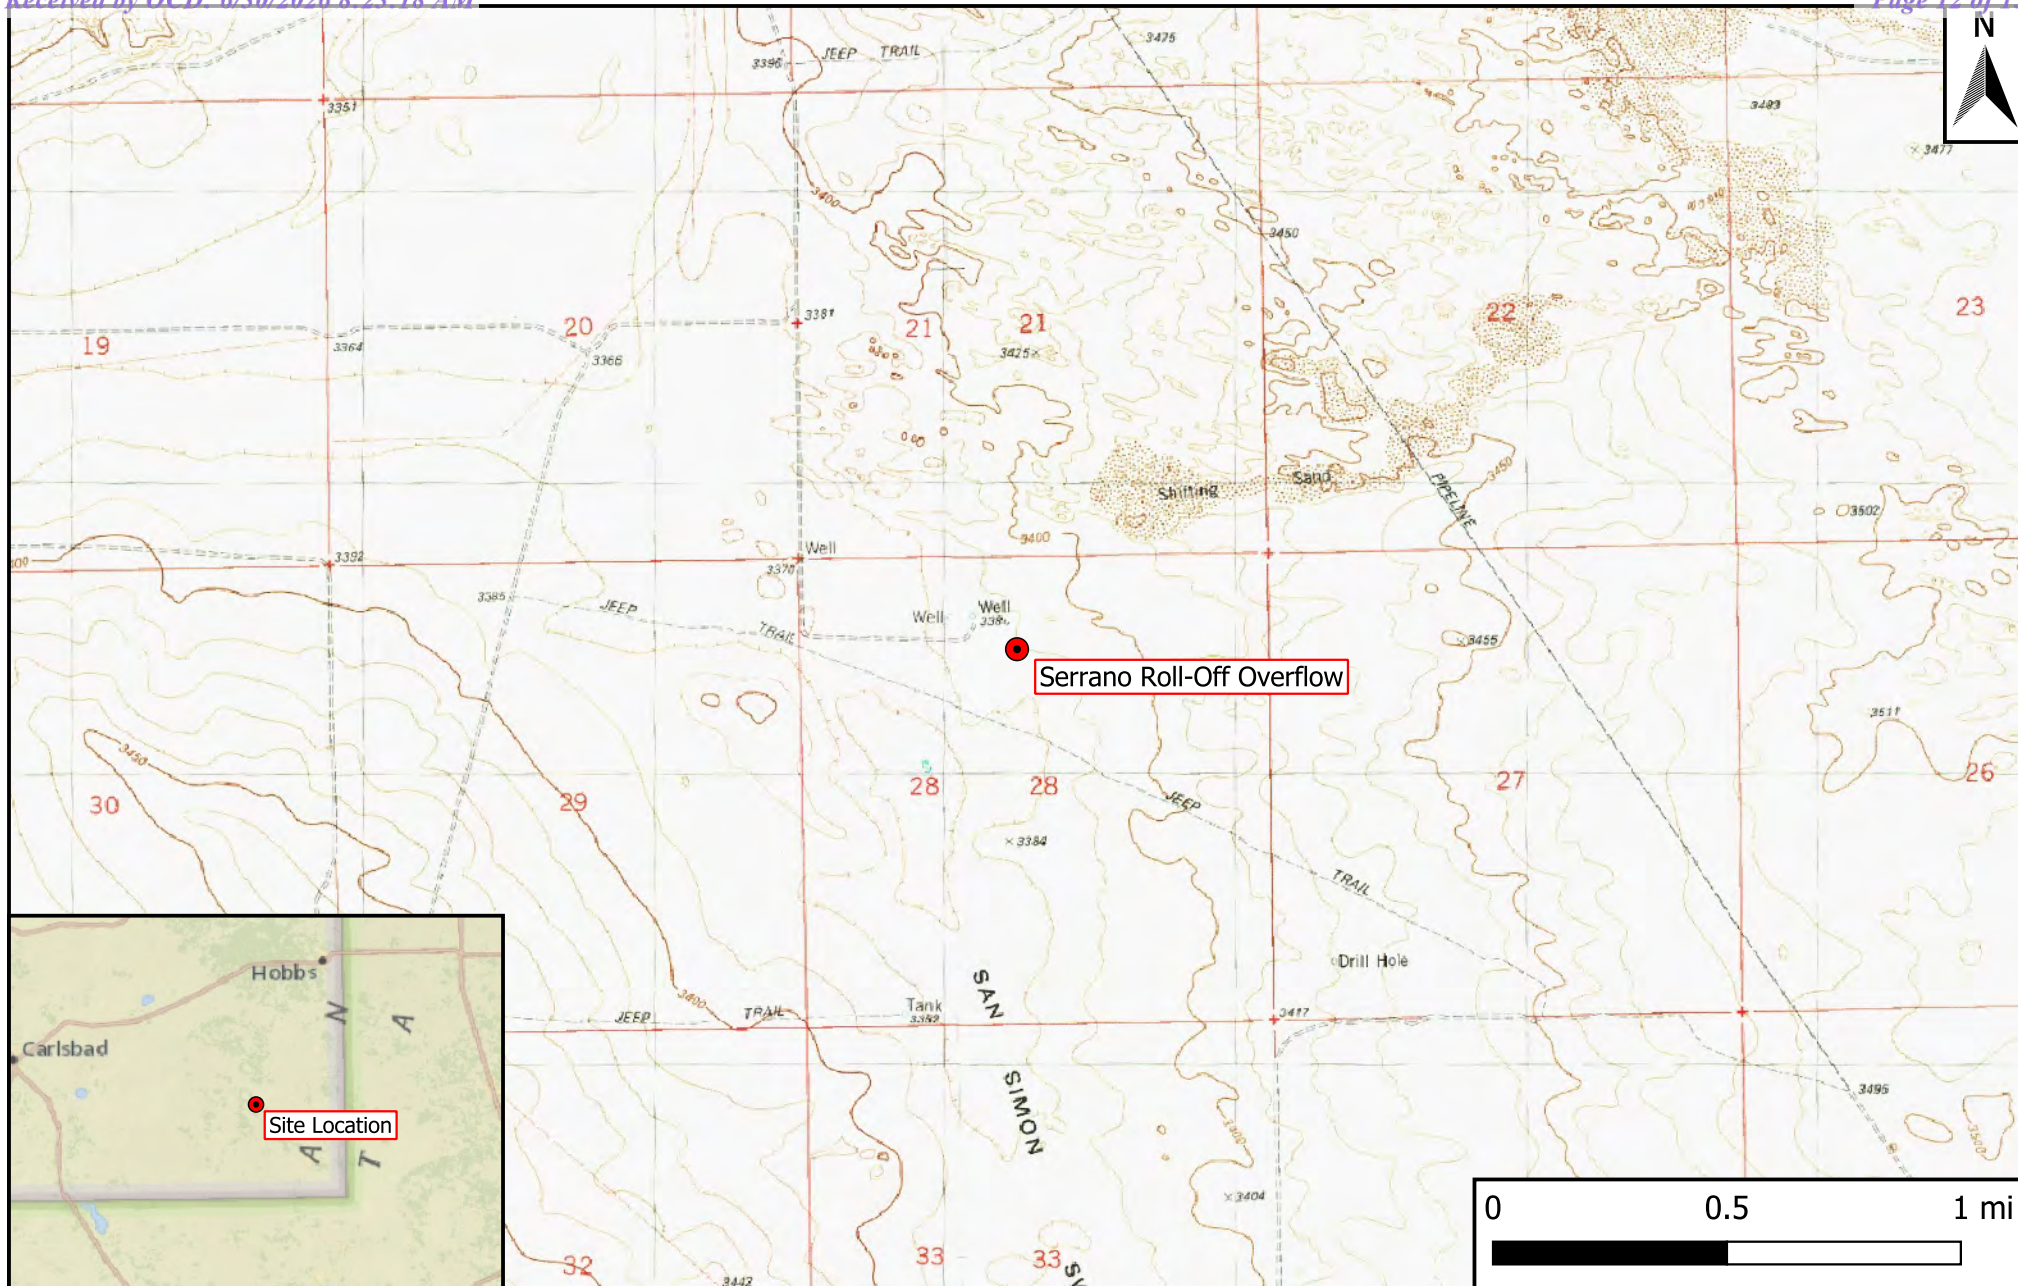

Legend

- Site Location

Figure 1
 Site Location Map
 Goodnight Midstream Permian, LLC
 Serrano Roll-Off Overflow
 GPS: 32.27997, -103.37313
 Lea County, New Mexico



Drafted: bja

Checked: rlc

Date: 5/18/2026

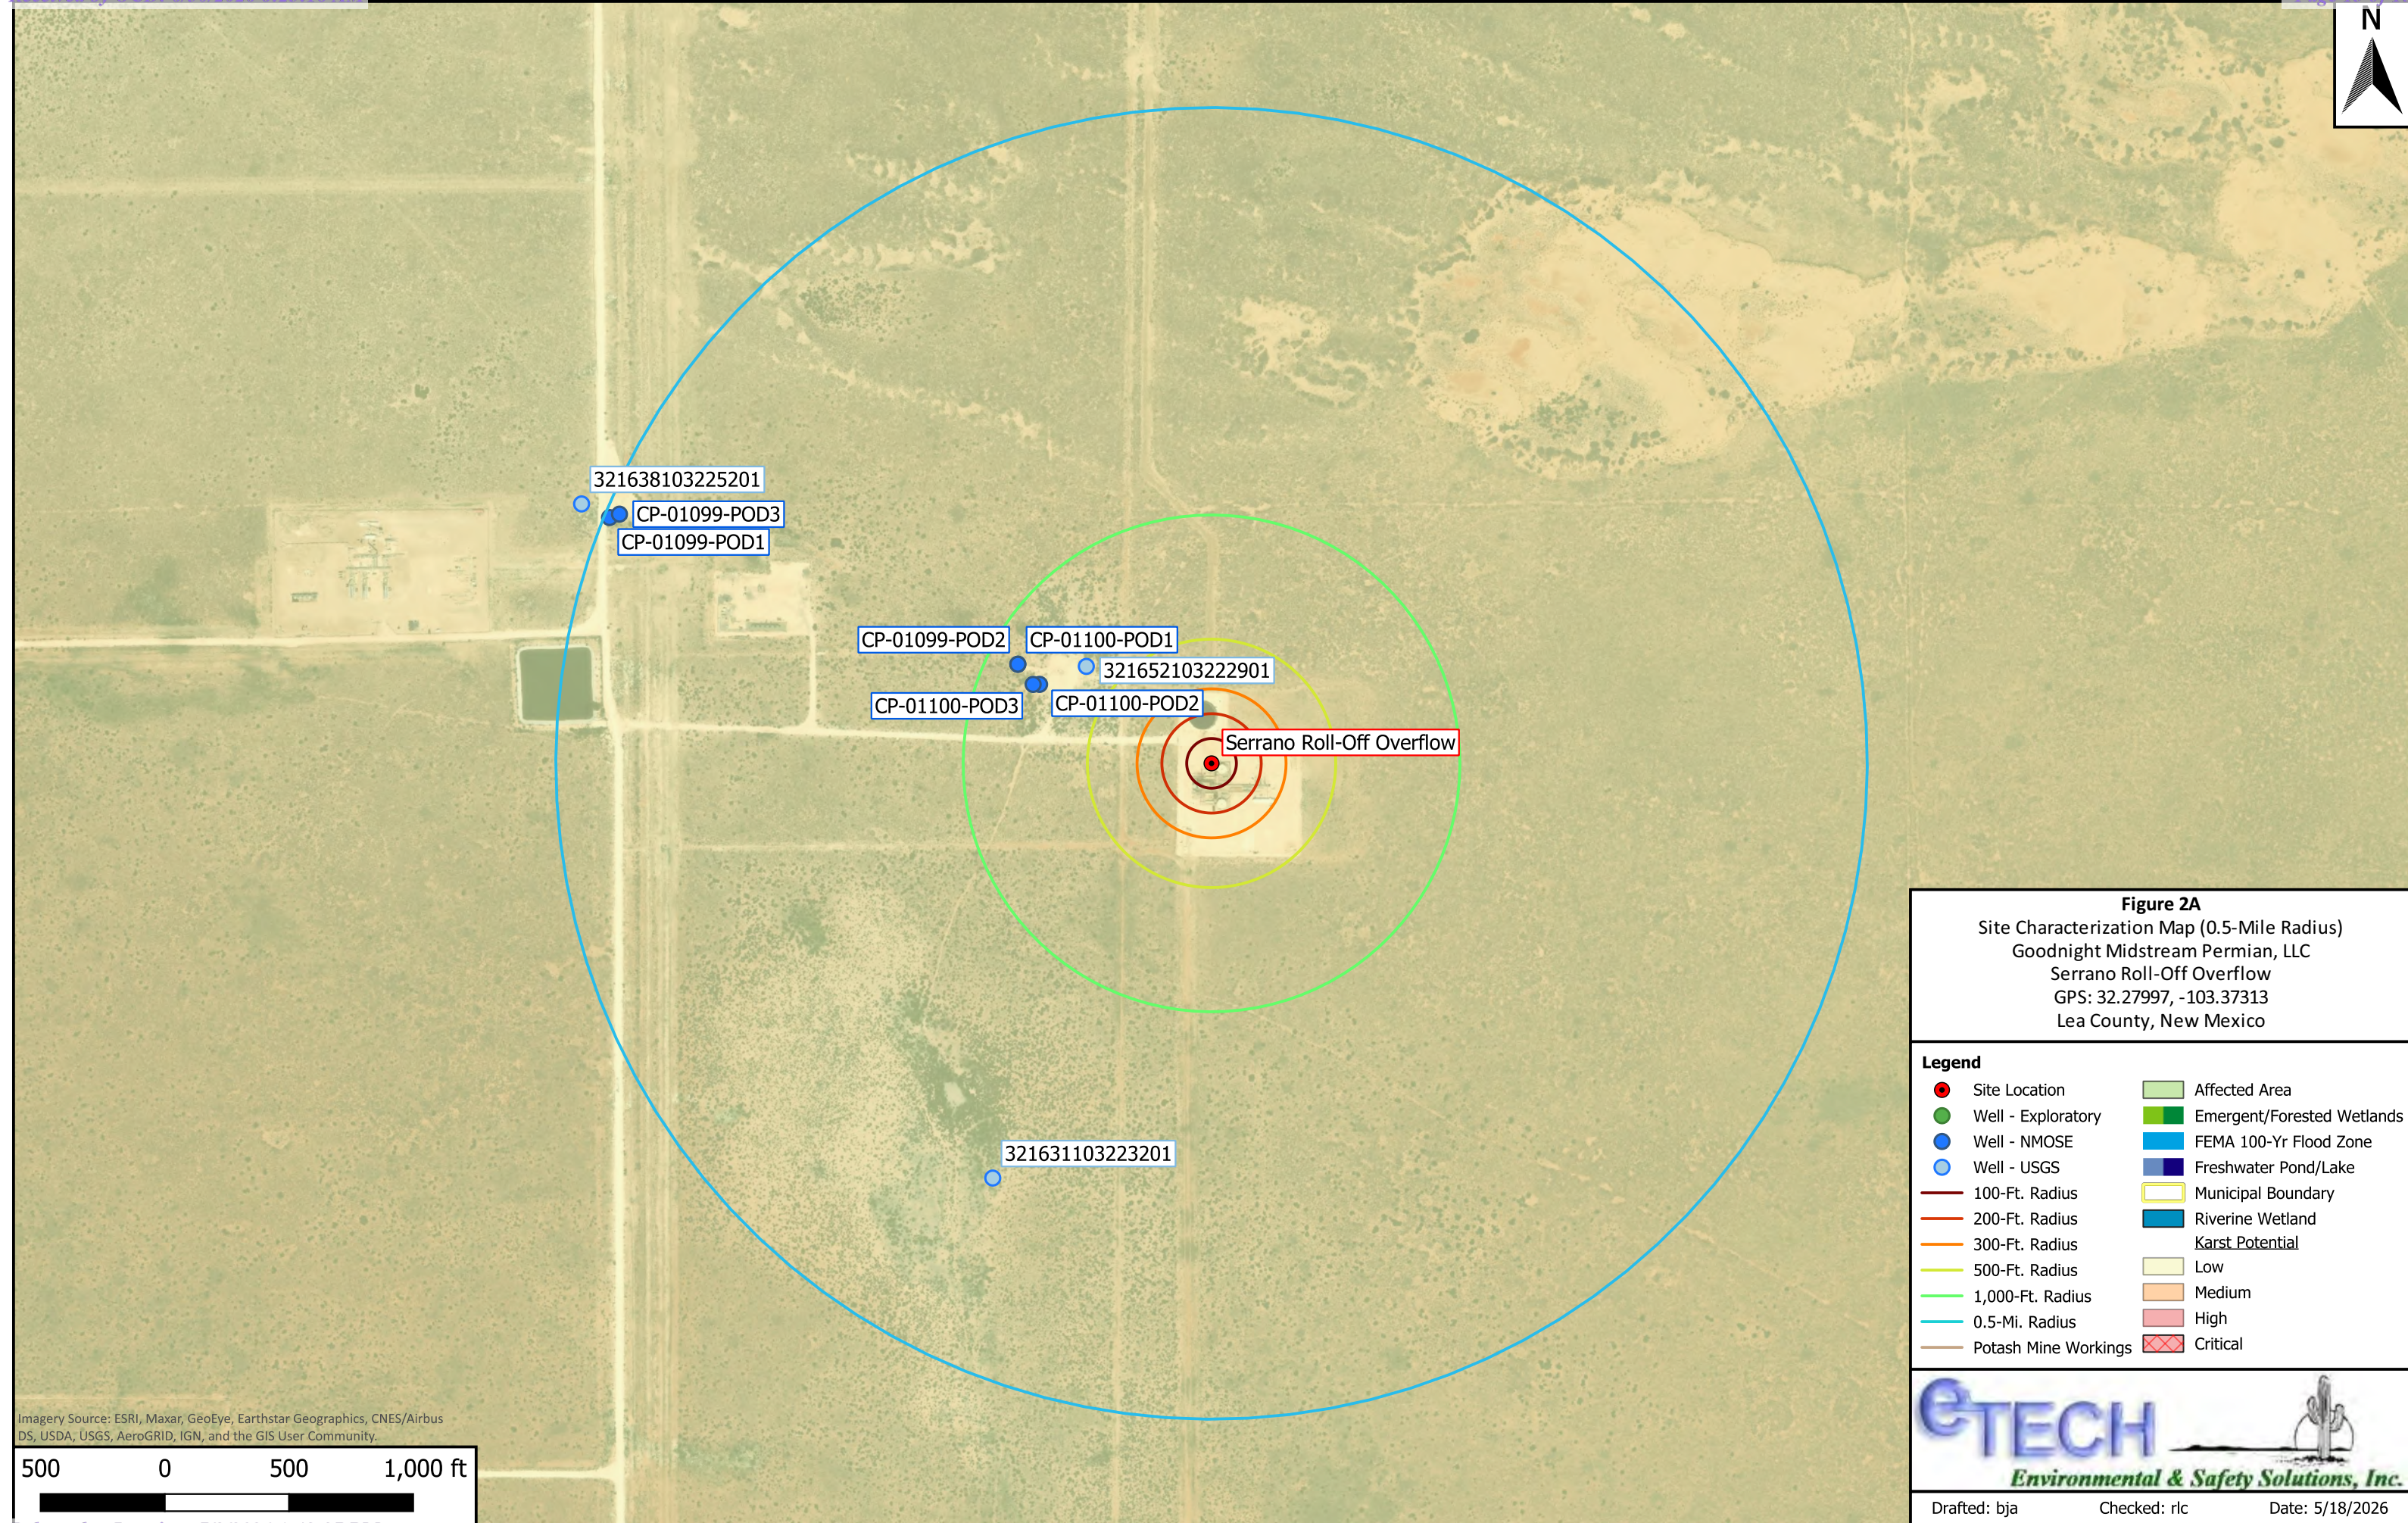



Figure 2A
Site Characterization Map (0.5-Mile Radius)
Goodnight Midstream Permian, LLC
Serrano Roll-Off Overflow
GPS: 32.27997, -103.37313
Lea County, New Mexico

- Legend**
- | | |
|----------------------|----------------------------|
| Site Location | Affected Area |
| Well - Exploratory | Emergent/Forested Wetlands |
| Well - NMOSE | FEMA 100-Yr Flood Zone |
| Well - USGS | Freshwater Pond/Lake |
| 100-Ft. Radius | Municipal Boundary |
| 200-Ft. Radius | Riverine Wetland |
| 300-Ft. Radius | Karst Potential |
| 500-Ft. Radius | Low |
| 1,000-Ft. Radius | Medium |
| 0.5-Mi. Radius | High |
| Potash Mine Workings | Critical |



Drafted: bja Checked: rlc Date: 5/18/2026

Imagery Source: ESRI, Maxar, GeoEye, Earthstar Geographics, CNES/Airbus DS, USDA, USGS, AeroGRID, IGN, and the GIS User Community.



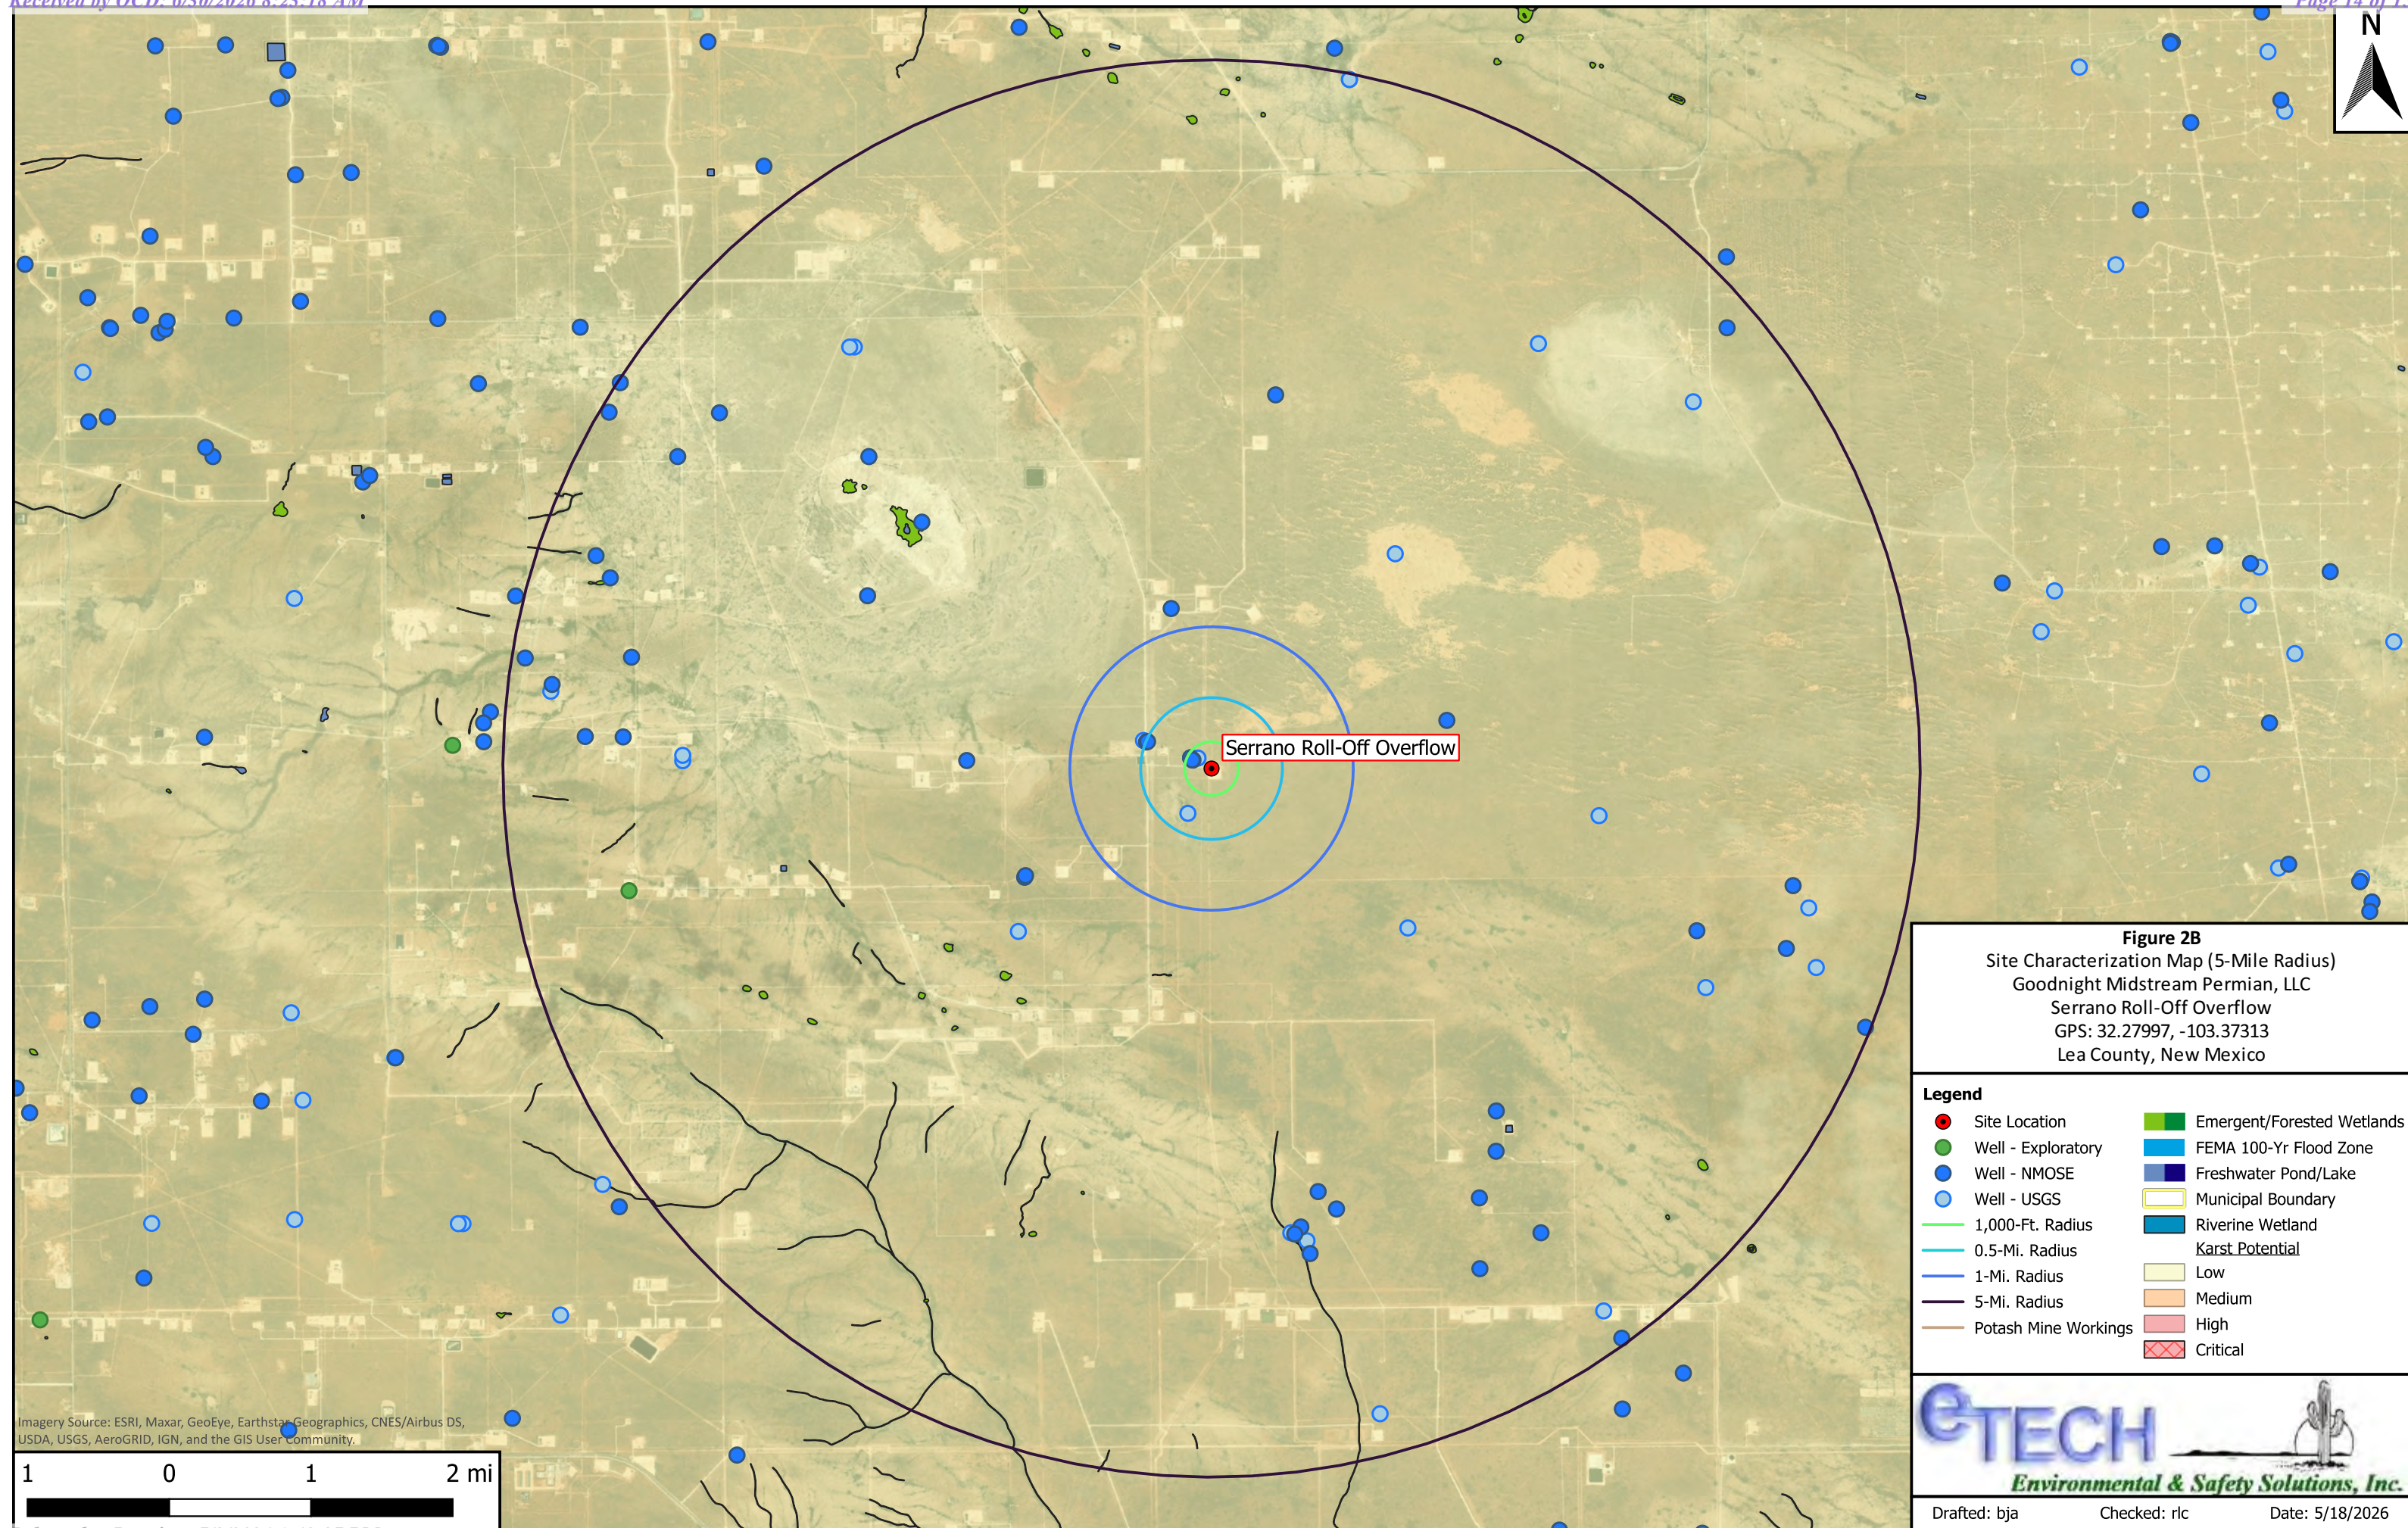


Figure 2B
Site Characterization Map (5-Mile Radius)
Goodnight Midstream Permian, LLC
Serrano Roll-Off Overflow
GPS: 32.27997, -103.37313
Lea County, New Mexico


- Legend**
- | | |
|----------------------|----------------------------|
| ● Site Location | Emergent/Forested Wetlands |
| ● Well - Exploratory | FEMA 100-Yr Flood Zone |
| ● Well - NMOSE | Freshwater Pond/Lake |
| ● Well - USGS | Municipal Boundary |
| 1,000-Ft. Radius | Riverine Wetland |
| 0.5-Mi. Radius | Karst Potential |
| 1-Mi. Radius | Low |
| 5-Mi. Radius | Medium |
| Potash Mine Workings | High |
| | Critical |



Drafted: bja Checked: rlc Date: 5/18/2026

Imagery Source: ESRI, Maxar, GeoEye, Earthstar Geographics, CNES/Airbus DS, USDA, USGS, AeroGRID, IGN, and the GIS User Community.


1 0 1 2 mi

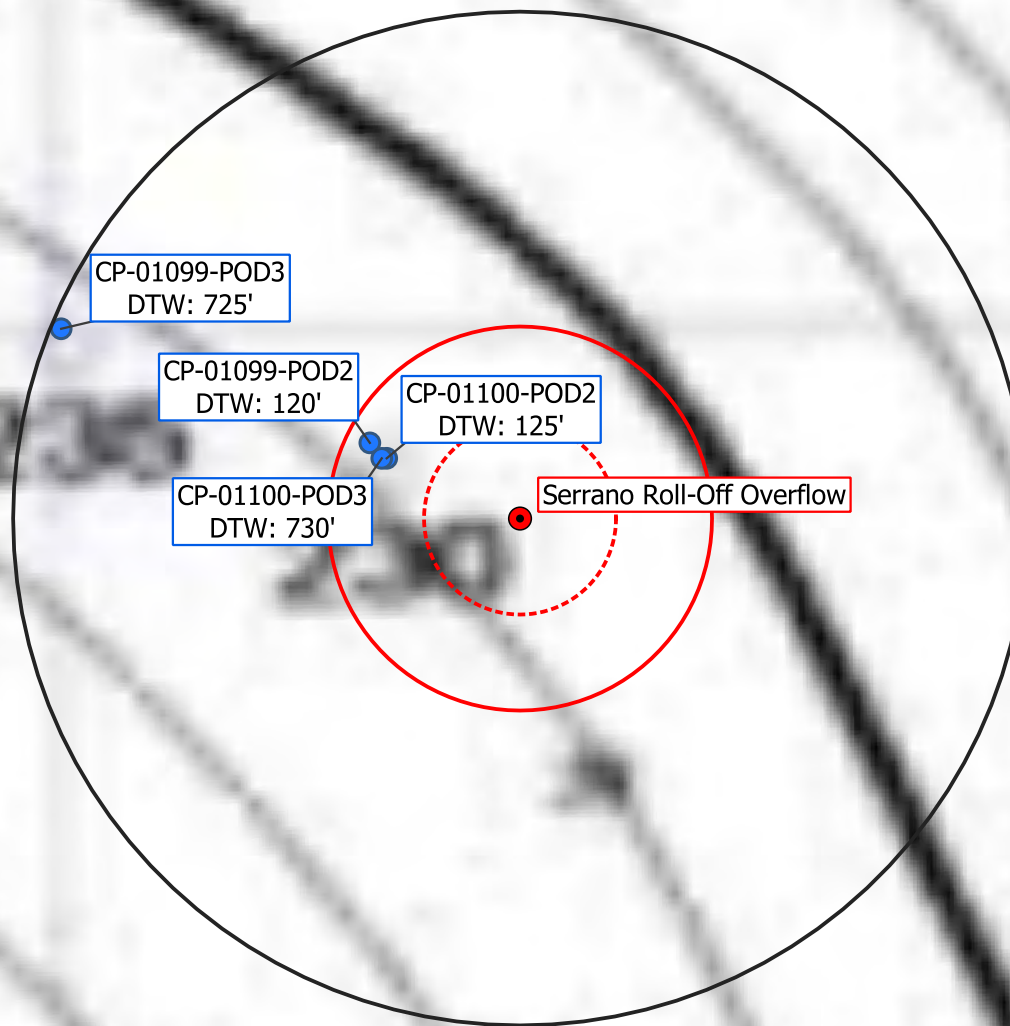

Source: NMOSE and USGS

Note: Only wells with depth to groundwater data ≤ 25 years old are depicted.

0.1 0 0.1 0.2 mi

**Legend**

- Site Location
- Well - NMOSE
- Well - USGS
- Well - Other
- 500-Ft Radius
- 1,000-Ft Radius
- 0.5-Mi Radius

Figure 3


Inferred Depth to Groundwater Map
 Goodnight Midstream Permian, LLC
 Serrano Roll-Off Overflow
 GPS: 32.27997, -103.37313
 Lea County, New Mexico



Drafted: bja

Checked: rlc

Date: 5/18/2026

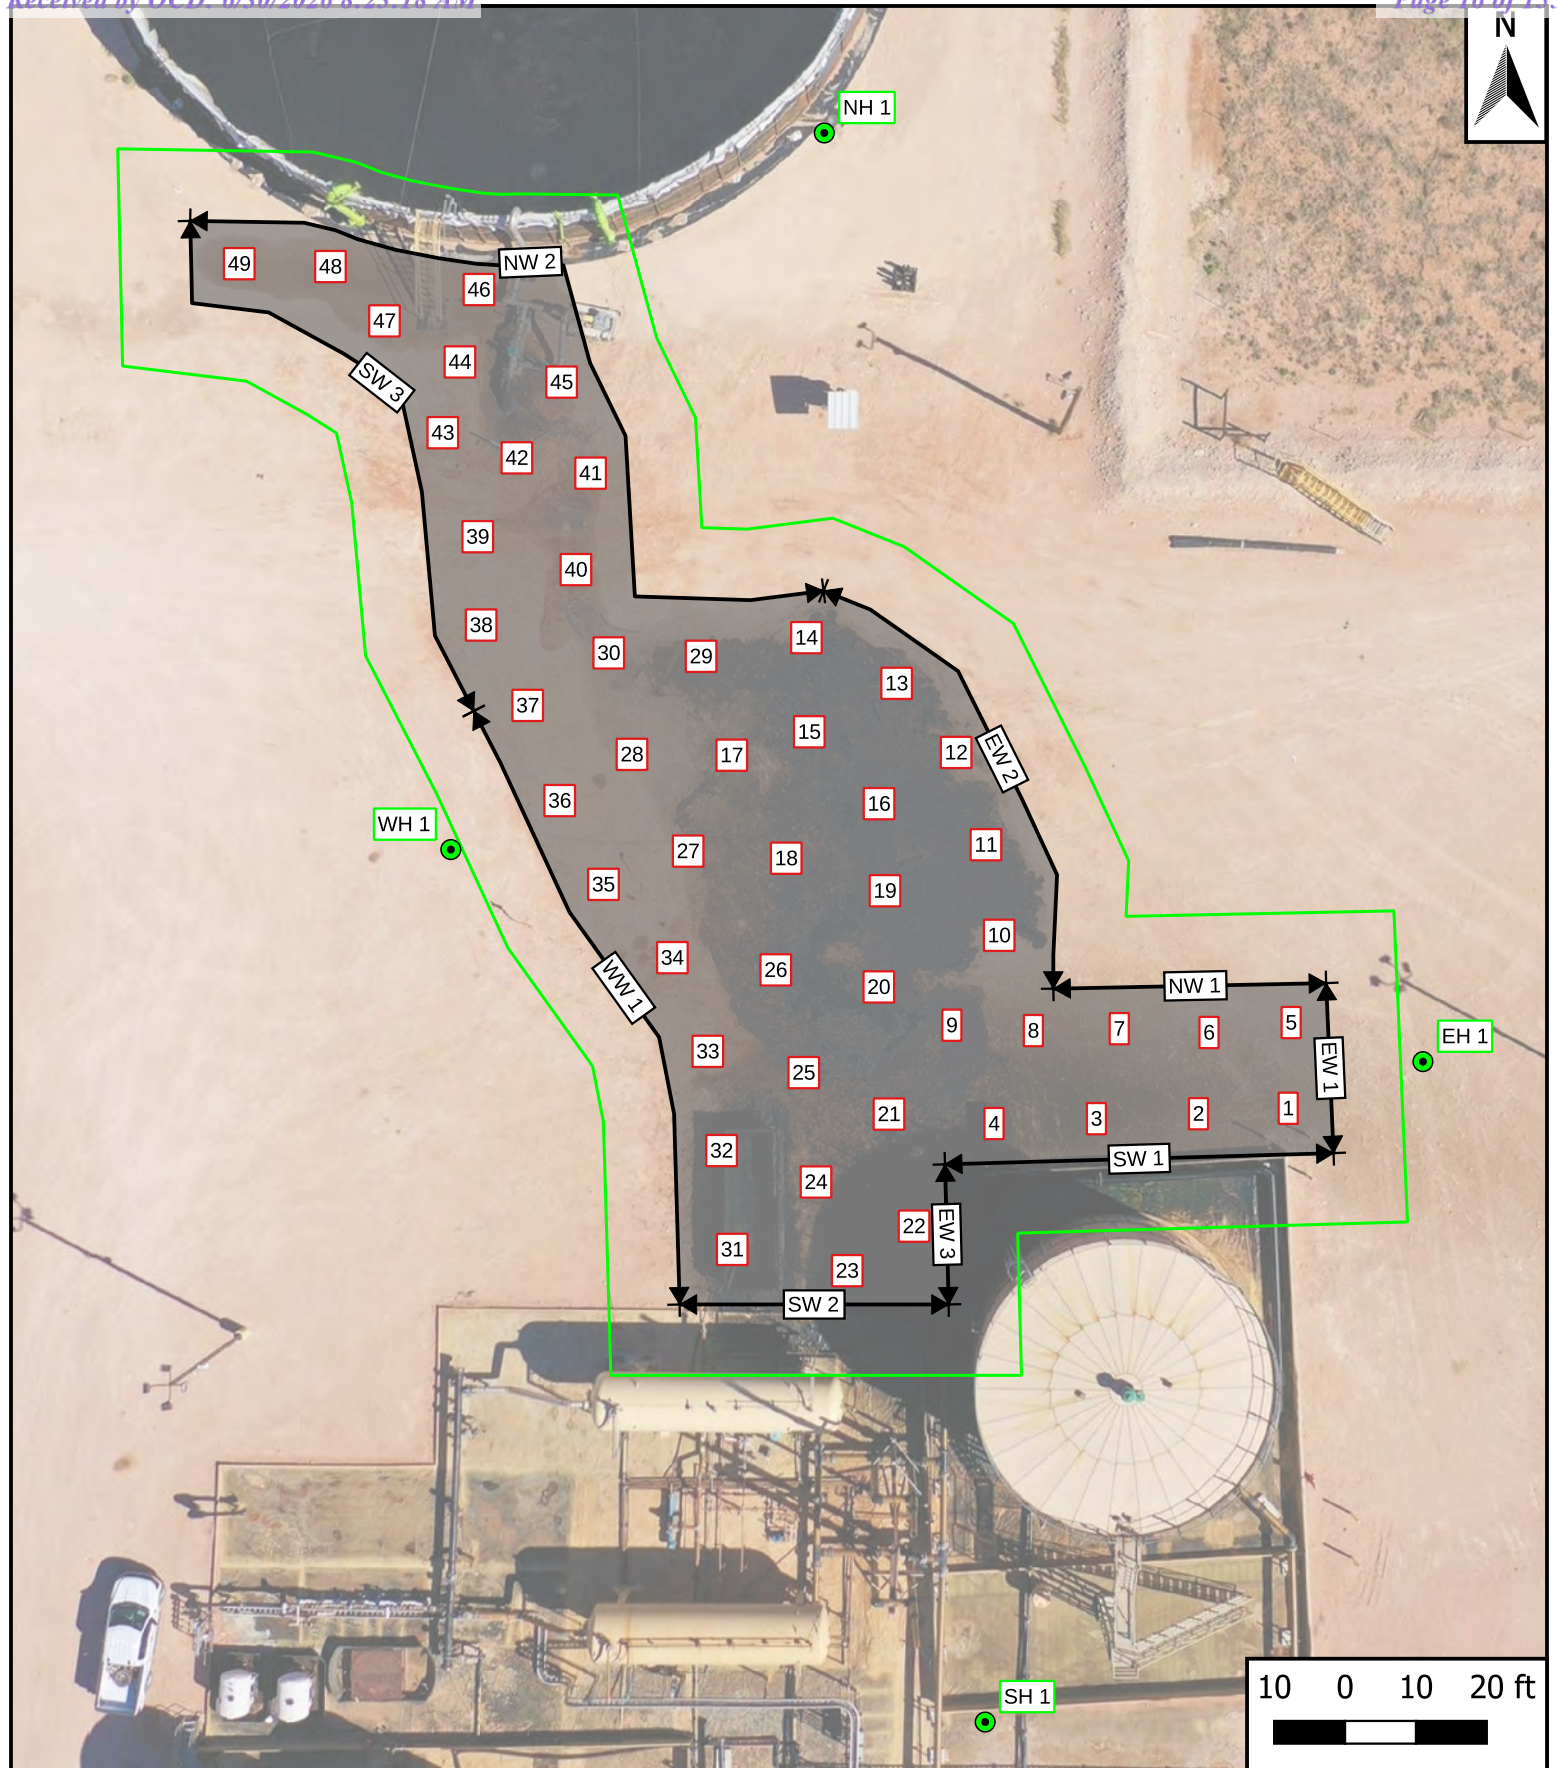**Legend**

- Excavation Extent (~8,653 ft²)
- Area to be Reclaimed (~13,145 ft²)
- Composite Floor Sample
- ←
→
 Composite Wall Sample
- Delineation Sample Location

Figure 4
Sample Location Map
Goodnight Midstream Permian, LLC
Serrano Roll-Off Overflow
GPS: 32.27997, -103.37313
Lea County, New Mexico

eTECH
 Environmental & Safety Solutions, Inc.

Drafted: bja

Checked: jwl

Date: 6/16/2026

Tables

Table 1
Concentrations of BTEX, TPH & Chloride in Soil
Goodnight Midstream Permian, LLC
Serrano Roll-Off Overflow
NMOCD Ref. #: nAPP2609314382

NMOCD Closure Criteria				10	50	-	-	1,000	-	2,500	20,000
NMOCD Reclamation Standard				10	50	-	-	-	-	100	600
Sample ID	Date	Depth (Feet)	Soil Status	SW 846 8021B		SW 846 8015M Ext.					4500 Cl
				Benzene (mg/kg)	BTEX (mg/kg)	GRO C ₆ -C ₁₀ (mg/kg)	DRO C ₁₀ -C ₂₈ (mg/kg)	GRO + DRO C ₆ -C ₂₈ (mg/kg)	ORO C ₂₈ -C ₃₆ (mg/kg)	TPH C ₆ -C ₃₆ (mg/kg)	Chloride (mg/kg)
NH 1 @ 1'	4/17/2026	1	In-Situ	<0.050	<0.300	<10.0	<10.0	<20.0	<10.0	<30.0	112
EH 1 @ 1'	4/17/2026	1	In-Situ	<0.050	<0.300	<10.0	<10.0	<20.0	<10.0	<30.0	32.0
SH 1 @ 1'	4/17/2026	1	In-Situ	<0.050	<0.300	<10.0	<10.0	<20.0	<10.0	<30.0	112
WH 1 @ 1'	4/17/2026	1	In-Situ	<0.050	<0.300	<10.0	<10.0	<20.0	<10.0	<30.0	<16.0
FL 1 @ 3"	4/16/2026	0.25	In-Situ	<0.050	<0.300	<10.0	214	214	56.4	270	5,760
FL 2 @ 3"	4/16/2026	0.25	In-Situ	<0.050	<0.300	<10.0	61.2	61.2	<10.0	61.2	4,560
FL 3 @ 3"	4/16/2026	0.25	In-Situ	<0.050	<0.300	<10.0	<10.0	<20.0	<10.0	<30.0	1,140
FL 4 @ 6"	4/16/2026	0.5	In-Situ	<0.050	<0.300	<10.0	<10.0	<20.0	<10.0	<30.0	128
FL 5 @ 3"	4/16/2026	0.25	In-Situ	<0.050	<0.300	<10.0	214	214	46.7	261	11,100
FL 6 @ 3"	4/16/2026	0.25	In-Situ	<0.050	<0.300	<10.0	642	642	128	770	5,200
FL 7 @ 3"	4/16/2026	0.25	In-Situ	<0.050	<0.300	<10.0	198	198	40.9	239	7,200
FL 8 @ 6"	4/16/2026	0.5	In-Situ	<0.050	<0.300	<10.0	147	147	12.9	160	1,970
FL 9 @ 6"	4/16/2026	0.5	In-Situ	<0.050	<0.300	<10.0	47.7	47.7	<10.0	47.7	1,070
FL 10 @ 6"	4/16/2026	0.5	In-Situ	<0.050	<0.300	<10.0	301	301	39.3	340	2,130
FL 11 @ 6"	4/16/2026	0.5	In-Situ	<0.050	<0.300	<10.0	13.1	13.1	<10.0	13.1	1,950
FL 12 @ 6"	4/16/2026	0.5	In-Situ	<0.050	<0.300	<10.0	236	236	36.1	272	1,730
FL 13 @ 6"	4/16/2026	0.5	In-Situ	<0.050	<0.300	<10.0	28.0	28.0	<10.0	28.0	2,610
FL 14 @ 6"	4/16/2026	0.5	In-Situ	<0.050	<0.300	<10.0	116	116	26.3	142	8,320
FL 15 @ 6"	4/16/2026	0.5	In-Situ	<0.050	<0.300	<10.0	72.8	72.8	<10.0	72.8	2,880
FL 16 @ 6"	4/16/2026	0.5	In-Situ	<0.050	<0.300	<10.0	21.7	21.7	<10.0	21.7	1,600
FL 17 @ 6"	4/16/2026	0.5	Excavated	<0.050	5.78	120	4,100	4,220	620	4,840	3,710
FL 17 @ 1'	4/23/2026	1	In-Situ	<0.050	<0.300	<10.0	<10.0	<20.0	<10.0	<30.0	320
FL 18 @ 6"	4/16/2026	0.5	In-Situ	<0.050	<0.300	<10.0	112	112	21.0	133	1,970
FL 19 @ 6"	4/16/2026	0.5	In-Situ	<0.050	<0.300	<10.0	75.0	75.0	<10.0	75.0	2,110
FL 20 @ 6"	4/16/2026	0.5	In-Situ	<0.050	<0.300	<10.0	21.0	21.0	<10.0	21.0	640
FL 21 @ 6"	4/16/2026	0.5	Excavated	<0.050	<0.300	<10.0	1,760	1,760	355	2,120	4,320
FL 21 @ 1'	4/23/2026	1	In-Situ	<0.050	<0.300	<10.0	<10.0	<20.0	<10.0	<30.0	96.0
FL 22 @ 6"	4/16/2026	0.5	In-Situ	<0.050	<0.300	<10.0	28.3	28.3	<10.0	28.3	5,080
FL 23 @ 6"	4/16/2026	0.5	In-Situ	<0.050	<0.300	<10.0	500	500	114	614	7,760
FL 24 @ 6"	4/16/2026	0.5	In-Situ	<0.050	<0.300	<10.0	<10.0	<20.0	<10.0	<30.0	1,920
FL 25 @ 6"	4/16/2026	0.5	In-Situ	<0.050	<0.300	<10.0	<10.0	<20.0	<10.0	<30.0	1,550
FL 26 @ 6"	4/16/2026	0.5	Excavated	<0.050	<0.300	<10.0	1,170	1,170	257	1,430	1,920
FL 26 @ 1'	4/23/2026	1	In-Situ	<0.050	<0.300	<10.0	<10.0	<20.0	<10.0	<30.0	176
FL 27 @ 6"	4/16/2026	0.5	Excavated	<0.050	<0.300	<10.0	1,860	1,860	394	2,250	3,080
FL 27 @ 1'	4/23/2026	1	In-Situ	<0.050	<0.300	<10.0	<10.0	<20.0	<10.0	<30.0	320
FL 28 @ 6"	4/16/2026	0.5	In-Situ	<0.050	<0.300	<10.0	601	601	138	739	3,400
FL 29 @ 6"	4/16/2026	0.5	In-Situ	<0.050	<0.300	<10.0	12.1	12.1	<10.0	12.1	1,360
FL 30 @ 6"	4/16/2026	0.5	In-Situ	<0.050	<0.300	<10.0	57.7	57.7	16.4	74.1	2,750
FL 31 @ 6"	4/16/2026	0.5	In-Situ	<0.050	<0.300	<10.0	<10.0	<20.0	<10.0	<30.0	2,640
FL 32 @ 6"	4/16/2026	0.5	In-Situ	<0.050	<0.300	<10.0	<10.0	<20.0	<10.0	<30.0	2,670
FL 33 @ 6"	4/16/2026	0.5	In-Situ	<0.050	<0.300	<10.0	<10.0	<20.0	<10.0	<30.0	2,590
FL 34 @ 6"	4/16/2026	0.5	Excavated	<0.050	<0.300	<10.0	3,020	3,020	748	3,770	1,710
FL 34 @ 1'	4/23/2026	1	In-Situ	<0.050	<0.300	<10.0	<10.0	<20.0	<10.0	<30.0	336
FL 35 @ 6"	4/16/2026	0.5	In-Situ	<0.050	<0.300	<10.0	55.8	55.8	<10.0	55.8	1,000
FL 36 @ 6"	4/16/2026	0.5	Excavated	<0.050	<0.300	40.1	4,930	4,970	984	5,950	3,630
FL 36 @ 1'	4/23/2026	1	In-Situ	<0.050	<0.300	<10.0	<10.0	<20.0	<10.0	<30.0	64.0
FL 37 @ 6"	4/16/2026	0.5	Excavated	<0.050	<0.300	<10.0	1,530	1,530	378	1,910	3,090

Dash (-): Not analyzed or not applicable.

Bold: NMOCD Closure Criteria exceedance.

Red: NMOCD Reclamation Standard exceedance.

Red Border with Shading: Highest observed concentration.

Table 1 Concentrations of BTEX, TPH & Chloride in Soil Goodnight Midstream Permian, LLC Serrano Roll-Off Overflow NMOCD Ref. #: nAPP2609314382											
NMOCD Closure Criteria				10	50	-	-	1,000	-	2,500	20,000
NMOCD Reclamation Standard				10	50	-	-	-	-	100	600
Sample ID	Date	Depth (Feet)	Soil Status	SW 846 8021B		SW 846 8015M Ext.					4500 Cl
				Benzene (mg/kg)	BTEX (mg/kg)	GRO C ₆ -C ₁₀ (mg/kg)	DRO C ₁₀ -C ₂₈ (mg/kg)	GRO + DRO C ₆ -C ₂₈ (mg/kg)	ORO C ₂₈ -C ₃₆ (mg/kg)	TPH C ₆ -C ₃₆ (mg/kg)	Chloride (mg/kg)
FL 37 @ 1'	4/23/2026	1	In-Situ	<0.050	<0.300	<10.0	<10.0	<20.0	<10.0	<30.0	112
FL 38 @ 6"	4/16/2026	0.5	In-Situ	<0.050	<0.300	<10.0	15.9	15.9	<10.0	15.9	1,520
FL 39 @ 6"	4/16/2026	0.5	In-Situ	<0.050	<0.300	<10.0	<10.0	<20.0	<10.0	<30.0	1,780
FL 40 @ 6"	4/16/2026	0.5	In-Situ	<0.050	<0.300	<10.0	<10.0	<20.0	<10.0	<30.0	2,680
FL 41 @ 6"	4/16/2026	0.5	In-Situ	<0.050	<0.300	<10.0	<10.0	<20.0	<10.0	<30.0	1,790
FL 42 @ 6"	4/16/2026	0.5	In-Situ	<0.050	<0.300	<10.0	<10.0	<20.0	<10.0	<30.0	2,190
FL 43 @ 6"	4/16/2026	0.5	In-Situ	<0.050	<0.300	<10.0	<10.0	<20.0	<10.0	<30.0	2,770
FL 44 @ 6"	4/16/2026	0.5	In-Situ	<0.050	<0.300	<10.0	<10.0	<20.0	<10.0	<30.0	1,390
FL 45 @ 6"	4/16/2026	0.5	In-Situ	<0.050	<0.300	<10.0	<10.0	<20.0	<10.0	<30.0	<16.0
FL 46 @ 6"	4/16/2026	0.5	In-Situ	<0.050	<0.300	<10.0	<10.0	<20.0	<10.0	<30.0	512
FL 47 @ 6"	4/16/2026	0.5	In-Situ	<0.050	<0.300	<10.0	<10.0	<20.0	<10.0	<30.0	<16.0
FL 48 @ 6"	4/16/2026	0.5	In-Situ	<0.050	<0.300	<10.0	<10.0	<20.0	<10.0	<30.0	<16.0
FL 49 @ 6"	4/16/2026	0.5	In-Situ	<0.050	<0.300	<10.0	<10.0	<20.0	<10.0	<30.0	<16.0
NW 1	4/17/2026	0-0.5	In-Situ	<0.050	<0.300	<10.0	<10.0	<20.0	<10.0	<30.0	14,400
NW 2	4/17/2026	0-0.5	In-Situ	<0.050	<0.300	<10.0	<10.0	<20.0	<10.0	<30.0	18,600
EW 1	4/17/2026	0-0.25	In-Situ	<0.050	<0.300	<10.0	<10.0	<20.0	<10.0	<30.0	19,400
EW 2	4/17/2026	0-0.5	In-Situ	<0.050	<0.300	<10.0	<10.0	<20.0	<10.0	<30.0	13,600
EW 3	4/17/2026	0-1	In-Situ	<0.050	<0.300	<10.0	<10.0	<20.0	<10.0	<30.0	17,800
SW 1	4/17/2026	0-0.5	In-Situ	<0.050	<0.300	<10.0	<10.0	<20.0	<10.0	<30.0	16,600
SW 2	4/17/2026	0-0.5	In-Situ	<0.050	<0.300	<10.0	<10.0	<20.0	<10.0	<30.0	10,800
SW 3	4/17/2026	0-0.5	In-Situ	<0.050	<0.300	<10.0	<10.0	<20.0	<10.0	<30.0	12,500
WW 1	4/17/2026	0-1	In-Situ	<0.050	<0.300	<10.0	<10.0	<20.0	<10.0	<30.0	12,800
Delaware Basin Backfill	6/17/2026	N/A	Backfill	<0.050	<0.300	<10.0	<10.0	<20.0	<10.0	<30.0	320

Dash (-): Not analyzed or not applicable.

Bold: NMOCD Closure Criteria exceedance.

Red: NMOCD Reclamation Standard exceedance.

Red Border with Shading: Highest observed concentration.

Appendices

Appendix A

Depth to Groundwater Information

Point of Diversion Summary

quarters are 1=NW 2=NE 3=SW 4=SE				NAD83 UTM in meters						
quarters are smallest to largest										
Well Tag	POD Nbr	Q64	Q16	Q4	Sec	Tws	Rng	X	Y	Map
221C0	CP 01099 POD2	SW	SW	SW	21	23S	35E	652968.3	3572750.9	

* UTM location was derived from PLSS - see Help

Driller License:	1706	Driller Company:	SUPERIOR DRILLING, LLC		
Driller Name:	WALLACE, BRYCE J.LEE.NER				
Drill Start Date:	2019-01-10	Drill Finish Date:	2019-01-13	Plug Date:	
Log File Date:	2019-01-24	PCW Rcv Date:		Source:	Shallow
Pump Type:		Pipe Discharge Size:		Estimated Yield:	90
Casing Size:	7.60	Depth Well:	750	Depth Water:	120

Water Bearing Stratifications:

Top	Bottom	Description
115	220	Sandstone/Gravel/Conglomerate
580	600	Sandstone/Gravel/Conglomerate
600	740	Other/Unknown

Casing Perforations:

Top	Bottom
460	750

Meter Information

Meter Number:		18926	Meter Make:		SEAMETRICS
Meter Serial Number:		042018001241	Meter Multiplier:		1.0000
Number of Dials:		8	Meter Type:		Diversion
Unit of Measure:		Barrels 42 gal.	Reading Frequency:		Monthly

Meter Readings (in Acre-Feet)

Read Date	Year	Mtr Reading	Flag	Rdr	Comment	Mtr Amount	Online
2019-01-01	2019	0.000	A	RPT	initial reading 01/2019	0.000	
2019-03-31	2019	38875.990	A	RPT		5.011	
2019-07-01	2019	74581.710	A	RPT		4.602	
2019-08-02	2019	79810.313	A	RPT		0.674	
2019-09-01	2019	92668.620	A	RPT		1.657	
2019-09-14	2019	96772.718	A	RPT	Final meter reading. Malfuncti	0.529	
2019-09-14	2019	3722.301	A	ca	Initial reading new meter	0.000	
2019-10-01	2019	13248.301	A	ca		1.228	
2019-11-04	2019	31369.278	A	RPT		2.336	
2019-12-03	2019	47755.642	A	RPT		2.112	
2020-02-01	2020	66698.087	A	RPT		2.442	
2020-03-02	2020	82490.283	A	RPT		2.036	
2020-04-01	2020	92296.819	A	RPT		1.264	
2020-04-13	2020	92296.819	A	RPT	Final Read; meter not working	0.000	
2020-04-13	2020	250287.000	A	RPT	Initial Meter Reading	0.000	
2020-05-04	2020	260756.690	A	RPT		1.349	
2020-06-04	2020	274288.630	A	RPT		1.744	
2020-07-01	2020	280383.000	A	RPT		0.786	
2020-08-03	2020	280462.050	A	RPT		0.010	
2020-10-09	2020	280543.260	A	RPT		0.010	
2020-11-06	2020	294221.930	A	RPT		1.763	
2021-02-10	2021	320664.430	A	ad		3.408	
2021-08-11	2021	420816.380	A	ad		12.909	
2021-09-01	2021	449294.030	A	ad		3.671	
2021-10-06	2021	484949.830	A	ad		4.596	
2021-11-04	2021	517366.960	A	ad		4.178	
2021-12-14	2021	562150.460	A	ad		5.772	
2022-01-01	2022	562150.460	A	ad		0.000	
2022-02-08	2022	562150.460	A	ad		0.000	

Read Date	Year	Mtr Reading	Flag	Rdr	Comment	Mtr Amount	Online
2022-03-02	2022	562150.460	A	ad		0.000	
2022-04-01	2022	562150.460	A	ad		0.000	
2022-09-09	2022	685930.000	A	ad		15.954	
2022-10-10	2022	685930.080	A	ad		0.000	
2022-11-10	2022	685930.080	A	ad		0.000	
2023-05-09	2023	685930.080	A	ad		0.000	
2023-06-07	2023	685930.080	A	ad		0.000	
2023-07-03	2023	685930.080	A	ad		0.000	
2023-08-09	2023	685930.080	A	ad		0.000	
2023-09-30	2023	685930.080	A	ad		0.000	
2023-10-09	2023	685930.080	A	ad		0.000	
2024-01-14	2024	685930.080	A	WEB		0.000	X
2024-02-06	2024	685930.080	A	WEB		0.000	X
2024-04-11	2024	685930.080	A	WEB		0.000	X
2024-05-13	2024	685930.080	A	WEB		0.000	X
2024-05-30	2024	685930.080	A	WEB		0.000	X
2024-07-01	2024	685930.080	A	WEB		0.000	X
2024-08-01	2024	685930.080	A	WEB		0.000	X
2024-09-01	2024	685930.080	A	WEB		0.000	X
2024-10-01	2024	685930.080	A	WEB		0.000	X
2024-11-08	2024	685930.080	A	WEB		0.000	X
2024-12-10	2024	685930.080	A	WEB		0.000	X

YTD Meter Amounts:

Year	Amount
2019	18.149
2020	11.404
2021	34.534

Year	Amount
2022	15.954
2023	0.000
2024	0.000

The data is furnished by the NMOSE/ISC and is accepted by the recipient with the expressed understanding that the OSE/ISC make no warranties, expressed or implied, concerning the accuracy, completeness, reliability, usability, or suitability for any particular purpose of the data.

6/15/26 9:08 AM MST

Point of Diversion Summary



WELL RECORD & LOG

OFFICE OF THE STATE ENGINEER

www.ose.state.nm.us

STATE ENGINEER OFFICE
ROSEMBO, NEW MEXICO


2019 JAN 24 PM 1:20

1. GENERAL AND WELL LOCATION	OSE POD NO. (WELL NO.) CP-1099-POD2		WELL TAG ID NO. ID 221C0		OSE FILE NO(S).			
	WELL OWNER NAME(S) Limestone Basin Properties Ranch, LLC				PHONE (OPTIONAL) 210-835-8057			
	WELL OWNER MAILING ADDRESS 3300 N. A Street, Bldg 1, Ste 220				CITY Midland	STATE TX	ZIP 79705	
	WELL LOCATION (FROM GPS)	DEGREES LATITUDE 32	MINUTES 16	SECONDS 58.1016 N	* ACCURACY REQUIRED: ONE TENTH OF A SECOND * DATUM REQUIRED: WGS 84			
DESCRIPTION RELATING WELL LOCATION TO STREET ADDRESS AND COMMON LANDMARKS - PLSS (SECTION, TOWNSHIP, RANGE) WHERE AVAILABLE								
2. DRILLING & CASING INFORMATION	LICENSE NO. WD1706		NAME OF LICENSED DRILLER Bryce Wallace			NAME OF WELL DRILLING COMPANY Elite Drillers Corporation		
	DRILLING STARTED 01/10/19	DRILLING ENDED 01/13/19	DEPTH OF COMPLETED WELL (FT) 750	BORE HOLE DEPTH (FT) 753	DEPTH WATER FIRST ENCOUNTERED (FT) 120			
	COMPLETED WELL IS: ☒ ARTESIAN ☐ DRY HOLE ☐ SHALLOW (UNCONFINED)				STATIC WATER LEVEL IN COMPLETED WELL (FT) 258			
	DRILLING FLUID: ☒ AIR ☐ MUD ADDITIVES - SPECIFY:							
	DRILLING METHOD: ☒ ROTARY ☐ HAMMER ☐ CABLE TOOL ☐ OTHER - SPECIFY:							
	DEPTH (feet bgl)		BORE HOLE DIAM (inches)	CASING MATERIAL AND/OR GRADE (include each casing string, and note sections of screen)	CASING CONNECTION TYPE (add coupling diameter)	CASING INSIDE DIAM. (inches)	CASING WALL THICKNESS (inches)	SLOT SIZE (inches)
	FROM	TO						
	0	20	20	ASTM53 GRADE B		15.5	.25	
	+2	460	14.75	ASTM53 GRADE B	Welded	8.125	.25	
	460	750	14.75	SDR 17 PVC	Spline	7.6	SDR 17	.032
3. ANNULAR MATERIAL	DEPTH (feet bgl)		BORE HOLE DIAM. (inches)	LIST ANNULAR SEAL MATERIAL AND GRAVEL PACK SIZE-RANGE BY INTERVAL	AMOUNT (cubic feet)	METHOD OF PLACEMENT		
	FROM	TO						
	0	20	20	Portland I/II Cement	22	Trimmie		
	0	453	14.75	Portland I/II Cement	370	Trimmie		
	453	750	14.75	8/16 Silica Sand	230	Pour		

FOR OSE INTERNAL USE

WR-20 WELL RECORD & LOG (Version 06/30/17)

FILE NO. CP-1099	POD NO.	TRN NO. 657214
LOCATION	WELL TAG ID NO.	PAGE 1 OF 2

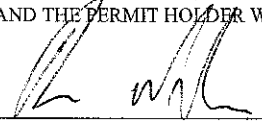DEPTH (feet bgl)	THICKNESS (feet)	COLOR AND TYPE OF MATERIAL ENCOUNTERED - INCLUDE WATER-BEARING CAVITIES OR FRACTURE ZONES (attach supplemental sheets to fully describe all units)	WATER BEARING? (YES / NO)	ESTIMATED YIELD FOR WATER-BEARING ZONES (gpm)	
					FROM
0	35	35	Tan Sand	Y ✓ N	
35	50	15	Red Sand Stone	Y ✓ N	
50	115	65	Red Clay	Y ✓ N	
115	220	105	Red Clay/Sandstone	✓ Y N	10.00
220	380	140	Red Sandstone/Red Siltstone/Red Clay	Y ✓ N	
380	420	40	Tan & Red Sandstone	Y ✓ N	
420	460	40	Red Sandstone/Red Siltstone	Y ✓ N	
460	580	120	Red Siltstone/Gray Clay	Y ✓ N	
580	600	20	Tan & Red Sandstone	✓ Y N	20.00
600	740	140	Red, Gray & Tan Sandstone/Red Clay	✓ Y N	60.00
740	753	13	Red Siltstone/Red Clay	Y ✓ N	
				Y N	
				Y N	
				Y N	
				Y N	
				Y N	
				Y N	
				Y N	
				Y N	
				Y N	
				Y N	
METHOD USED TO ESTIMATE YIELD OF WATER-BEARING STRATA:			TOTAL ESTIMATED WELL YIELD (gpm):		1:20 90.00
☐ PUMP ☒ AIR LIFT ☐ BAILER ☐ OTHER - SPECIFY:					
5. TEST RIG SUPERVISION	WELL TEST TEST RESULTS - ATTACH A COPY OF DATA COLLECTED DURING WELL TESTING, INCLUDING DISCHARGE METHOD, START TIME, END TIME, AND A TABLE SHOWING DISCHARGE AND DRAWDOWN OVER THE TESTING PERIOD.				
	MISCELLANEOUS INFORMATION: Estimated well yield is 70 - 80 GPM (air lift). Top water-bearing strata was cemented off.				
PRINT NAME(S) OF DRILL RIG SUPERVISOR(S) THAT PROVIDED ONSITE SUPERVISION OF WELL CONSTRUCTION OTHER THAN LICENSEE:					
6. SIGNATURE	THE UNDERSIGNED HEREBY CERTIFIES THAT, TO THE BEST OF HIS OR HER KNOWLEDGE AND BELIEF, THE FOREGOING IS A TRUE AND CORRECT RECORD OF THE ABOVE DESCRIBED HOLE AND THAT HE OR SHE WILL FILE THIS WELL RECORD WITH THE STATE ENGINEER AND THE PERMIT HOLDER WITHIN 20 DAYS AFTER COMPLETION OF WELL DRILLING:				
	 Bryce Wallace SIGNATURE OF DRILLER / PRINT SIGNEE NAME			01/14/19 DATE	

FOR OSE INTERNAL USE

WR-20 WELL RECORD & LOG (Version 06/30/2017)

FILE NO.


POD NO.

TRN NO.

LOCATION

WELL TAG ID NO.

PAGE 2 OF 2

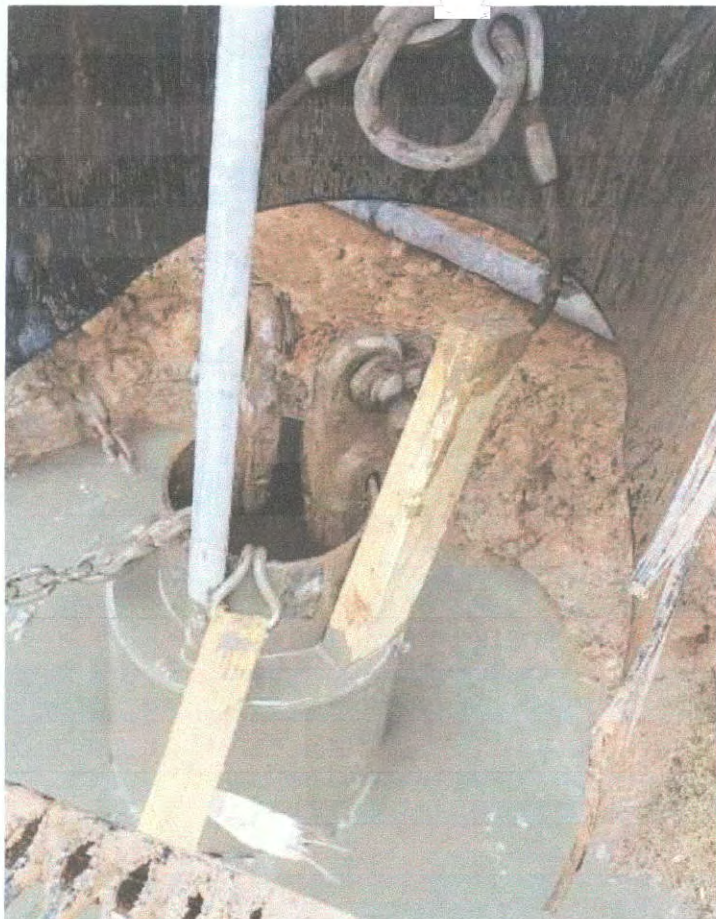

ID STATE OFFICE
ROSA MEXICO

2019 JAN 24 PM 1:20

Point of Diversion Summary

quarters are 1=NW 2=NE 3=SW 4=SE quarters are smallest to largest				NAD83 UTM in meters						
Well Tag	POD Nbr	Q64	Q16	Q4	Sec	Tws	Rng	X	Y	Map
NA	CP 01099 POD3	NW	NW	NW	28	23S	35E	652478.3	3572932.0	

* UTM location was derived from PLSS - see Help

Driller License:	1706	Driller Company:	SUPERIOR DRILLING, LLC
Driller Name:	WALLACE, BRYCE J.LEE.NER		
Drill Start Date:	2020-09-14	Drill Finish Date:	2020-11-02
Log File Date:	2020-11-17	PCW Rcv Date:	Source: Artesian
Pump Type:	Pipe Discharge Size:	Estimated Yield:	50
Casing Size:	7.87	Depth Well:	930
		Depth Water:	725

Water Bearing Stratifications:

Top	Bottom	Description
710	750	Sandstone/Gravel/Conglomerate
750	905	Sandstone/Gravel/Conglomerate

Casing Perforations:

Top	Bottom
640	930

The data is furnished by the NMOSE/ISC and is accepted by the recipient with the expressed understanding that the OSE/ISC make no warranties, expressed or implied, concerning the accuracy, completeness, reliability, usability, or suitability for any particular purpose of the data.



WELL RECORD & LOG

OFFICE OF THE STATE ENGINEER


www.ose.state.nm.us

1. GENERAL AND WELL LOCATION	OSE POD NO. (WELL NO.) CP-1099-POD3		WELL TAG ID NO. ID 20D16		OSE FILE NO(S)			
	WELL OWNER NAME(S) LIMESTONE BASIN PROPERTIES RANCH, LLC				PHONE (OPTIONAL)			
	WELL OWNER MAILING ADDRESS 3300 N A STREET, BLDG 1, STE 220				CITY MIDLAND	STATE TX	ZIP 79705	
	WELL LOCATION (FROM GPS)	DEGREES LATITUDE 32	MINUTES 16	SECONDS 58.03 N	* ACCURACY REQUIRED: ONE TENTH OF A SECOND * DATUM REQUIRED: WGS 84			
DESCRIPTION RELATING WELL LOCATION TO STREET ADDRESS AND COMMON LANDMARKS - PLSS (SECTION, TOWNSHIP, RANGE) WHERE AVAILABLE								
2. DRILLING & CASING INFORMATION	LICENSE NO. WD1706		NAME OF LICENSED DRILLER Bryce Wallace			NAME OF WELL DRILLING COMPANY Elite Drillers Corporation		
	DRILLING STARTED 09/14/20	DRILLING ENDED 11/02/20	DEPTH OF COMPLETED WELL (FT) 930	BORE HOLE DEPTH (FT) 930	DEPTH WATER FIRST ENCOUNTERED (FT) 725			
	COMPLETED WELL IS: ☒ ARTESIAN ☐ DRY HOLE ☐ SHALLOW (UNCONFINED)				STATIC WATER LEVEL IN COMPLETED WELL (FT) 282			
	DRILLING FLUID: ☐ AIR ☒ MUD ADDITIVES - SPECIFY:							
	DRILLING METHOD: ☒ ROTARY ☐ HAMMER ☐ CABLE TOOL ☐ OTHER - SPECIFY:							
	DEPTH (feet bgl)		BORE HOLE DIAM. (inches)	CASING MATERIAL AND/OR GRADE (include each casing string, and note sections of screen)	CASING CONNECTION TYPE (add coupling diameter)	CASING INSIDE DIAM. (inches)	CASING WALL THICKNESS (inches)	SLOT SIZE (inches)
	FROM	TO						
	0	666	17.5	J55 - 48#	T/C	12.615	.38	
	640	930	12.25	J55	T/C	7.875	.38	0.1
3. ANNULAR MATERIAL	DEPTH (feet bgl)		BORE HOLE DIAM. (inches)	LIST ANNULAR SEAL MATERIAL AND GRAVEL PACK SIZE-RANGE BY INTERVAL	AMOUNT (cubic feet)	METHOD OF PLACEMENT		
	FROM	TO						
	0	666	17.5	CLASS C	1021	Pressure Grout		
	640	930	12.25	3/8 PEA GRAVEL	150	Pour		

FOR OSE INTERNAL USE

WR-20 WELL RECORD & LOG (Version 06 30 17)

FILE NO.	CP-1099	POD NO.	3	TRN NO.	678293
LOCATION	235.35E.28.111		WELL TAG ID NO.	20D16	PAGE 1 OF 2

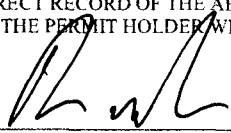	DEPTH (feet bgl)		THICKNESS (feet)	COLOR AND TYPE OF MATERIAL ENCOUNTERED - INCLUDE WATER-BEARING CAVITIES OR FRACTURE ZONES (attach supplemental sheets to fully describe all units)	WATER BEARING? (YES / NO)	ESTIMATED YIELD FOR WATER- BEARING ZONES (gpm)
	FROM	TO				
4. HYDROGEOLOGIC LOG OF WELL	0	60	60	SANDY CALICHE	Y ✓ N	
	60	440	380	RED/BROWN/GREENISH GRAY CLAY	Y ✓ N	
	440	645	205	GRAY/RED/BROWN CLAY	Y ✓ N	
	645	710	65	GRAY/RED/TAN SANDSTONE	Y ✓ N	
	710	750	40	YELLOW/RED STANDSTONE	✓ Y N	25.00
	750	905	155	TAN/RED/GRAY SANDSTONE	✓ Y N	25.00
	905	930	25	RED SILTSTONE/RED CLAY	Y ✓ N	
					Y N	
					Y N	
					Y N	
					Y N	
					Y N	
					Y N	
					Y N	
					Y N	
					Y N	
					Y N	
					Y N	
	METHOD USED TO ESTIMATE YIELD OF WATER-BEARING STRATA: ☐ PUMP ☒ AIR LIFT ☐ BAILER ☐ OTHER – SPECIFY:				TOTAL ESTIMATED WELL YIELD (gpm): 50.00	
	5. TEST; RIG SUPERVISION	WELL TEST	TEST RESULTS - ATTACH A COPY OF DATA COLLECTED DURING WELL TESTING, INCLUDING DISCHARGE METHOD, START TIME, END TIME, AND A TABLE SHOWING DISCHARGE AND DRAWDOWN OVER THE TESTING PERIOD.			
MISCELLANEOUS INFORMATION:						
PRINT NAME(S) OF DRILL RIG SUPERVISOR(S) THAT PROVIDED ONSITE SUPERVISION OF WELL CONSTRUCTION OTHER THAN LICENSEE:						
6. SIGNATURE	THE UNDERSIGNED HEREBY CERTIFIES THAT, TO THE BEST OF HIS OR HER KNOWLEDGE AND BELIEF, THE FOREGOING IS A TRUE AND CORRECT RECORD OF THE ABOVE DESCRIBED HOLE AND THAT HE OR SHE WILL FILE THIS WELL RECORD WITH THE STATE ENGINEER AND THE PERMIT HOLDER WITHIN 20 DAYS AFTER COMPLETION OF WELL DRILLING:					
	 Bryce Wallace					
SIGNATURE OF DRILLER / PRINT SIGNEE NAME					DATE	

FOR USE INTERNAL USE		WR-20 WELL RECORD & LOG (Version 06/30/2017)	
FILE NO.	CP-1099	POD NO.	3
LOCATION		TRN NO.	678293
		WELL TAG ID NO.	PAGE 2 OF 2

Point of Diversion Summary

quarters are 1=NW 2=NE 3=SW 4=SE				NAD83 UTM in meters						
quarters are smallest to largest										
Well Tag	POD Nbr	Q64	Q16	Q4	Sec	Tws	Rng	X	Y	Map
221C1	CP 01100 POD2		NE	NW	28	23S	35E	652995.1	3572726.4	

* UTM location was derived from PLSS - see Help

Driller License:	1706	Driller Company:	SUPERIOR DRILLING, LLC
Driller Name:	WALLACE, BRYCE J.LEE.NER		
Drill Start Date:	2018-12-02	Drill Finish Date:	2018-12-06
Log File Date:	2019-03-01	PCW Rcv Date:	Source: Artesian
Pump Type:	Pipe Discharge Size:	Estimated Yield:	88
Casing Size:	8.00	Depth Well:	750
		Depth Water:	125

Water Bearing Stratifications:

Top	Bottom	Description
120	230	Sandstone/Gravel/Conglomerate
610	650	Sandstone/Gravel/Conglomerate
650	680	Sandstone/Gravel/Conglomerate
680	740	Sandstone/Gravel/Conglomerate

Casing Perforations:

Top	Bottom
470	750

Meter Information

Meter Number:	18925	Meter Make:	TURBINES INC
Meter Serial Number:	104497107961	Meter Multiplier:	1.0000
Number of Dials:	7	Meter Type:	Diversion
Unit of Measure:	Barrels 42 gal.	Reading Frequency:	Monthly

Meter Readings (in Acre-Feet)

Read Date	Year	Mtr Reading	Flag	Rdr	Comment	Mtr Amount	Online
2019-01-01	2019	0.000	A	RPT	installed 1st week January '19	0.000	
2019-07-01	2019	148340.040	A	RPT		19.120	
2019-08-02	2019	164717.430	A	RPT		2.111	
2019-09-01	2019	187773.660	A	RPT		2.972	
2019-10-01	2019	217000.960	A	RPT		3.767	
2019-11-08	2019	251254.180	A	RPT		4.415	
2019-12-03	2019	279755.170	A	RPT		3.674	
2020-02-01	2020	316646.050	A	RPT		4.755	
2020-03-02	2020	349558.490	A	RPT		4.242	
2020-04-01	2020	378792.090	A	RPT		3.768	
2020-05-04	2020	409438.120	A	RPT		3.950	
2020-06-04	2020	447579.100	A	RPT		4.916	
2020-07-02	2020	480585.510	A	RPT		4.254	
2020-08-03	2020	518577.010	A	RPT		4.897	
2020-10-09	2020	593680.450	A	RPT		9.680	
2021-02-05	2021	718993.520	A	ad		16.152	
2021-09-01	2021	901930.740	A	RPT		23.579	
2021-10-05	2021	40856.000	A	ad		0.000	
2021-11-04	2021	82147.000	A	ad		5.322	
2021-12-14	2021	136208.000	A	ad		6.968	
2022-01-01	2022	146512.000	A	ad		1.328	
2022-02-08	2022	146512.000	A	ad		0.000	
2022-03-02	2022	146512.000	A	ad		0.000	
2022-04-01	2022	146512.000	A	ad		0.000	
2022-05-06	2022	180360.000	A	ad		4.363	
2022-06-07	2022	180360.000	A	ad		0.000	
2022-10-10	2022	180360.000	A	ad		0.000	
2022-11-10	2022	180360.000	A	ad		0.000	

Read Date	Year	Mtr Reading	Flag	Rdr	Comment	Mtr Amount	Online
2023-05-09	2023	180360.000	A	ad		0.000	
2023-06-07	2023	180360.000	A	ad		0.000	
2023-07-03	2023	180360.000	A	ad		0.000	
2023-08-09	2023	180360.000	A	ad		0.000	
2023-09-30	2023	180360.000	A	ad		0.000	
2023-10-09	2023	180360.000	A	ad		0.000	
2024-01-14	2024	180360.000	A	WEB		0.000	X
2024-02-06	2024	180360.000	A	WEB		0.000	X
2024-04-11	2024	180360.000	A	WEB		0.000	X
2024-05-13	2024	180360.000	A	WEB		0.000	X
2024-05-30	2024	180360.000	A	WEB		0.000	X
2024-07-01	2024	180360.000	A	WEB		0.000	X
2024-08-01	2024	180360.000	A	WEB		0.000	X
2024-09-01	2024	180360.000	A	WEB		0.000	X
2024-10-01	2024	180360.000	A	WEB		0.000	X
2024-11-08	2024	180360.000	A	WEB		0.000	X
2024-12-10	2024	180360.000	A	WEB		0.000	X

YTD Meter Amounts:

Year	Amount
2019	36.059
2020	40.462
2021	52.021
2022	5.691
2023	0.000
2024	0.000

The data is furnished by the NMOSE/ISC and is accepted by the recipient with the expressed understanding that the OSE/ISC make no warranties, expressed or implied, concerning the accuracy, completeness, reliability, usability, or suitability for any particular purpose of the data.

6/15/26 9:05 AM MST

Point of Diversion Summary

©2024 New Mexico Office of the State Engineer, All Rights Reserved. | [Disclaimer](#) | [Contact Us](#) | [Help](#) | [Home](#) |



WELL RECORD & LOG

OFFICE OF THE STATE ENGINEER


www.ose.state.nm.us

1. GENERAL AND WELL LOCATION	OSE POD NO. (WELL NO.) CP-1100-POD2		WELL TAG ID NO.		OSE FILE NO(S)			
	WELL OWNER NAME(S) Limestone Basin Properties Ranch, LLC				PHONE (OPTIONAL) 210-835-8057			
	WELL OWNER MAILING ADDRESS 3300 N. A Street, Bldg 1, Ste. 220				CITY Midland	STATE TX	ZIP 79705	
	WELL LOCATION (FROM GPS)	DEGREES LATITUDE 32	MINUTES 16	SECONDS 51.1 N	* ACCURACY REQUIRED: ONE TENTH OF A SECOND * DATUM REQUIRED: WGS 84			
DESCRIPTION RELATING WELL LOCATION TO STREET ADDRESS AND COMMON LANDMARKS (SECTION, TOWNSHIP, RANGE) WHERE AVAILABLE								
2. DRILLING & CASING INFORMATION	LICENSE NO. WD1706		NAME OF LICENSED DRILLER Bryce Wallace			NAME OF WELL DRILLING COMPANY Elite Drillers Corporation		
	DRILLING STARTED 12/02/18	DRILLING ENDED 12/06/18	DEPTH OF COMPLETED WELL (FT) 750	BORE HOLE DEPTH (FT) 752	DEPTH WATER FIRST ENCOUNTERED (FT) 125			
	COMPLETED WELL IS: ☒ ARTESIAN ☐ DRY HOLE ☐ SHALLOW (UNCONFINED)				STATIC WATER LEVEL IN COMPLETED WELL (FT) 266			
	DRILLING FLUID: ☒ AIR ☐ MUD ADDITIVES - SPECIFY:							
	DRILLING METHOD: ☒ ROTARY ☐ HAMMER ☐ CABLE TOOL ☐ OTHER - SPECIFY:							
	DEPTH (feet bgl)		BORE HOLE DIAM (inches)	CASING MATERIAL AND/OR GRADE (include each casing string, and note sections of screen)	CASING CONNECTION TYPE (ackl coupling diameter)	CASING INSIDE DIAM. (inches)	CASING WALL THICKNESS (inches)	SLOT SIZE (inches)
	FROM	TO						
	0	20	20	ASTM53 GRADE B		15.5	.25	
	20	290	14.75	ASTM53 GRADE B	Welded	8.125	.25	
	290	470	14.75	SDR 17 PVC	Spline	7.6	SDR 17	
470	750	14.75	SDR 17 PVC	Spline	7.6	SDR 17	.032	
3. ANNULAR MATERIAL	DEPTH (feet bgl)		BORE HOLE DIAM. (inches)	LIST ANNULAR SEAL MATERIAL AND GRAVEL PACK SIZE-RANGE BY INTERVAL	AMOUNT (cubic feet)	METHOD OF PLACEMENT		
	FROM	TO						
	0	20	20	Portland I/II Cement	25	Trimmie		
	0	394	14.75	Portland I/II Cement	315	Trimmie		
	394	750	14.75	8/16 Silica Sand	280	Pour		

FOR OSE INTERNAL USE

WR-20 WELL RECORD & LOG (Version 06-30-17)

FILE NO. CP-1100	POD NO. 2	TRN NO. 057207
LOCATION 235.35E.28.12	WELL TAG ID NO. 221C1	PAGE 1 OF 2

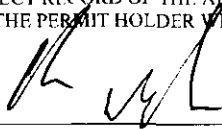4. HYDROGEOLOGIC LOG OF WELL	DEPTH (feet bgl)		THICKNESS (feet)	COLOR AND TYPE OF MATERIAL ENCOUNTERED - INCLUDE WATER-BEARING CAVITIES OR FRACTURE ZONES (attach supplemental sheets to fully describe all units)	WATER BEARING? (YES / NO)	ESTIMATED YIELD FOR WATER- BEARING ZONES (gpm)
	FROM	TO				
	0	10	10	Sand	Y ✓ N	
	10	50	40	Red Sand/Caliche	Y ✓ N	
	50	120	70	Red Clay	Y ✓ N	
	120	230	110	Red Clay/Red Sandstone	✓ Y N	8.00
	230	340	110	Red Sandstone/Siltstone	Y ✓ N	
	340	480	140	Red & Tan Sandstone	Y ✓ N	
	480	580	100	Red & Gray Clay/Siltstone	Y ✓ N	
	580	610	30	Tan & Red Sandstone	Y ✓ N	
	610	650	40	Red Sandstone/Siltstone	✓ Y N	30.00
	650	680	30	Red & Gray Sandstone	✓ Y N	20.00
	680	740	60	Red, Gray & Brown Sandstone/Siltstone	✓ Y N	30.00
	740	752	12	Red Siltstone/Clay	Y N	
					Y N	
					Y N	
					Y N	
					Y N	
					Y N	
					Y N	
					Y N	
					Y N	
METHOD USED TO ESTIMATE YIELD OF WATER-BEARING STRATA: ☐ PUMP ☒ AIR LIFT ☐ BAILER ☐ OTHER - SPECIFY:					TOTAL ESTIMATED WELL YIELD (gpm): 88.00	
5. TEST: RIG SUPERVISION	WELL TEST	TEST RESULTS - ATTACH A COPY OF DATA COLLECTED DURING WELL TESTING, INCLUDING DISCHARGE METHOD, START TIME, END TIME, AND A TABLE SHOWING DISCHARGE AND DRAWDOWN OVER THE TESTING PERIOD.				
	MISCELLANEOUS INFORMATION: Water encountered at 125' was sealed off.					
PRINT NAME(S) OF DRILL RIG SUPERVISOR(S) THAT PROVIDED ONSITE SUPERVISION OF WELL CONSTRUCTION OTHER THAN LICENSEE:						
6. SIGNATURE	THE UNDERSIGNED HEREBY CERTIFIES THAT, TO THE BEST OF HIS OR HER KNOWLEDGE AND BELIEF, THE FOREGOING IS A TRUE AND CORRECT RECORD OF THE ABOVE DESCRIBED HOLE AND THAT HE OR SHE WILL FILE THIS WELL RECORD WITH THE STATE ENGINEER AND THE PERMIT HOLDER WITHIN 20 DAYS AFTER COMPLETION OF WELL DRILLING:  Bryce Wallace 12/10/18 SIGNATURE OF DRILLER / PRINT SIGNEE NAME DATE					

FOR OSE INTERNAL USE

WR-20 WELL RECORD & LOG (Version 06/30/2017)

FILE NO. CP-1100	POD NO. 2	TRN NO. 657207
LOCATION	WELL TAG ID NO.	PAGE 2 OF 2

Point of Diversion Summary

quarters are 1=NW 2=NE 3=SW 4=SE				NAD83 UTM in meters						
quarters are smallest to largest										
Well Tag	POD Nbr	Q64	Q16	Q4	Sec	Tws	Rng	X	Y	Map
NA	CP 01100 POD3	SW	NE	NW	28	23S	35E	652987.2	3572726.3	

* UTM location was derived from PLSS - see Help

Driller License:	1706	Driller Company:	SUPERIOR DRILLING, LLC
Driller Name:	WALLACE, BRYCE J.LEE.NER		
Drill Start Date:	2020-09-12	Drill Finish Date:	2020-11-01
Log File Date:	2020-11-17	PCW Rcv Date:	Source: Artesian
Pump Type:	Pipe Discharge Size:	Estimated Yield:	55
Casing Size:	7.87	Depth Well:	950
		Depth Water:	730

Water Bearing Stratifications:

Top	Bottom	Description
705	940	Sandstone/Gravel/Conglomerate

Casing Perforations:

Top	Bottom
650	950

The data is furnished by the NMOSE/ISC and is accepted by the recipient with the expressed understanding that the OSE/ISC make no warranties, expressed or implied, concerning the accuracy, completeness, reliability, usability, or suitability for any particular purpose of the data.



WELL RECORD & LOG

OFFICE OF THE STATE ENGINEER

www.ose.state.nm.us

1. GENERAL AND WELL LOCATION	OSE POD NO. (WELL NO.) CP-1100-POD3		WELL TAG ID NO.		OSE FILE NO(S)			
	WELL OWNER NAME(S) LIMESTONE BASIN PROPERTIES RANCH, LLC				PHONE (OPTIONAL)			
	WELL OWNER MAILING ADDRESS 3300 N A STREET, BLDG 1, STE 220				CITY MIDLAND	STATE TX	ZIP 79705	
	WELL LOCATION (FROM GPS)	DEGREES LATITUDE 32	MINUTES 16	SECONDS 51.1 N	* ACCURACY REQUIRED: ONE TENTH OF A SECOND			
		LONGITUDE 103	22	31.6 W	* DATUM REQUIRED: WGS 84			
DESCRIPTION RELATING WELL LOCATION TO STREET ADDRESS AND COMMON LANDMARKS - PLSS (SECTION, TOWNSHIP, RANGE) WHERE AVAILABLE								
2. DRILLING & CASING INFORMATION	LICENSE NO. WD1706		NAME OF LICENSED DRILLER Bryce Wallace			NAME OF WELL DRILLING COMPANY Elite Drillers Corporation		
	DRILLING STARTED 09/12/20		DRILLING ENDED 11/01/20		DEPTH OF COMPLETED WELL (FT) 950	BORE HOLE DEPTH (FT) 950	DEPTH WATER FIRST ENCOUNTERED (FT) 730	
	COMPLETED WELL IS: ☒ ARTESIAN ☐ DRY HOLE ☐ SHALLOW (UNCONFINED)					STATIC WATER LEVEL IN COMPLETED WELL (FT) 322		
	DRILLING FLUID: ☐ AIR ☒ MUD ADDITIVES - SPECIFY:							
	DRILLING METHOD: ☒ ROTARY ☐ HAMMER ☐ CABLE TOOL ☐ OTHER - SPECIFY:							
	DEPTH (feet bgl)		BORE HOLE DIAM. (inches)	CASING MATERIAL AND/OR GRADE (include each casing string, and note sections of screen)	CASING CONNECTION TYPE (add coupling diameter)	CASING INSIDE DIAM. (inches)	CASING WALL THICKNESS (inches)	SLOT SIZE (inches)
	FROM	TO						
	0	666	17.5	J55 - 48#	T/C	12.615	.38	
	650	950	12.25	J55	T/C	7.875	.38	0.1
3. ANNULAR MATERIAL	DEPTH (feet bgl)		BORE HOLE DIAM. (inches)	LIST ANNULAR SEAL MATERIAL AND GRAVEL PACK SIZE-RANGE BY INTERVAL	AMOUNT (cubic feet)	METHOD OF PLACEMENT		
	FROM	TO						
	0	666	17.5	CLASS C	509	Pressure Grout		
	650	950	12.25	3/8 PEA GRAVEL	155	Pour		

FOR OSE INTERNAL USE

WR-20 WELL RECORD & LOG (Version 06/30/17)

FILE NO.	CP-1100	POD NO.	3	TRN NO.	678294
LOCATION	Exp1	235.35E.28.123	WELL TAG ID NO.		PAGE 1 OF 2

	DEPTH (feet bgl)		THICKNESS (feet)	COLOR AND TYPE OF MATERIAL ENCOUNTERED - INCLUDE WATER-BEARING CAVITIES OR FRACTURE ZONES <i>(attach supplemental sheets to fully describe all units)</i>	WATER BEARING? (YES / NO)	ESTIMATED YIELD FOR WATER-BEARING ZONES (gpm)	
	FROM	TO					
4. HYDROGEOLOGIC LOG OF WELL	0	20	20	RED/BROWN SAND	Y ✓ N		
	20	80	60	SANDY CALICHE	Y ✓ N		
	80	390	310	RED/BROWN/GREENISH GRAY CLAY	Y ✓ N		
	390	660	270	GRAY/RED/BROWN CLAY	Y ✓ N		
	660	690	30	POSSIBLE EVAPORITE, SANDSTONE	Y ✓ N		
	690	705	15	YELLOW/RED SANDSTONE, STRINGER COARSE SAND W/ CHERT	Y ✓ N		
	705	940	235	TAN/RED/LIGHT GRAY SANDSTONE	✓ Y N	55.00	
	940	950	10	RED SILTSTONE/RED CLAY	Y ✓ N		
					Y N		
					Y N		
					Y N		
					Y N		
					Y N		
					Y N		
					Y N		
					Y N		
					Y N		
					Y N		
	METHOD USED TO ESTIMATE YIELD OF WATER-BEARING STRATA: ☐ PUMP ☒ AIR LIFT ☐ BAILER ☐ OTHER – SPECIFY:					TOTAL ESTIMATED WELL YIELD (gpm): 55.00	
	5. TEST; RIG SUPERVISION	WELL TEST	TEST RESULTS - ATTACH A COPY OF DATA COLLECTED DURING WELL TESTING, INCLUDING DISCHARGE METHOD, START TIME, END TIME, AND A TABLE SHOWING DISCHARGE AND DRAWDOWN OVER THE TESTING PERIOD.				
MISCELLANEOUS INFORMATION:		SEAL # 2017-XXXX-XX					
PRINT NAME(S) OF DRILL RIG SUPERVISOR(S) THAT PROVIDED ONSITE SUPERVISION OF WELL CONSTRUCTION OTHER THAN LICENSEE:							
6. SIGNATURE	THE UNDERSIGNED HEREBY CERTIFIES THAT, TO THE BEST OF HIS OR HER KNOWLEDGE AND BELIEF, THE FOREGOING IS A TRUE AND CORRECT RECORD OF THE ABOVE DESCRIBED HOLE AND THAT HE OR SHE WILL FILE THIS WELL RECORD WITH THE STATE ENGINEER AND THE PERMIT HOLDER WITHIN 20 DAYS AFTER COMPLETION OF WELL DRILLING:						
	 Bryce Wallace					11/08/20	
	SIGNATURE OF DRILLER / PRINT SIGNEE NAME					DATE	

FOR USE INTERNAL USE		WR-20 WELL RECORD & LOG (Version 06/30/2017)	
FILE NO.	CP-1100	POD NO.	3
LOCATION		TRN NO.	678294
		WELL TAG ID NO.	PAGE 2 OF 2



National Water Information System: Web Interface

USGS Water Resources

Data Category:
Groundwater

Geographic Area:
United States

GO

[Click for News Bulletins](#)

Groundwater levels for the Nation

i Ground water level pages will be decommissioned in early 2026. These gwlevel pages are frozen as of November 18th, 2025. Please find the [modernized pages in WDFN](#) that suit you best. Learn more about our [modernization plans and timeline](#) and [new pages](#).

Search Results -- 1 sites found

Agency code = usgs
site_no list =

- 321249103211101

Minimum number of levels = 1
[Save file of selected sites](#) to local disk for future upload

USGS 321249103211101 24S.35E.15.234

Lea County, New Mexico
Latitude 32°12'49", Longitude 103°21'11" NAD27
Land-surface elevation 3,346 feet above NAVD88
This well is completed in the Other aquifers (N9999OTHER) national aquifer.

Output formats

Table of data
Tab-separated data
Graph of data
Reselect period

Date	Time	? Water-level date-time accuracy	? Parameter code	Water level, feet below land surface	Water level, feet above specific vertical datum	Referenced vertical datum	? Status	? Method of measurement	? Measuring agency	? Source of measurement	? Water-level approval status
			7								
1968-06-12		D	72019	1.45			1	Z			A
1970-12-09		D	72019	6.27			1	Z			A
1976-01-16		D	72019	9.83			1	Z			A

Explanation		
Section	Code	Description
Water-level date-time accuracy	D	Date is accurate to the Day
Parameter code	62610	Groundwater level above NGVD 1929, feet
Parameter code	62611	Groundwater level above NAVD 1988, feet
Parameter code	72019	Depth to water level, feet below land surface
Referenced vertical datum	NAVD88	North American Vertical Datum of 1988
Referenced vertical datum	NGVD29	National Geodetic Vertical Datum of 1929
Status	1	Static
Method of measurement	Z	Other.
Measuring agency		Not determined
Source of measurement		Not determined
Water-level approval status	A	Approved for publication -- Processing and review completed.

[Questions or Comments](#)[Help](#)[Data Tips](#)[Explanation of terms](#)[Subscribe for system changes](#)[Accessibility](#) [FOIA](#) [Privacy](#) [Policies and Notices](#)[U.S. Department of the Interior](#) | [U.S. Geological Survey](#)**Title: Groundwater for USA: Water Levels****URL: <https://nwis.waterdata.usgs.gov/nwis/gwlevels?>**Page Contact Information: [USGS Water Data Support Team](#)

Page Last Modified: 2026-01-22 18:03:36 EST

0.54 0.3 nadww01

Appendix B

Photographic Log

Photographic Log

Photo Number: 1	
Photo Direction: Overhead/Bird's Eye	
Photo Description: Aerial view of the affected area.	
Date: 4/2/2026	
Coordinates: 32.280162,-103.373068	

Photo Number: 2	
Photo Direction: West-Southwest	
Photo Description: View of the excavated area.	

Photographic Log

Photo Number: 3	
Photo Direction: Northwest	
Photo Description: View of the excavated area.	

Photo Number: 4	
Photo Direction: Southwest	
Photo Description: View of the excavated area.	

Photographic Log

Photo Number: 5	Apr 17, 2026 at 11:12:50 AM +32.280214,-103.373178 342° N 1035.7 m a.s.l. Speed:2.9km/h A photograph showing a large, reddish-brown excavated area. In the background, there is industrial equipment, including a large black pipe and a yellow structure. A compass rose in the bottom left corner indicates North is towards the top-left.
Photo Direction: North-Northwest	
Photo Description: View of the excavated area.	

Photo Number: 6	Apr 17, 2026 at 11:13:09 AM +32.280318,-103.373267 85° E 1035.5 m a.s.l. Speed:2.3km/h A photograph showing industrial equipment, including a large black pipe and a yellow structure, situated in an excavated area. A compass rose in the bottom left corner indicates North is towards the top-left.
Photo Direction: East	
Photo Description: View of the excavated area.	

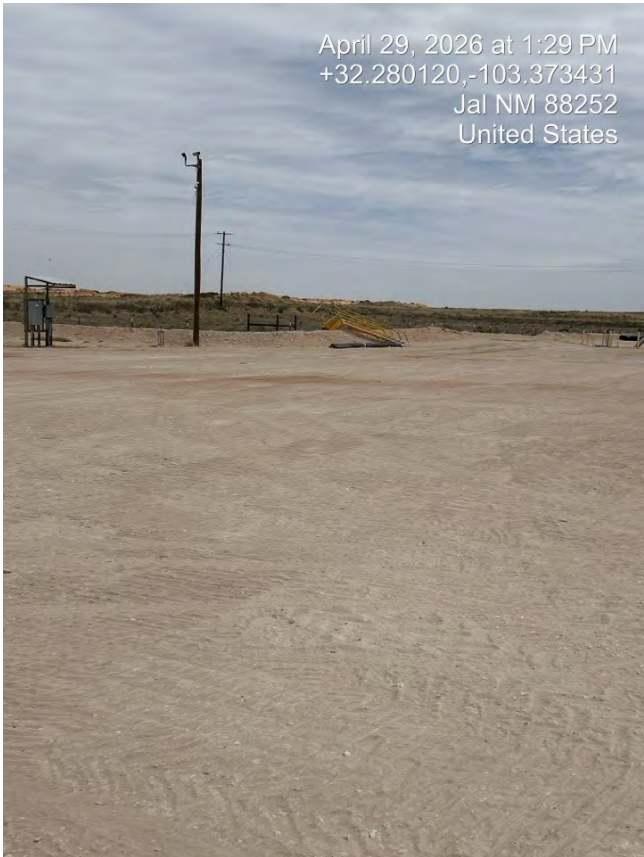
Photographic Log

Photo Number: 7	 April 29, 2026 at 1:27 PM +32.280083,-103.372904 Jal NM 88252 United States
Photo Direction: Northwest	
Photo Description: View of the remediated area following backfill and regrading.	

Photo Number: 8	 April 29, 2026 at 1:27 PM +32.280083,-103.372904 Jal NM 88252 United States
Photo Direction: West	
Photo Description: View of the remediated area following backfill and regrading.	

Photographic Log

Photo Number: 9	 April 29, 2026 at 1:28 PM +32.280288,-103.373341 Jal NM 88252 United States
Photo Direction: Southeast	
Photo Description: View of the remediated area following backfill and regrading.	

Photo Number: 10	 April 29, 2026 at 1:29 PM +32.280120,-103.373431 Jal NM 88252 United States
Photo Direction: East-Northeast	
Photo Description: View of the remediated area following backfill and regrading.	

Photographic Log

Photo Number: 11	 April 29, 2026 at 1:29 PM +32.280120,-103.373431 Jal NM 88252 United States
Photo Direction: East	
Photo Description: View of the remediated area following backfill and regrading.	

Photo Number: 12	 April 29, 2026 at 1:30 PM +32.280419,-103.373496 Jal NM 88252 United States
Photo Direction: East	
Photo Description: View of the remediated area following backfill and regrading.	

Appendix C

Field Data



Sample Log

Date: _____

Project: Serrano Roll-Off Overflow

Project Number: 23910 Latitude: 32.27997 Longitude: -103.37313

Sample ID	PID/Odor	Chloride Conc.	GPS
FL-1	-	11,652	
FL-2	-	1,888	
FL-3	-	7,777	
FL-4	-	4,112	
FL-5	-	5,676	
FL-6	-	2,412	
FL-7	-	1,096	
FL-8	-	14,116	
FL-9	-	3,789	
FL-10	-	12,760	
FL-11	-	15,360	
FL-12	-	4,840	
FL-13	-	12,760	
FL-14	-	15,360	
FL-1	-	7,148	
FL-2	-	4,756	
FL-3	-	1,176	
FL-4 @ 4'	-	112	
FL-5	-	11,168	
FL-6	-		
FL-7	-		
FL-8 @ 4'	-	2,272	
FL-9 @ 4'	-	1,316	
FL-10 @ 4'	-	2,496	
FL-11 @ 4'	-	2,496	
FL-12 @ 4'	-	2,292	
FL-13 @ 4'	-	3,794	
FL-14 @ 4'	-	9,276	
FL-15 @ 4'	-	3,794	
FL-16 @ 4'	-	1,600	
FL-17 @ 4'	-	3,794	
FL-18 @ 4'	-	1,924	
FL-19 @ 4'	-	2,712	
FL-20 @ 4'	-	1,176	
FL-21 @ 4'	-	5,586	

Sample Point = SP #1 @ ## etc
Floor = FL #1 etc
Sidewall = SW #1 etc

Test Trench = TT #1 @ ##
Refusal = SP #1 @ 4'-R
Soil Intended to be Deferred = SP #1 @ 4' In-Situ

Resamples= SP #1 @ 5b or SW #1b
Stockpile = Stockpile #1
GPS Sample Points, Center of Comp Areas



Sample Log

Date: _____

Project: Serrano Roll-Off Overflow

Project Number: 23910 Latitude: 32.27997 Longitude: -103.37313

Sample ID	PID/Odor	Chloride Conc.	GPS
FL-2206"	—	6,570	
FL-2306"	—	7,184	
FL-2406"	—	1,448	
FL-2506"	—	2,712	
FL-2606"	—	2,712	
FL-2706"	—	4,756	
FL-2806"	—	3,744	
FL-2906"	—	1,756	
FL-3006"	—	3,192	
FL-3106"	—	2,712	
FL-3206"	—	2,712	
FL-3306"	—	2,712	
FL-3406"	—	2,292	
FL-3506"	—	1,448	
FL-3606"	—	10,156	
FL-3706"	—	2,944	
FL-3806"	—	2,104	
FL-3906"	—	2,496	
FL-4006"	—	2,144	
FL-4106"	—	1,600	
FL-4206"	—	2,711	
FL-4306"	—	3,192	
FL-4406"	—	1,756	
FL-4506"	—	N/D	
FL-4606"	—	736	
FL-4706"	—	728	
FL-4806"	—	N/D	
FL-4906"	—	N/D	
FH-101	—	N/D	
NH-1-01	—	912	
WH-101	—	320	

Sample Point = SP #1 @ ## etc Test Trench = TT #1 @ ## Resamples= SP #1 @ 5b or SW #1b
Floor = FL #1 etc Refusal = SP #1 @ 4'-R Stockpile = Stockpile #1
Sidewall = SW #1 etc Soil Intended to be Deferred = SP #1 @ 4' In-Situ GPS Sample Points, Center of Comp Areas

Sample Log

Date: _____

Project: Serrano Roll-Off Overflow

Project Number: 23910 Latitude: 32.27997 Longitude: -103.37313

[illegible]

Sample Point = SP #1 @ ## etc

Floor = FL #1 etc

Sidewall = SW #1 etc

Test Trench = TT #1 @ ##

Refusal = SP #1 @ 4'-R

Soil Intended to be Deployed = SP #1 @ 4' In-Situ

Resamples= SP #1 @ 5b or SW #1b

Stockpile = Stockpile #1

GPS Sample Points, Center of Comp Areas

Appendix D

Laboratory Analytical Reports



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

April 21, 2026

JOEL LOWRY

Etech Environmental & Safety Solutions

2617 W MARLAND

HOBBS, NM 88240

RE: SERRANO ROLL-OFF OVERFLOW

Enclosed are the results of analyses for samples received by the laboratory on 04/17/26 14:53.

Cardinal Laboratories is accredited through Texas NELAP under certificate number TX-C25-00101. Accreditation applies to drinking water, non-potable water and solid and chemical materials. All accredited analytes are denoted by an asterisk (*). For a complete list of accredited analytes and matrices visit the TCEQ website at www.tceq.texas.gov/field/qa/lab_accred_certif.html.

Cardinal Laboratories is accredited through the State of Colorado Department of Public Health and Environment for:

Method EPA 552.2	Haloacetic Acids (HAA-5)
Method EPA 524.2	Total Trihalomethanes (TTHM)
Method EPA 524.4	Regulated VOCs (V1, V2, V3)

Accreditation applies to public drinking water matrices.

This report meets NELAP requirements and is made up of a cover page, analytical results, and a copy of the original chain-of-custody. If you have any questions concerning this report, please feel free to contact me.

Sincerely,

A handwritten signature in black ink that reads "Coley D. Keene". The signature is written in a cursive style with a large, stylized 'C' at the beginning.

Celey D. Keene

Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

Etech Environmental & Safety Solutions
 JOEL LOWRY
 2617 W MARLAND
 HOBBS NM, 88240
 Fax To:

Received: 04/17/2026
 Reported: 04/21/2026
 Project Name: SERRANO ROLL-OFF OVERFLOW
 Project Number: 23910
 Project Location: GOODNIGHT 32.27997-103.37313

Sampling Date: 04/16/2026
 Sampling Type: Soil
 Sampling Condition: Cool & Intact
 Sample Received By: Alyssa Parras

Sample ID: FL 1 @ 3" (H262234-01)

BTX 8021B		mg/kg		Analyzed By: JH					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Benzene*	<0.050	0.050	04/20/2026	ND	2.10	105	2.00	1.30	
Toluene*	<0.050	0.050	04/20/2026	ND	2.20	110	2.00	2.96	QM-07
Ethylbenzene*	<0.050	0.050	04/20/2026	ND	2.37	119	2.00	3.10	QM-07
Total Xylenes*	<0.150	0.150	04/20/2026	ND	7.18	120	6.00	1.86	QM-07
Total BTX	<0.300	0.300	04/20/2026	ND					

Surrogate: 4-Bromofluorobenzene (PID) 121 % 70.4-141

Chloride, SM4500Cl-B		mg/kg		Analyzed By: KH					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Chloride	5760	16.0	04/20/2026	ND	416	104	400	0.00	

TPH 8015M		mg/kg		Analyzed By: JF					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	<10.0	10.0	04/20/2026	ND	198	99.2	200	2.06	
DRO >C10-C28*	214	10.0	04/20/2026	ND	193	96.6	200	0.327	
EXT DRO >C28-C36	56.4	10.0	04/20/2026	ND					

Surrogate: 1-Chlorooctane 59.3 % 52.4-130

Surrogate: 1-Chlorooctadecane 58.0 % 39.9-141

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

Etech Environmental & Safety Solutions
 JOEL LOWRY
 2617 W MARLAND
 HOBBS NM, 88240
 Fax To:

Received: 04/17/2026
 Reported: 04/21/2026
 Project Name: SERRANO ROLL-OFF OVERFLOW
 Project Number: 23910
 Project Location: GOODNIGHT 32.27997-103.37313

Sampling Date: 04/16/2026
 Sampling Type: Soil
 Sampling Condition: Cool & Intact
 Sample Received By: Alyssa Parras

Sample ID: FL 2 @ 3" (H262234-02)

BTEx 8021B		mg/kg		Analyzed By: JH						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Benzene*	<0.050	0.050	04/20/2026	ND	2.10	105	2.00	1.30		
Toluene*	<0.050	0.050	04/20/2026	ND	2.20	110	2.00	2.96		
Ethylbenzene*	<0.050	0.050	04/20/2026	ND	2.37	119	2.00	3.10		
Total Xylenes*	<0.150	0.150	04/20/2026	ND	7.18	120	6.00	1.86		
Total BTEX	<0.300	0.300	04/20/2026	ND						

Surrogate: 4-Bromofluorobenzene (PID) 125 % 70.4-141

Chloride, SM4500Cl-B		mg/kg		Analyzed By: KH						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Chloride	4560	16.0	04/20/2026	ND	416	104	400	0.00		

TPH 8015M		mg/kg		Analyzed By: JF					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	<10.0	10.0	04/20/2026	ND	198	99.2	200	2.06	
DRO >C10-C28*	61.2	10.0	04/20/2026	ND	193	96.6	200	0.327	
EXT DRO >C28-C36	<10.0	10.0	04/20/2026	ND					

Surrogate: 1-Chlorooctane 64.5 % 52.4-130

Surrogate: 1-Chlorooctadecane 57.6 % 39.9-141

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

Etech Environmental & Safety Solutions
 JOEL LOWRY
 2617 W MARLAND
 HOBBS NM, 88240
 Fax To:

Received: 04/17/2026
 Reported: 04/21/2026
 Project Name: SERRANO ROLL-OFF OVERFLOW
 Project Number: 23910
 Project Location: GOODNIGHT 32.27997-103.37313

Sampling Date: 04/16/2026
 Sampling Type: Soil
 Sampling Condition: Cool & Intact
 Sample Received By: Alyssa Parras

Sample ID: FL 3 @ 3" (H262234-03)

BTEx 8021B		mg/kg		Analyzed By: JH						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Benzene*	<0.050	0.050	04/20/2026	ND	2.10	105	2.00	1.30		
Toluene*	<0.050	0.050	04/20/2026	ND	2.20	110	2.00	2.96		
Ethylbenzene*	<0.050	0.050	04/20/2026	ND	2.37	119	2.00	3.10		
Total Xylenes*	<0.150	0.150	04/20/2026	ND	7.18	120	6.00	1.86		
Total BTEX	<0.300	0.300	04/20/2026	ND						

Surrogate: 4-Bromofluorobenzene (PID) 116 % 70.4-141

Chloride, SM4500Cl-B		mg/kg		Analyzed By: KH						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Chloride	1140	16.0	04/20/2026	ND	416	104	400	0.00		

TPH 8015M		mg/kg		Analyzed By: JF					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	<10.0	10.0	04/20/2026	ND	198	99.2	200	2.06	
DRO >C10-C28*	<10.0	10.0	04/20/2026	ND	193	96.6	200	0.327	
EXT DRO >C28-C36	<10.0	10.0	04/20/2026	ND					

Surrogate: 1-Chlorooctane 60.4 % 52.4-130

Surrogate: 1-Chlorooctadecane 53.0 % 39.9-141

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

Etech Environmental & Safety Solutions
 JOEL LOWRY
 2617 W MARLAND
 HOBBS NM, 88240
 Fax To:

Received: 04/17/2026
 Reported: 04/21/2026
 Project Name: SERRANO ROLL-OFF OVERFLOW
 Project Number: 23910
 Project Location: GOODNIGHT 32.27997-103.37313

Sampling Date: 04/16/2026
 Sampling Type: Soil
 Sampling Condition: Cool & Intact
 Sample Received By: Alyssa Parras

Sample ID: FL 4 @ 6" (H262234-04)

BTEx 8021B		mg/kg		Analyzed By: JH						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Benzene*	<0.050	0.050	04/20/2026	ND	2.10	105	2.00	1.30		
Toluene*	<0.050	0.050	04/20/2026	ND	2.20	110	2.00	2.96		
Ethylbenzene*	<0.050	0.050	04/20/2026	ND	2.37	119	2.00	3.10		
Total Xylenes*	<0.150	0.150	04/20/2026	ND	7.18	120	6.00	1.86		
Total BTEX	<0.300	0.300	04/20/2026	ND						

Surrogate: 4-Bromofluorobenzene (PID) 107 % 70.4-141

Chloride, SM4500Cl-B		mg/kg		Analyzed By: KH						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Chloride	128	16.0	04/20/2026	ND	416	104	400	0.00		

TPH 8015M		mg/kg		Analyzed By: JF					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	<10.0	10.0	04/20/2026	ND	198	99.2	200	2.06	
DRO >C10-C28*	<10.0	10.0	04/20/2026	ND	193	96.6	200	0.327	
EXT DRO >C28-C36	<10.0	10.0	04/20/2026	ND					

Surrogate: 1-Chlorooctane 71.0 % 52.4-130

Surrogate: 1-Chlorooctadecane 60.7 % 39.9-141

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

Etech Environmental & Safety Solutions
 JOEL LOWRY
 2617 W MARLAND
 HOBBS NM, 88240
 Fax To:

Received: 04/17/2026
 Reported: 04/21/2026
 Project Name: SERRANO ROLL-OFF OVERFLOW
 Project Number: 23910
 Project Location: GOODNIGHT 32.27997-103.37313

Sampling Date: 04/16/2026
 Sampling Type: Soil
 Sampling Condition: Cool & Intact
 Sample Received By: Alyssa Parras

Sample ID: FL 5 @ 3" (H262234-05)

BTEx 8021B		mg/kg		Analyzed By: JH					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Benzene*	<0.050	0.050	04/20/2026	ND	2.10	105	2.00	1.30	
Toluene*	<0.050	0.050	04/20/2026	ND	2.20	110	2.00	2.96	
Ethylbenzene*	<0.050	0.050	04/20/2026	ND	2.37	119	2.00	3.10	
Total Xylenes*	<0.150	0.150	04/20/2026	ND	7.18	120	6.00	1.86	
Total BTEX	<0.300	0.300	04/20/2026	ND					

Surrogate: 4-Bromofluorobenzene (PID) 123 % 70.4-141

Chloride, SM4500Cl-B		mg/kg		Analyzed By: KH					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Chloride	11100	16.0	04/20/2026	ND	416	104	400	0.00	

TPH 8015M		mg/kg		Analyzed By: JF					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	<10.0	10.0	04/20/2026	ND	198	99.2	200	2.06	
DRO >C10-C28*	214	10.0	04/20/2026	ND	193	96.6	200	0.327	
EXT DRO >C28-C36	46.7	10.0	04/20/2026	ND					

Surrogate: 1-Chlorooctane 69.9 % 52.4-130

Surrogate: 1-Chlorooctadecane 68.4 % 39.9-141

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

Etech Environmental & Safety Solutions
 JOEL LOWRY
 2617 W MARLAND
 HOBBS NM, 88240
 Fax To:

Received: 04/17/2026
 Reported: 04/21/2026
 Project Name: SERRANO ROLL-OFF OVERFLOW
 Project Number: 23910
 Project Location: GOODNIGHT 32.27997-103.37313

Sampling Date: 04/16/2026
 Sampling Type: Soil
 Sampling Condition: Cool & Intact
 Sample Received By: Alyssa Parras

Sample ID: FL 6 @ 3" (H262234-06)

BTEx 8021B		mg/kg		Analyzed By: JH					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Benzene*	<0.050	0.050	04/20/2026	ND	2.10	105	2.00	1.30	
Toluene*	<0.050	0.050	04/20/2026	ND	2.20	110	2.00	2.96	
Ethylbenzene*	<0.050	0.050	04/20/2026	ND	2.37	119	2.00	3.10	
Total Xylenes*	<0.150	0.150	04/20/2026	ND	7.18	120	6.00	1.86	
Total BTEX	<0.300	0.300	04/20/2026	ND					

Surrogate: 4-Bromofluorobenzene (PID) 121 % 70.4-141

Chloride, SM4500Cl-B		mg/kg		Analyzed By: KH						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Chloride	5200	16.0	04/20/2026	ND	416	104	400	0.00		

TPH 8015M		mg/kg		Analyzed By: JF					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	<10.0	10.0	04/20/2026	ND	198	99.2	200	2.06	
DRO >C10-C28*	642	10.0	04/20/2026	ND	193	96.6	200	0.327	
EXT DRO >C28-C36	128	10.0	04/20/2026	ND					

Surrogate: 1-Chlorooctane 59.8 % 52.4-130

Surrogate: 1-Chlorooctadecane 72.9 % 39.9-141

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

Etech Environmental & Safety Solutions
 JOEL LOWRY
 2617 W MARLAND
 HOBBS NM, 88240
 Fax To:

Received: 04/17/2026
 Reported: 04/21/2026
 Project Name: SERRANO ROLL-OFF OVERFLOW
 Project Number: 23910
 Project Location: GOODNIGHT 32.27997-103.37313

Sampling Date: 04/16/2026
 Sampling Type: Soil
 Sampling Condition: Cool & Intact
 Sample Received By: Alyssa Parras

Sample ID: FL 7 @ 3" (H262234-07)

BTEx 8021B		mg/kg		Analyzed By: JH					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Benzene*	<0.050	0.050	04/20/2026	ND	2.10	105	2.00	1.30	
Toluene*	<0.050	0.050	04/20/2026	ND	2.20	110	2.00	2.96	
Ethylbenzene*	<0.050	0.050	04/20/2026	ND	2.37	119	2.00	3.10	
Total Xylenes*	<0.150	0.150	04/20/2026	ND	7.18	120	6.00	1.86	
Total BTEX	<0.300	0.300	04/20/2026	ND					

Surrogate: 4-Bromofluorobenzene (PID) 118 % 70.4-141

Chloride, SM4500Cl-B		mg/kg		Analyzed By: KH						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Chloride	7200	16.0	04/20/2026	ND	416	104	400	0.00		

TPH 8015M		mg/kg		Analyzed By: JF					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	<10.0	10.0	04/20/2026	ND	198	99.2	200	2.06	
DRO >C10-C28*	198	10.0	04/20/2026	ND	193	96.6	200	0.327	
EXT DRO >C28-C36	40.9	10.0	04/20/2026	ND					

Surrogate: 1-Chlorooctane 56.7 % 52.4-130

Surrogate: 1-Chlorooctadecane 56.1 % 39.9-141

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

Etech Environmental & Safety Solutions
 JOEL LOWRY
 2617 W MARLAND
 HOBBS NM, 88240
 Fax To:

Received: 04/17/2026
 Reported: 04/21/2026
 Project Name: SERRANO ROLL-OFF OVERFLOW
 Project Number: 23910
 Project Location: GOODNIGHT 32.27997-103.37313

Sampling Date: 04/16/2026
 Sampling Type: Soil
 Sampling Condition: Cool & Intact
 Sample Received By: Alyssa Parras

Sample ID: FL 8 @ 6" (H262234-08)

BTEx 8021B		mg/kg		Analyzed By: JH					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Benzene*	<0.050	0.050	04/20/2026	ND	2.10	105	2.00	1.30	
Toluene*	<0.050	0.050	04/20/2026	ND	2.20	110	2.00	2.96	
Ethylbenzene*	<0.050	0.050	04/20/2026	ND	2.37	119	2.00	3.10	
Total Xylenes*	<0.150	0.150	04/20/2026	ND	7.18	120	6.00	1.86	
Total BTEX	<0.300	0.300	04/20/2026	ND					

Surrogate: 4-Bromofluorobenzene (PID) 99.1 % 70.4-141

Chloride, SM4500Cl-B		mg/kg		Analyzed By: KH					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Chloride	1970	16.0	04/20/2026	ND	416	104	400	0.00	

TPH 8015M		mg/kg		Analyzed By: JF					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	<10.0	10.0	04/20/2026	ND	198	99.2	200	2.06	
DRO >C10-C28*	147	10.0	04/20/2026	ND	193	96.6	200	0.327	
EXT DRO >C28-C36	12.9	10.0	04/20/2026	ND					

Surrogate: 1-Chlorooctane 66.9 % 52.4-130

Surrogate: 1-Chlorooctadecane 63.2 % 39.9-141

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

Etech Environmental & Safety Solutions
 JOEL LOWRY
 2617 W MARLAND
 HOBBS NM, 88240
 Fax To:

Received: 04/17/2026
 Reported: 04/21/2026
 Project Name: SERRANO ROLL-OFF OVERFLOW
 Project Number: 23910
 Project Location: GOODNIGHT 32.27997-103.37313

Sampling Date: 04/16/2026
 Sampling Type: Soil
 Sampling Condition: Cool & Intact
 Sample Received By: Alyssa Parras

Sample ID: FL 9 @ 6" (H262234-09)

BTEx 8021B		mg/kg		Analyzed By: JH						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Benzene*	<0.050	0.050	04/20/2026	ND	2.10	105	2.00	1.30		
Toluene*	<0.050	0.050	04/20/2026	ND	2.20	110	2.00	2.96		
Ethylbenzene*	<0.050	0.050	04/20/2026	ND	2.37	119	2.00	3.10		
Total Xylenes*	<0.150	0.150	04/20/2026	ND	7.18	120	6.00	1.86		
Total BTEX	<0.300	0.300	04/20/2026	ND						

Surrogate: 4-Bromofluorobenzene (PID) 112 % 70.4-141

Chloride, SM4500Cl-B		mg/kg		Analyzed By: KH						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Chloride	1070	16.0	04/20/2026	ND	416	104	400	0.00		

TPH 8015M		mg/kg		Analyzed By: JF					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	<10.0	10.0	04/20/2026	ND	198	99.2	200	2.06	
DRO >C10-C28*	47.7	10.0	04/20/2026	ND	193	96.6	200	0.327	
EXT DRO >C28-C36	<10.0	10.0	04/20/2026	ND					

Surrogate: 1-Chlorooctane 64.0 % 52.4-130

Surrogate: 1-Chlorooctadecane 56.9 % 39.9-141

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

Etech Environmental & Safety Solutions
 JOEL LOWRY
 2617 W MARLAND
 HOBBS NM, 88240
 Fax To:

Received: 04/17/2026
 Reported: 04/21/2026
 Project Name: SERRANO ROLL-OFF OVERFLOW
 Project Number: 23910
 Project Location: GOODNIGHT 32.27997-103.37313

Sampling Date: 04/16/2026
 Sampling Type: Soil
 Sampling Condition: Cool & Intact
 Sample Received By: Alyssa Parras

Sample ID: FL 10 @ 6" (H262234-10)

BTX 8021B		mg/kg		Analyzed By: JH						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Benzene*	<0.050	0.050	04/20/2026	ND	2.10	105	2.00	1.30		
Toluene*	<0.050	0.050	04/20/2026	ND	2.20	110	2.00	2.96		
Ethylbenzene*	<0.050	0.050	04/20/2026	ND	2.37	119	2.00	3.10		
Total Xylenes*	<0.150	0.150	04/20/2026	ND	7.18	120	6.00	1.86		
Total BTX	<0.300	0.300	04/20/2026	ND						

Surrogate: 4-Bromofluorobenzene (PID) 113 % 70.4-141

Chloride, SM4500Cl-B		mg/kg		Analyzed By: KH						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Chloride	2130	16.0	04/20/2026	ND	416	104	400	0.00		

TPH 8015M		mg/kg		Analyzed By: JF					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	<10.0	10.0	04/20/2026	ND	198	99.2	200	2.06	
DRO >C10-C28*	301	10.0	04/20/2026	ND	193	96.6	200	0.327	
EXT DRO >C28-C36	39.3	10.0	04/20/2026	ND					

Surrogate: 1-Chlorooctane 54.6 % 52.4-130

Surrogate: 1-Chlorooctadecane 53.7 % 39.9-141

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

Etech Environmental & Safety Solutions
 JOEL LOWRY
 2617 W MARLAND
 HOBBS NM, 88240
 Fax To:

Received: 04/17/2026
 Reported: 04/21/2026
 Project Name: SERRANO ROLL-OFF OVERFLOW
 Project Number: 23910
 Project Location: GOODNIGHT 32.27997-103.37313

Sampling Date: 04/16/2026
 Sampling Type: Soil
 Sampling Condition: Cool & Intact
 Sample Received By: Alyssa Parras

Sample ID: FL 11 @ 6" (H262234-11)

BTEx 8021B		mg/kg		Analyzed By: JH						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Benzene*	<0.050	0.050	04/20/2026	ND	2.10	105	2.00	1.30		
Toluene*	<0.050	0.050	04/20/2026	ND	2.20	110	2.00	2.96		
Ethylbenzene*	<0.050	0.050	04/20/2026	ND	2.37	119	2.00	3.10		
Total Xylenes*	<0.150	0.150	04/20/2026	ND	7.18	120	6.00	1.86		
Total BTEX	<0.300	0.300	04/20/2026	ND						

Surrogate: 4-Bromofluorobenzene (PID) 120 % 70.4-141

Chloride, SM4500Cl-B		mg/kg		Analyzed By: KH						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Chloride	1950	16.0	04/20/2026	ND	416	104	400	0.00		

TPH 8015M		mg/kg		Analyzed By: JF					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	<10.0	10.0	04/20/2026	ND	198	99.2	200	2.06	
DRO >C10-C28*	13.1	10.0	04/20/2026	ND	193	96.6	200	0.327	
EXT DRO >C28-C36	<10.0	10.0	04/20/2026	ND					

Surrogate: 1-Chlorooctane 55.3 % 52.4-130

Surrogate: 1-Chlorooctadecane 47.6 % 39.9-141

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

Etech Environmental & Safety Solutions
 JOEL LOWRY
 2617 W MARLAND
 HOBBS NM, 88240
 Fax To:

Received: 04/17/2026
 Reported: 04/21/2026
 Project Name: SERRANO ROLL-OFF OVERFLOW
 Project Number: 23910
 Project Location: GOODNIGHT 32.27997-103.37313

Sampling Date: 04/16/2026
 Sampling Type: Soil
 Sampling Condition: Cool & Intact
 Sample Received By: Alyssa Parras

Sample ID: FL 12 @ 6" (H262234-12)

BTEx 8021B		mg/kg		Analyzed By: JH						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Benzene*	<0.050	0.050	04/20/2026	ND	2.10	105	2.00	1.30		
Toluene*	<0.050	0.050	04/20/2026	ND	2.20	110	2.00	2.96		
Ethylbenzene*	<0.050	0.050	04/20/2026	ND	2.37	119	2.00	3.10		
Total Xylenes*	<0.150	0.150	04/20/2026	ND	7.18	120	6.00	1.86		
Total BTEx	<0.300	0.300	04/20/2026	ND						

Surrogate: 4-Bromofluorobenzene (PID) 117 % 70.4-141

Chloride, SM4500Cl-B		mg/kg		Analyzed By: KH						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Chloride	1730	16.0	04/20/2026	ND	416	104	400	0.00		

TPH 8015M		mg/kg		Analyzed By: JF					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	<10.0	10.0	04/20/2026	ND	198	99.2	200	2.06	
DRO >C10-C28*	236	10.0	04/20/2026	ND	193	96.6	200	0.327	
EXT DRO >C28-C36	36.1	10.0	04/20/2026	ND					

Surrogate: 1-Chlorooctane 76.3 % 52.4-130

Surrogate: 1-Chlorooctadecane 71.7 % 39.9-141

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

Etech Environmental & Safety Solutions
 JOEL LOWRY
 2617 W MARLAND
 HOBBS NM, 88240
 Fax To:

Received: 04/17/2026
 Reported: 04/21/2026
 Project Name: SERRANO ROLL-OFF OVERFLOW
 Project Number: 23910
 Project Location: GOODNIGHT 32.27997-103.37313

Sampling Date: 04/16/2026
 Sampling Type: Soil
 Sampling Condition: Cool & Intact
 Sample Received By: Alyssa Parras

Sample ID: FL 13 @ 6" (H262234-13)

BTEx 8021B		mg/kg		Analyzed By: JH						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Benzene*	<0.050	0.050	04/20/2026	ND	2.10	105	2.00	1.30		
Toluene*	<0.050	0.050	04/20/2026	ND	2.20	110	2.00	2.96		
Ethylbenzene*	<0.050	0.050	04/20/2026	ND	2.37	119	2.00	3.10		
Total Xylenes*	<0.150	0.150	04/20/2026	ND	7.18	120	6.00	1.86		
Total BTEX	<0.300	0.300	04/20/2026	ND						

Surrogate: 4-Bromofluorobenzene (PID) 120 % 70.4-141

Chloride, SM4500Cl-B		mg/kg		Analyzed By: KH						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Chloride	2610	16.0	04/20/2026	ND	416	104	400	0.00		

TPH 8015M		mg/kg		Analyzed By: JF					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	<10.0	10.0	04/20/2026	ND	198	99.2	200	2.06	
DRO >C10-C28*	28.0	10.0	04/20/2026	ND	193	96.6	200	0.327	
EXT DRO >C28-C36	<10.0	10.0	04/20/2026	ND					

Surrogate: 1-Chlorooctane 122 % 52.4-130

Surrogate: 1-Chlorooctadecane 115 % 39.9-141

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

Etech Environmental & Safety Solutions
 JOEL LOWRY
 2617 W MARLAND
 HOBBS NM, 88240
 Fax To:

Received: 04/17/2026
 Reported: 04/21/2026
 Project Name: SERRANO ROLL-OFF OVERFLOW
 Project Number: 23910
 Project Location: GOODNIGHT 32.27997-103.37313

Sampling Date: 04/16/2026
 Sampling Type: Soil
 Sampling Condition: Cool & Intact
 Sample Received By: Alyssa Parras

Sample ID: FL 14 @ 6" (H262234-14)

BTEx 8021B		mg/kg		Analyzed By: JH						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Benzene*	<0.050	0.050	04/20/2026	ND	2.10	105	2.00	1.30		
Toluene*	<0.050	0.050	04/20/2026	ND	2.20	110	2.00	2.96		
Ethylbenzene*	<0.050	0.050	04/20/2026	ND	2.37	119	2.00	3.10		
Total Xylenes*	<0.150	0.150	04/20/2026	ND	7.18	120	6.00	1.86		
Total BTEX	<0.300	0.300	04/20/2026	ND						

Surrogate: 4-Bromofluorobenzene (PID) 122 % 70.4-141

Chloride, SM4500Cl-B		mg/kg		Analyzed By: KH						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Chloride	8320	16.0	04/20/2026	ND	416	104	400	0.00		

TPH 8015M		mg/kg		Analyzed By: JF					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	<10.0	10.0	04/20/2026	ND	198	99.2	200	2.06	
DRO >C10-C28*	116	10.0	04/20/2026	ND	193	96.6	200	0.327	
EXT DRO >C28-C36	26.3	10.0	04/20/2026	ND					

Surrogate: 1-Chlorooctane 63.8 % 52.4-130

Surrogate: 1-Chlorooctadecane 59.5 % 39.9-141

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

Etech Environmental & Safety Solutions
 JOEL LOWRY
 2617 W MARLAND
 HOBBS NM, 88240
 Fax To:

Received: 04/17/2026
 Reported: 04/21/2026
 Project Name: SERRANO ROLL-OFF OVERFLOW
 Project Number: 23910
 Project Location: GOODNIGHT 32.27997-103.37313

Sampling Date: 04/16/2026
 Sampling Type: Soil
 Sampling Condition: Cool & Intact
 Sample Received By: Alyssa Parras

Sample ID: FL 15 @ 6" (H262234-15)

BTX 8021B		mg/kg		Analyzed By: JH						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Benzene*	<0.050	0.050	04/20/2026	ND	2.10	105	2.00	1.30		
Toluene*	<0.050	0.050	04/20/2026	ND	2.20	110	2.00	2.96		
Ethylbenzene*	<0.050	0.050	04/20/2026	ND	2.37	119	2.00	3.10		
Total Xylenes*	<0.150	0.150	04/20/2026	ND	7.18	120	6.00	1.86		
Total BTX	<0.300	0.300	04/20/2026	ND						

Surrogate: 4-Bromofluorobenzene (PID) 98.9 % 70.4-141

Chloride, SM4500Cl-B		mg/kg		Analyzed By: KH						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Chloride	2880	16.0	04/20/2026	ND	416	104	400	0.00		

TPH 8015M		mg/kg		Analyzed By: JF					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	<10.0	10.0	04/20/2026	ND	198	99.2	200	2.06	
DRO >C10-C28*	72.8	10.0	04/20/2026	ND	193	96.6	200	0.327	
EXT DRO >C28-C36	<10.0	10.0	04/20/2026	ND					

Surrogate: 1-Chlorooctane 65.7 % 52.4-130

Surrogate: 1-Chlorooctadecane 60.2 % 39.9-141

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

Etech Environmental & Safety Solutions
 JOEL LOWRY
 2617 W MARLAND
 HOBBS NM, 88240
 Fax To:

Received: 04/17/2026
 Reported: 04/21/2026
 Project Name: SERRANO ROLL-OFF OVERFLOW
 Project Number: 23910
 Project Location: GOODNIGHT 32.27997-103.37313

Sampling Date: 04/16/2026
 Sampling Type: Soil
 Sampling Condition: Cool & Intact
 Sample Received By: Alyssa Parras

Sample ID: FL 16 @ 6" (H262234-16)

BTEx 8021B		mg/kg		Analyzed By: JH						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Benzene*	<0.050	0.050	04/20/2026	ND	2.10	105	2.00	1.30		
Toluene*	<0.050	0.050	04/20/2026	ND	2.20	110	2.00	2.96		
Ethylbenzene*	<0.050	0.050	04/20/2026	ND	2.37	119	2.00	3.10		
Total Xylenes*	<0.150	0.150	04/20/2026	ND	7.18	120	6.00	1.86		
Total BTEX	<0.300	0.300	04/20/2026	ND						

Surrogate: 4-Bromofluorobenzene (PID) 119 % 70.4-141

Chloride, SM4500Cl-B		mg/kg		Analyzed By: KH						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Chloride	1600	16.0	04/20/2026	ND	416	104	400	0.00		

TPH 8015M		mg/kg		Analyzed By: JF					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	<10.0	10.0	04/20/2026	ND	198	99.2	200	2.06	
DRO >C10-C28*	21.7	10.0	04/20/2026	ND	193	96.6	200	0.327	
EXT DRO >C28-C36	<10.0	10.0	04/20/2026	ND					

Surrogate: 1-Chlorooctane 69.8 % 52.4-130

Surrogate: 1-Chlorooctadecane 61.1 % 39.9-141

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

Etech Environmental & Safety Solutions
 JOEL LOWRY
 2617 W MARLAND
 HOBBS NM, 88240
 Fax To:

Received: 04/17/2026
 Reported: 04/21/2026
 Project Name: SERRANO ROLL-OFF OVERFLOW
 Project Number: 23910
 Project Location: GOODNIGHT 32.27997-103.37313

Sampling Date: 04/16/2026
 Sampling Type: Soil
 Sampling Condition: Cool & Intact
 Sample Received By: Alyssa Parras

Sample ID: FL 17 @ 6" (H262234-17)

BTEx 8021B		mg/kg	Analyzed By: JH					S-04	
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Benzene*	<0.050	0.050	04/20/2026	ND	2.10	105	2.00	1.30	
Toluene*	0.160	0.050	04/20/2026	ND	2.20	110	2.00	2.96	
Ethylbenzene*	0.787	0.050	04/20/2026	ND	2.37	119	2.00	3.10	
Total Xylenes*	4.83	0.150	04/20/2026	ND	7.18	120	6.00	1.86	GC-NC1
Total BTEX	5.78	0.300	04/20/2026	ND					GC-NC1

Surrogate: 4-Bromofluorobenzene (PID) 212 % 70.4-141

Chloride, SM4500Cl-B		mg/kg	Analyzed By: KH						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Chloride	3710	16.0	04/20/2026	ND	416	104	400	0.00	

TPH 8015M		mg/kg	Analyzed By: JF						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	120	10.0	04/20/2026	ND	198	99.2	200	2.06	
DRO >C10-C28*	4100	10.0	04/20/2026	ND	193	96.6	200	0.327	
EXT DRO >C28-C36	620	10.0	04/20/2026	ND					

Surrogate: 1-Chlorooctane 86.5 % 52.4-130

Surrogate: 1-Chlorooctadecane 96.3 % 39.9-141

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

Etech Environmental & Safety Solutions
 JOEL LOWRY
 2617 W MARLAND
 HOBBS NM, 88240
 Fax To:

Received: 04/17/2026
 Reported: 04/21/2026
 Project Name: SERRANO ROLL-OFF OVERFLOW
 Project Number: 23910
 Project Location: GOODNIGHT 32.27997-103.37313

Sampling Date: 04/16/2026
 Sampling Type: Soil
 Sampling Condition: Cool & Intact
 Sample Received By: Alyssa Parras

Sample ID: FL 18 @ 6" (H262234-18)

BTEx 8021B		mg/kg		Analyzed By: JH						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Benzene*	<0.050	0.050	04/20/2026	ND	2.10	105	2.00	1.30		
Toluene*	<0.050	0.050	04/20/2026	ND	2.20	110	2.00	2.96		
Ethylbenzene*	<0.050	0.050	04/20/2026	ND	2.37	119	2.00	3.10		
Total Xylenes*	<0.150	0.150	04/20/2026	ND	7.18	120	6.00	1.86		
Total BTEX	<0.300	0.300	04/20/2026	ND						

Surrogate: 4-Bromofluorobenzene (PID) 116 % 70.4-141

Chloride, SM4500Cl-B		mg/kg		Analyzed By: KH						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Chloride	1970	16.0	04/20/2026	ND	416	104	400	0.00		

TPH 8015M		mg/kg		Analyzed By: JF					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	<10.0	10.0	04/20/2026	ND	198	99.2	200	2.06	
DRO >C10-C28*	112	10.0	04/20/2026	ND	193	96.6	200	0.327	
EXT DRO >C28-C36	21.0	10.0	04/20/2026	ND					

Surrogate: 1-Chlorooctane 68.2 % 52.4-130

Surrogate: 1-Chlorooctadecane 62.8 % 39.9-141

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

Etech Environmental & Safety Solutions
 JOEL LOWRY
 2617 W MARLAND
 HOBBS NM, 88240
 Fax To:

Received: 04/17/2026
 Reported: 04/21/2026
 Project Name: SERRANO ROLL-OFF OVERFLOW
 Project Number: 23910
 Project Location: GOODNIGHT 32.27997-103.37313

Sampling Date: 04/16/2026
 Sampling Type: Soil
 Sampling Condition: Cool & Intact
 Sample Received By: Alyssa Parras

Sample ID: FL 19 @ 6" (H262234-19)

BTEx 8021B		mg/kg		Analyzed By: JH						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Benzene*	<0.050	0.050	04/20/2026	ND	2.10	105	2.00	1.30		
Toluene*	<0.050	0.050	04/20/2026	ND	2.20	110	2.00	2.96		
Ethylbenzene*	<0.050	0.050	04/20/2026	ND	2.37	119	2.00	3.10		
Total Xylenes*	<0.150	0.150	04/20/2026	ND	7.18	120	6.00	1.86		
Total BTEX	<0.300	0.300	04/20/2026	ND						

Surrogate: 4-Bromofluorobenzene (PID) 108 % 70.4-141

Chloride, SM4500Cl-B		mg/kg		Analyzed By: KH						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Chloride	2110	16.0	04/20/2026	ND	416	104	400	0.00		

TPH 8015M		mg/kg		Analyzed By: JF					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	<10.0	10.0	04/20/2026	ND	198	99.2	200	2.06	
DRO >C10-C28*	75.0	10.0	04/20/2026	ND	193	96.6	200	0.327	
EXT DRO >C28-C36	<10.0	10.0	04/20/2026	ND					

Surrogate: 1-Chlorooctane 68.1 % 52.4-130

Surrogate: 1-Chlorooctadecane 62.1 % 39.9-141

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

Etech Environmental & Safety Solutions
 JOEL LOWRY
 2617 W MARLAND
 HOBBS NM, 88240
 Fax To:

Received: 04/17/2026
 Reported: 04/21/2026
 Project Name: SERRANO ROLL-OFF OVERFLOW
 Project Number: 23910
 Project Location: GOODNIGHT 32.27997-103.37313

Sampling Date: 04/16/2026
 Sampling Type: Soil
 Sampling Condition: Cool & Intact
 Sample Received By: Alyssa Parras

Sample ID: FL 20 @ 6" (H262234-20)

BTEx 8021B		mg/kg		Analyzed By: JH						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Benzene*	<0.050	0.050	04/20/2026	ND	2.10	105	2.00	1.30		
Toluene*	<0.050	0.050	04/20/2026	ND	2.20	110	2.00	2.96		
Ethylbenzene*	<0.050	0.050	04/20/2026	ND	2.37	119	2.00	3.10		
Total Xylenes*	<0.150	0.150	04/20/2026	ND	7.18	120	6.00	1.86		
Total BTEx	<0.300	0.300	04/20/2026	ND						

Surrogate: 4-Bromofluorobenzene (PID) 122 % 70.4-141

Chloride, SM4500Cl-B		mg/kg		Analyzed By: AC						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Chloride	640	16.0	04/20/2026	ND	416	104	400	0.00		

TPH 8015M		mg/kg		Analyzed By: JF					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	<10.0	10.0	04/20/2026	ND	198	99.2	200	2.06	
DRO >C10-C28*	21.0	10.0	04/20/2026	ND	193	96.6	200	0.327	
EXT DRO >C28-C36	<10.0	10.0	04/20/2026	ND					

Surrogate: 1-Chlorooctane 66.3 % 52.4-130

Surrogate: 1-Chlorooctadecane 59.8 % 39.9-141

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

Etech Environmental & Safety Solutions
 JOEL LOWRY
 2617 W MARLAND
 HOBBS NM, 88240
 Fax To:

Received: 04/17/2026
 Reported: 04/21/2026
 Project Name: SERRANO ROLL-OFF OVERFLOW
 Project Number: 23910
 Project Location: GOODNIGHT 32.27997-103.37313

Sampling Date: 04/16/2026
 Sampling Type: Soil
 Sampling Condition: Cool & Intact
 Sample Received By: Alyssa Parras

Sample ID: FL 21 @ 6" (H262234-21)

BTEx 8021B		mg/kg		Analyzed By: JH					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Benzene*	<0.050	0.050	04/20/2026	ND	2.11	106	2.00	0.540	
Toluene*	<0.050	0.050	04/20/2026	ND	2.01	101	2.00	0.740	
Ethylbenzene*	<0.050	0.050	04/20/2026	ND	1.96	98.0	2.00	0.264	
Total Xylenes*	<0.150	0.150	04/20/2026	ND	5.73	95.5	6.00	0.115	
Total BTEX	<0.300	0.300	04/20/2026	ND					

Surrogate: 4-Bromofluorobenzene (PID) 97.9 % 70.4-141

Chloride, SM4500Cl-B		mg/kg		Analyzed By: AC					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Chloride	4320	16.0	04/20/2026	ND	416	104	400	0.00	

TPH 8015M		mg/kg		Analyzed By: JF					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	<10.0	10.0	04/20/2026	ND	217	109	200	0.418	
DRO >C10-C28*	1760	10.0	04/20/2026	ND	229	114	200	0.197	QM-07
EXT DRO >C28-C36	355	10.0	04/20/2026	ND					

Surrogate: 1-Chlorooctane 82.4 % 52.4-130

Surrogate: 1-Chlorooctadecane 112 % 39.9-141

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

Etech Environmental & Safety Solutions
 JOEL LOWRY
 2617 W MARLAND
 HOBBS NM, 88240
 Fax To:

Received: 04/17/2026
 Reported: 04/21/2026
 Project Name: SERRANO ROLL-OFF OVERFLOW
 Project Number: 23910
 Project Location: GOODNIGHT 32.27997-103.37313

Sampling Date: 04/16/2026
 Sampling Type: Soil
 Sampling Condition: Cool & Intact
 Sample Received By: Alyssa Parras

Sample ID: FL 22 @ 6" (H262234-22)

BTEx 8021B		mg/kg		Analyzed By: JH						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Benzene*	<0.050	0.050	04/20/2026	ND	2.11	106	2.00	0.540		
Toluene*	<0.050	0.050	04/20/2026	ND	2.01	101	2.00	0.740		
Ethylbenzene*	<0.050	0.050	04/20/2026	ND	1.96	98.0	2.00	0.264		
Total Xylenes*	<0.150	0.150	04/20/2026	ND	5.73	95.5	6.00	0.115		
Total BTEX	<0.300	0.300	04/20/2026	ND						

Surrogate: 4-Bromofluorobenzene (PID) 98.4 % 70.4-141

Chloride, SM4500Cl-B		mg/kg		Analyzed By: AC						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Chloride	5080	16.0	04/20/2026	ND	416	104	400	0.00		

TPH 8015M		mg/kg		Analyzed By: JF					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	<10.0	10.0	04/21/2026	ND	217	109	200	0.418	
DRO >C10-C28*	28.3	10.0	04/21/2026	ND	229	114	200	0.197	
EXT DRO >C28-C36	<10.0	10.0	04/21/2026	ND					

Surrogate: 1-Chlorooctane 80.2 % 52.4-130

Surrogate: 1-Chlorooctadecane 79.9 % 39.9-141

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

Etech Environmental & Safety Solutions
 JOEL LOWRY
 2617 W MARLAND
 HOBBS NM, 88240
 Fax To:

Received: 04/17/2026
 Reported: 04/21/2026
 Project Name: SERRANO ROLL-OFF OVERFLOW
 Project Number: 23910
 Project Location: GOODNIGHT 32.27997-103.37313

Sampling Date: 04/16/2026
 Sampling Type: Soil
 Sampling Condition: Cool & Intact
 Sample Received By: Alyssa Parras

Sample ID: FL 23 @ 6" (H262234-23)

BTEx 8021B		mg/kg		Analyzed By: JH						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Benzene*	<0.050	0.050	04/20/2026	ND	2.11	106	2.00	0.540		
Toluene*	<0.050	0.050	04/20/2026	ND	2.01	101	2.00	0.740		
Ethylbenzene*	<0.050	0.050	04/20/2026	ND	1.96	98.0	2.00	0.264		
Total Xylenes*	<0.150	0.150	04/20/2026	ND	5.73	95.5	6.00	0.115		
Total BTEX	<0.300	0.300	04/20/2026	ND						

Surrogate: 4-Bromofluorobenzene (PID) 96.9 % 70.4-141

Chloride, SM4500Cl-B		mg/kg		Analyzed By: AC					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Chloride	7760	16.0	04/20/2026	ND	416	104	400	0.00	

TPH 8015M		mg/kg		Analyzed By: JF					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	<10.0	10.0	04/20/2026	ND	217	109	200	0.418	
DRO >C10-C28*	500	10.0	04/20/2026	ND	229	114	200	0.197	
EXT DRO >C28-C36	114	10.0	04/20/2026	ND					

Surrogate: 1-Chlorooctane 81.1 % 52.4-130

Surrogate: 1-Chlorooctadecane 86.3 % 39.9-141

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

Etech Environmental & Safety Solutions
 JOEL LOWRY
 2617 W MARLAND
 HOBBS NM, 88240
 Fax To:

Received: 04/17/2026
 Reported: 04/21/2026
 Project Name: SERRANO ROLL-OFF OVERFLOW
 Project Number: 23910
 Project Location: GOODNIGHT 32.27997-103.37313

Sampling Date: 04/16/2026
 Sampling Type: Soil
 Sampling Condition: Cool & Intact
 Sample Received By: Alyssa Parras

Sample ID: FL 24 @ 6" (H262234-24)

BTEx 8021B		mg/kg		Analyzed By: JH						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Benzene*	<0.050	0.050	04/20/2026	ND	2.11	106	2.00	0.540		
Toluene*	<0.050	0.050	04/20/2026	ND	2.01	101	2.00	0.740		
Ethylbenzene*	<0.050	0.050	04/20/2026	ND	1.96	98.0	2.00	0.264		
Total Xylenes*	<0.150	0.150	04/20/2026	ND	5.73	95.5	6.00	0.115		
Total BTEX	<0.300	0.300	04/20/2026	ND						

Surrogate: 4-Bromofluorobenzene (PID) 97.1 % 70.4-141

Chloride, SM4500Cl-B		mg/kg		Analyzed By: AC						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Chloride	1920	16.0	04/20/2026	ND	416	104	400	0.00		

TPH 8015M		mg/kg		Analyzed By: JF					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	<10.0	10.0	04/20/2026	ND	217	109	200	0.418	
DRO >C10-C28*	<10.0	10.0	04/20/2026	ND	229	114	200	0.197	
EXT DRO >C28-C36	<10.0	10.0	04/20/2026	ND					

Surrogate: 1-Chlorooctane 80.8 % 52.4-130

Surrogate: 1-Chlorooctadecane 77.0 % 39.9-141

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

Etech Environmental & Safety Solutions
 JOEL LOWRY
 2617 W MARLAND
 HOBBS NM, 88240
 Fax To:

Received: 04/17/2026
 Reported: 04/21/2026
 Project Name: SERRANO ROLL-OFF OVERFLOW
 Project Number: 23910
 Project Location: GOODNIGHT 32.27997-103.37313

Sampling Date: 04/16/2026
 Sampling Type: Soil
 Sampling Condition: Cool & Intact
 Sample Received By: Alyssa Parras

Sample ID: FL 25 @ 6" (H262234-25)

BTEx 8021B		mg/kg		Analyzed By: JH						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Benzene*	<0.050	0.050	04/20/2026	ND	2.11	106	2.00	0.540		
Toluene*	<0.050	0.050	04/20/2026	ND	2.01	101	2.00	0.740		
Ethylbenzene*	<0.050	0.050	04/20/2026	ND	1.96	98.0	2.00	0.264		
Total Xylenes*	<0.150	0.150	04/20/2026	ND	5.73	95.5	6.00	0.115		
Total BTEX	<0.300	0.300	04/20/2026	ND						

Surrogate: 4-Bromofluorobenzene (PID) 95.9 % 70.4-141

Chloride, SM4500Cl-B		mg/kg		Analyzed By: AC						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Chloride	1550	16.0	04/20/2026	ND	416	104	400	0.00		

TPH 8015M		mg/kg		Analyzed By: JF					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	<10.0	10.0	04/20/2026	ND	217	109	200	0.418	
DRO >C10-C28*	<10.0	10.0	04/20/2026	ND	229	114	200	0.197	
EXT DRO >C28-C36	<10.0	10.0	04/20/2026	ND					

Surrogate: 1-Chlorooctane 83.8 % 52.4-130

Surrogate: 1-Chlorooctadecane 80.0 % 39.9-141

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

Etech Environmental & Safety Solutions
 JOEL LOWRY
 2617 W MARLAND
 HOBBS NM, 88240
 Fax To:

Received: 04/17/2026
 Reported: 04/21/2026
 Project Name: SERRANO ROLL-OFF OVERFLOW
 Project Number: 23910
 Project Location: GOODNIGHT 32.27997-103.37313

Sampling Date: 04/16/2026
 Sampling Type: Soil
 Sampling Condition: Cool & Intact
 Sample Received By: Alyssa Parras

Sample ID: FL 26 @ 6" (H262234-26)

BTEx 8021B		mg/kg		Analyzed By: JH					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Benzene*	<0.050	0.050	04/20/2026	ND	2.11	106	2.00	0.540	
Toluene*	<0.050	0.050	04/20/2026	ND	2.01	101	2.00	0.740	
Ethylbenzene*	<0.050	0.050	04/20/2026	ND	1.96	98.0	2.00	0.264	
Total Xylenes*	<0.150	0.150	04/20/2026	ND	5.73	95.5	6.00	0.115	
Total BTEX	<0.300	0.300	04/20/2026	ND					

Surrogate: 4-Bromofluorobenzene (PID) 98.1 % 70.4-141

Chloride, SM4500Cl-B		mg/kg		Analyzed By: AC					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Chloride	1920	16.0	04/20/2026	ND	416	104	400	0.00	

TPH 8015M		mg/kg		Analyzed By: JF					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	<10.0	10.0	04/20/2026	ND	217	109	200	0.418	
DRO >C10-C28*	1170	10.0	04/20/2026	ND	229	114	200	0.197	
EXT DRO >C28-C36	257	10.0	04/20/2026	ND					

Surrogate: 1-Chlorooctane 77.2 % 52.4-130

Surrogate: 1-Chlorooctadecane 94.3 % 39.9-141

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

Etech Environmental & Safety Solutions
 JOEL LOWRY
 2617 W MARLAND
 HOBBS NM, 88240
 Fax To:

Received: 04/17/2026
 Reported: 04/21/2026
 Project Name: SERRANO ROLL-OFF OVERFLOW
 Project Number: 23910
 Project Location: GOODNIGHT 32.27997-103.37313

Sampling Date: 04/16/2026
 Sampling Type: Soil
 Sampling Condition: Cool & Intact
 Sample Received By: Alyssa Parras

Sample ID: FL 27 @ 6" (H262234-27)

BTEx 8021B		mg/kg		Analyzed By: JH						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Benzene*	<0.050	0.050	04/20/2026	ND	2.11	106	2.00	0.540		
Toluene*	<0.050	0.050	04/20/2026	ND	2.01	101	2.00	0.740		
Ethylbenzene*	<0.050	0.050	04/20/2026	ND	1.96	98.0	2.00	0.264		
Total Xylenes*	<0.150	0.150	04/20/2026	ND	5.73	95.5	6.00	0.115		
Total BTEX	<0.300	0.300	04/20/2026	ND						

Surrogate: 4-Bromofluorobenzene (PID) 96.5 % 70.4-141

Chloride, SM4500Cl-B		mg/kg		Analyzed By: AC						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Chloride	3080	16.0	04/20/2026	ND	416	104	400	0.00		

TPH 8015M		mg/kg		Analyzed By: JF					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	<10.0	10.0	04/20/2026	ND	217	109	200	0.418	
DRO >C10-C28*	1860	10.0	04/20/2026	ND	229	114	200	0.197	
EXT DRO >C28-C36	394	10.0	04/20/2026	ND					

Surrogate: 1-Chlorooctane 72.8 % 52.4-130

Surrogate: 1-Chlorooctadecane 109 % 39.9-141

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

Etech Environmental & Safety Solutions
 JOEL LOWRY
 2617 W MARLAND
 HOBBS NM, 88240
 Fax To:

Received: 04/17/2026
 Reported: 04/21/2026
 Project Name: SERRANO ROLL-OFF OVERFLOW
 Project Number: 23910
 Project Location: GOODNIGHT 32.27997-103.37313

Sampling Date: 04/16/2026
 Sampling Type: Soil
 Sampling Condition: Cool & Intact
 Sample Received By: Alyssa Parras

Sample ID: FL 28 @ 6" (H262234-28)

BTEx 8021B		mg/kg		Analyzed By: JH					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Benzene*	<0.050	0.050	04/20/2026	ND	2.11	106	2.00	0.540	
Toluene*	<0.050	0.050	04/20/2026	ND	2.01	101	2.00	0.740	
Ethylbenzene*	<0.050	0.050	04/20/2026	ND	1.96	98.0	2.00	0.264	
Total Xylenes*	<0.150	0.150	04/20/2026	ND	5.73	95.5	6.00	0.115	
Total BTEX	<0.300	0.300	04/20/2026	ND					

Surrogate: 4-Bromofluorobenzene (PID) 97.4 % 70.4-141

Chloride, SM4500Cl-B		mg/kg		Analyzed By: AC						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Chloride	3400	16.0	04/20/2026	ND	416	104	400	0.00		

TPH 8015M		mg/kg		Analyzed By: JF					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	<10.0	10.0	04/20/2026	ND	217	109	200	0.418	
DRO >C10-C28*	601	10.0	04/20/2026	ND	229	114	200	0.197	
EXT DRO >C28-C36	138	10.0	04/20/2026	ND					

Surrogate: 1-Chlorooctane 79.9 % 52.4-130

Surrogate: 1-Chlorooctadecane 85.5 % 39.9-141

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

Etech Environmental & Safety Solutions
 JOEL LOWRY
 2617 W MARLAND
 HOBBS NM, 88240
 Fax To:

Received: 04/17/2026
 Reported: 04/21/2026
 Project Name: SERRANO ROLL-OFF OVERFLOW
 Project Number: 23910
 Project Location: GOODNIGHT 32.27997-103.37313

Sampling Date: 04/16/2026
 Sampling Type: Soil
 Sampling Condition: Cool & Intact
 Sample Received By: Alyssa Parras

Sample ID: FL 29 @ 6" (H262234-29)

BTEx 8021B		mg/kg		Analyzed By: JH						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Benzene*	<0.050	0.050	04/20/2026	ND	2.11	106	2.00	0.540		
Toluene*	<0.050	0.050	04/20/2026	ND	2.01	101	2.00	0.740		
Ethylbenzene*	<0.050	0.050	04/20/2026	ND	1.96	98.0	2.00	0.264		
Total Xylenes*	<0.150	0.150	04/20/2026	ND	5.73	95.5	6.00	0.115		
Total BTEX	<0.300	0.300	04/20/2026	ND						

Surrogate: 4-Bromofluorobenzene (PID) 97.9 % 70.4-141

Chloride, SM4500Cl-B		mg/kg		Analyzed By: AC						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Chloride	1360	16.0	04/20/2026	ND	416	104	400	0.00		

TPH 8015M		mg/kg		Analyzed By: JF					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	<10.0	10.0	04/21/2026	ND	217	109	200	0.418	
DRO >C10-C28*	12.1	10.0	04/21/2026	ND	229	114	200	0.197	
EXT DRO >C28-C36	<10.0	10.0	04/21/2026	ND					

Surrogate: 1-Chlorooctane 73.2 % 52.4-130

Surrogate: 1-Chlorooctadecane 68.2 % 39.9-141

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

Etech Environmental & Safety Solutions
 JOEL LOWRY
 2617 W MARLAND
 HOBBS NM, 88240
 Fax To:

Received: 04/17/2026
 Reported: 04/21/2026
 Project Name: SERRANO ROLL-OFF OVERFLOW
 Project Number: 23910
 Project Location: GOODNIGHT 32.27997-103.37313

Sampling Date: 04/16/2026
 Sampling Type: Soil
 Sampling Condition: Cool & Intact
 Sample Received By: Alyssa Parras

Sample ID: FL 30 @ 6" (H262234-30)

BTEx 8021B		mg/kg		Analyzed By: JH						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Benzene*	<0.050	0.050	04/20/2026	ND	2.11	106	2.00	0.540		
Toluene*	<0.050	0.050	04/20/2026	ND	2.01	101	2.00	0.740		
Ethylbenzene*	<0.050	0.050	04/20/2026	ND	1.96	98.0	2.00	0.264		
Total Xylenes*	<0.150	0.150	04/20/2026	ND	5.73	95.5	6.00	0.115		
Total BTEX	<0.300	0.300	04/20/2026	ND						

Surrogate: 4-Bromofluorobenzene (PID) 96.7 % 70.4-141

Chloride, SM4500Cl-B		mg/kg		Analyzed By: AC						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Chloride	2750	16.0	04/20/2026	ND	416	104	400	0.00		

TPH 8015M		mg/kg		Analyzed By: JF					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	<10.0	10.0	04/20/2026	ND	217	109	200	0.418	
DRO >C10-C28*	57.7	10.0	04/20/2026	ND	229	114	200	0.197	
EXT DRO >C28-C36	16.4	10.0	04/20/2026	ND					

Surrogate: 1-Chlorooctane 77.9 % 52.4-130

Surrogate: 1-Chlorooctadecane 73.6 % 39.9-141

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

Etech Environmental & Safety Solutions
 JOEL LOWRY
 2617 W MARLAND
 HOBBS NM, 88240
 Fax To:

Received: 04/17/2026
 Reported: 04/21/2026
 Project Name: SERRANO ROLL-OFF OVERFLOW
 Project Number: 23910
 Project Location: GOODNIGHT 32.27997-103.37313

Sampling Date: 04/16/2026
 Sampling Type: Soil
 Sampling Condition: Cool & Intact
 Sample Received By: Alyssa Parras

Sample ID: FL 31 @ 6" (H262234-31)

BTX 8021B		mg/kg		Analyzed By: JH						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Benzene*	<0.050	0.050	04/20/2026	ND	2.11	106	2.00	0.540		
Toluene*	<0.050	0.050	04/20/2026	ND	2.01	101	2.00	0.740		
Ethylbenzene*	<0.050	0.050	04/20/2026	ND	1.96	98.0	2.00	0.264		
Total Xylenes*	<0.150	0.150	04/20/2026	ND	5.73	95.5	6.00	0.115		
Total BTX	<0.300	0.300	04/20/2026	ND						

Surrogate: 4-Bromofluorobenzene (PID) 97.7 % 70.4-141

Chloride, SM4500CI-B		mg/kg		Analyzed By: AC						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Chloride	2640	16.0	04/20/2026	ND	416	104	400	0.00		

TPH 8015M		mg/kg		Analyzed By: JF					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	<10.0	10.0	04/20/2026	ND	217	109	200	0.418	
DRO >C10-C28*	<10.0	10.0	04/20/2026	ND	229	114	200	0.197	
EXT DRO >C28-C36	<10.0	10.0	04/20/2026	ND					

Surrogate: 1-Chlorooctane 70.5 % 52.4-130

Surrogate: 1-Chlorooctadecane 67.5 % 39.9-141

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

Etech Environmental & Safety Solutions
 JOEL LOWRY
 2617 W MARLAND
 HOBBS NM, 88240
 Fax To:

Received: 04/17/2026
 Reported: 04/21/2026
 Project Name: SERRANO ROLL-OFF OVERFLOW
 Project Number: 23910
 Project Location: GOODNIGHT 32.27997-103.37313

Sampling Date: 04/16/2026
 Sampling Type: Soil
 Sampling Condition: Cool & Intact
 Sample Received By: Alyssa Parras

Sample ID: FL 32 @ 6" (H262234-32)

BTX 8021B		mg/kg		Analyzed By: JH					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Benzene*	<0.050	0.050	04/20/2026	ND	2.11	106	2.00	0.540	
Toluene*	<0.050	0.050	04/20/2026	ND	2.01	101	2.00	0.740	
Ethylbenzene*	<0.050	0.050	04/20/2026	ND	1.96	98.0	2.00	0.264	
Total Xylenes*	<0.150	0.150	04/20/2026	ND	5.73	95.5	6.00	0.115	
Total BTX	<0.300	0.300	04/20/2026	ND					

Surrogate: 4-Bromofluorobenzene (PID) 97.7 % 70.4-141

Chloride, SM4500Cl-B		mg/kg		Analyzed By: AC					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Chloride	2670	16.0	04/20/2026	ND	416	104	400	0.00	

TPH 8015M		mg/kg		Analyzed By: JF					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	<10.0	10.0	04/20/2026	ND	217	109	200	0.418	
DRO >C10-C28*	<10.0	10.0	04/20/2026	ND	229	114	200	0.197	
EXT DRO >C28-C36	<10.0	10.0	04/20/2026	ND					

Surrogate: 1-Chlorooctane 81.2 % 52.4-130

Surrogate: 1-Chlorooctadecane 78.4 % 39.9-141

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

Etech Environmental & Safety Solutions
 JOEL LOWRY
 2617 W MARLAND
 HOBBS NM, 88240
 Fax To:

Received: 04/17/2026
 Reported: 04/21/2026
 Project Name: SERRANO ROLL-OFF OVERFLOW
 Project Number: 23910
 Project Location: GOODNIGHT 32.27997-103.37313

Sampling Date: 04/16/2026
 Sampling Type: Soil
 Sampling Condition: Cool & Intact
 Sample Received By: Alyssa Parras

Sample ID: FL 33 @ 6" (H262234-33)

BTEx 8021B		mg/kg		Analyzed By: JH					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Benzene*	<0.050	0.050	04/20/2026	ND	2.11	106	2.00	0.540	
Toluene*	<0.050	0.050	04/20/2026	ND	2.01	101	2.00	0.740	
Ethylbenzene*	<0.050	0.050	04/20/2026	ND	1.96	98.0	2.00	0.264	
Total Xylenes*	<0.150	0.150	04/20/2026	ND	5.73	95.5	6.00	0.115	
Total BTEX	<0.300	0.300	04/20/2026	ND					

Surrogate: 4-Bromofluorobenzene (PID) 97.5 % 70.4-141

Chloride, SM4500Cl-B		mg/kg		Analyzed By: AC						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Chloride	2590	16.0	04/20/2026	ND	416	104	400	0.00		

TPH 8015M		mg/kg		Analyzed By: JF					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	<10.0	10.0	04/20/2026	ND	217	109	200	0.418	
DRO >C10-C28*	<10.0	10.0	04/20/2026	ND	229	114	200	0.197	
EXT DRO >C28-C36	<10.0	10.0	04/20/2026	ND					

Surrogate: 1-Chlorooctane 77.2 % 52.4-130

Surrogate: 1-Chlorooctadecane 73.2 % 39.9-141

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

Etech Environmental & Safety Solutions
 JOEL LOWRY
 2617 W MARLAND
 HOBBS NM, 88240
 Fax To:

Received: 04/17/2026
 Reported: 04/21/2026
 Project Name: SERRANO ROLL-OFF OVERFLOW
 Project Number: 23910
 Project Location: GOODNIGHT 32.27997-103.37313

Sampling Date: 04/16/2026
 Sampling Type: Soil
 Sampling Condition: Cool & Intact
 Sample Received By: Alyssa Parras

Sample ID: FL 34 @ 6" (H262234-34)

BTEx 8021B		mg/kg		Analyzed By: JH						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Benzene*	<0.050	0.050	04/20/2026	ND	2.11	106	2.00	0.540		
Toluene*	<0.050	0.050	04/20/2026	ND	2.01	101	2.00	0.740		
Ethylbenzene*	<0.050	0.050	04/20/2026	ND	1.96	98.0	2.00	0.264		
Total Xylenes*	<0.150	0.150	04/20/2026	ND	5.73	95.5	6.00	0.115		
Total BTEX	<0.300	0.300	04/20/2026	ND						

Surrogate: 4-Bromofluorobenzene (PID) 101 % 70.4-141

Chloride, SM4500Cl-B		mg/kg		Analyzed By: AC					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Chloride	1710	16.0	04/20/2026	ND	416	104	400	0.00	

TPH 8015M		mg/kg		Analyzed By: JF				S-04	
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	<10.0	10.0	04/20/2026	ND	217	109	200	0.418	
DRO >C10-C28*	3020	10.0	04/20/2026	ND	229	114	200	0.197	
EXT DRO >C28-C36	748	10.0	04/20/2026	ND					

Surrogate: 1-Chlorooctane 83.3 % 52.4-130

Surrogate: 1-Chlorooctadecane 145 % 39.9-141

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

Etech Environmental & Safety Solutions
 JOEL LOWRY
 2617 W MARLAND
 HOBBS NM, 88240
 Fax To:

Received: 04/17/2026
 Reported: 04/21/2026
 Project Name: SERRANO ROLL-OFF OVERFLOW
 Project Number: 23910
 Project Location: GOODNIGHT 32.27997-103.37313

Sampling Date: 04/16/2026
 Sampling Type: Soil
 Sampling Condition: Cool & Intact
 Sample Received By: Alyssa Parras

Sample ID: FL 35 @ 6" (H262234-35)

BTEx 8021B		mg/kg		Analyzed By: JH					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Benzene*	<0.050	0.050	04/20/2026	ND	2.11	106	2.00	0.540	
Toluene*	<0.050	0.050	04/20/2026	ND	2.01	101	2.00	0.740	
Ethylbenzene*	<0.050	0.050	04/20/2026	ND	1.96	98.0	2.00	0.264	
Total Xylenes*	<0.150	0.150	04/20/2026	ND	5.73	95.5	6.00	0.115	
Total BTEX	<0.300	0.300	04/20/2026	ND					

Surrogate: 4-Bromofluorobenzene (PID) 96.8 % 70.4-141

Chloride, SM4500Cl-B		mg/kg		Analyzed By: AC					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Chloride	1000	16.0	04/20/2026	ND	416	104	400	0.00	

TPH 8015M		mg/kg		Analyzed By: JF					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	<10.0	10.0	04/21/2026	ND	217	109	200	0.418	
DRO >C10-C28*	55.8	10.0	04/21/2026	ND	229	114	200	0.197	
EXT DRO >C28-C36	<10.0	10.0	04/21/2026	ND					

Surrogate: 1-Chlorooctane 79.2 % 52.4-130

Surrogate: 1-Chlorooctadecane 75.3 % 39.9-141

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

Etech Environmental & Safety Solutions
 JOEL LOWRY
 2617 W MARLAND
 HOBBS NM, 88240
 Fax To:

Received: 04/17/2026
 Reported: 04/21/2026
 Project Name: SERRANO ROLL-OFF OVERFLOW
 Project Number: 23910
 Project Location: GOODNIGHT 32.27997-103.37313

Sampling Date: 04/16/2026
 Sampling Type: Soil
 Sampling Condition: Cool & Intact
 Sample Received By: Alyssa Parras

Sample ID: FL 36 @ 6" (H262234-36)

BTEx 8021B		mg/kg		Analyzed By: JH						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Benzene*	<0.050	0.050	04/20/2026	ND	2.11	106	2.00	0.540		
Toluene*	<0.050	0.050	04/20/2026	ND	2.01	101	2.00	0.740		
Ethylbenzene*	<0.050	0.050	04/20/2026	ND	1.96	98.0	2.00	0.264		
Total Xylenes*	0.252	0.150	04/20/2026	ND	5.73	95.5	6.00	0.115	GC-NC1	
Total BTEX	<0.300	0.300	04/20/2026	ND						

Surrogate: 4-Bromofluorobenzene (PID) 104 % 70.4-141

Chloride, SM4500Cl-B		mg/kg	Analyzed By: AC							
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Chloride	3630	16.0	04/20/2026	ND	416	104	400	0.00		

TPH 8015M	mg/kg		Analyzed By: JF					S-04	
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	40.1	10.0	04/20/2026	ND	217	109	200	0.418	
DRO >C10-C28*	4930	10.0	04/20/2026	ND	229	114	200	0.197	
EXT DRO >C28-C36	984	10.0	04/20/2026	ND					

Surrogate: 1-Chlorooctane 90.8 % 52.4-130

Surrogate: 1-Chlorooctadecane 185 % 39.9-141

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

Etech Environmental & Safety Solutions
 JOEL LOWRY
 2617 W MARLAND
 HOBBS NM, 88240
 Fax To:

Received: 04/17/2026
 Reported: 04/21/2026
 Project Name: SERRANO ROLL-OFF OVERFLOW
 Project Number: 23910
 Project Location: GOODNIGHT 32.27997-103.37313

Sampling Date: 04/16/2026
 Sampling Type: Soil
 Sampling Condition: Cool & Intact
 Sample Received By: Alyssa Parras

Sample ID: FL 37 @ 6" (H262234-37)

BTEx 8021B		mg/kg		Analyzed By: JH						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Benzene*	<0.050	0.050	04/20/2026	ND	2.11	106	2.00	0.540		
Toluene*	<0.050	0.050	04/20/2026	ND	2.01	101	2.00	0.740		
Ethylbenzene*	<0.050	0.050	04/20/2026	ND	1.96	98.0	2.00	0.264		
Total Xylenes*	<0.150	0.150	04/20/2026	ND	5.73	95.5	6.00	0.115		
Total BTEX	<0.300	0.300	04/20/2026	ND						

Surrogate: 4-Bromofluorobenzene (PID) 96.7 % 70.4-141

Chloride, SM4500Cl-B		mg/kg		Analyzed By: AC						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Chloride	3090	16.0	04/20/2026	ND	416	104	400	0.00		

TPH 8015M		mg/kg		Analyzed By: JF					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	<10.0	10.0	04/21/2026	ND	217	109	200	0.418	
DRO >C10-C28*	1530	10.0	04/21/2026	ND	229	114	200	0.197	
EXT DRO >C28-C36	378	10.0	04/21/2026	ND					

Surrogate: 1-Chlorooctane 75.4 % 52.4-130

Surrogate: 1-Chlorooctadecane 99.6 % 39.9-141

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

Etech Environmental & Safety Solutions
 JOEL LOWRY
 2617 W MARLAND
 HOBBS NM, 88240
 Fax To:

Received: 04/17/2026
 Reported: 04/21/2026
 Project Name: SERRANO ROLL-OFF OVERFLOW
 Project Number: 23910
 Project Location: GOODNIGHT 32.27997-103.37313

Sampling Date: 04/16/2026
 Sampling Type: Soil
 Sampling Condition: Cool & Intact
 Sample Received By: Alyssa Parras

Sample ID: FL 38 @ 6" (H262234-38)

BTEx 8021B		mg/kg		Analyzed By: JH						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Benzene*	<0.050	0.050	04/20/2026	ND	2.11	106	2.00	0.540		
Toluene*	<0.050	0.050	04/20/2026	ND	2.01	101	2.00	0.740		
Ethylbenzene*	<0.050	0.050	04/20/2026	ND	1.96	98.0	2.00	0.264		
Total Xylenes*	<0.150	0.150	04/20/2026	ND	5.73	95.5	6.00	0.115		
Total BTEX	<0.300	0.300	04/20/2026	ND						

Surrogate: 4-Bromofluorobenzene (PID) 97.2 % 70.4-141

Chloride, SM4500Cl-B		mg/kg		Analyzed By: AC						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Chloride	1520	16.0	04/20/2026	ND	416	104	400	0.00		

TPH 8015M		mg/kg		Analyzed By: MS					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	<10.0	10.0	04/21/2026	ND	217	109	200	0.418	
DRO >C10-C28*	15.9	10.0	04/21/2026	ND	229	114	200	0.197	
EXT DRO >C28-C36	<10.0	10.0	04/21/2026	ND					

Surrogate: 1-Chlorooctane 75.6 % 52.4-130

Surrogate: 1-Chlorooctadecane 74.1 % 39.9-141

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

Etech Environmental & Safety Solutions
 JOEL LOWRY
 2617 W MARLAND
 HOBBS NM, 88240
 Fax To:

Received: 04/17/2026
 Reported: 04/21/2026
 Project Name: SERRANO ROLL-OFF OVERFLOW
 Project Number: 23910
 Project Location: GOODNIGHT 32.27997-103.37313

Sampling Date: 04/16/2026
 Sampling Type: Soil
 Sampling Condition: Cool & Intact
 Sample Received By: Alyssa Parras

Sample ID: FL 39 @ 6" (H262234-39)

BTEx 8021B		mg/kg		Analyzed By: JH						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Benzene*	<0.050	0.050	04/20/2026	ND	2.11	106	2.00	0.540		
Toluene*	<0.050	0.050	04/20/2026	ND	2.01	101	2.00	0.740		
Ethylbenzene*	<0.050	0.050	04/20/2026	ND	1.96	98.0	2.00	0.264		
Total Xylenes*	<0.150	0.150	04/20/2026	ND	5.73	95.5	6.00	0.115		
Total BTEX	<0.300	0.300	04/20/2026	ND						

Surrogate: 4-Bromofluorobenzene (PID) 96.6 % 70.4-141

Chloride, SM4500Cl-B		mg/kg		Analyzed By: AC					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Chloride	1780	16.0	04/20/2026	ND	416	104	400	0.00	

TPH 8015M		mg/kg		Analyzed By: JF					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	<10.0	10.0	04/21/2026	ND	217	109	200	0.418	
DRO >C10-C28*	<10.0	10.0	04/21/2026	ND	229	114	200	0.197	
EXT DRO >C28-C36	<10.0	10.0	04/21/2026	ND					

Surrogate: 1-Chlorooctane 85.9 % 52.4-130

Surrogate: 1-Chlorooctadecane 83.4 % 39.9-141

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

Etech Environmental & Safety Solutions
 JOEL LOWRY
 2617 W MARLAND
 HOBBS NM, 88240
 Fax To:

Received: 04/17/2026
 Reported: 04/21/2026
 Project Name: SERRANO ROLL-OFF OVERFLOW
 Project Number: 23910
 Project Location: GOODNIGHT 32.27997-103.37313

Sampling Date: 04/16/2026
 Sampling Type: Soil
 Sampling Condition: Cool & Intact
 Sample Received By: Alyssa Parras

Sample ID: FL 40 @ 6" (H262234-40)

BTEx 8021B		mg/kg		Analyzed By: JH					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Benzene*	<0.050	0.050	04/20/2026	ND	2.11	106	2.00	0.540	
Toluene*	<0.050	0.050	04/20/2026	ND	2.01	101	2.00	0.740	
Ethylbenzene*	<0.050	0.050	04/20/2026	ND	1.96	98.0	2.00	0.264	
Total Xylenes*	<0.150	0.150	04/20/2026	ND	5.73	95.5	6.00	0.115	
Total BTEX	<0.300	0.300	04/20/2026	ND					

Surrogate: 4-Bromofluorobenzene (PID) 96.8 % 70.4-141

Chloride, SM4500Cl-B		mg/kg		Analyzed By: KH						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Chloride	2680	16.0	04/20/2026	ND	416	104	400	3.77		

TPH 8015M		mg/kg		Analyzed By: JF					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	<10.0	10.0	04/21/2026	ND	217	109	200	0.418	
DRO >C10-C28*	<10.0	10.0	04/21/2026	ND	229	114	200	0.197	
EXT DRO >C28-C36	<10.0	10.0	04/21/2026	ND					

Surrogate: 1-Chlorooctane 83.4 % 52.4-130

Surrogate: 1-Chlorooctadecane 80.7 % 39.9-141

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

Etech Environmental & Safety Solutions
 JOEL LOWRY
 2617 W MARLAND
 HOBBS NM, 88240
 Fax To:

Received: 04/17/2026
 Reported: 04/21/2026
 Project Name: SERRANO ROLL-OFF OVERFLOW
 Project Number: 23910
 Project Location: GOODNIGHT 32.27997-103.37313

Sampling Date: 04/16/2026
 Sampling Type: Soil
 Sampling Condition: Cool & Intact
 Sample Received By: Alyssa Parras

Sample ID: FL 41 @ 6" (H262234-41)

BTEx 8021B		mg/kg		Analyzed By: JH						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Benzene*	<0.050	0.050	04/20/2026	ND	2.04	102	2.00	1.38	QM-07	
Toluene*	<0.050	0.050	04/20/2026	ND	1.82	91.0	2.00	2.40		
Ethylbenzene*	<0.050	0.050	04/20/2026	ND	1.76	88.0	2.00	1.01		
Total Xylenes*	<0.150	0.150	04/20/2026	ND	5.21	86.8	6.00	0.0958		
Total BTEX	<0.300	0.300	04/20/2026	ND						

Surrogate: 4-Bromofluorobenzene (PID) 101 % 70.4-141

Chloride, SM4500Cl-B		mg/kg		Analyzed By: KH						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Chloride	1790	16.0	04/20/2026	ND	416	104	400	3.77		

TPH 8015M		mg/kg		Analyzed By: JF					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	<10.0	10.0	04/20/2026	ND	197	98.5	200	4.80	
DRO >C10-C28*	<10.0	10.0	04/20/2026	ND	205	103	200	3.92	
EXT DRO >C28-C36	<10.0	10.0	04/20/2026	ND					

Surrogate: 1-Chlorooctane 73.4 % 52.4-130

Surrogate: 1-Chlorooctadecane 68.6 % 39.9-141

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

Etech Environmental & Safety Solutions
 JOEL LOWRY
 2617 W MARLAND
 HOBBS NM, 88240
 Fax To:

Received: 04/17/2026
 Reported: 04/21/2026
 Project Name: SERRANO ROLL-OFF OVERFLOW
 Project Number: 23910
 Project Location: GOODNIGHT 32.27997-103.37313

Sampling Date: 04/16/2026
 Sampling Type: Soil
 Sampling Condition: Cool & Intact
 Sample Received By: Alyssa Parras

Sample ID: FL 42 @ 6" (H262234-42)

BTEx 8021B		mg/kg		Analyzed By: JH						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Benzene*	<0.050	0.050	04/20/2026	ND	2.04	102	2.00	1.38		
Toluene*	<0.050	0.050	04/20/2026	ND	1.82	91.0	2.00	2.40		
Ethylbenzene*	<0.050	0.050	04/20/2026	ND	1.76	88.0	2.00	1.01		
Total Xylenes*	<0.150	0.150	04/20/2026	ND	5.21	86.8	6.00	0.0958		
Total BTEX	<0.300	0.300	04/20/2026	ND						

Surrogate: 4-Bromofluorobenzene (PID) 97.3 % 70.4-141

Chloride, SM4500Cl-B		mg/kg		Analyzed By: KH						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Chloride	2190	16.0	04/20/2026	ND	416	104	400	3.77		

TPH 8015M		mg/kg		Analyzed By: JF					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	<10.0	10.0	04/20/2026	ND	197	98.5	200	4.80	
DRO >C10-C28*	<10.0	10.0	04/20/2026	ND	205	103	200	3.92	
EXT DRO >C28-C36	<10.0	10.0	04/20/2026	ND					

Surrogate: 1-Chlorooctane 77.0 % 52.4-130

Surrogate: 1-Chlorooctadecane 71.1 % 39.9-141

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

Etech Environmental & Safety Solutions
 JOEL LOWRY
 2617 W MARLAND
 HOBBS NM, 88240
 Fax To:

Received: 04/17/2026
 Reported: 04/21/2026
 Project Name: SERRANO ROLL-OFF OVERFLOW
 Project Number: 23910
 Project Location: GOODNIGHT 32.27997-103.37313

Sampling Date: 04/16/2026
 Sampling Type: Soil
 Sampling Condition: Cool & Intact
 Sample Received By: Alyssa Parras

Sample ID: FL 43 @ 6" (H262234-43)

BTEx 8021B		mg/kg		Analyzed By: JH						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Benzene*	<0.050	0.050	04/20/2026	ND	2.04	102	2.00	1.38		
Toluene*	<0.050	0.050	04/20/2026	ND	1.82	91.0	2.00	2.40		
Ethylbenzene*	<0.050	0.050	04/20/2026	ND	1.76	88.0	2.00	1.01		
Total Xylenes*	<0.150	0.150	04/20/2026	ND	5.21	86.8	6.00	0.0958		
Total BTEX	<0.300	0.300	04/20/2026	ND						

Surrogate: 4-Bromofluorobenzene (PID) 99.4 % 70.4-141

Chloride, SM4500Cl-B		mg/kg		Analyzed By: KH						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Chloride	2770	16.0	04/20/2026	ND	416	104	400	3.77		

TPH 8015M		mg/kg		Analyzed By: JF					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	<10.0	10.0	04/20/2026	ND	197	98.5	200	4.80	
DRO >C10-C28*	<10.0	10.0	04/20/2026	ND	205	103	200	3.92	
EXT DRO >C28-C36	<10.0	10.0	04/20/2026	ND					

Surrogate: 1-Chlorooctane 76.0 % 52.4-130

Surrogate: 1-Chlorooctadecane 71.2 % 39.9-141

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

Etech Environmental & Safety Solutions
 JOEL LOWRY
 2617 W MARLAND
 HOBBS NM, 88240
 Fax To:

Received: 04/17/2026
 Reported: 04/21/2026
 Project Name: SERRANO ROLL-OFF OVERFLOW
 Project Number: 23910
 Project Location: GOODNIGHT 32.27997-103.37313

Sampling Date: 04/16/2026
 Sampling Type: Soil
 Sampling Condition: Cool & Intact
 Sample Received By: Alyssa Parras

Sample ID: FL 44 @ 6" (H262234-44)

BTEx 8021B		mg/kg		Analyzed By: JH						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Benzene*	<0.050	0.050	04/20/2026	ND	2.04	102	2.00	1.38		
Toluene*	<0.050	0.050	04/20/2026	ND	1.82	91.0	2.00	2.40		
Ethylbenzene*	<0.050	0.050	04/20/2026	ND	1.76	88.0	2.00	1.01		
Total Xylenes*	<0.150	0.150	04/20/2026	ND	5.21	86.8	6.00	0.0958		
Total BTEX	<0.300	0.300	04/20/2026	ND						

Surrogate: 4-Bromofluorobenzene (PID) 96.9 % 70.4-141

Chloride, SM4500Cl-B		mg/kg		Analyzed By: KH						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Chloride	1390	16.0	04/20/2026	ND	416	104	400	3.77		

TPH 8015M		mg/kg		Analyzed By: JF					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	<10.0	10.0	04/20/2026	ND	197	98.5	200	4.80	
DRO >C10-C28*	<10.0	10.0	04/20/2026	ND	205	103	200	3.92	
EXT DRO >C28-C36	<10.0	10.0	04/20/2026	ND					

Surrogate: 1-Chlorooctane 71.7 % 52.4-130

Surrogate: 1-Chlorooctadecane 65.3 % 39.9-141

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

Etech Environmental & Safety Solutions
 JOEL LOWRY
 2617 W MARLAND
 HOBBS NM, 88240
 Fax To:

Received: 04/17/2026
 Reported: 04/21/2026
 Project Name: SERRANO ROLL-OFF OVERFLOW
 Project Number: 23910
 Project Location: GOODNIGHT 32.27997-103.37313

Sampling Date: 04/16/2026
 Sampling Type: Soil
 Sampling Condition: Cool & Intact
 Sample Received By: Alyssa Parras

Sample ID: FL 45 @ 6" (H262234-45)

BTEx 8021B		mg/kg		Analyzed By: JH						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Benzene*	<0.050	0.050	04/20/2026	ND	2.04	102	2.00	1.38		
Toluene*	<0.050	0.050	04/20/2026	ND	1.82	91.0	2.00	2.40		
Ethylbenzene*	<0.050	0.050	04/20/2026	ND	1.76	88.0	2.00	1.01		
Total Xylenes*	<0.150	0.150	04/20/2026	ND	5.21	86.8	6.00	0.0958		
Total BTEX	<0.300	0.300	04/20/2026	ND						

Surrogate: 4-Bromofluorobenzene (PID) 101 % 70.4-141

Chloride, SM4500Cl-B		mg/kg		Analyzed By: KH						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Chloride	<16.0	16.0	04/20/2026	ND	416	104	400	3.77		

TPH 8015M		mg/kg		Analyzed By: JF					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	<10.0	10.0	04/20/2026	ND	197	98.5	200	4.80	
DRO >C10-C28*	<10.0	10.0	04/20/2026	ND	205	103	200	3.92	
EXT DRO >C28-C36	<10.0	10.0	04/20/2026	ND					

Surrogate: 1-Chlorooctane 75.6 % 52.4-130

Surrogate: 1-Chlorooctadecane 70.8 % 39.9-141

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

Etech Environmental & Safety Solutions
 JOEL LOWRY
 2617 W MARLAND
 HOBBS NM, 88240
 Fax To:

Received: 04/17/2026
 Reported: 04/21/2026
 Project Name: SERRANO ROLL-OFF OVERFLOW
 Project Number: 23910
 Project Location: GOODNIGHT 32.27997-103.37313

Sampling Date: 04/16/2026
 Sampling Type: Soil
 Sampling Condition: Cool & Intact
 Sample Received By: Alyssa Parras

Sample ID: FL 46 @ 6" (H262234-46)

BTEx 8021B		mg/kg		Analyzed By: JH					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Benzene*	<0.050	0.050	04/20/2026	ND	2.04	102	2.00	1.38	
Toluene*	<0.050	0.050	04/20/2026	ND	1.82	91.0	2.00	2.40	
Ethylbenzene*	<0.050	0.050	04/20/2026	ND	1.76	88.0	2.00	1.01	
Total Xylenes*	<0.150	0.150	04/20/2026	ND	5.21	86.8	6.00	0.0958	
Total BTEX	<0.300	0.300	04/20/2026	ND					

Surrogate: 4-Bromofluorobenzene (PID) 99.6 % 70.4-141

Chloride, SM4500Cl-B		mg/kg		Analyzed By: KH					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Chloride	512	16.0	04/20/2026	ND	416	104	400	3.77	

TPH 8015M		mg/kg		Analyzed By: JF					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	<10.0	10.0	04/20/2026	ND	197	98.5	200	4.80	
DRO >C10-C28*	<10.0	10.0	04/20/2026	ND	205	103	200	3.92	
EXT DRO >C28-C36	<10.0	10.0	04/20/2026	ND					

Surrogate: 1-Chlorooctane 77.5 % 52.4-130

Surrogate: 1-Chlorooctadecane 71.3 % 39.9-141

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

Etech Environmental & Safety Solutions
 JOEL LOWRY
 2617 W MARLAND
 HOBBS NM, 88240
 Fax To:

Received: 04/17/2026
 Reported: 04/21/2026
 Project Name: SERRANO ROLL-OFF OVERFLOW
 Project Number: 23910
 Project Location: GOODNIGHT 32.27997-103.37313

Sampling Date: 04/16/2026
 Sampling Type: Soil
 Sampling Condition: Cool & Intact
 Sample Received By: Alyssa Parras

Sample ID: FL 47 @ 6" (H262234-47)

BTEx 8021B		mg/kg		Analyzed By: JH						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Benzene*	<0.050	0.050	04/20/2026	ND	2.04	102	2.00	1.38		
Toluene*	<0.050	0.050	04/20/2026	ND	1.82	91.0	2.00	2.40		
Ethylbenzene*	<0.050	0.050	04/20/2026	ND	1.76	88.0	2.00	1.01		
Total Xylenes*	<0.150	0.150	04/20/2026	ND	5.21	86.8	6.00	0.0958		
Total BTEX	<0.300	0.300	04/20/2026	ND						

Surrogate: 4-Bromofluorobenzene (PID) 100 % 70.4-141

Chloride, SM4500Cl-B		mg/kg		Analyzed By: KH					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Chloride	<16.0	16.0	04/20/2026	ND	416	104	400	3.77	

TPH 8015M		mg/kg		Analyzed By: JF					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	<10.0	10.0	04/20/2026	ND	197	98.5	200	4.80	
DRO >C10-C28*	<10.0	10.0	04/20/2026	ND	205	103	200	3.92	
EXT DRO >C28-C36	<10.0	10.0	04/20/2026	ND					

Surrogate: 1-Chlorooctane 83.0 % 52.4-130

Surrogate: 1-Chlorooctadecane 75.8 % 39.9-141

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

Etech Environmental & Safety Solutions
 JOEL LOWRY
 2617 W MARLAND
 HOBBS NM, 88240
 Fax To:

Received: 04/17/2026
 Reported: 04/21/2026
 Project Name: SERRANO ROLL-OFF OVERFLOW
 Project Number: 23910
 Project Location: GOODNIGHT 32.27997-103.37313

Sampling Date: 04/16/2026
 Sampling Type: Soil
 Sampling Condition: Cool & Intact
 Sample Received By: Alyssa Parras

Sample ID: FL 48 @ 6" (H262234-48)

BTEx 8021B		mg/kg		Analyzed By: JH					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Benzene*	<0.050	0.050	04/20/2026	ND	2.04	102	2.00	1.38	
Toluene*	<0.050	0.050	04/20/2026	ND	1.82	91.0	2.00	2.40	
Ethylbenzene*	<0.050	0.050	04/20/2026	ND	1.76	88.0	2.00	1.01	
Total Xylenes*	<0.150	0.150	04/20/2026	ND	5.21	86.8	6.00	0.0958	
Total BTEX	<0.300	0.300	04/20/2026	ND					

Surrogate: 4-Bromofluorobenzene (PID) 101 % 70.4-141

Chloride, SM4500Cl-B		mg/kg		Analyzed By: KH						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Chloride	<16.0	16.0	04/20/2026	ND	416	104	400	3.77		

TPH 8015M		mg/kg		Analyzed By: JF					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	<10.0	10.0	04/20/2026	ND	197	98.5	200	4.80	
DRO >C10-C28*	<10.0	10.0	04/20/2026	ND	205	103	200	3.92	
EXT DRO >C28-C36	<10.0	10.0	04/20/2026	ND					

Surrogate: 1-Chlorooctane 81.4 % 52.4-130

Surrogate: 1-Chlorooctadecane 74.9 % 39.9-141

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

Etech Environmental & Safety Solutions
 JOEL LOWRY
 2617 W MARLAND
 HOBBS NM, 88240
 Fax To:

Received: 04/17/2026
 Reported: 04/21/2026
 Project Name: SERRANO ROLL-OFF OVERFLOW
 Project Number: 23910
 Project Location: GOODNIGHT 32.27997-103.37313

Sampling Date: 04/16/2026
 Sampling Type: Soil
 Sampling Condition: Cool & Intact
 Sample Received By: Alyssa Parras

Sample ID: FL 49 @ 6" (H262234-49)

BTEx 8021B		mg/kg		Analyzed By: JH						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Benzene*	<0.050	0.050	04/20/2026	ND	2.04	102	2.00	1.38		
Toluene*	<0.050	0.050	04/20/2026	ND	1.82	91.0	2.00	2.40		
Ethylbenzene*	<0.050	0.050	04/20/2026	ND	1.76	88.0	2.00	1.01		
Total Xylenes*	<0.150	0.150	04/20/2026	ND	5.21	86.8	6.00	0.0958		
Total BTEx	<0.300	0.300	04/20/2026	ND						

Surrogate: 4-Bromofluorobenzene (PID) 99.5 % 70.4-141

Chloride, SM4500CI-B		mg/kg		Analyzed By: KH						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Chloride	<16.0	16.0	04/20/2026	ND	416	104	400	3.77		

TPH 8015M		mg/kg		Analyzed By: JF					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	<10.0	10.0	04/20/2026	ND	197	98.5	200	4.80	
DRO >C10-C28*	<10.0	10.0	04/20/2026	ND	205	103	200	3.92	
EXT DRO >C28-C36	<10.0	10.0	04/20/2026	ND					

Surrogate: 1-Chlorooctane 75.7 % 52.4-130

Surrogate: 1-Chlorooctadecane 70.3 % 39.9-141

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager

PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Notes and Definitions

S-04	The surrogate recovery for this sample is outside of established control limits due to a sample matrix effect.
QM-07	The spike recovery was outside acceptance limits for the MS and/or MSD. The batch was accepted based on acceptable LCS recovery.
GC-NC1	8260 confirmation analysis was performed; initial GC results were not supported by GC/MS analysis and are biased high with interfering compounds.
BS-3	Blank spike recovery outside of lab established statistical limits, but still within method limits. Data is not adversely affected.
ND	Analyte NOT DETECTED at or above the reporting limit
RPD	Relative Percent Difference
**	Samples not received at proper temperature of 6°C or below.
***	Insufficient time to reach temperature.
-	Chloride by SM4500Cl-B does not require samples be received at or below 6°C Samples reported on an as received basis (wet) unless otherwise noted on report

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

A handwritten signature in black ink, appearing to read "Celey D. Keene".

Celey D. Keene, Lab Director/Quality Manager

101 East Marland, Hobbs, NM 88240
(575) 393-2326 FAX (575) 393-2476

Pg 1 of 5

Page 52 of 56

Company Name: Etech Environmental & Safety Solutions, Inc.						BILL TO		ANALYSIS REQUEST																	
Project Manager: Joel Lowry						P.O. #:		Chloride TPH (8015M) BTEX (8021B)																	
Address: 2617 West Marland						Company: Goodnight Midstream																			
City: Hobbs State: NM Zip: 88240						Attn: Ralph Tijerina																			
Phone #: (575) 264-9884 Fax #:						Address:																			
Project #: 23910 Project Owner: Goodnight Midstream Partners, LLC						City:																			
Project Name: Serrano Roll-Off Overflow						State: Zip:																			
Project Location: 32 27997, -103.37313						Phone #:																			
Sampler Name: Martin Sepulveda						Fax #:																			
FOR LAB USE ONLY						MATRIX		PRESERV.	SAMPLING																
Lab I.D.	Sample I.D.	(G/RAB OR C/COMP)	# CONTAINERS	GROUNDWATER	WASTEWATER	SOIL	OIL	SLUDGE	OTHER	ACID/BASE	ICE / COOL	OTHER	DATE	TIME											
HERE DO NOT USE	FL 1 @ 3"	C	1		X					X			4/16/26		X	X	X								
	FL 2 @ 3"	C	1		X					X			4/16/26		X	X	X								
	FL 3 @ 3"	C	1		X					X			4/16/26		X	X	X								
	FL 4 @ 6"	C	1		X					X			4/16/26		X	X	X								
	FL 5 @ 3"	C	1		X					X			4/16/26		X	X	X								
	FL 6 @ 3"	C	1		X					X			4/16/26		X	X	X								
	FL 7 @ 3"	C	1		X					X			4/16/26		X	X	X								
	FL 8 @ 6"	C	1		X					X			4/16/26		X	X	X								
	FL 9 @ 6"	C	1		X					X			4/16/26		X	X	X								
	FL 10 @ 6"	C	1		X					X			4/16/26		X	X	X								
PLEASE NOTE: Liability and Coverage: Cardtek's facility and clients activities strictly for any claim arising whether based or not, shall be limited to the amount paid by the client for the services. All claims involving third parties for negligence and any other cause whatsoever shall be limited unless stated in writing and received by Cardtek within 30 days after completion of the analytical service. No event shall Cardtek be liable for consequential damages, including without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of services hereunder by Cardtek, regardless of whether such claim is based upon any of the above stated theories or otherwise.																									
Relinquished By: [Signature]						Received By: [Signature]						Verbal Result: ☒ Yes ☐ No Add'l Phone #:													
Date: 4/17/26 Time: 1:53 PM						Date: 4/17/26 Time: 1:53 PM						All Results are emailed. Please provide Email address: pm@etechenv.com													
Relinquished By:						Received By:						REMARKS: 48H Rush													
Delivered By: (Circle One) Sampler - UPS - Bus - Other:						Observed Temp. °C: -51 Corrected Temp. °C: -50.2						Sample Condition Cool Intact ☒ Yes ☐ No													
						CHECKED BY: (Initials) HPD						Turnaround Time: Standard ☐ Rush ☒													
						Thermometer ID: #140 Correction Factor: +0.1°C						Bacteria (only) Sample Condition Cool Intact ☐ Yes ☐ No Observed Temp. °C: Corrected Temp. °C:													

† Cardinal cannot accept verbal changes. Please email changes to celey.keene@cardinallabsnm.com



CHAIN-OF-CUSTODY AND ANALYSIS REQUEST

101 East Marland, Hobbs, NM 88240
(575) 393-2326 FAX (575) 393-2476

Pg 2 of 5

Page 53 of 56

Company Name: Etech Environmental & Safety Solutions, Inc.				BILL TO				ANALYSIS REQUEST																					
Project Manager: Joel Lowry				P.O. #:				Chloride TPH (8015M) BTEX (8021B)																					
Address: 2617 West Marland				Company: Goodnight Midstream																									
City: Hobbs State: NM Zip: 88240				Attn: Ralph Tijerina																									
Phone #: (575) 264-9884 Fax #:				Address:																									
Project #: 23910 Project Owner: Goodnight Midstream Permian, LLC				City:																									
Project Name: Serrano Roll-Off Overflow				State: Zip:																									
Project Location: 32.27997, -103.37313				Phone #:																									
Sampler Name: Martin Sepulveda				Fax #:																									
FOR LAB USE ONLY		Lab I.D.		Sample I.D.		(G)RAB OR (C)OMP.		# CONTAINERS		MATRIX				PRESERV.		SAMPLING													
										GROUNDWATER WASTEWATER SOIL OIL SLUDGE OTHER				ACID/BASE ICE / COOL OTHER		DATE TIME													
101/20234		11		FL 11 @ 6"		C 1				X				X		4/16/26		X X X											
12		12		FL 12 @ 6"		C 1				X				X		4/16/26		X X X											
13		13		FL 13 @ 6"		C 1				X				X		4/16/26		X X X											
14		14		FL 14 @ 6"		C 1				X				X		4/16/26		X X X											
15		15		FL 15 @ 6"		C 1				X				X		4/16/26		X X X											
16		16		FL 16 @ 6"		C 1				X				X		4/16/26		X X X											
17		17		FL 17 @ 6"		C 1				X				X		4/16/26		X X X											
18		18		FL 18 @ 6"		C 1				X				X		4/16/26		X X X											
19		19		FL 19 @ 6"		C 1				X				X		4/16/26		X X X											
20		20		FL 20 @ 6"		C 1				X				X		4/16/26		X X X											

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's evaluation (mostly for use cases where liability is not at issue) is limited to the amount paid by the client for the services. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within 30 days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including without limitation, business interruptions, loss of use, or loss of profits incurred by client, or substitution, shipment or destruction of samples and/or in relation to the performance of services furnished by Cardinal, regardless of whether such claim is based upon any of the above stated causes or otherwise.

Relinquished By:		Date: 4-17-26		Received By:		Verbal Result: ☐ Yes ☒ No Add'l Phone #:	
Relinquished By:		Date: 4-15-26		Received By:		REMARKS: 48H Rush	
Delivered By: (Circle One) Sampler - UPS - Bus - Other:		Observed Temp. °C 5.16 Corrected Temp. °C 5.02		Sample Condition Cool Intact ☒ Yes ☐ No		Turnaround Time: Standard ☐ Rush ☒	
				CHECKED BY: (Initials) AJP		Bacteria (only) Sample Condition Cool Intact ☐ Yes ☒ No	
						Thermometer ID #143 Correction Factor +0.1°C	

† Cardinal cannot accept verbal changes. Please email changes to celey.keene@cardinallabsnm.com

101 East Marland, Hobbs, NM 88240
(575) 393-2326 FAX (575) 393-2476

CHAIN-OF-CUSTODY AND ANALYSIS REQUEST

Pg 3 of 5

Page 54 of 56

[illegible]

PLEASE NOTE: Liability and damages. Cardinal's liability and claim's exclusive remedy is: Any claim arising whether based in contract or tort, shall be limited to the amount paid by the client for the analysis. All claims, including those for negligence and any other cause whatsoever, shall be deemed waived unless made in writing and received by Cardinal within 30 days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including without limitation, business interruptions, loss of data, or loss of profits incurred by client. No arbitrator, arbitrator or arbitrators writing out of or related to the performance of services hereunder by Cardinal, regardless of whether such claim is based upon any of the above listed theories or otherwise.

Relinquished By: <i>Matt</i>		Date: <i>4-1-20</i>		Received By: <i>[Signature]</i>		Verbal Result: ☐ Yes ☐ No Add'l Phone #:	
Time: <i>1453</i>		Time:		Time:		All Results are emailed. Please provide Email address: gm@starchenry.com	
Relinquished By:		Date:		Received By:		REMARKS:	
Time:		Time:		Time:		<i>48H Rush</i>	
Delivered By: (Circle One)		Observed Temp. °C <i>-51-</i>		Sample Condition Cool Intact		CHECKED BY: (Initials)	
Sampler - UPS - Bus - Other:		Corrected Temp. °C <i>-50-</i>		☐ Yes ☐ No ☐ Yes ☐ No		Turnaround Time: Standard ☐ Rush ☒	
				<i>AP</i>		Bacteria (only) Sample Condition Cool Intact Observed Temp. °C ☐ Yes ☐ No ☐ Yes ☐ No Corrected Temp. °C	
						Thermometer ID #140 Correction Factor +0.1°C	

† Cardinal cannot accept verbal changes. Please email changes to celey.keene@cardinallabsnm.com



CHAIN-OF-CUSTODY AND ANALYSIS REQUEST

101 East Marland, Hobbs, NM 88240
(575) 393-2326 FAX (575) 393-2476

Pg 4 of 5

Company Name: Etch Environmental & Safety Solutions, Inc.				BILL TO				ANALYSIS REQUEST																	
Project Manager: Joel Lowry				P.O. #:				Chloride TPH (8015M) BTEX (8021B)																	
Address: 2517 West Marland				Company: Goodnight Midstream																					
City: Hobbs State: NM Zip: 88240				Attn: Ralph Tijerina																					
Phone #: (575) 264-9884 Fax #:				Address:																					
Project #: 23910 Project Owner: Goodnight Midstream Partners, LLC				City:																					
Project Name: Serrano Roll-Off Overflow				State: Zip:																					
Project Location: 32.27997, -103.37313				Phone #:																					
Sampler Name: Martin Sepulveda				Fax #:																					
FOR LAB USE ONLY		Lab I.D.		Sample I.D.		GRAB OR (COMP. # CONTAINERS)		MATRIX		PRESERV.		SAMPLING													
								GROUNDWATER WASTEWATER SOIL OIL SLUDGE OTHER		ACID/BASE ICE / COOL OTHER		DATE TIME													
48162234		31		FL 31 @ 5"		C 1		X		X		4/16/26		X X X											
32		32		FL 32 @ 5"		C 1		X		X		4/16/26		X X X											
33		33		FL 33 @ 5"		C 1		X		X		4/16/26		X X X											
34		34		FL 34 @ 5"		C 1		X		X		4/16/26		X X X											
35		35		FL 35 @ 5"		C 1		X		X		4/16/26		X X X											
36		36		FL 36 @ 5"		C 1		X		X		4/16/26		X X X											
37		37		FL 37 @ 5"		C 1		X		X		4/16/26		X X X											
38		38		FL 38 @ 5"		C 1		X		X		4/16/26		X X X											
39		39		FL 39 @ 5"		C 1		X		X		4/16/26		X X X											
40		40		FL 40 @ 5"		C 1		X		X		4/16/26		X X X											

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising whether based in contract or tort, shall be limited to the amount paid by the client for the analysis. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within 30 days after completion of the analytical services. In no event shall Cardinal be liable for incidental or consequential damages, including without limitation, business interruptions, loss of use, or loss of profits incurred by client. An assumption of responsibility or warranty arising out of or related to the performance of services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise.

Relinquished By:		Date: 4/15/26	Received By:		Verbal Result: ☐ Yes ☒ No Add'l Phone #:	
Time: 1:53			Time: 2:03		All Results are emailed. Please provide Email address: gm@etechnv.com	
Relinquished By:		Date:	Received By:		REMARKS:	
Time:					48H Rush	
Delivered By: (Circle One)		Observed Temp. °C	Sample Condition		Turnaround Time: Standard ☐ Rush ☒	
Sampler - UP5 - Bus - Other:		Corrected Temp. °C	Cool Intact ☐ Yes ☐ No ☐ Yes ☐ No		Bacteria (only) Sample Condition	
			CHECKED BY: (Initials)		Cool Intact ☐ Yes ☐ No ☐ Yes ☐ No	
					Observed Temp. °C	
					Corrected Temp. °C	

† Cardinal cannot accept verbal changes. Please email changes to celey.keene@cardinallabsnm.com



101 East Marland, Hobbs, NM 88240
(575) 393-2326 FAX (575) 393-2476

CHAIN-OF-CUSTODY AND ANALYSIS REQUEST

Pg 5 of 5

Company Name: Elach Environmental & Safety Solutions, Inc.				BILL TO				ANALYSIS REQUEST											
Project Manager: Joel Lowry				P.O. #:															
Address: 2617 West Marland				Company: Goodnight Midstream															
City: Hobbs State: NM Zip: 88240				Attn: Ralph Tijerina															
Phone #: (575) 264-9884 Fax #:				Address:															
Project #: 23910 Project Owner: Goodnight Midstream Partners, LLC				City:															
Project Name: Serrano Roll-Off Overflow				State: Zip:															
Project Location: 32.27997 -103.57313				Phone #:															
Sampler Name: Martin Sepulveda				Fax #:															
FOR LAB USE ONLY				MATRIX		PRESERV.		SAMPLING											
Lab I.D.	Sample I.D.	(G/RAG OR C/COMP)	# CONTAINERS	GROUNDWATER	WASTEWATER	SOIL	OIL	SILUDGE	OTHER										
41	FL 41 @ 5'	C	1			X				X			4/15/26						
42	FL 42 @ 5'	C	1			X				X			4/15/26						
43	FL 43 @ 5'	C	1			X				X			4/15/26						
44	FL 44 @ 5'	C	1			X				X			4/15/26						
45	FL 45 @ 5'	C	1			X				X			4/15/26						
46	FL 46 @ 5'	C	1			X				X			4/15/26						
47	FL 47 @ 5'	C	1			X				X			4/15/26						
48	FL 48 @ 5'	C	1			X				X			4/15/26						
49	FL 49 @ 5'	C	1			X				X			4/15/26						

LAB USE ONLY: Liability and Damages: (Customer's) and their customer's liability for any claim arising from the use of the sample is limited to the amount paid for the test for the sample. All results, including those for hazardous and any other dangerous materials, shall be provided within 30 days of the receipt of the sample. In no event shall Cardinal be liable for indirect or consequential damages, including without limitation, business interruption, loss of data, or loss of profits arising from the use of the sample. Results of analyses shall not be used to determine the performance of any product or service provided by Cardinal. Cardinal's liability shall be limited to the amount paid for the test for the sample.

Relinquished By: <i>Martin Sepulveda</i>	Date: 4-17-26 Time: 14:57	Received By: <i>[Signature]</i>	Verbal Result: ☐ Yes ☒ No Add'l Phone #:
Relinquished By:	Date:	Received By:	All Results are emailed. Please provide Email address: pjm@etechem.com
Delivered By: (Circle One) Sampler - UPS - Bus - Other:	Observed Temp. °C: -5.1	Sample Condition: Cool ☒ Intact ☒ Yes ☐ No ☐	Turnaround Time: Standard ☒ Rush ☐
	Corrected Temp. °C: -5.14	CHECKED BY: (Initials) <i>AS</i>	REMARKS: 49H Rush
		Thermometer ID: #140 Correction Factor: +0.1°C	Bacteria (only) Sample Condition: Cool ☐ Intact ☐ Yes ☐ No ☐

† Cardinal cannot accept verbal changes. Please email changes to: pjm@etechem.com



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

April 22, 2026

JOEL LOWRY

Etech Environmental & Safety Solutions

2617 W MARLAND

HOBBS, NM 88240

RE: SERRANO ROLL-OFF OVERFLOW

Enclosed are the results of analyses for samples received by the laboratory on 04/20/26 14:43.

Cardinal Laboratories is accredited through Texas NELAP under certificate number TX-C25-00101. Accreditation applies to drinking water, non-potable water and solid and chemical materials. All accredited analytes are denoted by an asterisk (*). For a complete list of accredited analytes and matrices visit the TCEQ website at www.tceq.texas.gov/field/qa/lab_accred_certif.html.

Cardinal Laboratories is accredited through the State of Colorado Department of Public Health and Environment for:

Method EPA 552.2	Haloacetic Acids (HAA-5)
Method EPA 524.2	Total Trihalomethanes (TTHM)
Method EPA 524.4	Regulated VOCs (V1, V2, V3)

Accreditation applies to public drinking water matrices.

This report meets NELAP requirements and is made up of a cover page, analytical results, and a copy of the original chain-of-custody. If you have any questions concerning this report, please feel free to contact me.

Sincerely,

A handwritten signature in black ink that reads "Coley D. Keene". The signature is written in a cursive style with a large, stylized 'C' at the beginning.

Celey D. Keene

Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

Etech Environmental & Safety Solutions
 JOEL LOWRY
 2617 W MARLAND
 HOBBS NM, 88240
 Fax To:

Received: 04/20/2026
 Reported: 04/22/2026
 Project Name: SERRANO ROLL-OFF OVERFLOW
 Project Number: 23910
 Project Location: GOODNIGHT 32.27997-103.37313

Sampling Date: 04/17/2026
 Sampling Type: Soil
 Sampling Condition: Cool & Intact
 Sample Received By: Shalyn Rodriguez

Sample ID: NW 1 (H262267-01)

BTX 8021B		mg/kg		Analyzed By: JH						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Benzene*	<0.050	0.050	04/21/2026	ND	2.14	107	2.00	0.907		
Toluene*	<0.050	0.050	04/21/2026	ND	2.02	101	2.00	1.18		
Ethylbenzene*	<0.050	0.050	04/21/2026	ND	1.92	95.9	2.00	1.42		
Total Xylenes*	<0.150	0.150	04/21/2026	ND	5.58	93.0	6.00	1.41		
Total BTX	<0.300	0.300	04/21/2026	ND						

Surrogate: 4-Bromofluorobenzene (PID) 96.2 % 70.4-141

Chloride, SM4500Cl-B		mg/kg		Analyzed By: KH						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Chloride	14400	16.0	04/21/2026	ND	416	104	400	3.77		

TPH 8015M		mg/kg		Analyzed By: JF					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	<10.0	10.0	04/21/2026	ND	198	99.0	200	3.82	
DRO >C10-C28*	<10.0	10.0	04/21/2026	ND	206	103	200	2.02	
EXT DRO >C28-C36	<10.0	10.0	04/21/2026	ND					

Surrogate: 1-Chlorooctane 65.9 % 52.4-130

Surrogate: 1-Chlorooctadecane 62.9 % 39.9-141

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

Etech Environmental & Safety Solutions
 JOEL LOWRY
 2617 W MARLAND
 HOBBS NM, 88240
 Fax To:

Received: 04/20/2026
 Reported: 04/22/2026
 Project Name: SERRANO ROLL-OFF OVERFLOW
 Project Number: 23910
 Project Location: GOODNIGHT 32.27997-103.37313

Sampling Date: 04/17/2026
 Sampling Type: Soil
 Sampling Condition: Cool & Intact
 Sample Received By: Shalyn Rodriguez

Sample ID: NW 2 (H262267-02)

BTEx 8021B		mg/kg		Analyzed By: JH					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Benzene*	<0.050	0.050	04/21/2026	ND	2.14	107	2.00	0.907	
Toluene*	<0.050	0.050	04/21/2026	ND	2.02	101	2.00	1.18	
Ethylbenzene*	<0.050	0.050	04/21/2026	ND	1.92	95.9	2.00	1.42	
Total Xylenes*	<0.150	0.150	04/21/2026	ND	5.58	93.0	6.00	1.41	
Total BTEX	<0.300	0.300	04/21/2026	ND					

Surrogate: 4-Bromofluorobenzene (PID) 96.4 % 70.4-141

Chloride, SM4500Cl-B		mg/kg		Analyzed By: KH					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Chloride	18600	16.0	04/21/2026	ND	416	104	400	3.77	

TPH 8015M		mg/kg		Analyzed By: JF					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	<10.0	10.0	04/21/2026	ND	198	99.0	200	3.82	
DRO >C10-C28*	<10.0	10.0	04/21/2026	ND	206	103	200	2.02	
EXT DRO >C28-C36	<10.0	10.0	04/21/2026	ND					

Surrogate: 1-Chlorooctane 56.8 % 52.4-130

Surrogate: 1-Chlorooctadecane 53.8 % 39.9-141

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

Etech Environmental & Safety Solutions
 JOEL LOWRY
 2617 W MARLAND
 HOBBS NM, 88240
 Fax To:

Received: 04/20/2026
 Reported: 04/22/2026
 Project Name: SERRANO ROLL-OFF OVERFLOW
 Project Number: 23910
 Project Location: GOODNIGHT 32.27997-103.37313

Sampling Date: 04/17/2026
 Sampling Type: Soil
 Sampling Condition: Cool & Intact
 Sample Received By: Shalyn Rodriguez

Sample ID: EW 1 (H262267-03)

BTEx 8021B		mg/kg		Analyzed By: JH						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Benzene*	<0.050	0.050	04/21/2026	ND	2.14	107	2.00	0.907		
Toluene*	<0.050	0.050	04/21/2026	ND	2.02	101	2.00	1.18		
Ethylbenzene*	<0.050	0.050	04/21/2026	ND	1.92	95.9	2.00	1.42		
Total Xylenes*	<0.150	0.150	04/21/2026	ND	5.58	93.0	6.00	1.41		
Total BTEX	<0.300	0.300	04/21/2026	ND						

Surrogate: 4-Bromofluorobenzene (PID) 96.4 % 70.4-141

Chloride, SM4500Cl-B		mg/kg		Analyzed By: KH					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Chloride	19400	16.0	04/21/2026	ND	416	104	400	3.77	

TPH 8015M		mg/kg		Analyzed By: JF					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	<10.0	10.0	04/21/2026	ND	198	99.0	200	3.82	
DRO >C10-C28*	<10.0	10.0	04/21/2026	ND	206	103	200	2.02	
EXT DRO >C28-C36	<10.0	10.0	04/21/2026	ND					

Surrogate: 1-Chlorooctane 67.7 % 52.4-130

Surrogate: 1-Chlorooctadecane 65.1 % 39.9-141

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

Etech Environmental & Safety Solutions
 JOEL LOWRY
 2617 W MARLAND
 HOBBS NM, 88240
 Fax To:

Received: 04/20/2026
 Reported: 04/22/2026
 Project Name: SERRANO ROLL-OFF OVERFLOW
 Project Number: 23910
 Project Location: GOODNIGHT 32.27997-103.37313

Sampling Date: 04/17/2026
 Sampling Type: Soil
 Sampling Condition: Cool & Intact
 Sample Received By: Shalyn Rodriguez

Sample ID: EW 2 (H262267-04)

BTX 8021B		mg/kg		Analyzed By: JH					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Benzene*	<0.050	0.050	04/21/2026	ND	2.14	107	2.00	0.907	
Toluene*	<0.050	0.050	04/21/2026	ND	2.02	101	2.00	1.18	
Ethylbenzene*	<0.050	0.050	04/21/2026	ND	1.92	95.9	2.00	1.42	
Total Xylenes*	<0.150	0.150	04/21/2026	ND	5.58	93.0	6.00	1.41	
Total BTX	<0.300	0.300	04/21/2026	ND					

Surrogate: 4-Bromofluorobenzene (PID) 96.1 % 70.4-141

Chloride, SM4500Cl-B		mg/kg		Analyzed By: KH					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Chloride	13600	16.0	04/21/2026	ND	416	104	400	3.77	

TPH 8015M		mg/kg		Analyzed By: JF					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	<10.0	10.0	04/21/2026	ND	198	99.0	200	3.82	
DRO >C10-C28*	<10.0	10.0	04/21/2026	ND	206	103	200	2.02	
EXT DRO >C28-C36	<10.0	10.0	04/21/2026	ND					

Surrogate: 1-Chlorooctane 65.6 % 52.4-130

Surrogate: 1-Chlorooctadecane 62.5 % 39.9-141

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

Etech Environmental & Safety Solutions
 JOEL LOWRY
 2617 W MARLAND
 HOBBS NM, 88240
 Fax To:

Received: 04/20/2026
 Reported: 04/22/2026
 Project Name: SERRANO ROLL-OFF OVERFLOW
 Project Number: 23910
 Project Location: GOODNIGHT 32.27997-103.37313

Sampling Date: 04/17/2026
 Sampling Type: Soil
 Sampling Condition: Cool & Intact
 Sample Received By: Shalyn Rodriguez

Sample ID: EW 3 (H262267-05)

BTEx 8021B		mg/kg		Analyzed By: JH						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Benzene*	<0.050	0.050	04/21/2026	ND	2.14	107	2.00	0.907		
Toluene*	<0.050	0.050	04/21/2026	ND	2.02	101	2.00	1.18		
Ethylbenzene*	<0.050	0.050	04/21/2026	ND	1.92	95.9	2.00	1.42		
Total Xylenes*	<0.150	0.150	04/21/2026	ND	5.58	93.0	6.00	1.41		
Total BTEX	<0.300	0.300	04/21/2026	ND						

Surrogate: 4-Bromofluorobenzene (PID) 96.0 % 70.4-141

Chloride, SM4500Cl-B		mg/kg		Analyzed By: KH						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Chloride	17800	16.0	04/21/2026	ND	416	104	400	3.77		

TPH 8015M		mg/kg		Analyzed By: JF					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	<10.0	10.0	04/21/2026	ND	198	99.0	200	3.82	
DRO >C10-C28*	<10.0	10.0	04/21/2026	ND	206	103	200	2.02	
EXT DRO >C28-C36	<10.0	10.0	04/21/2026	ND					

Surrogate: 1-Chlorooctane 70.0 % 52.4-130

Surrogate: 1-Chlorooctadecane 67.1 % 39.9-141

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

Etech Environmental & Safety Solutions
 JOEL LOWRY
 2617 W MARLAND
 HOBBS NM, 88240
 Fax To:

Received: 04/20/2026
 Reported: 04/22/2026
 Project Name: SERRANO ROLL-OFF OVERFLOW
 Project Number: 23910
 Project Location: GOODNIGHT 32.27997-103.37313

Sampling Date: 04/17/2026
 Sampling Type: Soil
 Sampling Condition: Cool & Intact
 Sample Received By: Shalyn Rodriguez

Sample ID: SW 1 (H262267-06)

BTEx 8021B		mg/kg		Analyzed By: JH						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Benzene*	<0.050	0.050	04/21/2026	ND	2.14	107	2.00	0.907		
Toluene*	<0.050	0.050	04/21/2026	ND	2.02	101	2.00	1.18		
Ethylbenzene*	<0.050	0.050	04/21/2026	ND	1.92	95.9	2.00	1.42		
Total Xylenes*	<0.150	0.150	04/21/2026	ND	5.58	93.0	6.00	1.41		
Total BTEX	<0.300	0.300	04/21/2026	ND						

Surrogate: 4-Bromofluorobenzene (PID) 95.4 % 70.4-141

Chloride, SM4500Cl-B		mg/kg		Analyzed By: KH						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Chloride	16600	16.0	04/21/2026	ND	416	104	400	3.77		

TPH 8015M		mg/kg		Analyzed By: JF					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	<10.0	10.0	04/21/2026	ND	198	99.0	200	3.82	
DRO >C10-C28*	<10.0	10.0	04/21/2026	ND	206	103	200	2.02	
EXT DRO >C28-C36	<10.0	10.0	04/21/2026	ND					

Surrogate: 1-Chlorooctane 71.3 % 52.4-130

Surrogate: 1-Chlorooctadecane 67.8 % 39.9-141

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

Etech Environmental & Safety Solutions
 JOEL LOWRY
 2617 W MARLAND
 HOBBS NM, 88240
 Fax To:

Received: 04/20/2026
 Reported: 04/22/2026
 Project Name: SERRANO ROLL-OFF OVERFLOW
 Project Number: 23910
 Project Location: GOODNIGHT 32.27997-103.37313

Sampling Date: 04/17/2026
 Sampling Type: Soil
 Sampling Condition: Cool & Intact
 Sample Received By: Shalyn Rodriguez

Sample ID: SW 2 (H262267-07)

BTEx 8021B		mg/kg		Analyzed By: JH						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Benzene*	<0.050	0.050	04/21/2026	ND	2.14	107	2.00	0.907		
Toluene*	<0.050	0.050	04/21/2026	ND	2.02	101	2.00	1.18		
Ethylbenzene*	<0.050	0.050	04/21/2026	ND	1.92	95.9	2.00	1.42		
Total Xylenes*	<0.150	0.150	04/21/2026	ND	5.58	93.0	6.00	1.41		
Total BTEX	<0.300	0.300	04/21/2026	ND						

Surrogate: 4-Bromofluorobenzene (PID) 93.3 % 70.4-141

Chloride, SM4500Cl-B		mg/kg		Analyzed By: KH						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Chloride	10800	16.0	04/21/2026	ND	416	104	400	3.77		

TPH 8015M		mg/kg		Analyzed By: JF					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	<10.0	10.0	04/21/2026	ND	198	99.0	200	3.82	
DRO >C10-C28*	<10.0	10.0	04/21/2026	ND	206	103	200	2.02	
EXT DRO >C28-C36	<10.0	10.0	04/21/2026	ND					

Surrogate: 1-Chlorooctane 63.4 % 52.4-130

Surrogate: 1-Chlorooctadecane 61.0 % 39.9-141

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

Etech Environmental & Safety Solutions
 JOEL LOWRY
 2617 W MARLAND
 HOBBS NM, 88240
 Fax To:

Received: 04/20/2026
 Reported: 04/22/2026
 Project Name: SERRANO ROLL-OFF OVERFLOW
 Project Number: 23910
 Project Location: GOODNIGHT 32.27997-103.37313

Sampling Date: 04/17/2026
 Sampling Type: Soil
 Sampling Condition: Cool & Intact
 Sample Received By: Shalyn Rodriguez

Sample ID: SW 3 (H262267-08)

BTEx 8021B		mg/kg		Analyzed By: JH						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Benzene*	<0.050	0.050	04/21/2026	ND	2.14	107	2.00	0.907		
Toluene*	<0.050	0.050	04/21/2026	ND	2.02	101	2.00	1.18		
Ethylbenzene*	<0.050	0.050	04/21/2026	ND	1.92	95.9	2.00	1.42		
Total Xylenes*	<0.150	0.150	04/21/2026	ND	5.58	93.0	6.00	1.41		
Total BTEX	<0.300	0.300	04/21/2026	ND						

Surrogate: 4-Bromofluorobenzene (PID) 96.7 % 70.4-141

Chloride, SM4500Cl-B		mg/kg		Analyzed By: KH						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Chloride	12500	16.0	04/21/2026	ND	416	104	400	3.77		

TPH 8015M		mg/kg		Analyzed By: JF					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	<10.0	10.0	04/21/2026	ND	198	99.0	200	3.82	
DRO >C10-C28*	<10.0	10.0	04/21/2026	ND	206	103	200	2.02	
EXT DRO >C28-C36	<10.0	10.0	04/21/2026	ND					

Surrogate: 1-Chlorooctane 69.8 % 52.4-130

Surrogate: 1-Chlorooctadecane 66.5 % 39.9-141

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

Etech Environmental & Safety Solutions
 JOEL LOWRY
 2617 W MARLAND
 HOBBS NM, 88240
 Fax To:

Received: 04/20/2026
 Reported: 04/22/2026
 Project Name: SERRANO ROLL-OFF OVERFLOW
 Project Number: 23910
 Project Location: GOODNIGHT 32.27997-103.37313

Sampling Date: 04/17/2026
 Sampling Type: Soil
 Sampling Condition: Cool & Intact
 Sample Received By: Shalyn Rodriguez

Sample ID: WW 1 (H262267-09)

BTEx 8021B		mg/kg		Analyzed By: JH					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Benzene*	<0.050	0.050	04/21/2026	ND	2.14	107	2.00	0.907	
Toluene*	<0.050	0.050	04/21/2026	ND	2.02	101	2.00	1.18	
Ethylbenzene*	<0.050	0.050	04/21/2026	ND	1.92	95.9	2.00	1.42	
Total Xylenes*	<0.150	0.150	04/21/2026	ND	5.58	93.0	6.00	1.41	
Total BTEX	<0.300	0.300	04/21/2026	ND					

Surrogate: 4-Bromofluorobenzene (PID) 96.3 % 70.4-141

Chloride, SM4500Cl-B		mg/kg		Analyzed By: KH					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Chloride	12800	16.0	04/21/2026	ND	416	104	400	3.77	

TPH 8015M		mg/kg		Analyzed By: JF					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	<10.0	10.0	04/21/2026	ND	198	99.0	200	3.82	
DRO >C10-C28*	<10.0	10.0	04/21/2026	ND	206	103	200	2.02	
EXT DRO >C28-C36	<10.0	10.0	04/21/2026	ND					

Surrogate: 1-Chlorooctane 65.5 % 52.4-130

Surrogate: 1-Chlorooctadecane 62.5 % 39.9-141

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Notes and Definitions

- QM-07 The spike recovery was outside acceptance limits for the MS and/or MSD. The batch was accepted based on acceptable LCS recovery.
- ND Analyte NOT DETECTED at or above the reporting limit
- RPD Relative Percent Difference
- ** Samples not received at proper temperature of 6°C or below.
- *** Insufficient time to reach temperature.
- Chloride by SM4500Cl-B does not require samples be received at or below 6°C
Samples reported on an as received basis (wet) unless otherwise noted on report

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

A handwritten signature in black ink, appearing to read "Celey D. Keene".

Celey D. Keene, Lab Director/Quality Manager



CHAIN-OF-CUSTODY AND ANALYSIS REQUEST

101 East Marland, Hobbs, NM 88240
(575) 393-2326 FAX (575) 393-2476

Pg 1 of 1

Page 12 of 12

Company Name: Etech Environmental & Safety Solutions, Inc. Project Manager: Joel Lowry Address: 2617 West Marland City: Hobbs State: NM Zip: 88240 Phone #: (575) 264-9884 Fax #: Project #: 23910 Project Owner: Goodnight Midstream Permian, LLC Project Name: Serrano Roll-Off Overflow Project Location: 32 27997, -103 37313 Sampler Name: Martin Sepulveda				BILL TO P.O. #: Company: Goodnight Midstream Attn: Ralph Tijerna Address: City: State: Zip: Phone #: Fax #:				ANALYSIS REQUEST																		
								Chloride TPH (8015M) BTEX (8021B)																		
Lab I.D.	Sample I.D.	GRAB OR COMPOSITE	# CONTAINERS	MATRIX						PRESERV.	SAMPLING															
				GROUNDWATER	WASTEWATER	SOIL	OIL	SLUDGE	OTHER	ACID/BASE	ICE / COOL	OTHER	DATE	TIME												
H262367	NW 1	C	1			X				X			4/17/26		X	X	X									
	NW 2	C	1			X				X			4/17/26		X	X	X									
	EW 1	C	1			X				X			4/17/26		X	X	X									
	EW 2	C	1			X				X			4/17/26		X	X	X									
	EW 3	C	1			X				X			4/17/26		X	X	X									
	SW 1	C	1			X				X			4/17/26		X	X	X									
	SW 2	C	1			X				X			4/17/26		X	X	X									
	SW 3	C	1			X				X			4/17/26		X	X	X									
	WW 1	C	1			X				X			4/17/26		X	X	X									

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising out of or from this contract or from any use of the services shall be limited to the amount paid by the client for the services. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless notice is written and received by Cardinal within 30 days after completion of the applicable service. In no event shall Cardinal be liable for substantial or consequential damages, including without limitation, business interruptions, loss of use, or loss of profits, even if such damages are foreseeable. Cardinal's liability shall be limited to the performance of services performed by Cardinal, regardless of whether such claim is based upon any or all the above stated theories or otherwise.

Relinquished By: Relinquished By:	Date: 4-20-26 Time: 1443	Received By: Received By:	Verbal Result: ☐ Yes ☐ No Add'l Phone #: All Results are emailed. Please provide Email address: pm@etechnv.com
REMARKS: 48H Rush			Turnaround Time: ☒ Standard ☐ Rush Thermometer ID #140 Correction Factor +0.1°C
Delivered By: (Circle One) Sampler - UPS - Bus - Other:	Observed Temp. °C -3.6 Corrected Temp. °C -3.5	Sample Condition Cool Intact ☒ Yes ☐ No	Checked By: (Initials)
Bacteria (only) Sample Condition Cool Intact Observed Temp. °C ☐ Yes ☐ No		Corrected Temp. °C	

† Cardinal cannot accept verbal changes. Please email changes to celey.keene@cardinallabsnm.com



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

April 24, 2026

JOEL LOWRY

Etech Environmental & Safety Solutions

2617 W MARLAND

HOBBS, NM 88240

RE: SERRANO ROLL-OFF OVERFLOW

Enclosed are the results of analyses for samples received by the laboratory on 04/20/26 14:43.

Cardinal Laboratories is accredited through Texas NELAP under certificate number TX-C25-00101. Accreditation applies to drinking water, non-potable water and solid and chemical materials. All accredited analytes are denoted by an asterisk (*). For a complete list of accredited analytes and matrices visit the TCEQ website at www.tceq.texas.gov/field/qa/lab_accred_certif.html.

Cardinal Laboratories is accredited through the State of Colorado Department of Public Health and Environment for:

Method EPA 552.2	Haloacetic Acids (HAA-5)
Method EPA 524.2	Total Trihalomethanes (TTHM)
Method EPA 524.4	Regulated VOCs (V1, V2, V3)

Accreditation applies to public drinking water matrices.

This report meets NELAP requirements and is made up of a cover page, analytical results, and a copy of the original chain-of-custody. If you have any questions concerning this report, please feel free to contact me.

Sincerely,

A handwritten signature in black ink that reads "Coley D. Keene".

Celey D. Keene

Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

Etech Environmental & Safety Solutions
 JOEL LOWRY
 2617 W MARLAND
 HOBBS NM, 88240
 Fax To:

Received: 04/20/2026
 Reported: 04/24/2026
 Project Name: SERRANO ROLL-OFF OVERFLOW
 Project Number: 23910
 Project Location: GOODNIGHT 32.27997-103.37313

Sampling Date: 04/17/2026
 Sampling Type: Soil
 Sampling Condition: Cool & Intact
 Sample Received By: Shalyn Rodriguez

Sample ID: NH 1 @ 1' (H262270-01)

BTX 8021B		mg/kg		Analyzed By: JH					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Benzene*	<0.050	0.050	04/23/2026	ND	2.22	111	2.00	3.89	
Toluene*	<0.050	0.050	04/23/2026	ND	1.97	98.7	2.00	1.65	
Ethylbenzene*	<0.050	0.050	04/23/2026	ND	1.90	95.1	2.00	1.87	
Total Xylenes*	<0.150	0.150	04/23/2026	ND	5.74	95.6	6.00	1.03	
Total BTX	<0.300	0.300	04/23/2026	ND					

Surrogate: 4-Bromofluorobenzene (PID) 98.8 % 70.4-141

Chloride, SM4500Cl-B		mg/kg		Analyzed By: KH						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Chloride	112	16.0	04/21/2026	ND	432	108	400	0.00		

TPH 8015M		mg/kg		Analyzed By: MS					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	<10.0	10.0	04/22/2026	ND	183	91.6	200	4.23	
DRO >C10-C28*	<10.0	10.0	04/22/2026	ND	186	92.9	200	4.37	
EXT DRO >C28-C36	<10.0	10.0	04/22/2026	ND					

Surrogate: 1-Chlorooctane 103 % 52.4-130

Surrogate: 1-Chlorooctadecane 104 % 39.9-141

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

Etech Environmental & Safety Solutions
 JOEL LOWRY
 2617 W MARLAND
 HOBBS NM, 88240
 Fax To:

Received: 04/20/2026
 Reported: 04/24/2026
 Project Name: SERRANO ROLL-OFF OVERFLOW
 Project Number: 23910
 Project Location: GOODNIGHT 32.27997-103.37313

Sampling Date: 04/17/2026
 Sampling Type: Soil
 Sampling Condition: Cool & Intact
 Sample Received By: Shalyn Rodriguez

Sample ID: EH 1 @ 1' (H262270-02)

BTEx 8021B		mg/kg		Analyzed By: JH						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Benzene*	<0.050	0.050	04/23/2026	ND	2.22	111	2.00	3.89		
Toluene*	<0.050	0.050	04/23/2026	ND	1.97	98.7	2.00	1.65		
Ethylbenzene*	<0.050	0.050	04/23/2026	ND	1.90	95.1	2.00	1.87		
Total Xylenes*	<0.150	0.150	04/23/2026	ND	5.74	95.6	6.00	1.03		
Total BTEX	<0.300	0.300	04/23/2026	ND						

Surrogate: 4-Bromofluorobenzene (PID) 97.6 % 70.4-141

Chloride, SM4500Cl-B		mg/kg		Analyzed By: KH						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Chloride	32.0	16.0	04/21/2026	ND	432	108	400	0.00		

TPH 8015M		mg/kg		Analyzed By: MS					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	<10.0	10.0	04/22/2026	ND	183	91.6	200	4.23	
DRO >C10-C28*	<10.0	10.0	04/22/2026	ND	186	92.9	200	4.37	
EXT DRO >C28-C36	<10.0	10.0	04/22/2026	ND					

Surrogate: 1-Chlorooctane 91.4 % 52.4-130

Surrogate: 1-Chlorooctadecane 91.4 % 39.9-141

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

Etech Environmental & Safety Solutions
 JOEL LOWRY
 2617 W MARLAND
 HOBBS NM, 88240
 Fax To:

Received: 04/20/2026
 Reported: 04/24/2026
 Project Name: SERRANO ROLL-OFF OVERFLOW
 Project Number: 23910
 Project Location: GOODNIGHT 32.27997-103.37313

Sampling Date: 04/17/2026
 Sampling Type: Soil
 Sampling Condition: Cool & Intact
 Sample Received By: Shalyn Rodriguez

Sample ID: SH 1 @ 1' (H262270-03)

BTEx 8021B		mg/kg		Analyzed By: JH						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Benzene*	<0.050	0.050	04/23/2026	ND	2.22	111	2.00	3.89		
Toluene*	<0.050	0.050	04/23/2026	ND	1.97	98.7	2.00	1.65		
Ethylbenzene*	<0.050	0.050	04/23/2026	ND	1.90	95.1	2.00	1.87		
Total Xylenes*	<0.150	0.150	04/23/2026	ND	5.74	95.6	6.00	1.03		
Total BTEX	<0.300	0.300	04/23/2026	ND						

Surrogate: 4-Bromofluorobenzene (PID) 105 % 70.4-141

Chloride, SM4500Cl-B		mg/kg		Analyzed By: KH					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Chloride	112	16.0	04/21/2026	ND	432	108	400	0.00	

TPH 8015M		mg/kg		Analyzed By: MS					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	<10.0	10.0	04/22/2026	ND	183	91.6	200	4.23	
DRO >C10-C28*	<10.0	10.0	04/22/2026	ND	186	92.9	200	4.37	
EXT DRO >C28-C36	<10.0	10.0	04/22/2026	ND					

Surrogate: 1-Chlorooctane 91.2 % 52.4-130

Surrogate: 1-Chlorooctadecane 92.8 % 39.9-141

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

Etech Environmental & Safety Solutions
 JOEL LOWRY
 2617 W MARLAND
 HOBBS NM, 88240
 Fax To:

Received: 04/20/2026
 Reported: 04/24/2026
 Project Name: SERRANO ROLL-OFF OVERFLOW
 Project Number: 23910
 Project Location: GOODNIGHT 32.27997-103.37313

Sampling Date: 04/17/2026
 Sampling Type: Soil
 Sampling Condition: Cool & Intact
 Sample Received By: Shalyn Rodriguez

Sample ID: WH 1 @ 1' (H262270-04)

BTEx 8021B		mg/kg		Analyzed By: JH						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Benzene*	<0.050	0.050	04/23/2026	ND	2.22	111	2.00	3.89		
Toluene*	<0.050	0.050	04/23/2026	ND	1.97	98.7	2.00	1.65		
Ethylbenzene*	<0.050	0.050	04/23/2026	ND	1.90	95.1	2.00	1.87		
Total Xylenes*	<0.150	0.150	04/23/2026	ND	5.74	95.6	6.00	1.03		
Total BTEX	<0.300	0.300	04/23/2026	ND						

Surrogate: 4-Bromofluorobenzene (PID) 99.7 % 70.4-141

Chloride, SM4500Cl-B		mg/kg		Analyzed By: AC						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Chloride	<16.0	16.0	04/21/2026	ND	400	100	400	3.92		

TPH 8015M		mg/kg		Analyzed By: MS					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	<10.0	10.0	04/22/2026	ND	183	91.6	200	4.23	
DRO >C10-C28*	<10.0	10.0	04/22/2026	ND	186	92.9	200	4.37	
EXT DRO >C28-C36	<10.0	10.0	04/22/2026	ND					

Surrogate: 1-Chlorooctane 91.0 % 52.4-130

Surrogate: 1-Chlorooctadecane 91.9 % 39.9-141

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager

PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Notes and Definitions

QM-07	The spike recovery was outside acceptance limits for the MS and/or MSD. The batch was accepted based on acceptable LCS recovery.
BS-3	Blank spike recovery outside of lab established statistical limits, but still within method limits. Data is not adversely affected.
ND	Analyte NOT DETECTED at or above the reporting limit
RPD	Relative Percent Difference
**	Samples not received at proper temperature of 6°C or below.
***	Insufficient time to reach temperature.
-	Chloride by SM4500Cl-B does not require samples be received at or below 6°C Samples reported on an as received basis (wet) unless otherwise noted on report

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

A handwritten signature in black ink, appearing to read "Celey D. Keene", is written over a horizontal line.

Celey D. Keene, Lab Director/Quality Manager

101 East Marland, Hobbs, NM 88240
(575) 393-2326 FAX (575) 393-2476

Pg 1 of 1

Page 7 of 7

[illegible]

PLEASE NOTE: Liability and Damages. Cardiac's liability and liability exclusivity for any claim arising whether based in contract or tort, shall be limited to the amount paid by the court for its services. All claims involving third parties regardless of any other cause whatsoever shall be limited to the amount paid by Cardiac within 30 days after completion of the applicable services. All claims shall be limited to the extent of the actual damages sustained, including without limitation, business interruption, loss of use, loss of profits caused by Cardiac. Its subsidiaries, affiliates or subsidiaries arising out of or related to the performance of services hereunder by Cardiac, regardless of whether such claim is based upon any of the above stated causes or otherwise.

C5-0403401K

Relinquished By: <i>Matt</i>		Date: <i>4-20-20</i>		Received By: <i>Spodrigney</i>		Verbal Result: ☐ Yes ☐ No Add'l Phone #:	
		Time: <i>1443</i>				All Results are emailed. Please provide Email address: pm@refecthenw.com	
Relinquished By:		Date:		Received By:		REMARKS:	
		Time:					
Delivered By: (Circle One)		Observed Temp. °C <i>-3.6</i>		Sample Condition Cool ☒ Intact ☐		CHECKED BY: (Initials) <i>SP</i>	
Sampler - UPS - Bus - Other:		Corrected Temp. °C <i>-3.5</i>		Yes ☐ No ☐		Turnaround Time: Standard ☒ Rust ☐	
						Thermometer ID #140 Correction Factor +0.1°C	
						Bacteria (only) Sample Condition Cool ☐ Intact ☐ Observed Temp. °C Yes ☐ No ☐	
						Corrected Temp. °C	

† Cardinal cannot accept verbal changes. Please email changes to deley.keene@cardinallabsnm.com



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

April 24, 2026

JOEL LOWRY

Etech Environmental & Safety Solutions

2617 W MARLAND

HOBBS, NM 88240

RE: SERRANO ROLL-OFF OVERFLOW

Enclosed are the results of analyses for samples received by the laboratory on 04/23/26 14:56.

Cardinal Laboratories is accredited through Texas NELAP under certificate number TX-C25-00101. Accreditation applies to drinking water, non-potable water and solid and chemical materials. All accredited analytes are denoted by an asterisk (*). For a complete list of accredited analytes and matrices visit the TCEQ website at www.tceq.texas.gov/field/qa/lab_accred_certif.html.

Cardinal Laboratories is accredited through the State of Colorado Department of Public Health and Environment for:

Method EPA 552.2	Haloacetic Acids (HAA-5)
Method EPA 524.2	Total Trihalomethanes (TTHM)
Method EPA 524.4	Regulated VOCs (V1, V2, V3)

Accreditation applies to public drinking water matrices.

This report meets NELAP requirements and is made up of a cover page, analytical results, and a copy of the original chain-of-custody. If you have any questions concerning this report, please feel free to contact me.

Sincerely,

A handwritten signature in black ink that reads "Coley D. Keene". The signature is written in a cursive style.

Celey D. Keene

Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

Etech Environmental & Safety Solutions
 JOEL LOWRY
 2617 W MARLAND
 HOBBS NM, 88240
 Fax To:

Received: 04/23/2026
 Reported: 04/24/2026
 Project Name: SERRANO ROLL-OFF OVERFLOW
 Project Number: 23910
 Project Location: GOODNIGHT 32.27997-103.37313

Sampling Date: 04/23/2026
 Sampling Type: Soil
 Sampling Condition: Cool & Intact
 Sample Received By: Alyssa Parras

Sample ID: FL 17 @ 1' (H262353-01)

BTX 8021B		mg/kg		Analyzed By: JH					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Benzene*	<0.050	0.050	04/24/2026	ND	2.17	109	2.00	3.51	
Toluene*	<0.050	0.050	04/24/2026	ND	1.91	95.7	2.00	3.26	
Ethylbenzene*	<0.050	0.050	04/24/2026	ND	1.86	93.0	2.00	4.80	
Total Xylenes*	<0.150	0.150	04/24/2026	ND	5.63	93.8	6.00	4.95	
Total BTX	<0.300	0.300	04/24/2026	ND					

Surrogate: 4-Bromofluorobenzene (PID) 94.0 % 70.4-141

Chloride, SM4500Cl-B		mg/kg		Analyzed By: SA						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Chloride	320	16.0	04/24/2026	ND	432	108	400	3.77		

TPH 8015M		mg/kg		Analyzed By: JF					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	<10.0	10.0	04/24/2026	ND	192	95.9	200	0.417	
DRO >C10-C28*	<10.0	10.0	04/24/2026	ND	203	102	200	0.427	
EXT DRO >C28-C36	<10.0	10.0	04/24/2026	ND					

Surrogate: 1-Chlorooctane 87.9 % 52.4-130

Surrogate: 1-Chlorooctadecane 83.0 % 39.9-141

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

Etech Environmental & Safety Solutions
 JOEL LOWRY
 2617 W MARLAND
 HOBBS NM, 88240
 Fax To:

Received: 04/23/2026
 Reported: 04/24/2026
 Project Name: SERRANO ROLL-OFF OVERFLOW
 Project Number: 23910
 Project Location: GOODNIGHT 32.27997-103.37313

Sampling Date: 04/23/2026
 Sampling Type: Soil
 Sampling Condition: Cool & Intact
 Sample Received By: Alyssa Parras

Sample ID: FL 21 @ 1' (H262353-02)

BTX 8021B		mg/kg		Analyzed By: JH						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Benzene*	<0.050	0.050	04/24/2026	ND	2.17	109	2.00	3.51		
Toluene*	<0.050	0.050	04/24/2026	ND	1.91	95.7	2.00	3.26		
Ethylbenzene*	<0.050	0.050	04/24/2026	ND	1.86	93.0	2.00	4.80		
Total Xylenes*	<0.150	0.150	04/24/2026	ND	5.63	93.8	6.00	4.95		
Total BTX	<0.300	0.300	04/24/2026	ND						

Surrogate: 4-Bromofluorobenzene (PID) 95.8 % 70.4-141

Chloride, SM4500Cl-B		mg/kg		Analyzed By: SA						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Chloride	96.0	16.0	04/24/2026	ND	432	108	400	3.77		

TPH 8015M		mg/kg		Analyzed By: JF					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	<10.0	10.0	04/24/2026	ND	192	95.9	200	0.417	
DRO >C10-C28*	<10.0	10.0	04/24/2026	ND	203	102	200	0.427	
EXT DRO >C28-C36	<10.0	10.0	04/24/2026	ND					

Surrogate: 1-Chlorooctane 89.8 % 52.4-130

Surrogate: 1-Chlorooctadecane 84.4 % 39.9-141

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

Etech Environmental & Safety Solutions
 JOEL LOWRY
 2617 W MARLAND
 HOBBS NM, 88240
 Fax To:

Received: 04/23/2026
 Reported: 04/24/2026
 Project Name: SERRANO ROLL-OFF OVERFLOW
 Project Number: 23910
 Project Location: GOODNIGHT 32.27997-103.37313

Sampling Date: 04/23/2026
 Sampling Type: Soil
 Sampling Condition: Cool & Intact
 Sample Received By: Alyssa Parras

Sample ID: FL 26 @ 1' (H262353-03)

BTX 8021B		mg/kg		Analyzed By: JH						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Benzene*	<0.050	0.050	04/24/2026	ND	2.17	109	2.00	3.51		
Toluene*	<0.050	0.050	04/24/2026	ND	1.91	95.7	2.00	3.26		
Ethylbenzene*	<0.050	0.050	04/24/2026	ND	1.86	93.0	2.00	4.80		
Total Xylenes*	<0.150	0.150	04/24/2026	ND	5.63	93.8	6.00	4.95		
Total BTX	<0.300	0.300	04/24/2026	ND						

Surrogate: 4-Bromofluorobenzene (PID) 92.6 % 70.4-141

Chloride, SM4500Cl-B		mg/kg		Analyzed By: SA						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Chloride	176	16.0	04/24/2026	ND	432	108	400	3.77		

TPH 8015M		mg/kg		Analyzed By: JF					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	<10.0	10.0	04/24/2026	ND	192	95.9	200	0.417	
DRO >C10-C28*	<10.0	10.0	04/24/2026	ND	203	102	200	0.427	
EXT DRO >C28-C36	<10.0	10.0	04/24/2026	ND					

Surrogate: 1-Chlorooctane 87.0 % 52.4-130

Surrogate: 1-Chlorooctadecane 81.7 % 39.9-141

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

Etech Environmental & Safety Solutions
 JOEL LOWRY
 2617 W MARLAND
 HOBBS NM, 88240
 Fax To:

Received: 04/23/2026
 Reported: 04/24/2026
 Project Name: SERRANO ROLL-OFF OVERFLOW
 Project Number: 23910
 Project Location: GOODNIGHT 32.27997-103.37313

Sampling Date: 04/23/2026
 Sampling Type: Soil
 Sampling Condition: Cool & Intact
 Sample Received By: Alyssa Parras

Sample ID: FL 27 @ 1' (H262353-04)

BTX 8021B		mg/kg		Analyzed By: JH						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Benzene*	<0.050	0.050	04/24/2026	ND	2.17	109	2.00	3.51		
Toluene*	<0.050	0.050	04/24/2026	ND	1.91	95.7	2.00	3.26		
Ethylbenzene*	<0.050	0.050	04/24/2026	ND	1.86	93.0	2.00	4.80		
Total Xylenes*	<0.150	0.150	04/24/2026	ND	5.63	93.8	6.00	4.95		
Total BTX	<0.300	0.300	04/24/2026	ND						

Surrogate: 4-Bromofluorobenzene (PID) 94.5 % 70.4-141

Chloride, SM4500CI-B		mg/kg		Analyzed By: SA						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Chloride	320	16.0	04/24/2026	ND	432	108	400	3.77		

TPH 8015M		mg/kg		Analyzed By: JF					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	<10.0	10.0	04/24/2026	ND	192	95.9	200	0.417	
DRO >C10-C28*	<10.0	10.0	04/24/2026	ND	203	102	200	0.427	
EXT DRO >C28-C36	<10.0	10.0	04/24/2026	ND					

Surrogate: 1-Chlorooctane 86.6 % 52.4-130

Surrogate: 1-Chlorooctadecane 81.4 % 39.9-141

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

Etech Environmental & Safety Solutions
 JOEL LOWRY
 2617 W MARLAND
 HOBBS NM, 88240
 Fax To:

Received: 04/23/2026
 Reported: 04/24/2026
 Project Name: SERRANO ROLL-OFF OVERFLOW
 Project Number: 23910
 Project Location: GOODNIGHT 32.27997-103.37313

Sampling Date: 04/23/2026
 Sampling Type: Soil
 Sampling Condition: Cool & Intact
 Sample Received By: Alyssa Parras

Sample ID: FL 34 @ 1' (H262353-05)

BTEx 8021B		mg/kg		Analyzed By: JH						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Benzene*	<0.050	0.050	04/24/2026	ND	2.17	109	2.00	3.51		
Toluene*	<0.050	0.050	04/24/2026	ND	1.91	95.7	2.00	3.26		
Ethylbenzene*	<0.050	0.050	04/24/2026	ND	1.86	93.0	2.00	4.80		
Total Xylenes*	<0.150	0.150	04/24/2026	ND	5.63	93.8	6.00	4.95		
Total BTEX	<0.300	0.300	04/24/2026	ND						

Surrogate: 4-Bromofluorobenzene (PID) 95.8 % 70.4-141

Chloride, SM4500Cl-B		mg/kg		Analyzed By: SA						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Chloride	336	16.0	04/24/2026	ND	432	108	400	3.77		

TPH 8015M		mg/kg		Analyzed By: JF					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	<10.0	10.0	04/24/2026	ND	192	95.9	200	0.417	
DRO >C10-C28*	<10.0	10.0	04/24/2026	ND	203	102	200	0.427	
EXT DRO >C28-C36	<10.0	10.0	04/24/2026	ND					

Surrogate: 1-Chlorooctane 87.7 % 52.4-130

Surrogate: 1-Chlorooctadecane 81.4 % 39.9-141

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

Etech Environmental & Safety Solutions
 JOEL LOWRY
 2617 W MARLAND
 HOBBS NM, 88240
 Fax To:

Received: 04/23/2026
 Reported: 04/24/2026
 Project Name: SERRANO ROLL-OFF OVERFLOW
 Project Number: 23910
 Project Location: GOODNIGHT 32.27997-103.37313

Sampling Date: 04/23/2026
 Sampling Type: Soil
 Sampling Condition: Cool & Intact
 Sample Received By: Alyssa Parras

Sample ID: FL 36 @ 1' (H262353-06)

BTEx 8021B		mg/kg		Analyzed By: JH						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Benzene*	<0.050	0.050	04/24/2026	ND	2.17	109	2.00	3.51		
Toluene*	<0.050	0.050	04/24/2026	ND	1.91	95.7	2.00	3.26		
Ethylbenzene*	<0.050	0.050	04/24/2026	ND	1.86	93.0	2.00	4.80		
Total Xylenes*	<0.150	0.150	04/24/2026	ND	5.63	93.8	6.00	4.95		
Total BTEX	<0.300	0.300	04/24/2026	ND						

Surrogate: 4-Bromofluorobenzene (PID) 94.2 % 70.4-141

Chloride, SM4500Cl-B		mg/kg		Analyzed By: SA						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Chloride	64.0	16.0	04/24/2026	ND	432	108	400	3.77		

TPH 8015M		mg/kg		Analyzed By: JF					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	<10.0	10.0	04/24/2026	ND	192	95.9	200	0.417	
DRO >C10-C28*	<10.0	10.0	04/24/2026	ND	203	102	200	0.427	
EXT DRO >C28-C36	<10.0	10.0	04/24/2026	ND					

Surrogate: 1-Chlorooctane 90.1 % 52.4-130

Surrogate: 1-Chlorooctadecane 84.0 % 39.9-141

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

Etech Environmental & Safety Solutions
 JOEL LOWRY
 2617 W MARLAND
 HOBBS NM, 88240
 Fax To:

Received: 04/23/2026
 Reported: 04/24/2026
 Project Name: SERRANO ROLL-OFF OVERFLOW
 Project Number: 23910
 Project Location: GOODNIGHT 32.27997-103.37313

Sampling Date: 04/23/2026
 Sampling Type: Soil
 Sampling Condition: Cool & Intact
 Sample Received By: Alyssa Parras

Sample ID: FL 37 @ 1' (H262353-07)

BTEx 8021B		mg/kg		Analyzed By: JH						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Benzene*	<0.050	0.050	04/23/2026	ND	2.08	104	2.00	1.53		
Toluene*	<0.050	0.050	04/23/2026	ND	1.89	94.7	2.00	3.24		
Ethylbenzene*	<0.050	0.050	04/23/2026	ND	1.82	91.2	2.00	2.28		
Total Xylenes*	<0.150	0.150	04/23/2026	ND	5.44	90.7	6.00	2.42		
Total BTEX	<0.300	0.300	04/23/2026	ND						

Surrogate: 4-Bromofluorobenzene (PID) 90.9 % 70.4-141

Chloride, SM4500Cl-B		mg/kg		Analyzed By: SA						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Chloride	112	16.0	04/24/2026	ND	432	108	400	3.77		

TPH 8015M		mg/kg		Analyzed By: JF					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	<10.0	10.0	04/24/2026	ND	192	95.9	200	0.417	
DRO >C10-C28*	<10.0	10.0	04/24/2026	ND	203	102	200	0.427	
EXT DRO >C28-C36	<10.0	10.0	04/24/2026	ND					

Surrogate: 1-Chlorooctane 82.6 % 52.4-130

Surrogate: 1-Chlorooctadecane 77.1 % 39.9-141

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Notes and Definitions

ND	Analyte NOT DETECTED at or above the reporting limit
RPD	Relative Percent Difference
**	Samples not received at proper temperature of 6°C or below.
***	Insufficient time to reach temperature.
-	Chloride by SM4500Cl-B does not require samples be received at or below 6°C Samples reported on an as received basis (wet) unless otherwise noted on report

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

A handwritten signature in black ink, appearing to read "Celey D. Keene", is written over a horizontal line.

Celey D. Keene, Lab Director/Quality Manager



CHAIN-OF-CUSTODY AND ANALYSIS REQUEST

101 East Marland, Hobbs, NM 88240
(575) 393-2326 FAX (575) 393-2476

Pg 1 of 1

Company Name: Elech Environmental & Safety Solutions, Inc.		BILL TO		ANALYSIS REQUEST																					
Project Manager: Joel Lowry		P.O. #:		Chloride TPH (8015M) BTEX (8021B)																					
Address: 2617 West Marland		Company: Goodnight Midstream																							
City: Hobbs State: NM Zip: 88240		Attn: Ralph Tijena																							
Phone #: (575) 264-9884 Fax #:		Address:																							
Project #: 23910 Project Owner: Goodnight Midstream Partners, LLC		City:																							
Project Name: Serrano Roll-Off Overflow		State: Zip:																							
Project Location: 32.27997, -103.37313		Phone #:																							
Sampler Name: Gabriela Tarango		Fax #:																							
FOR LAB USE ONLY				MATRIX		PRESERV.		SAMPLING																	
Lab I.D.	Sample I.D.	IGRAB OR (C)COMP.	# CONTAINERS	GROUNDWATER	WASTEWATER	SOIL	OIL	SILUDGE	OTHER :	ACID/BASE	ICE / COOL	OTHER :	DATE	TIME											
HAL0353																									
1	FL 17 @ 1'	C	1			X				X			4/23/26		X	X	X								
2	FL 21 @ 1'	C	1			X				X			4/23/26		X	X	X								
3	FL 26 @ 1'	C	1			X				X			4/23/26		X	X	X								
4	FL 27 @ 1'	C	1			X				X			4/23/26		X	X	X								
5	FL 34 @ 1'	C	1			X				X			4/23/26		X	X	X								
6	FL 36 @ 1'	C	1			X				X			4/23/26		X	X	X								
7	FL 37 @ 1'	C	1			X				X			4/23/26		X	X	X								

PLEASE NOTE: Liability and Damages. Cardinal hereby disclaims its exclusive remedy for any claims arising whether based in contract or tort, shall be limited to the amount paid by the client for the analysis. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within 30 days after completion of the analysis. In no event shall Cardinal be liable for punitive or consequential damages, including without limitation, business interruption, loss of use, or loss of profits sustained by client. In no event shall Cardinal be liable for the performance of services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated remedies or otherwise.

Relinquished By: 	Date: 4/23/26 Time: 1:43	Received By: 	Verbal Result: ☐ Yes ☒ No Add'l Phone #:
Relinquished By:	Date:	Received By:	All Results are emailed. Please provide Email address: pm@etechnv.com
Delivered By: (Circle One)	Observed Temp. °C 43	Sample Condition Cool Intact ☒ Yes ☐ No	REMARKS: 24H Rush
Sampler - UPS - Bus - Other:	Corrected Temp. °C 43	CHECKED BY: (Initials)	Turnaround Time: Standard ☐ Rush ☒
			Bacteria (only) Sample Condition Cool Intact ☐ Yes ☐ No Observed Temp. °C Corrected Temp. °C
			Thermometer ID #140 Correction Factor +0.1°C

† Cardinal cannot accept verbal changes. Please email changes to coley.keene@cardinallabsnm.com



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

June 18, 2026

JOEL LOWRY

Etech Environmental & Safety Solutions

2617 W MARLAND

HOBBS, NM 88240

RE: SERRANO ROLL-OFF OVERFLOW

Enclosed are the results of analyses for samples received by the laboratory on 06/17/26 15:07.

Cardinal Laboratories is accredited through Texas NELAP under certificate number TX-C26-00106. Accreditation applies to drinking water, non-potable water and solid and chemical materials. All accredited analytes are denoted by an asterisk (*). For a complete list of accredited analytes and matrices visit the TCEQ website at www.tceq.texas.gov/field/qa/lab_accred_certif.html.

Cardinal Laboratories is accredited through the State of Colorado Department of Public Health and Environment for:

Method EPA 552.2	Haloacetic Acids (HAA-5)
Method EPA 524.2	Total Trihalomethanes (TTHM)
Method EPA 524.4	Regulated VOCs (V1, V2, V3)

Accreditation applies to public drinking water matrices.

This report meets NELAP requirements and is made up of a cover page, analytical results, and a copy of the original chain-of-custody. If you have any questions concerning this report, please feel free to contact me.

Sincerely,

A handwritten signature in black ink that reads "Celey D. Keene". The signature is written in a cursive style with a large, stylized 'C' and 'K'.

Celey D. Keene

Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

Etech Environmental & Safety Solutions
 JOEL LOWRY
 2617 W MARLAND
 HOBBS NM, 88240
 Fax To:

Received: 06/17/2026
 Reported: 06/18/2026
 Project Name: SERRANO ROLL-OFF OVERFLOW
 Project Number: 23910
 Project Location: GOODNIGHT 32.27997-103.37313

Sampling Date: 06/17/2026
 Sampling Type: Soil
 Sampling Condition: Cool & Intact
 Sample Received By: Alyssa Parras

Sample ID: DELAWARE BASIN BACKFILL (H263468-01)

BTX 8021B		mg/kg		Analyzed By: JH					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Benzene*	<0.050	0.050	06/18/2026	ND	2.12	106	2.00	3.55	
Toluene*	<0.050	0.050	06/18/2026	ND	2.08	104	2.00	3.10	
Ethylbenzene*	<0.050	0.050	06/18/2026	ND	1.97	98.5	2.00	2.52	
Total Xylenes*	<0.150	0.150	06/18/2026	ND	5.75	95.8	6.00	1.92	
Total BTX	<0.300	0.300	06/18/2026	ND					

Surrogate: 4-Bromofluorobenzene (PID) 94.2 % 61.5-142

Chloride, SM4500Cl-B		mg/kg		Analyzed By: ED						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Chloride	320	16.0	06/18/2026	ND	464	116	400	3.39		

TPH 8015M		mg/kg		Analyzed By: MS					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	<10.0	10.0	06/17/2026	ND	208	104	200	6.72	
DRO >C10-C28*	<10.0	10.0	06/17/2026	ND	225	113	200	7.31	
EXT DRO >C28-C36	<10.0	10.0	06/17/2026	ND					

Surrogate: 1-Chlorooctane 70.7 % 47.1-117

Surrogate: 1-Chlorooctadecane 65.0 % 37.2-119

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager

PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Notes and Definitions

QM-07	The spike recovery was outside acceptance limits for the MS and/or MSD. The batch was accepted based on acceptable LCS recovery.
ND	Analyte NOT DETECTED at or above the reporting limit
RPD	Relative Percent Difference
**	Samples not received at proper temperature of 6°C or below.
***	Insufficient time to reach temperature.
-	Chloride by SM4500Cl-B does not require samples be received at or below 6°C Samples reported on an as received basis (wet) unless otherwise noted on report

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

A handwritten signature in black ink, appearing to read "Celey D. Keene".

Celey D. Keene, Lab Director/Quality Manager

101 East Marland, Hobbs, NM 88240
(575) 393-2326 FAX (575) 393-2476

CHAIN-OF-CUSTODY AND ANALYSIS REQUEST

Pg 1 of 1

Page 4 of 4

[illegible]

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising whether based in contract or tort, shall be limited to the amount paid by the client for the analyses. All claims including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within 30 days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise.

Relinquished By: <i>Matt</i>		Date: <i>6-17-20</i>	Received By: <i>Amos</i>	Verbal Result: ☐ Yes ☐ No ☐ Add'l Phone #: All Results are emailed. Please provide Email address: pm@etechnv.com	
Relinquished By:		Date:	Received By:	REMARKS: 24H Rush	
		Time: <i>1507</i>			
Delivered By: (Circle One)	Observed Temp. °C <i>-8.7</i>	Sample Condition Cool ☐ Intact ☐	CHECKED BY: (Initials) <i>AP</i>	Turnaround Time: Standard ☐ Rush ☒	Bacteria (only) Sample Condition Cool ☐ Intact ☐
Sampler - UPS - Bus - Other:	Corrected Temp. °C <i>-8.6</i>	☒ Yes ☐ No ☐ Yes ☐ No		Thermometer ID #140 Correction Factor +0.1°C	Observed Temp. °C ☐ Yes ☐ No ☐ Yes ☐ No Corrected Temp. °C

† Cardinal cannot accept verbal changes. Please email changes to celey.keene@cardinallabsnm.com

Appendix E

Regulatory Correspondence

From: OCDOnline@emnrd.nm.gov <OCDOnline@emnrd.nm.gov>
Sent: Monday, April 13, 2026 10:32 AM
To: Ralph Tijerina <rtijerina@goodnightmidstream.com>
Subject: The Oil Conservation Division (OCD) has accepted the application, Application ID: 574419

[EXTERNAL EMAIL NOTIFICATION] This message was received from outside the Goodnight Midstream Organization, do not click links or attachments unless you recognize the sender and know the content is safe.

To whom it may concern (c/o Ralph Tijerina for GOODNIGHT MIDSTREAM PERMIAN, LLC),
The OCD has received the submitted *Notification for (Final) Sampling of a Release* (C-141N), for incident ID (n#) nAPP2609314382.

The sampling event is expected to take place:

When: 04/16/2026 @ 08:00
Where: C-28-23S-35E 0 FNL 0 FEL (32.27997, -103.37313)

Additional Information: Jose Meza (432) 204.9094

Additional Instructions: From the intersection of Delaware Basin Rd and Teague Switch Rd (32.342168, -103.313718), head SW on Delaware Basin Rd for 5.43 mi, then SE for 3.48 mi, then E for 0.45 mi to arrive at the Serrano Roll-Off Overflow release area (32.27997, -103.37313).

An OCD representative may be available onsite at the date and time reported. In the absence or presence of an OCD representative, sampling pursuant to 19.15.29.12.D NMAC is required. Sampling must be performed following an approved sampling plan or pursuant to 19.15.29.12.D.(1).(c) NMAC. Should there be a change in the scheduled date and time of the sampling event, then another notification should be resubmitted through OCD permitting as soon as possible.

- **Failure to notify the OCD of sampling events including any changes in date/time per the requirements of 19.15.29.12.D.(1).(a) NMAC, may result in the remediation closure samples not being accepted.**
- **If confirmation sampling is going to take place over multiple days, individual C-141N applications must be submitted for each sampling date. Date ranges are not currently accepted on the C-141N application.**

If you have any questions regarding this application, or don't know why you have received this email, please contact us.

New Mexico Energy, Minerals and Natural Resources Department
1220 South St. Francis Drive
Santa Fe, NM 87505

From: OCDOnline@emnrd.nm.gov <OCDOnline@emnrd.nm.gov>
Sent: Monday, April 13, 2026 10:33 AM
To: Ralph Tijerina <rtijerina@goodnightmidstream.com>
Subject: The Oil Conservation Division (OCD) has accepted the application, Application ID: 574422

[EXTERNAL EMAIL NOTIFICATION] This message was received from outside the Goodnight Midstream Organization, do not click links or attachments unless you recognize the sender and know the content is safe.

To whom it may concern (c/o Ralph Tijerina for GOODNIGHT MIDSTREAM PERMIAN, LLC),
The OCD has received the submitted *Notification for (Final) Sampling of a Release* (C-141N), for incident ID (n#) nAPP2609314382.

The sampling event is expected to take place:

When: 04/17/2026 @ 08:00
Where: C-28-23S-35E 0 FNL 0 FEL (32.27997,-103.37313)

Additional Information: Jose Meza (432) 204-9094

Additional Instructions: From the intersection of Delaware Basin Rd and Teague Switch Rd (32.342168, -103.313718), head SW on Delaware Basin Rd for 5.43 mi, then SE for 3.48 mi, then E for 0.45 mi to arrive at the Serrano Roll-Off Overflow release area (32.27997, -103.37313).

An OCD representative may be available onsite at the date and time reported. In the absence or presence of an OCD representative, sampling pursuant to 19.15.29.12.D NMAC is required. Sampling must be performed following an approved sampling plan or pursuant to 19.15.29.12.D.(1).(c) NMAC. Should there be a change in the scheduled date and time of the sampling event, then another notification should be resubmitted through OCD permitting as soon as possible.

- **Failure to notify the OCD of sampling events including any changes in date/time per the requirements of 19.15.29.12.D.(1).(a) NMAC, may result in the remediation closure samples not being accepted.**
- **If confirmation sampling is going to take place over multiple days, individual C-141N applications must be submitted for each sampling date. Date ranges are not currently accepted on the C-141N application.**

If you have any questions regarding this application, or don't know why you have received this email, please contact us.

New Mexico Energy, Minerals and Natural Resources Department
1220 South St. Francis Drive
Santa Fe, NM 87505

From: OCDOnline@emnrd.nm.gov <OCDOnline@emnrd.nm.gov>
Sent: Tuesday, April 21, 2026 11:55 AM
To: Ralph Tijerina <rtijerina@goodnightmidstream.com>
Subject: The Oil Conservation Division (OCD) has accepted the application, Application ID: 577740

[EXTERNAL EMAIL NOTIFICATION] This message was received from outside the Goodnight Midstream Organization, do not click links or attachments unless you recognize the sender and know the content is safe

To whom it may concern (c/o Ralph Tijerina for GOODNIGHT MIDSTREAM PERMIAN, LLC),
The OCD has received the submitted *Notification for (Final) Sampling of a Release* (C-141N), for incident ID (n#) nAPP2609314382.

The sampling event is expected to take place:

When: 04/23/2026 @ 08:00

Where: C-28-23S-35E 0 FNL 0 FEL (32.27997, -103.37313)

Additional Information: Garbriela Tarango (432-204-9084)

Additional Instructions: From the intersection of Delaware Basin Rd and Teague Switch Rd (32.342168, -103.313718), head SW on Delaware Basin Rd for 5.43 mi, then SE for 3.48 mi, then E for 0.45 mi to arrive at the Serrano Roll-Off Overflow release area (32.27997, -103.37313).

An OCD representative may be available onsite at the date and time reported. In the absence or presence of an OCD representative, sampling pursuant to 19.15.29.12.D NMAC is required. Sampling must be performed following an approved sampling plan or pursuant to 19.15.29.12.D.(1).(c) NMAC. Should there be a change in the scheduled date and time of the sampling event, then another notification should be resubmitted through OCD permitting as soon as possible.

- **Failure to notify the OCD of sampling events including any changes in date/time per the requirements of 19.15.29.12.D.(1).(a) NMAC, may result in the remediation closure samples not being accepted.**
- **If confirmation sampling is going to take place over multiple days, individual C-141N applications must be submitted for each sampling date. Date ranges are not currently accepted on the C-141N application.**

If you have any questions regarding this application, or don't know why you have received this email, please contact us.

New Mexico Energy, Minerals and Natural Resources Department
1220 South St. Francis Drive
Santa Fe, NM 87505

Sante Fe Main Office
Phone: (505) 476-3441

General Information
Phone: (505) 629-6116

Online Phone Directory
<https://www.emnrd.nm.gov/ocd/contact-us>

State of New Mexico
Energy, Minerals and Natural Resources
Oil Conservation Division
1220 S. St Francis Dr.
Santa Fe, NM 87505

QUESTIONS

Action 600620

QUESTIONS

Operator: GOODNIGHT MIDSTREAM PERMIAN, LLC 5910 North Central Expressway Dallas, TX 75206	OGRID: 372311
	Action Number: 600620
	Action Type: [C-141] Remediation Closure Request C-141 (C-141-v-Closure)

QUESTIONS

Prerequisites	
Incident ID (n#)	nAPP2609314382
Incident Name	NAPP2609314382 SERRANO ROLL-OFF OVERFLOW @ C-28-23S-35E
Incident Type	Produced Water Release
Incident Status	Remediation Closure Report Received

Location of Release Source

Please answer all the questions in this group.

Site Name	SERRANO ROLL-OFF OVERFLOW
Date Release Discovered	04/01/2026
Surface Owner	Private

Incident Details

Please answer all the questions in this group.

Incident Type	Produced Water Release
Did this release result in a fire or is the result of a fire	No
Did this release result in any injuries	No
Has this release reached or does it have a reasonable probability of reaching a watercourse	No
Has this release endangered or does it have a reasonable probability of endangering public health	No
Has this release substantially damaged or will it substantially damage property or the environment	No
Is this release of a volume that is or may with reasonable probability be detrimental to fresh water	No

Nature and Volume of Release

Material(s) released, please answer all that apply below. Any calculations or specific justifications for the volumes provided should be attached to the follow-up C-141 submission.

Crude Oil Released (bbls) Details	Not answered.
Produced Water Released (bbls) Details	Cause: Human Error Valve Produced Water Released: 50 BBL Recovered: 30 BBL Lost: 20 BBL.
Is the concentration of chloride in the produced water >10,000 mg/l	Yes
Condensate Released (bbls) Details	Not answered.
Natural Gas Vented (Mcf) Details	Not answered.
Natural Gas Flared (Mcf) Details	Not answered.
Other Released Details	Not answered.
Are there additional details for the questions above (i.e. any answer containing Other, Specify, Unknown, and/or Fire, or any negative lost amounts)	Not answered.

Sante Fe Main Office
Phone: (505) 476-3441

General Information
Phone: (505) 629-6116

Online Phone Directory
<https://www.emnrd.nm.gov/ocd/contact-us>

State of New Mexico
Energy, Minerals and Natural Resources
Oil Conservation Division
1220 S. St Francis Dr.
Santa Fe, NM 87505

QUESTIONS, Page 2

Action 600620

QUESTIONS (continued)

Operator: GOODNIGHT MIDSTREAM PERMIAN, LLC 5910 North Central Expressway Dallas, TX 75206	OGRID: 372311
	Action Number: 600620
	Action Type: [C-141] Remediation Closure Request C-141 (C-141-v-Closure)

QUESTIONS

Nature and Volume of Release (continued)	
Is this a gas only submission (i.e. only significant Mcf values reported)	No, according to supplied volumes this does not appear to be a "gas only" report.
Was this a major release as defined by Subsection A of 19.15.29.7 NMAC	Yes
Reasons why this would be considered a submission for a notification of a major release	From paragraph A. "Major release" determine using: (1) an unauthorized release of a volume, excluding gases, of 25 barrels or more.
With the implementation of the 19.15.27 NMAC (05/25/2021), venting and/or flaring of natural gas (i.e. gas only) are to be submitted on the C-129 form.	

Initial Response

The responsible party must undertake the following actions immediately unless they could create a safety hazard that would result in injury.

The source of the release has been stopped	True
The impacted area has been secured to protect human health and the environment	True
Released materials have been contained via the use of berms or dikes, absorbent pads, or other containment devices	True
All free liquids and recoverable materials have been removed and managed appropriately	True
If all the actions described above have not been undertaken, explain why	Not answered.

Per Paragraph (4) of Subsection B of 19.15.29.8 NMAC the responsible party may commence remediation immediately after discovery of a release. If remediation has begun, please prepare and attach a narrative of actions to date in the follow-up C-141 submission. If remedial efforts have been successfully completed or if the release occurred within a lined containment area (see Subparagraph (a) of Paragraph (5) of Subsection A of 19.15.29.11 NMAC), please prepare and attach all information needed for closure evaluation in the follow-up C-141 submission.

I hereby certify that the information given above is true and complete to the best of my knowledge and understand that pursuant to OCD rules and regulations all operators are required to report and/or file certain release notifications and perform corrective actions for releases which may endanger public health or the environment. The acceptance of a C-141 report by the OCD does not relieve the operator of liability should their operations have failed to adequately investigate and remediate contamination that pose a threat to groundwater, surface water, human health or the environment. In addition, OCD acceptance of a C-141 report does not relieve the operator of responsibility for compliance with any other federal, state, or local laws and/or regulations.

I hereby agree and sign off to the above statement	Name: Ralph Tijerina Title: Director of EH&S Email: rtijerina@goodnightmidstream.com Date: 06/30/2026
--	--

Sante Fe Main Office
Phone: (505) 476-3441

General Information
Phone: (505) 629-6116

Online Phone Directory
<https://www.emnrd.nm.gov/ocd/contact-us>

State of New Mexico
Energy, Minerals and Natural Resources
Oil Conservation Division
1220 S. St Francis Dr.
Santa Fe, NM 87505

QUESTIONS, Page 3

Action 600620

QUESTIONS (continued)

Operator: GOODNIGHT MIDSTREAM PERMIAN, LLC 5910 North Central Expressway Dallas, TX 75206	OGRID: 372311
	Action Number: 600620
	Action Type: [C-141] Remediation Closure Request C-141 (C-141-v-Closure)

QUESTIONS

Site Characterization	
<i>Please answer all the questions in this group (only required when seeking remediation plan approval and beyond). This information must be provided to the appropriate district office no later than 90 days after the release discovery date.</i>	
What is the shallowest depth to groundwater beneath the area affected by the release in feet below ground surface (ft bgs)	Between 100 and 500 (ft.)
What method was used to determine the depth to ground water	NM OSE iWaters Database Search
Did this release impact groundwater or surface water	No
What is the minimum distance, between the closest lateral extents of the release and the following surface areas:	
A continuously flowing watercourse or any other significant watercourse	Between 1 and 5 (mi.)
Any lakebed, sinkhole, or playa lake (measured from the ordinary high-water mark)	Between 1 and 5 (mi.)
An occupied permanent residence, school, hospital, institution, or church	Greater than 5 (mi.)
A spring or a private domestic fresh water well used by less than five households for domestic or stock watering purposes	Between 500 and 1000 (ft.)
Any other fresh water well or spring	Greater than 5 (mi.)
Incorporated municipal boundaries or a defined municipal fresh water well field	Greater than 5 (mi.)
A wetland	Between 1 and 5 (mi.)
A subsurface mine	Greater than 5 (mi.)
An (non-karst) unstable area	Between 1 and 5 (mi.)
Categorize the risk of this well / site being in a karst geology	Low
A 100-year floodplain	Greater than 5 (mi.)
Did the release impact areas not on an exploration, development, production, or storage site	No

Remediation Plan	
<i>Please answer all the questions that apply or are indicated. This information must be provided to the appropriate district office no later than 90 days after the release discovery date.</i>	
Requesting a remediation plan approval with this submission	Yes
<i>Attach a comprehensive report demonstrating the lateral and vertical extents of soil contamination associated with the release have been determined, pursuant to 19.15.29.11 NMAC and 19.15.29.13 NMAC.</i>	
Have the lateral and vertical extents of contamination been fully delineated	Yes
Was this release entirely contained within a lined containment area	No
Soil Contamination Sampling: (Provide the highest observable value for each, in milligrams per kilograms.)	
Chloride (EPA 300.0 or SM4500 Cl B)	19400
TPH (GRO+DRO+MRO) (EPA SW-846 Method 8015M)	5950
GRO+DRO (EPA SW-846 Method 8015M)	4970
BTEX (EPA SW-846 Method 8021B or 8260B)	5.8
Benzene (EPA SW-846 Method 8021B or 8260B)	0
<i>Per Subsection B of 19.15.29.11 NMAC unless the site characterization report includes completed efforts at remediation, the report must include a proposed remediation plan in accordance with 19.15.29.12 NMAC, which includes the anticipated timelines for beginning and completing the remediation.</i>	
On what estimated date will the remediation commence	04/14/2026
On what date will (or did) the final sampling or liner inspection occur	04/23/2026
On what date will (or was) the remediation complete(d)	04/29/2026
What is the estimated surface area (in square feet) that will be reclaimed	13145
What is the estimated volume (in cubic yards) that will be reclaimed	1948
What is the estimated surface area (in square feet) that will be remediated	8653
What is the estimated volume (in cubic yards) that will be remediated	180
<i>These estimated dates and measurements are recognized to be the best guess or calculation at the time of submission and may (be) change(d) over time as more remediation efforts are completed.</i>	
<i>The OCD recognizes that proposed remediation measures may have to be minimally adjusted in accordance with the physical realities encountered during remediation. If the responsible party has any need to significantly deviate from the remediation plan proposed, then it should consult with the division to determine if another remediation plan submission is required.</i>	

Sante Fe Main Office
Phone: (505) 476-3441

General Information
Phone: (505) 629-6116

Online Phone Directory
<https://www.emnrd.nm.gov/ocd/contact-us>

State of New Mexico
Energy, Minerals and Natural Resources
Oil Conservation Division
1220 S. St Francis Dr.
Santa Fe, NM 87505

QUESTIONS, Page 4

Action 600620

QUESTIONS (continued)

Operator: GOODNIGHT MIDSTREAM PERMIAN, LLC 5910 North Central Expressway Dallas, TX 75206	OGRID: 372311
	Action Number: 600620
	Action Type: [C-141] Remediation Closure Request C-141 (C-141-v-Closure)

QUESTIONS

Remediation Plan (continued)	
<i>Please answer all the questions that apply or are indicated. This information must be provided to the appropriate district office no later than 90 days after the release discovery date.</i>	
This remediation will (or is expected to) utilize the following processes to remediate / reduce contaminants:	
<i>(Select all answers below that apply.)</i>	
(Ex Situ) Excavation and off-site disposal (i.e. dig and haul, hydrovac, etc.)	Yes
Which OCD approved facility will be used for off-site disposal	fJEG1635837366 OWL LANDFILL JAL
OR which OCD approved well (API) will be used for off-site disposal	Not answered.
OR is the off-site disposal site, to be used, out-of-state	Not answered.
OR is the off-site disposal site, to be used, an NMED facility	Not answered.
(Ex Situ) Excavation and on-site remediation (i.e. On-Site Land Farms)	Not answered.
(In Situ) Soil Vapor Extraction	Not answered.
(In Situ) Chemical processing (i.e. Soil Shredding, Potassium Permanganate, etc.)	Not answered.
(In Situ) Biological processing (i.e. Microbes / Fertilizer, etc.)	Not answered.
(In Situ) Physical processing (i.e. Soil Washing, Gypsum, Disking, etc.)	Not answered.
Ground Water Abatement pursuant to 19.15.30 NMAC	Not answered.
OTHER (Non-listed remedial process)	Not answered.
<i>Per Subsection B of 19.15.29.11 NMAC unless the site characterization report includes completed efforts at remediation, the report must include a proposed remediation plan in accordance with 19.15.29.12 NMAC, which includes the anticipated timelines for beginning and completing the remediation.</i>	
I hereby certify that the information given above is true and complete to the best of my knowledge and understand that pursuant to OCD rules and regulations all operators are required to report and/or file certain release notifications and perform corrective actions for releases which may endanger public health or the environment. The acceptance of a C-141 report by the OCD does not relieve the operator of liability should their operations have failed to adequately investigate and remediate contamination that pose a threat to groundwater, surface water, human health or the environment. In addition, OCD acceptance of a C-141 report does not relieve the operator of responsibility for compliance with any other federal, state, or local laws and/or regulations.	
I hereby agree and sign off to the above statement	Name: Ralph Tijerina Title: Director of EH&S Email: rtijerina@goodnightmidstream.com Date: 06/30/2026
<i>The OCD recognizes that proposed remediation measures may have to be minimally adjusted in accordance with the physical realities encountered during remediation. If the responsible party has any need to significantly deviate from the remediation plan proposed, then it should consult with the division to determine if another remediation plan submission is required.</i>	

Sante Fe Main Office
Phone: (505) 476-3441

General Information
Phone: (505) 629-6116

Online Phone Directory
<https://www.emnrd.nm.gov/ocd/contact-us>

State of New Mexico
Energy, Minerals and Natural Resources
Oil Conservation Division
1220 S. St Francis Dr.
Santa Fe, NM 87505

QUESTIONS, Page 5

Action 600620

QUESTIONS (continued)

Operator: GOODNIGHT MIDSTREAM PERMIAN, LLC 5910 North Central Expressway Dallas, TX 75206	OGRID: 372311
	Action Number: 600620
	Action Type: [C-141] Remediation Closure Request C-141 (C-141-v-Closure)

QUESTIONS

Deferral Requests Only	
Only answer the questions in this group if seeking a deferral upon approval this submission. Each of the following items must be confirmed as part of any request for deferral of remediation.	
Requesting a deferral of the remediation closure due date with the approval of this submission	No

Sante Fe Main Office
Phone: (505) 476-3441

General Information
Phone: (505) 629-6116

Online Phone Directory
<https://www.emnrd.nm.gov/ocd/contact-us>

State of New Mexico
Energy, Minerals and Natural Resources
Oil Conservation Division
1220 S. St Francis Dr.
Santa Fe, NM 87505

QUESTIONS, Page 6

Action 600620

QUESTIONS (continued)

Operator: GOODNIGHT MIDSTREAM PERMIAN, LLC 5910 North Central Expressway Dallas, TX 75206	OGRID: 372311
	Action Number: 600620
	Action Type: [C-141] Remediation Closure Request C-141 (C-141-v-Closure)

QUESTIONS

Sampling Event Information	
Last sampling notification (C-141N) recorded	577740
Sampling date pursuant to Subparagraph (a) of Paragraph (1) of Subsection D of 19.15.29.12 NMAC	04/23/2026
What was the (estimated) number of samples that were to be gathered	7
What was the sampling surface area in square feet	1400

Remediation Closure Request	
<i>Only answer the questions in this group if seeking remediation closure for this release because all remediation steps have been completed.</i>	
Requesting a remediation closure approval with this submission	Yes
Have the lateral and vertical extents of contamination been fully delineated	Yes
Was this release entirely contained within a lined containment area	No
All areas reasonably needed for production or subsequent drilling operations have been stabilized, returned to the sites existing grade, and have a soil cover that prevents ponding of water, minimizing dust and erosion	Yes
What was the total surface area (in square feet) remediated	8653
What was the total volume (cubic yards) remediated	180
All areas not reasonably needed for production or subsequent drilling operations have been reclaimed to contain a minimum of four feet of non-waste contain earthen material with concentrations less than 600 mg/kg chlorides, 100 mg/kg TPH, 50 mg/kg BTEX, and 10 mg/kg Benzene	Yes
What was the total surface area (in square feet) reclaimed	1416
What was the total volume (in cubic yards) reclaimed	47
Summarize any additional remediation activities not included by answers (above)	Remediation Activities were conducted in accordance with the NMOCD. Final reclamation and reseedling will be conducted upon abandoning and decommissioning the facility.
<i>The responsible party must attach information demonstrating they have complied with all applicable closure requirements and any conditions or directives of the OCD. This demonstration should be in the form of a comprehensive report (in .pdf format) including a scaled site map, sampling diagrams, relevant field notes, photographs of any excavation prior to backfilling, laboratory data including chain of custody documents of final sampling, and a narrative of the remedial activities. Refer to 19.15.29.12 NMAC.</i>	
I hereby certify that the information given above is true and complete to the best of my knowledge and understand that pursuant to OCD rules and regulations all operators are required to report and/or file certain release notifications and perform corrective actions for releases which may endanger public health or the environment. The acceptance of a C-141 report by the OCD does not relieve the operator of liability should their operations have failed to adequately investigate and remediate contamination that pose a threat to groundwater, surface water, human health or the environment. In addition, OCD acceptance of a C-141 report does not relieve the operator of responsibility for compliance with any other federal, state, or local laws and/or regulations. The responsible party acknowledges they must substantially restore, reclaim, and re-vegetate the impacted surface area to the conditions that existed prior to the release or their final land use in accordance with 19.15.29.13 NMAC including notification to the OCD when reclamation and re-vegetation are complete.	
I hereby agree and sign off to the above statement	Name: Ralph Tijerina Title: Director of EH&S Email: rtijerina@goodnightmidstream.com Date: 06/30/2026

Sante Fe Main Office
Phone: (505) 476-3441

General Information
Phone: (505) 629-6116

Online Phone Directory
<https://www.emnrd.nm.gov/ocd/contact-us>

State of New Mexico
Energy, Minerals and Natural Resources
Oil Conservation Division
1220 S. St Francis Dr.
Santa Fe, NM 87505

QUESTIONS, Page 7

Action 600620

QUESTIONS (continued)

Operator: GOODNIGHT MIDSTREAM PERMIAN, LLC 5910 North Central Expressway Dallas, TX 75206	OGRID: 372311
	Action Number: 600620
	Action Type: [C-141] Remediation Closure Request C-141 (C-141-v-Closure)

QUESTIONS

Reclamation Report	
Only answer the questions in this group if all reclamation steps have been completed.	
Requesting a reclamation approval with this submission	No

Sante Fe Main Office
Phone: (505) 476-3441

General Information
Phone: (505) 629-6116

Online Phone Directory
<https://www.emnrd.nm.gov/ocd/contact-us>

State of New Mexico
Energy, Minerals and Natural Resources
Oil Conservation Division
1220 S. St Francis Dr.
Santa Fe, NM 87505

CONDITIONS

Action 600620

CONDITIONS

Operator: GOODNIGHT MIDSTREAM PERMIAN, LLC 5910 North Central Expressway Dallas, TX 75206	OGRID: 372311
	Action Number: 600620
	Action Type: [C-141] Remediation Closure Request C-141 (C-141-v-Closure)

CONDITIONS

Created By	Condition	Condition Date
michael.buchanan	Remediation closure approved.	7/8/2026
michael.buchanan	A reclamation report will not be accepted until reclamation of the release area, including areas reasonably needed for production or drilling activities, is complete and meet the requirements of 19.15.29.13 NMAC. Areas not reasonably needed for production or drilling activities will still need to be reclaimed and revegetated as early as practicable.	7/8/2026
michael.buchanan	The reclamation report will need to include: Executive Summary of the reclamation activities; Scaled Site Map including sampling locations; Analytical results including, but not limited to, results showing that any remaining impacts meet the reclamation standards and results to prove the backfill is non-waste containing; At least one (1) representative 5-point composite sample will need to be collected from the backfill material that will be used for the reclamation of the top four feet of the excavation. The OCD reserves the right to request additional sampling if needed; pictures of the backfilled areas showing that the area is back, as nearly as practical, to the original condition or the final land use and maintain those areas to control dust and minimize erosion to the extent practical; pictures of the top layer, which is either the background thickness of topsoil or one foot of suitable material to establish vegetation at the site, whichever is greater; and a revegetation plan.	7/8/2026
michael.buchanan	A revegetation report will not be accepted until revegetation of the release area, including areas reasonably needed for production or drilling activities, is complete and meet the requirements of 19.15.29.13 NMAC. Areas not reasonably needed for production or drilling activities will still need to be reclaimed and revegetated as early as practicable.	7/8/2026
michael.buchanan	All revegetation activities will need to be documented and included in the revegetation report. The revegetation report will need to include: An executive summary of the revegetation activities including: Seed mix, Method of seeding, dates of when the release area was reseeded, information pertinent to inspections, information about any amendments added to the soil, information on how the vegetative cover established meets the life-form ratio of plus or minus fifty percent of pre-disturbance levels and a total percent plant cover of at least seventy percent of pre-disturbance levels, excluding noxious weeds per 19.15.29.13 D.(3) NMAC, and any additional information; a scaled Site Map including area that was revegetated in square feet; and pictures of the revegetated areas during reseeding activities, inspections, and final pictures when revegetation is achieved.	7/8/2026
michael.buchanan	Per 19.15.29.13 E. NMAC, if a reclamation and revegetation report has been submitted to the surface owner, it may be used if the requirements of the surface owner provide equal or better protection of freshwater, human health, and the environment. A copy of the approval of the reclamation and revegetation report from the surface owner and a copy of the approved reclamation and revegetation report will need to be submitted to the OCD via the Permitting website.	7/8/2026