

Standard Safety and Supply

August 27, 2026
<https://standardtx.com/>



Site Characterization and Remediation Workplan
OXY USA Inc [16696]
Lost Tank 18 Tankless CPF
nAPP2618354985
32.38711,-103.71812
N-18-22S-32E
Lea County, New Mexico

Introduction

Standard Safety and Supply (Standard) on behalf of Oxy USA INC. (Oxy) is pleased to submit this Site Characterization and Remediation Workplan. Based on the Notification of Release the spill was discovered on June 17, 2026, and was attributed to corrosion failure. There was an approximate net loss of ten (10) barrels (bbls) of crude oil and ten (10) bbls of produced water. Attachment B: Figure 1 depicts the Site with respect to the nearest town and Figure 2 depicts the topographic features in the area.

Site Characterization

Based on a site characterization desktop review the area is within a Low Karst area. Furthermore, there are no receptors [significant watercourse, lakebed, playa, sinkhole, an occupied residence, school, hospital, institution, church, freshwater spring for domestic or stock watering purposes, other fresh water well/spring, municipal water boundary, wetland, subsurface mine, and/or an unstable area] within the specified distance set forth in the New Mexico Administrative Code 19.15.29.12. Based on a groundwater determination bore log from November of 2022, referenced in the spill nAPP2427026341 closure report, the groundwater is greater than one hundred and one (101) ft below ground surface (bgs). The groundwater determination bore was drilled by Trinity Oilfield Services on November 15th, 2022. The groundwater determination bore was drilled to a depth of one hundred and ten (110) feet and no moisture was encountered throughout each interval. After a period of 72 hours, the soil boring was observed to be dry and was subsequently backfilled. The groundwater determination bore is approximately 0.45 miles away from the site. The Soil Bore Log is attached under attachment C: Site Characterization. Based upon the site characterization the following closure criteria will be utilized:

Standard Safety and Supply

<https://standardtx.com/>

	NMAC Closure Criteria Remediation and Reclamation				
depths in feet (ft)	Benzene	BTEX	GRO-DRO	TPH (GRO-DRO-MRO)	Chloride
0 - Max depth (ft)	10 mg/kg	50mg/kg	1,000 mg/kg	2,500 mg/kg	20,000 mg/kg
	*value must not exceed TPH (GRO-DRO-MRO) value				

The documentation used to characterize the site can be found in the report under Attachment C: Site Characterization.

Initial Assessment

On July 31, 2026, Standard performed an initial assessment to characterize impacts. Thirteen (13) horizontal sample points (H-1 to H-13) were collected starting at surface (0) depth to half a foot (0.5) ft bgs. Eight (8) vertical samples points (V-1 to V-8) were collected from surface (0) to one and a half (1.5) ft bgs in half foot (0.5) ft intervals. Soil samples were placed into lab provided containers, onto ice then transported to Cardinal Laboratories in Hobbs, New Mexico, for the analysis of benzene, toluene, ethylbenzene, and xylenes (BTEX 8021B), Total Petroleum Hydrocarbons (TPH 8015M) and chloride (EPA 300.0). Proper chain-of-custody was followed during the collection and delivery of the samples to the laboratory. Analytical results indicated that delineation was not achieved.

On August 11, 2026, Standard returned to the site to continue with vertical delineation efforts. One (1) vertical sample point (V-3) was reinstalled starting at two (2) ft bgs and collected in half (0.5) ft intervals. Furthermore, nine (9) additional horizontal sample points were collected adjacent to the spill to define the extent of impacts. Soil samples were submitted to Cardinal for the analysis of BTEX, TPH, and chloride. Analytical results indicated that vertical & horizontal delineation was achieved.

The delineation data can be found in this report under Attachment A: Table 1 Delineation Assessment Analytical Data Table and the lab report and chain of custody can be found under Attachment E: Laboratory Analytical Method Documentation with Chain-of-Custody.

The delineation sample locations are located under Attachment B: Figure 3 Delineation Assessment Map while photographs of the impacted area are under Attachment D: Photographic Log.



Standard Safety and Supply

<https://standardtx.com/>

Proposed Remedial Action Activities and Confirmation Sampling

Based on the site assessment findings Standard proposes the remedial actions as follows:

- Excavate the areas of V-1, V-2, V-5, V-6, H-1, H-3, H-12, and H-13 down to half a foot (0.5) ft bgs.
- Excavate the areas of V-4, V-7, V-8, H-4, H-6, H-7, H-9, and H-10 down to one (1) ft bgs.
- Excavate the areas of V-3 down to two (2) ft bgs.
- Confirmation samples the open excavations.

There is an estimated three hundred thirty-seven (337) cubic yards of impacted material that will be excavated and transported to the closest approved disposal facility.

Soil samples will be collected as a five-point composite and will represent an area no greater than 200 square feet each. Soil samples will be placed into lab provided containers, onto ice then transported to Cardinal Laboratories in Hobbs, New Mexico, for the analysis of BTEX, TPH, and chloride.

Closing

If you have any questions regarding the Site Characterization and Remediation Workplan for [nAPP2618354985] – Lost Tank 18 Tankless CPF please contact us at the following:

Address: 2524 Trunk St, Odessa TX 79761

Contact: 432-653-0393



Standard Safety and Supply

<https://standardtx.com/>

Attachments

- Attachment A: Analytical Data Tables
 1. Table 1: Delineation Assessment Analytical Data Table
- Attachment B: Figures
 1. Site Location Map
 2. Topographic Map
 3. Delineation Assessment Map
 4. Proposed Excavation Map
- Attachment C: Site Characterization
 1. OCD Well map and Karst Potential
 2. OSE POD
 3. Groundwater Bore Location
 4. Soil Bore Log
 5. Open Environment Wetlands
 6. Wetlands Inventory
 7. National Flood Hazard Layer
- Attachment D: Photographic Documentation
- Attachment E: Laboratory Analytical Method Documentation with Chain-of-Custody



Standard Safety and Supply

<https://standardtx.com/>



ATTACHMENT A: ANALYTICAL DATA TABLES



Table 1: Delineation Assessment Analytical Data Table

Oxy USA Inc
Lost Tank 18 Tankless CPF (6-17-26)
Lea County, New Mexico

			Chloride	TPH Total (C6-C35)	GRO (C6-C12)	DRO (C12-C28)	GRO+DRO (C6-C28)	MRO (C28-C35)	Benzene	Toluene	Ethylbenzene	Xylenes	BTEX
Remediation (GW >101ft)			20,000 mg/Kg	2,500 mg/Kg	**	**	1,000 mg/Kg	****	10 mg/Kg	*	*	*	50 mg/Kg
Sample ID	Depth (ft)	Date											
V-1	0-6"	7/31/2026	64.0	<10.0	<10.0	<10.0	<10.0	<10.0	<0.050	<0.050	<0.050	<0.150	<0.300
	1-1.5	7/31/2026	16.0	<10.0	<10.0	<10.0	<10.0	<10.0	<0.050	<0.050	<0.050	<0.150	<0.300
V-2	0-6"	7/31/2026	32.0	<10.0	<10.0	<10.0	<10.0	<10.0	<0.050	<0.050	<0.050	<0.150	<0.300
	1-1.5	7/31/2026	32.0	<10.0	<10.0	<10.0	<10.0	<10.0	<0.050	<0.050	<0.050	<0.150	<0.300
V-3	0-6"	7/31/2026	2,360	9,922	562	8,050	8,612	1,310	<0.050	<0.050	0.477	5.97	6.44
	1-1.5	7/31/2026	480	1,214	35.0	1,000	1,035	179	<0.050	<0.050	<0.050	<0.150	<0.300
	2-2.5	8/11/2026	80.0	16.1	<10.0	16.1	16.1	<10.0	<0.050	<0.050	<0.050	<0.150	<0.300
V-4	0-6"	7/31/2026	2,850	1,856	<10.0	1,480	1,480	376	<0.050	<0.050	<0.050	<0.150	<0.300
	1-1.5	7/31/2026	48.0	<10.0	<10.0	<10.0	<10.0	<10.0	<0.050	<0.050	<0.050	<0.150	<0.300
V-5	0-6"	7/31/2026	4,640	978	<10.0	803	803	175	<0.050	<0.050	<0.050	<0.150	<0.300
	1-1.5	7/31/2026	560	117.8	<10.0	88.0	88	29.8	<0.050	<0.050	<0.050	<0.150	<0.300
V-6	0-6"	7/31/2026	13,600	229.9	<10.0	163	163	66.9	<0.050	<0.050	<0.050	<0.150	<0.300
	1-1.5	7/31/2026	224	<10.0	<10.0	<10.0	<10.0	<10.0	<0.050	<0.050	<0.050	<0.150	<0.300
V-7	0-6"	7/31/2026	3,240	1,768	<10.0	1,440	1,440	328	<0.050	<0.050	<0.050	<0.150	<0.300
	1-1.5	7/31/2026	80.0	29.4	<10.0	29.4	29.4	<10.0	<0.050	<0.050	<0.050	<0.150	<0.300
V-8	0-6"	7/31/2026	2,860	14,480	<10.0	12,200	12,200	2280	<0.050	<0.050	<0.050	<0.150	<0.300
	1-1.5	7/31/2026	80.0	284.6	<10.0	252	252	32.6	<0.050	<0.050	<0.050	<0.150	<0.300
H-1	0-6"	7/31/2026	192	1,997	<10.0	1,540	1,540	457	<0.050	<0.050	<0.050	<0.150	<0.300
H-1A	0-6"	8/11/2026	64.0	<10.0	<10.0	<10.0	<10.0	<10.0	<0.050	<0.050	<0.050	<0.150	<0.300
H-2	0-6"	7/31/2026	464	<10.0	<10.0	<10.0	<10.0	<10.0	<0.050	<0.050	<0.050	<0.150	<0.300
H-3	0-6"	7/31/2026	240	1,988	<10.0	1,540	1,540	448	<0.050	<0.050	<0.050	<0.150	<0.300
H-3A	0-6"	8/11/2026	480	110.3	<10.0	87.5	87.5	22.8	<0.050	<0.050	<0.050	<0.150	<0.300
H-4	0-6"	7/31/2026	192	1,592	<10.0	1,230	1,230	362	<0.050	<0.050	<0.050	<0.150	<0.300
H-4A	0-6"	8/11/2026	464	99.5	<10.0	68	68	31.5	<0.050	<0.050	<0.050	<0.150	<0.300
H-5	0-6"	7/31/2026	480	<10.0	<10.0	<10.0	<10.0	<10.0	<0.050	<0.050	<0.050	<0.150	<0.300
H-6	0-6"	7/31/2026	256	1,924	<10.0	1,540	1,540	384	<0.050	<0.050	<0.050	<0.150	<0.300
H-6A	0-6"	8/11/2026	304	39.4	<10.0	28.2	28.2	11.2	<0.050	<0.050	<0.050	<0.150	<0.300
H-7	0-6"	7/31/2026	224	1,971	<10.0	1,560	1,560	411	<0.050	<0.050	<0.050	<0.150	<0.300
H-7A	0-6"	8/11/2026	144	<10.0	<10.0	<10.0	<10.0	<10.0	<0.050	<0.050	<0.050	<0.150	<0.300
H-8	0-6"	7/31/2026	480	<10.0	<10.0	<10.0	<10.0	<10.0	<0.050	<0.050	<0.050	<0.150	<0.300
H-9	0-6"	7/31/2026	192	2,111	<10.0	1,650	1,650	461	<0.050	<0.050	<0.050	<0.150	<0.300
H-9A	0-6"	8/11/2026	160	<10.0	<10.0	<10.0	<10.0	<10.0	<0.050	<0.050	<0.050	<0.150	<0.300

Table 1: Delineation Assessment Analytical Data Table

Oxy USA Inc
Lost Tank 18 Tankless CPF (6-17-26)
Lea County, New Mexico

			Chloride	TPH Total (C6-C35)	GRO (C6-C12)	DRO (C12-C28)	GRO+DRO (C6-C28)	MRO (C28-C35)	Benzene	Toluene	Ethylbenzene	Xylenes	BTEX
Remediation (GW >101ft)			20,000 mg/Kg	2,500 mg/Kg	**	**	1,000 mg/Kg	****	10 mg/Kg	*	*	*	50 mg/Kg
Sample ID	Depth (ft)	Date											
H-10	0-6"	7/31/2026	256	1,783	<10.0	1,430	1,430	353	<0.050	<0.050	<0.050	<0.150	<0.300
H-10A	0-6"	8/11/2026	368	52	<10.0	35.4	35.4	16.6	<0.050	<0.050	<0.050	<0.150	<0.300
H-11	0-6"	7/31/2026	464	<10.0	<10.0	<10.0	<10.0	<10.0	<0.050	<0.050	<0.050	<0.150	<0.300
H-12	0-6"	7/31/2026	240	2,067	<10.0	1,630	1,630	437	<0.050	<0.050	<0.050	<0.150	<0.300
H-12A	0-6"	8/11/2026	96	<10.0	<10.0	<10.0	<10.0	<10.0	<0.050	<0.050	<0.050	<0.150	<0.300
H-13	0-6"	7/31/2026	224	1,840	<10.0	1,450	1,450	390	<0.050	<0.050	<0.050	<0.150	<0.300
H-13A	0-6"	8/11/2026	224	80.8	<10.0	49.7	49.7	31.1	<0.050	<0.050	<0.050	<0.150	<0.300

Notes

1. mg/kg - milligram per kilogram
2. TPH - Total Petroleum Hydrocarbons
3. (CS) - Confirmation Sample
4. (SW) - Sidewall Sample
5. * Indicates Value must be equal to or less than Total BTEX

- 6.** Indicates that total value must be equal to or less than total TPH
- 7.*** Indicates that total value must be equal to or less than GRO+DRO total
- 8.**** Indicates that Total value must be equal or less than total TPH
9. H = Horizontal Sample
10. V= Vertical Sample

11. Remediation Limits

12. Reclamation Limits (0-4ft below ground surface)


Standard Safety and Supply


<https://standardtx.com/>




ATTACHMENT B: FIGURES



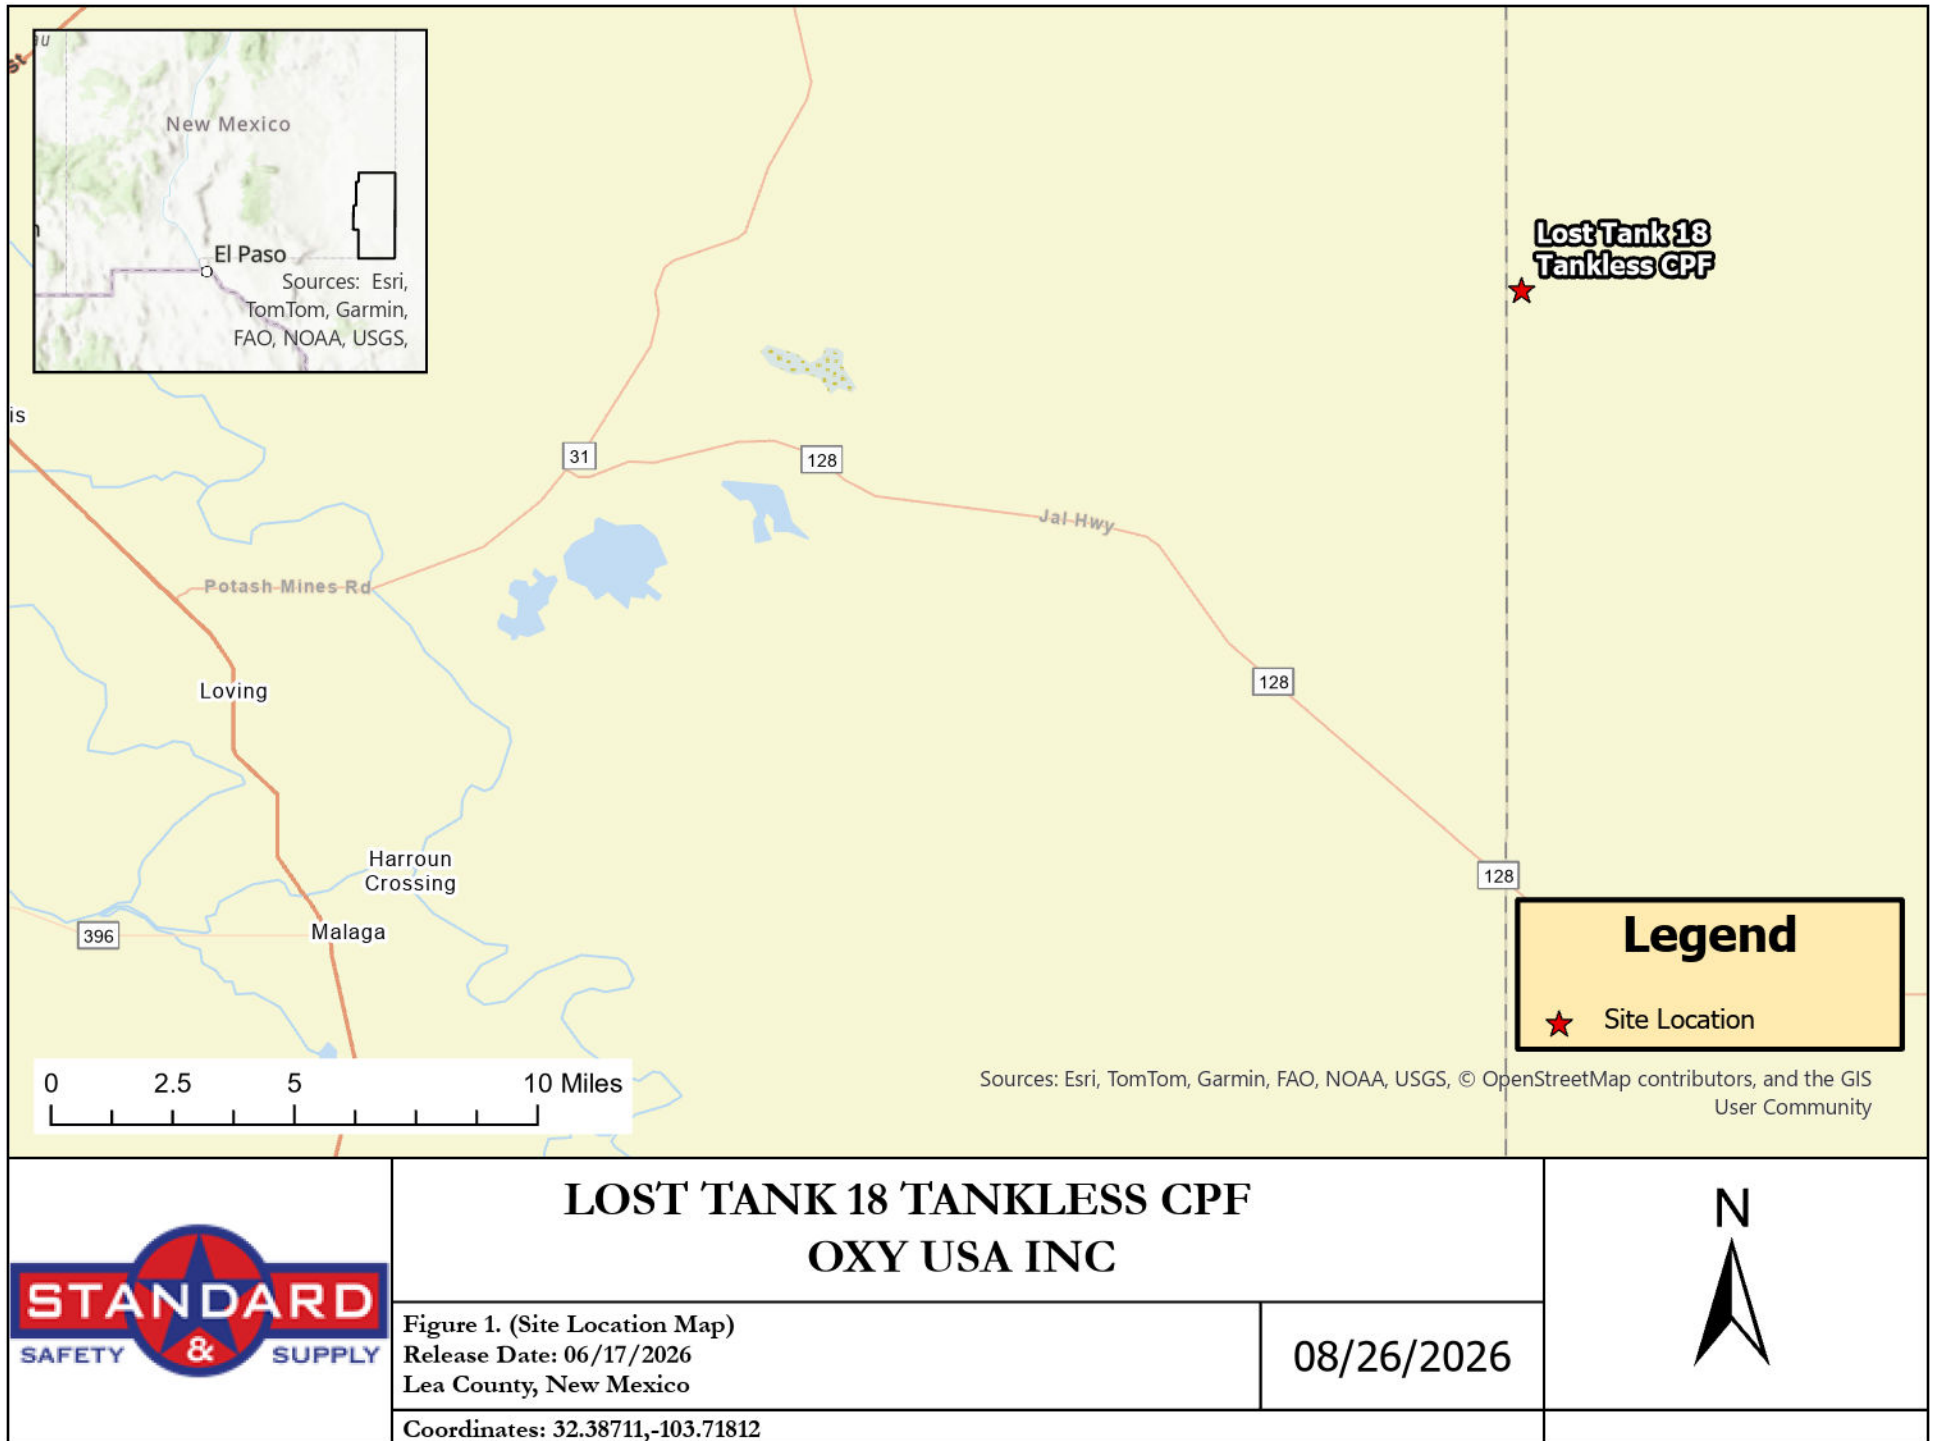


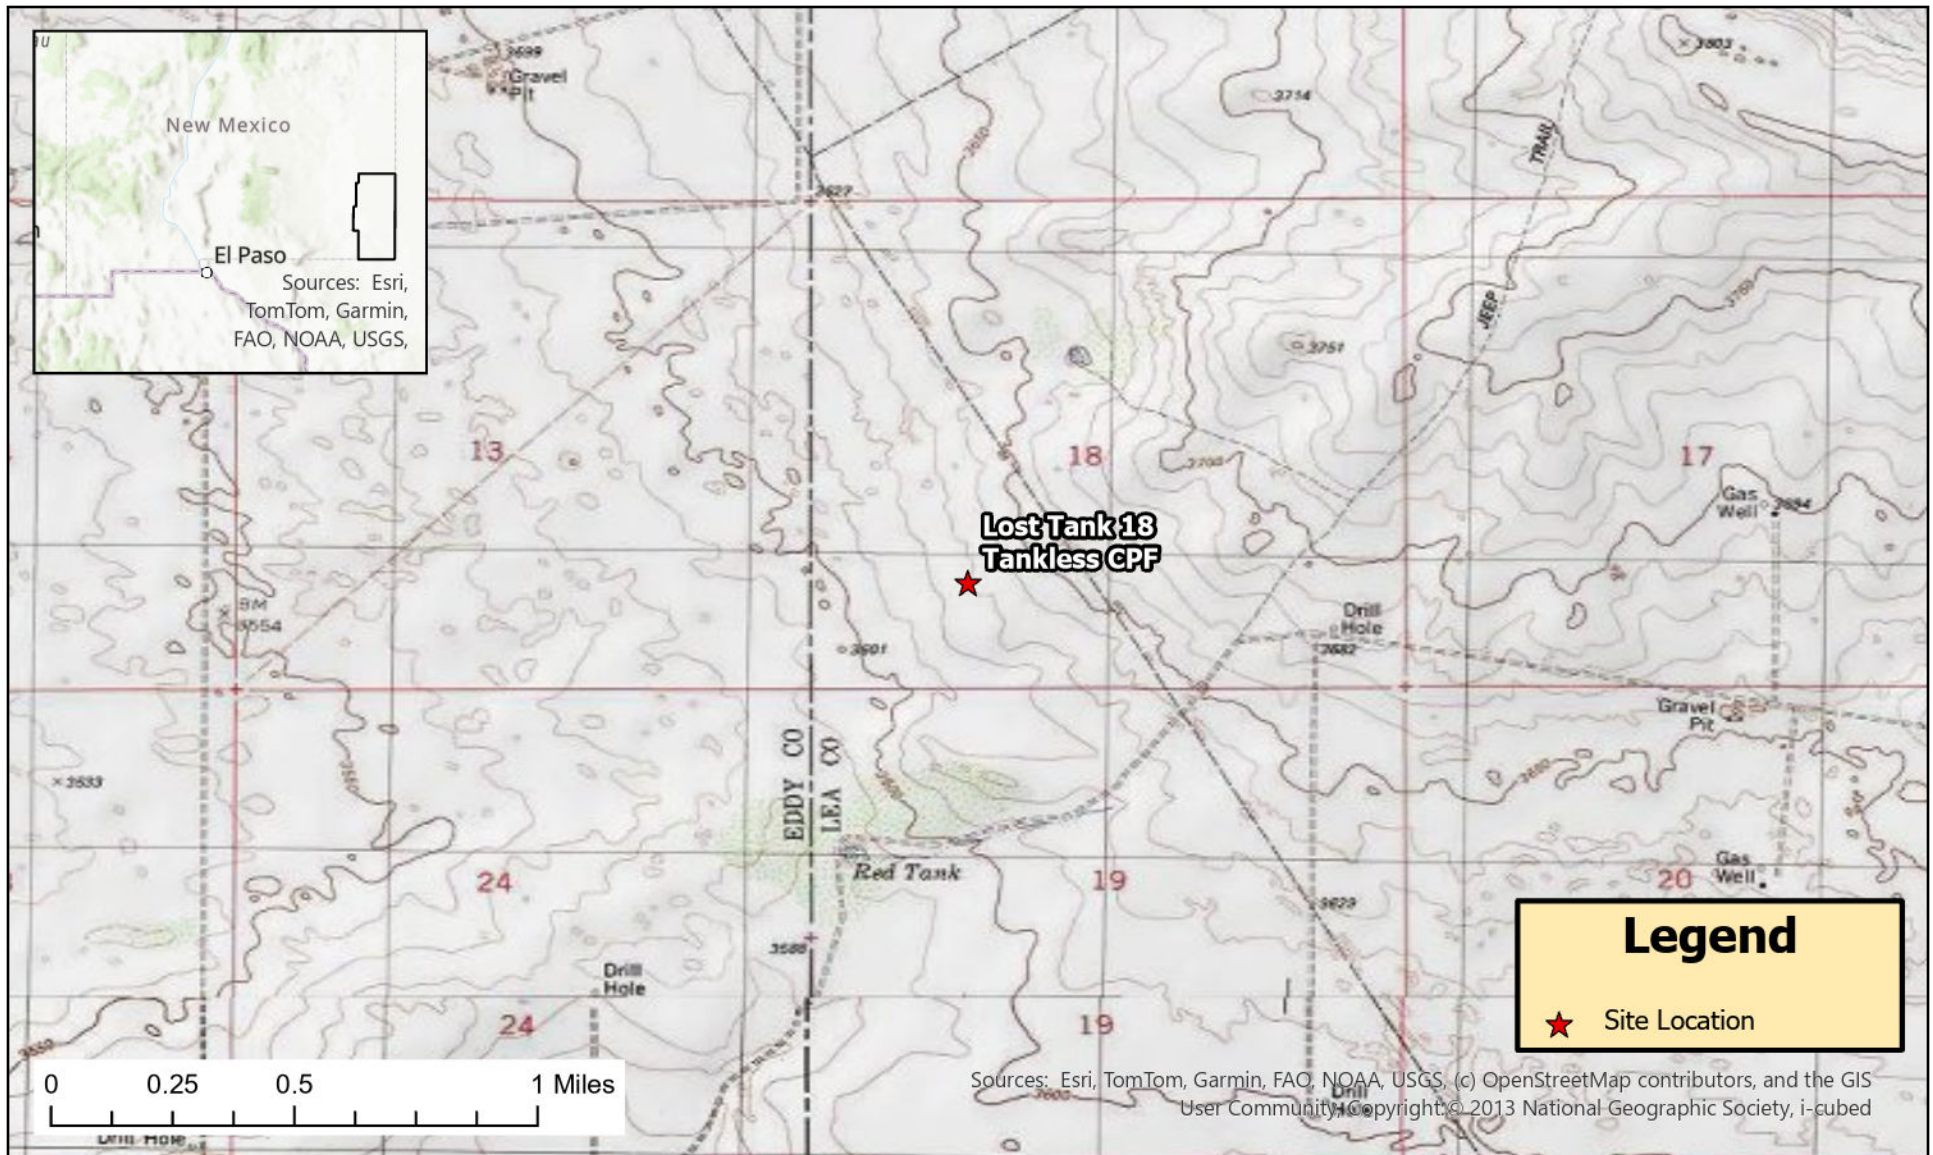

	LOST TANK 18 TANKLESS CPF		
	OXY USA INC		
	Figure 2. (Topographic Map) Release Date: 06/17/2026 Lea County, New Mexico	08/26/2026	
	Coordinates: 32.38711,-103.71812		

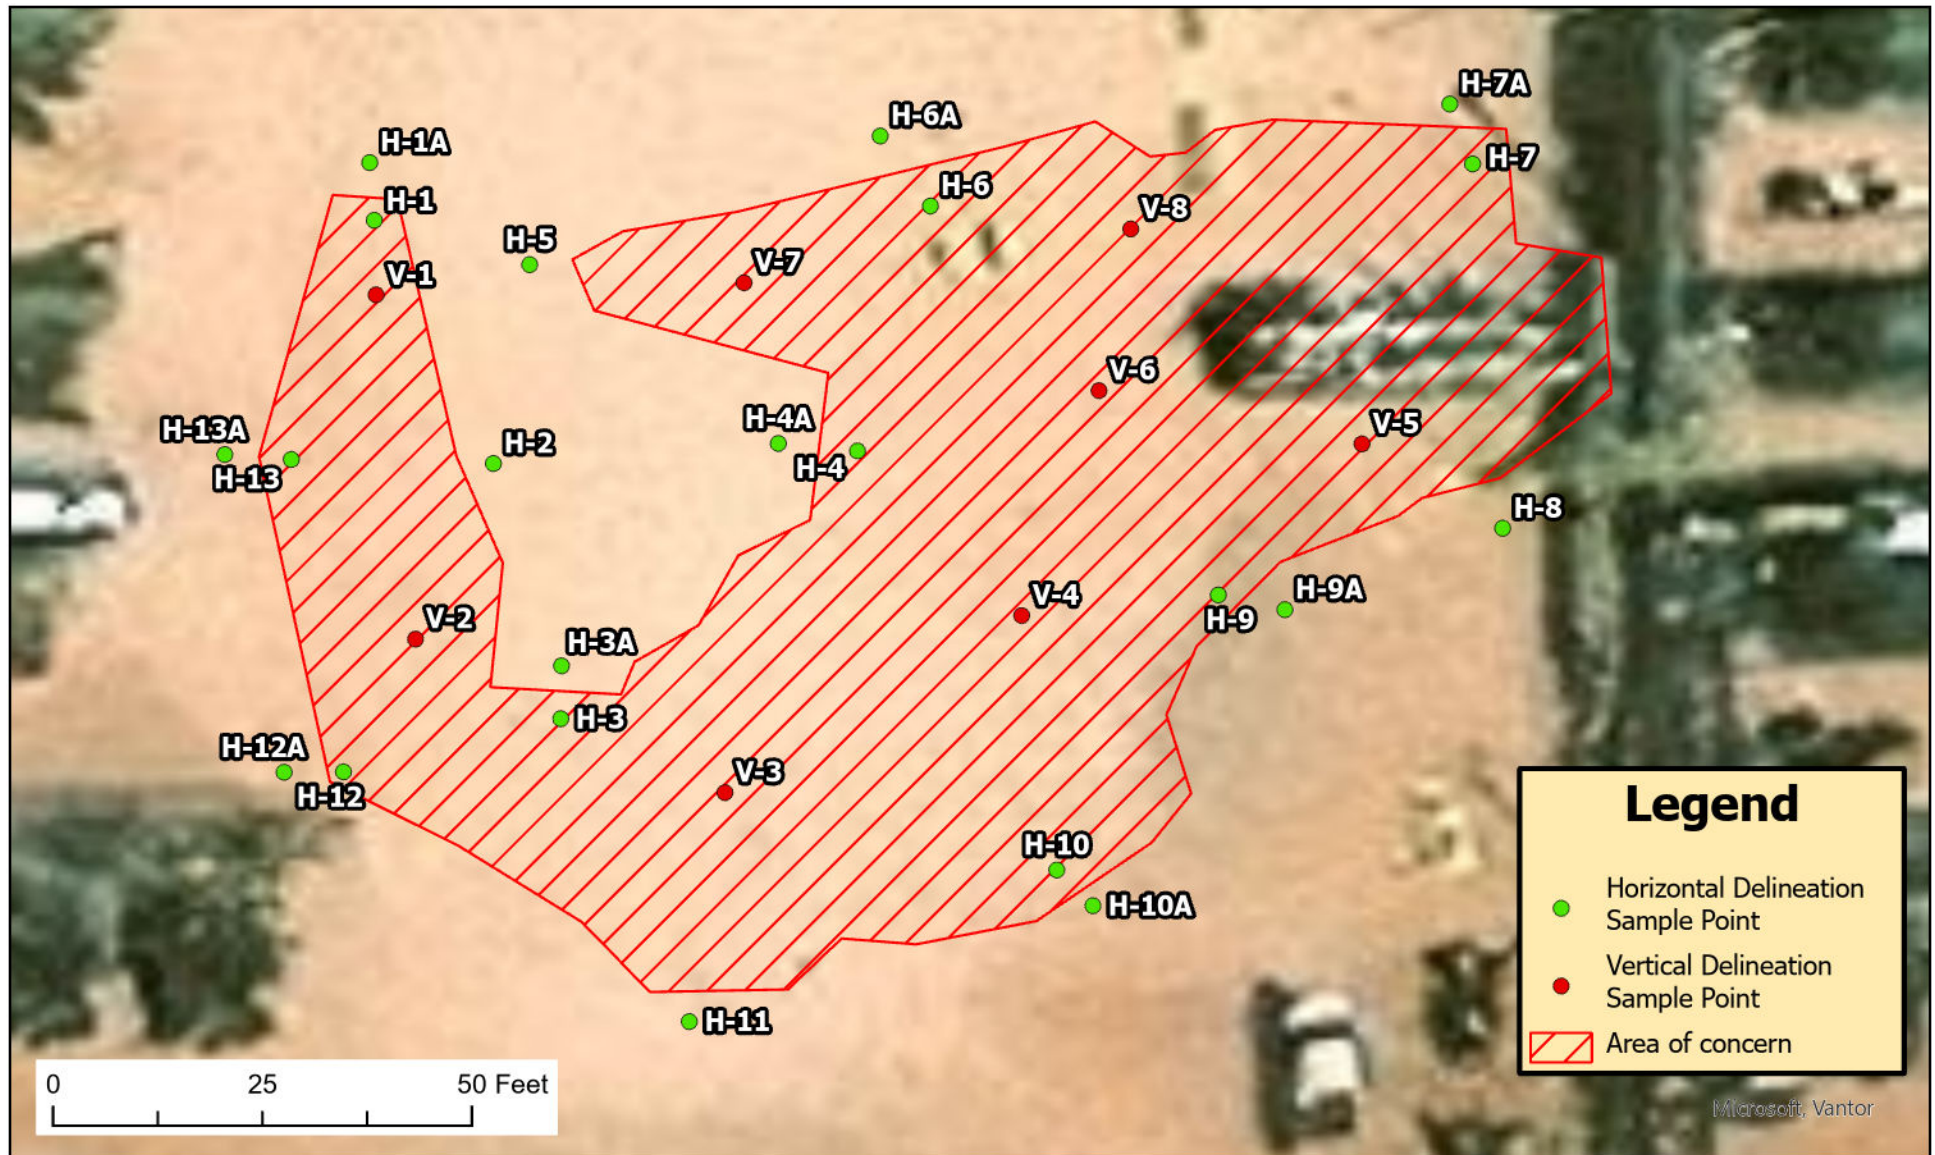

	LOST TANK 18 TANKLESS CPF		
	OXY USA INC		
	Figure 3. (Delineation Map) Release Date: 06/17/2026 Lea County, New Mexico	08/26/2026	
	Coordinates: 32.38711,-103.71812		

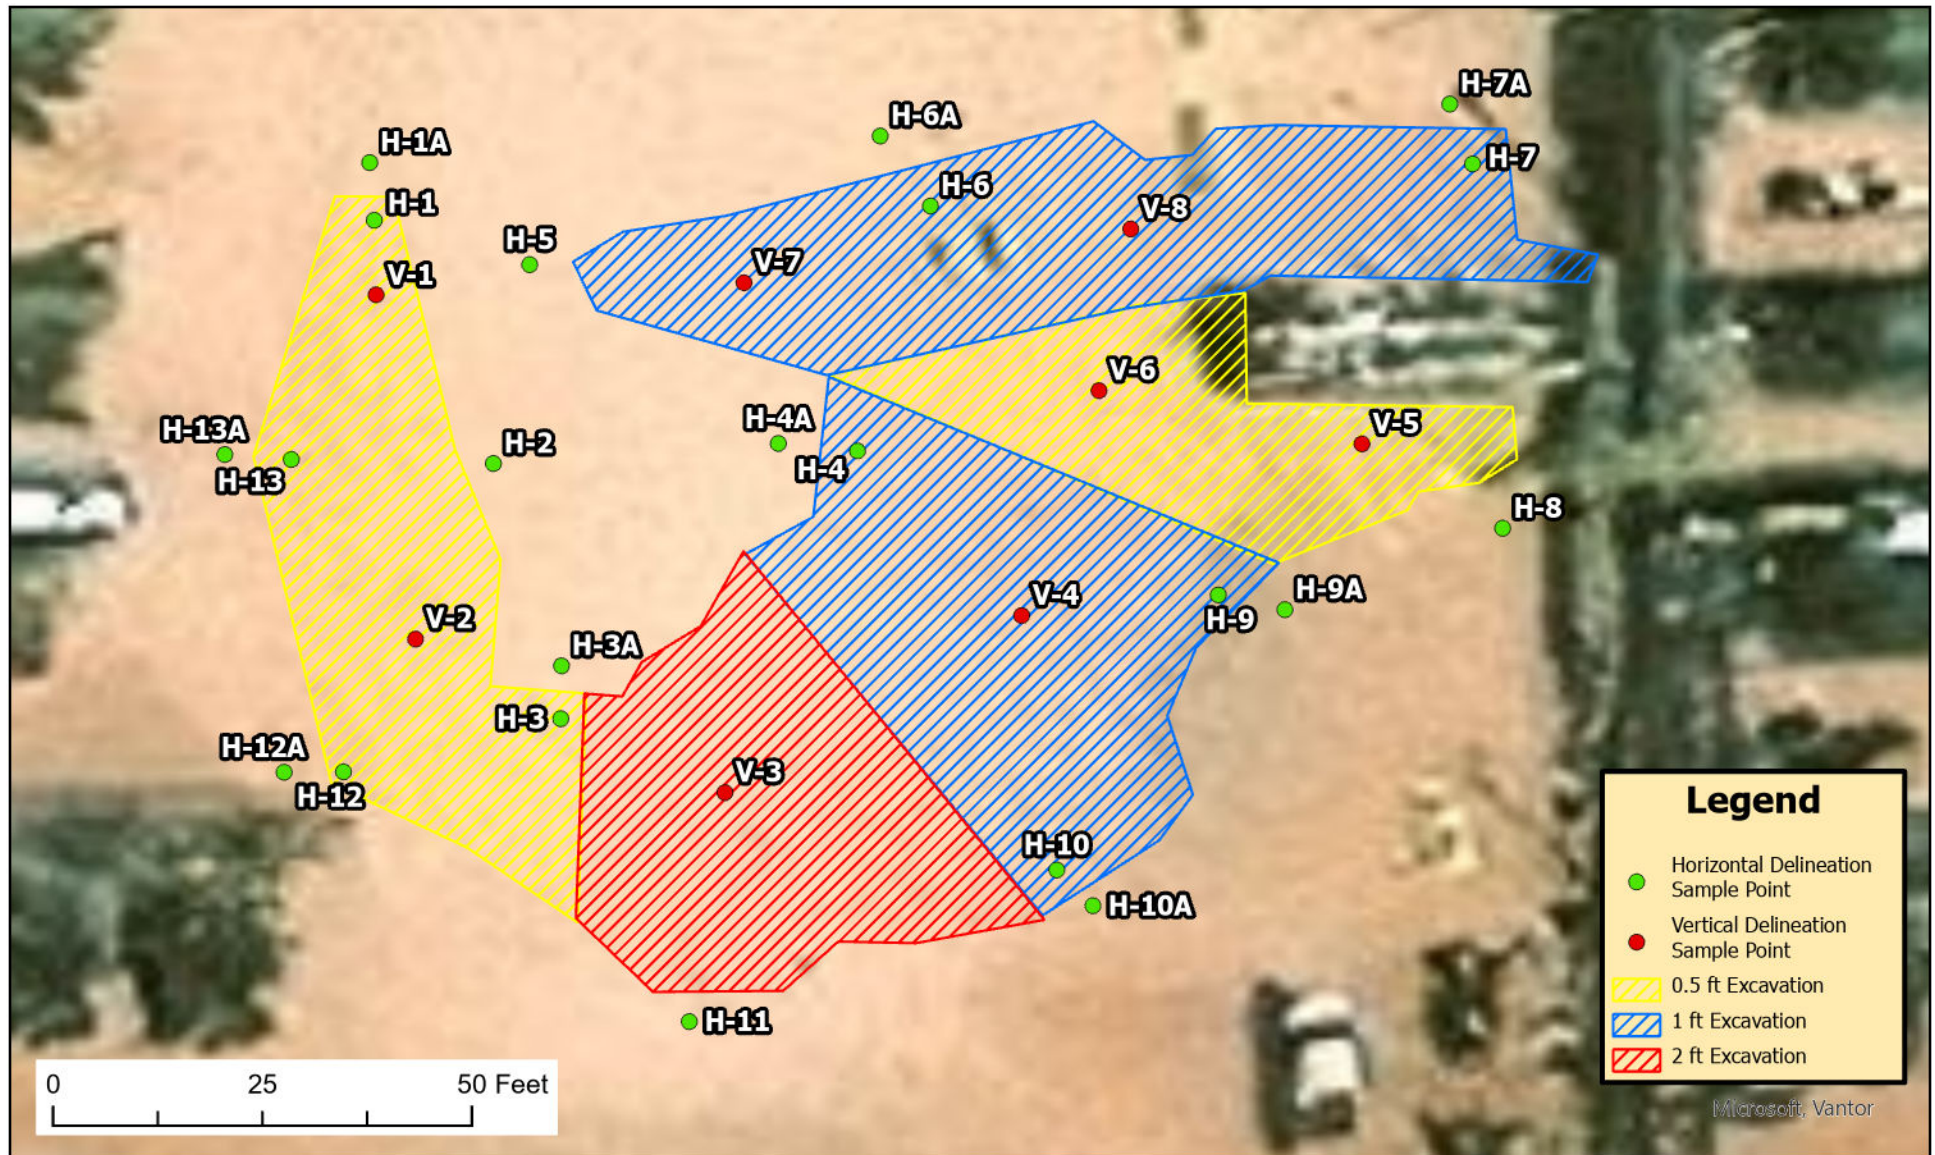

	LOST TANK 18 TANKLESS CPF		
	OXY USA INC		
	Figure 4. (Proposed Excavation Map) Release Date: 06/17/2026 Lea County, New Mexico	08/26/2026	
	Coordinates: 32.38711,-103.71812		

Proposed Excavation Map


OXY USA INC
Lost Tank 18 Tankless CPF
Lea County, New Mexico
32.38711,-103.71812

Area of Yellow: 2,511 sqft x 0.5ft ~ 47 CY
Area of Green: 3,500 sqft x 1ft ~ 130 CY
Area of Red: 1,415 sqft x 2 ~ 105 CY
Total Excavated Volume: 281 CY
Total Excavated Volume w/ 20% Fluff ~ 337 CY

sqft - Square Feet
CY - Cubic Yard(s)

Legend

-  0.5 ft Scrape
-  1 ft Excavation
-  2 ft Excavation
-  Horizontal Delineation Sample Point
-  Underground Gas Line
-  Vertical Delineation Sample Point

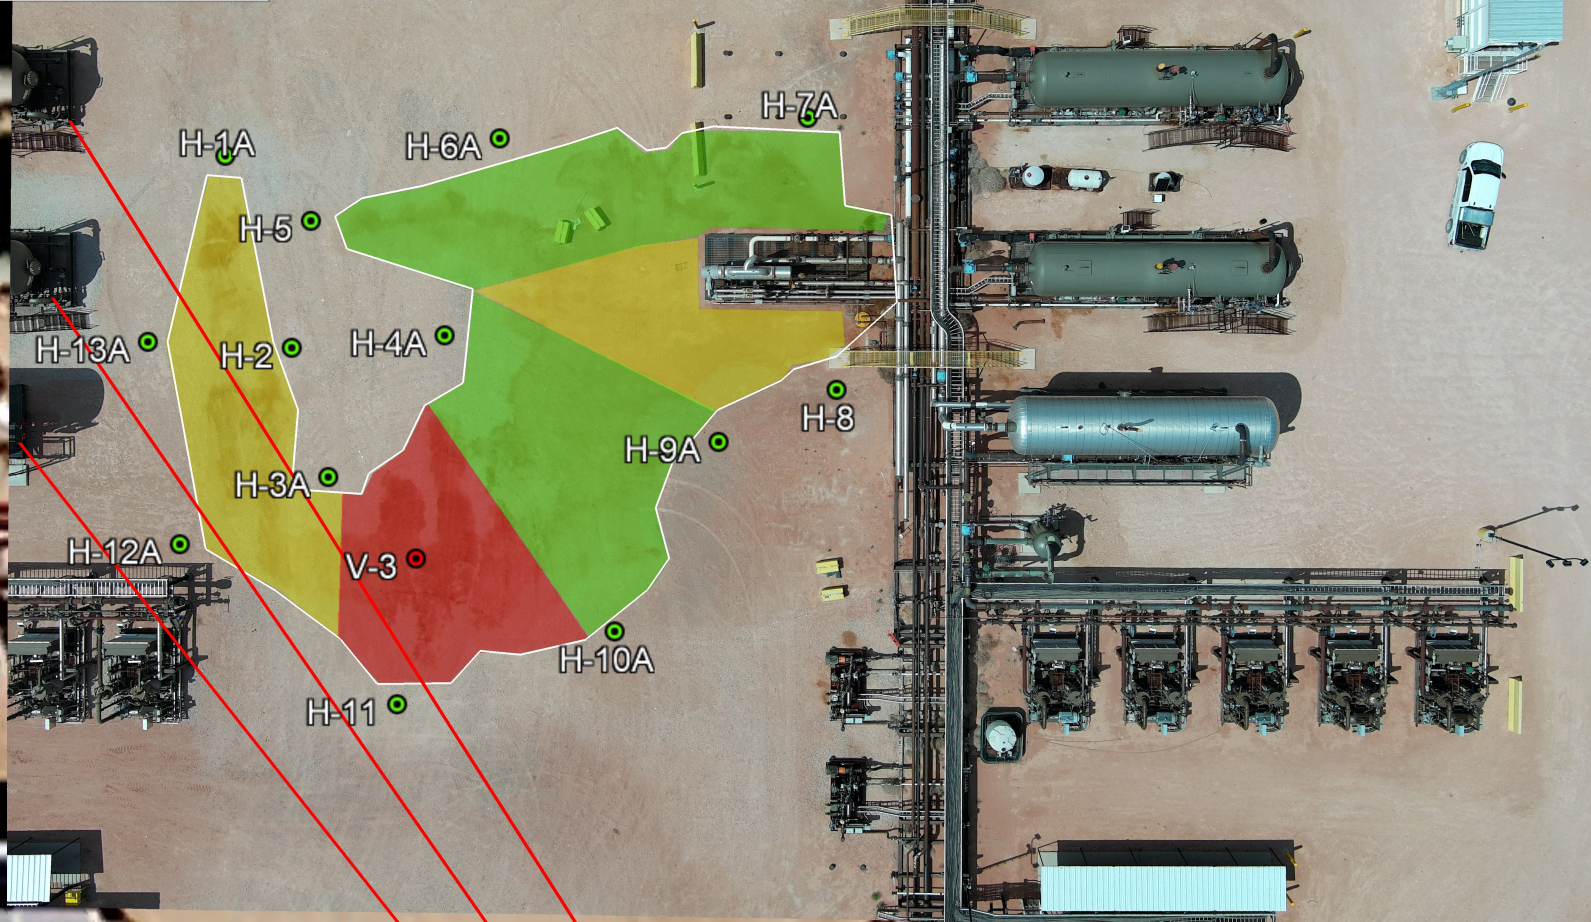

Standard Safety and Supply

<https://standardtx.com/>



ATTACHMENT C: SITE CHARACTERIZATION



OCD Well Locations



9/8/2025, 3:08:11 PM

- Wells - Large Scale
- Oil, New

● Oil, Active


● Oil, Cancelled

■ Karst Occurrence Potential

■ Low

▭ PLSS Second Division

▭ PLSS First Division

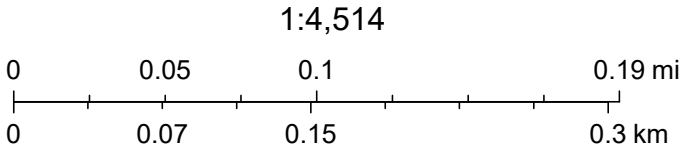

BLM, OCD, New Mexico Tech, OCD, Maxar, BLM

Legend

Basemap

Query

1:9,028

All Layers On/Off

All Layer Transparency

NM Wetlands Mapping and Classification

NM Wetlands Mapping and Classification

Mapping Status

Riparian Habitat

Hydrogeomorphic Mapping (HGM) Linears

Riverine

Hydrogeomorphic Mapping (HGM) Polygons

Depressional

Flats

Lacustrine Fringe

Riverine

Slope

Landscape Position and Water Body (LLWW) Linears

Lentic (LE)

Lotic Rİver (LR)

Lotic Stream (LS)

Pond (PD)

River (RV)

Stream (ST)

Terrene (TE)

Landscape Position and Water Body (LLWW) Polygons

Lentic (LE)

Lake (LK)

Lotic River (LR)

Lotic Stream (LS)

Pond (PD)

River (RV)

Stream (ST)

Terrene (TE)

Landform (LLWW)

Basin

Flat


Floodplain

The figure is an aerial map of a landscape, likely a wetland area, showing various features such as water bodies, roads, and buildings. A legend on the left side of the map provides a key for the symbols used. The legend is organized into sections: 'Legend' (with 'Basemap' and 'Query' tabs), 'NM Wetlands Mapping and Classification', 'Mapping Status', 'Hydrogeomorphic Mapping (HGM) Linears', 'Hydrogeomorphic Mapping (HGM) Polygons', 'Landscape Position and Water Body (LLWW) Linears', 'Landscape Position and Water Body (LLWW) Polygons', and 'Landform (LLWW)'. The 'NM Wetlands Mapping and Classification' section includes a checkbox for 'All Layers On/Off' and a slider for 'All Layer Transparency'. The 'Mapping Status' section includes a checkbox for 'Riparian Habitat'. The 'Hydrogeomorphic Mapping (HGM) Linears' section includes a checkbox for 'Riverine'. The 'Hydrogeomorphic Mapping (HGM) Polygons' section includes checkboxes for 'Depressional', 'Flats', 'Lacustrine Fringe', 'Riverine', and 'Slope'. The 'Landscape Position and Water Body (LLWW) Linears' section includes checkboxes for 'Lentic (LE)', 'Lotic Rİver (LR)', 'Lotic Stream (LS)', 'Pond (PD)', 'River (RV)', 'Stream (ST)', and 'Terrene (TE)'. The 'Landscape Position and Water Body (LLWW) Polygons' section includes checkboxes for 'Lentic (LE)', 'Lake (LK)', 'Lotic River (LR)', 'Lotic Stream (LS)', 'Pond (PD)', 'River (RV)', 'Stream (ST)', and 'Terrene (TE)'. The 'Landform (LLWW)' section includes checkboxes for 'Basin', 'Flat', and 'Floodplain'. A scale bar at the bottom right indicates a length of 2,580.87 ft and a scale of 1:9,028. A coordinate box at the bottom left shows 'Lon: -103.7166°' and 'Lat: 32.3868°'. A scale bar at the bottom right shows '0 300 600ft'. A text box at the bottom right says 'New Mexico Environment Departmer'. A text box at the bottom right says 'Click to add a point'.

Released to Imaging: 9/4/2026 3:21:34 PM

1/1

OSE POD Locations Map

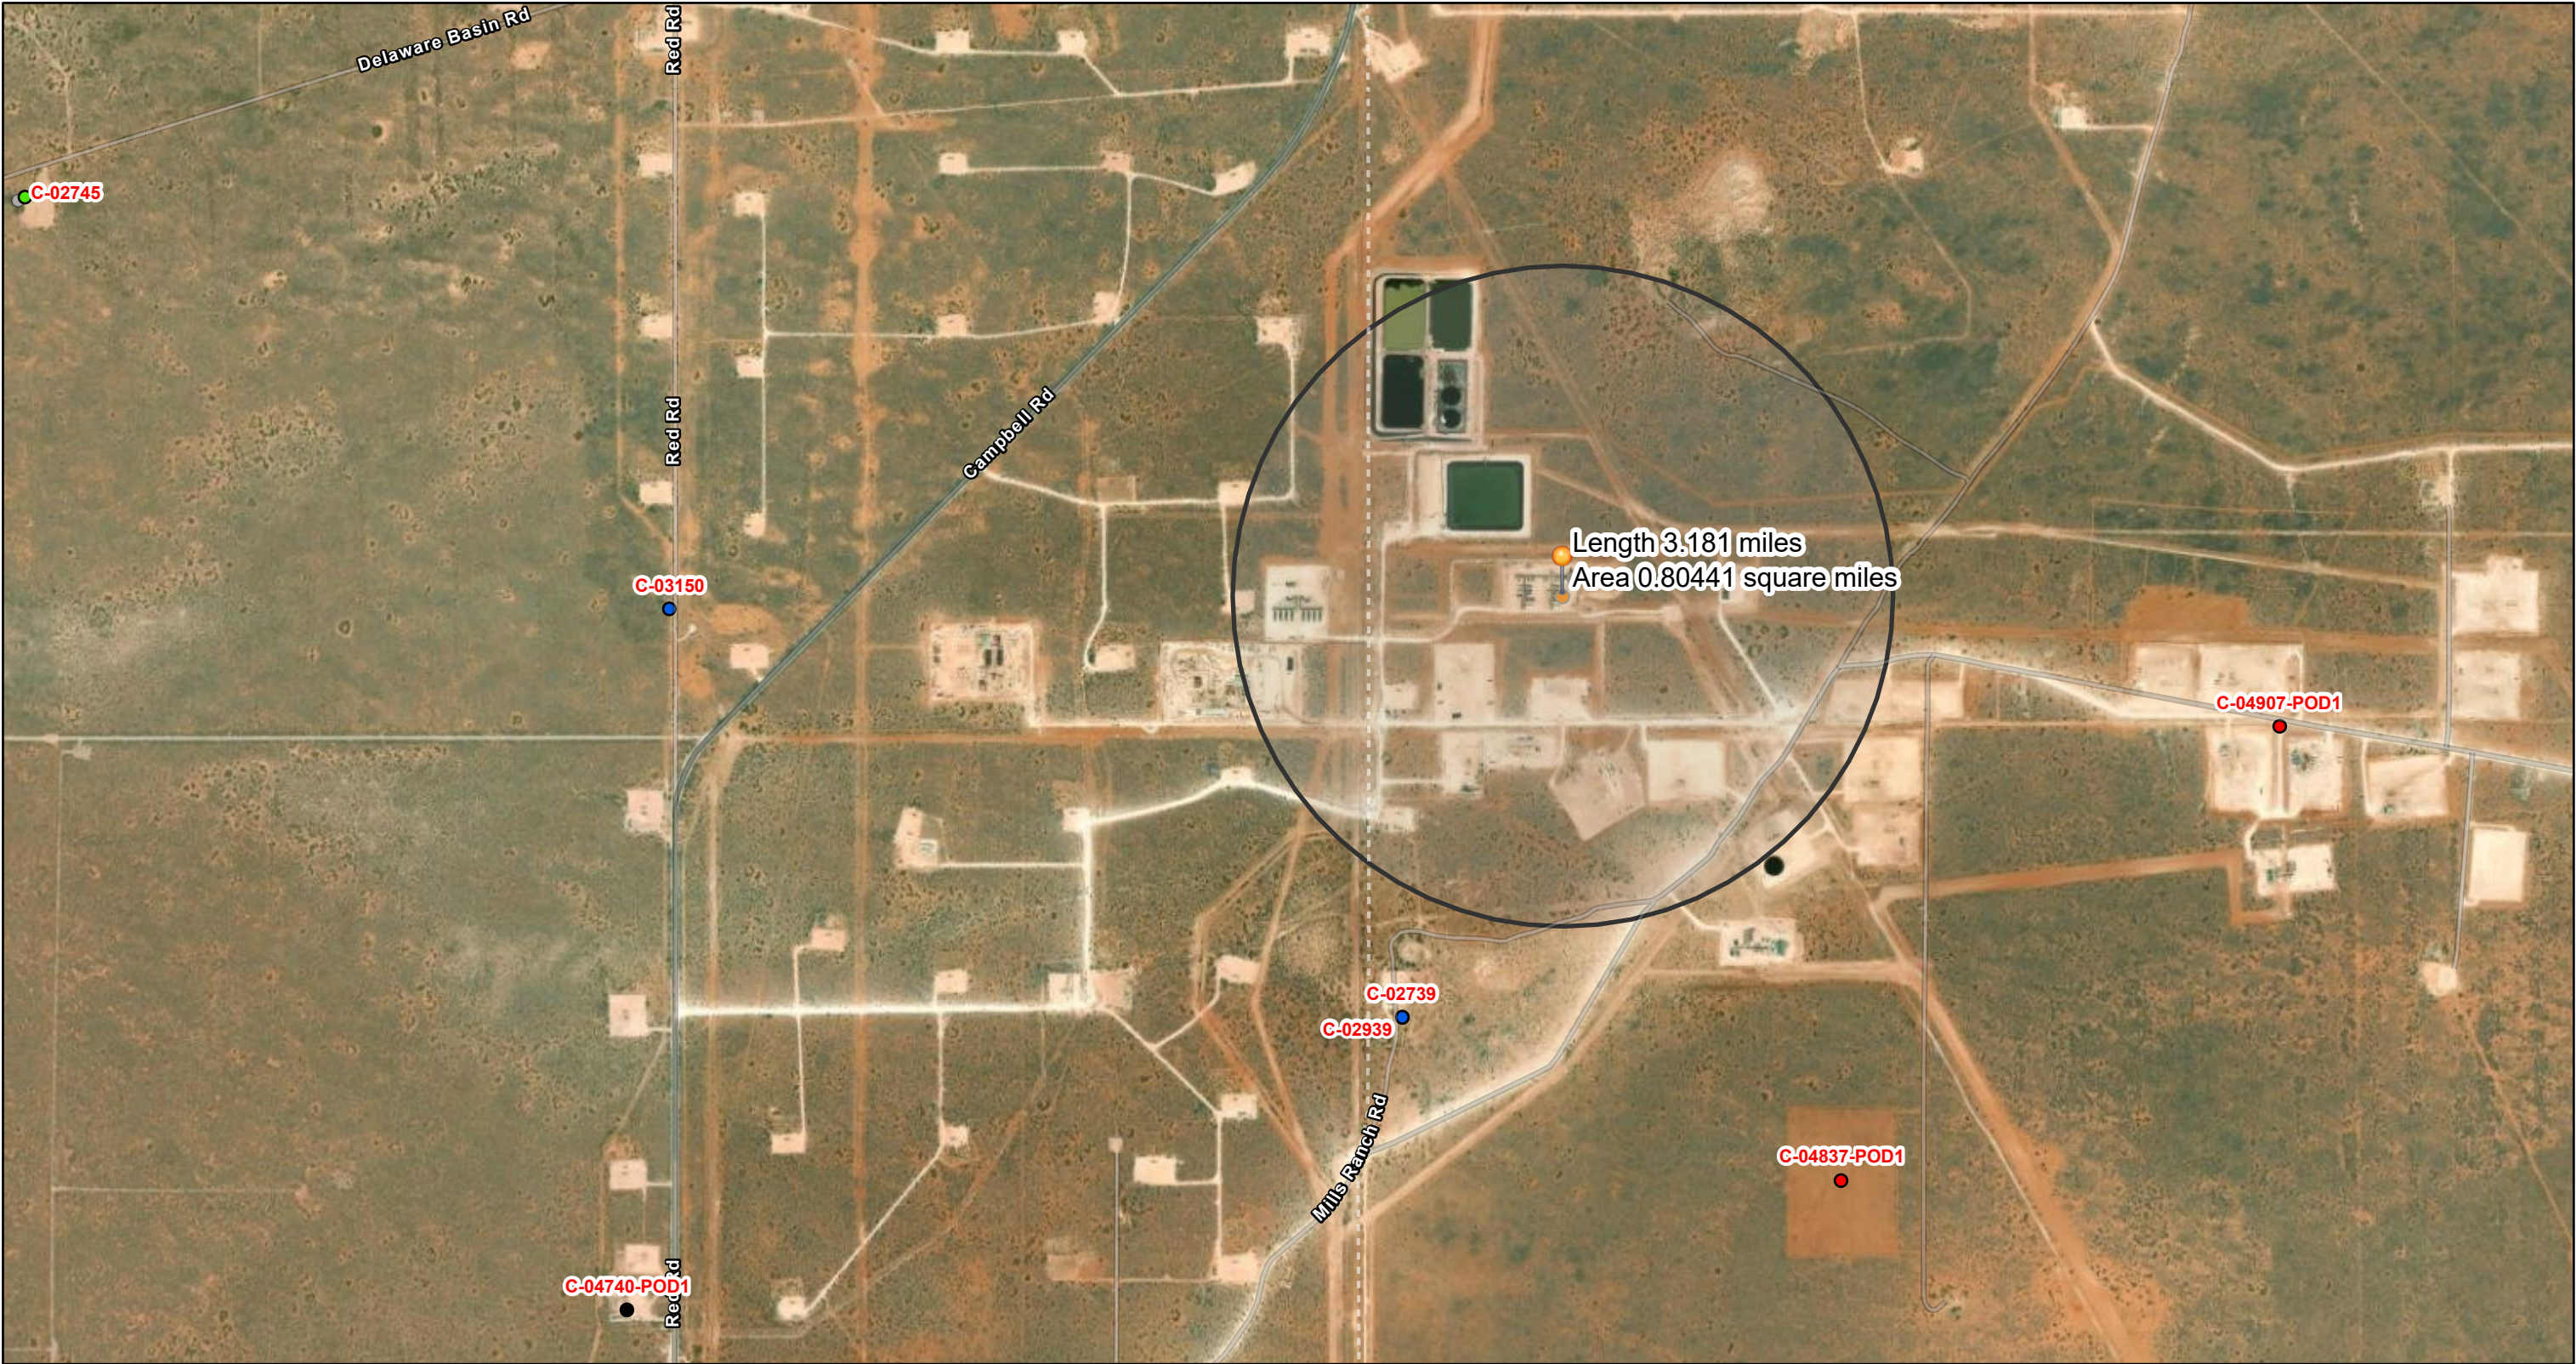

9/8/2025, 3:09:13 PM

GIS WATERS PODs

- Active
- Pending
- Inactive



Plugged



World Imagery

Low Resolution 15m Imagery


High Resolution 60cm Imagery

High Resolution 30cm Imagery

Citations

4.8m Resolution Metadata

1:18,815




Sources: Esri, TomTom, Garmin, FAO, NOAA, USGS, (c) OpenStreetMap contributors, and the GIS User Community, Maxar

Groundwater Bore Location

Lost Tank 18 Tankless CPF
nAPP2524524222

Legend

-  0.5-mile Radius
-  Lost Tank 18 Tankless CPF
-  SB-09

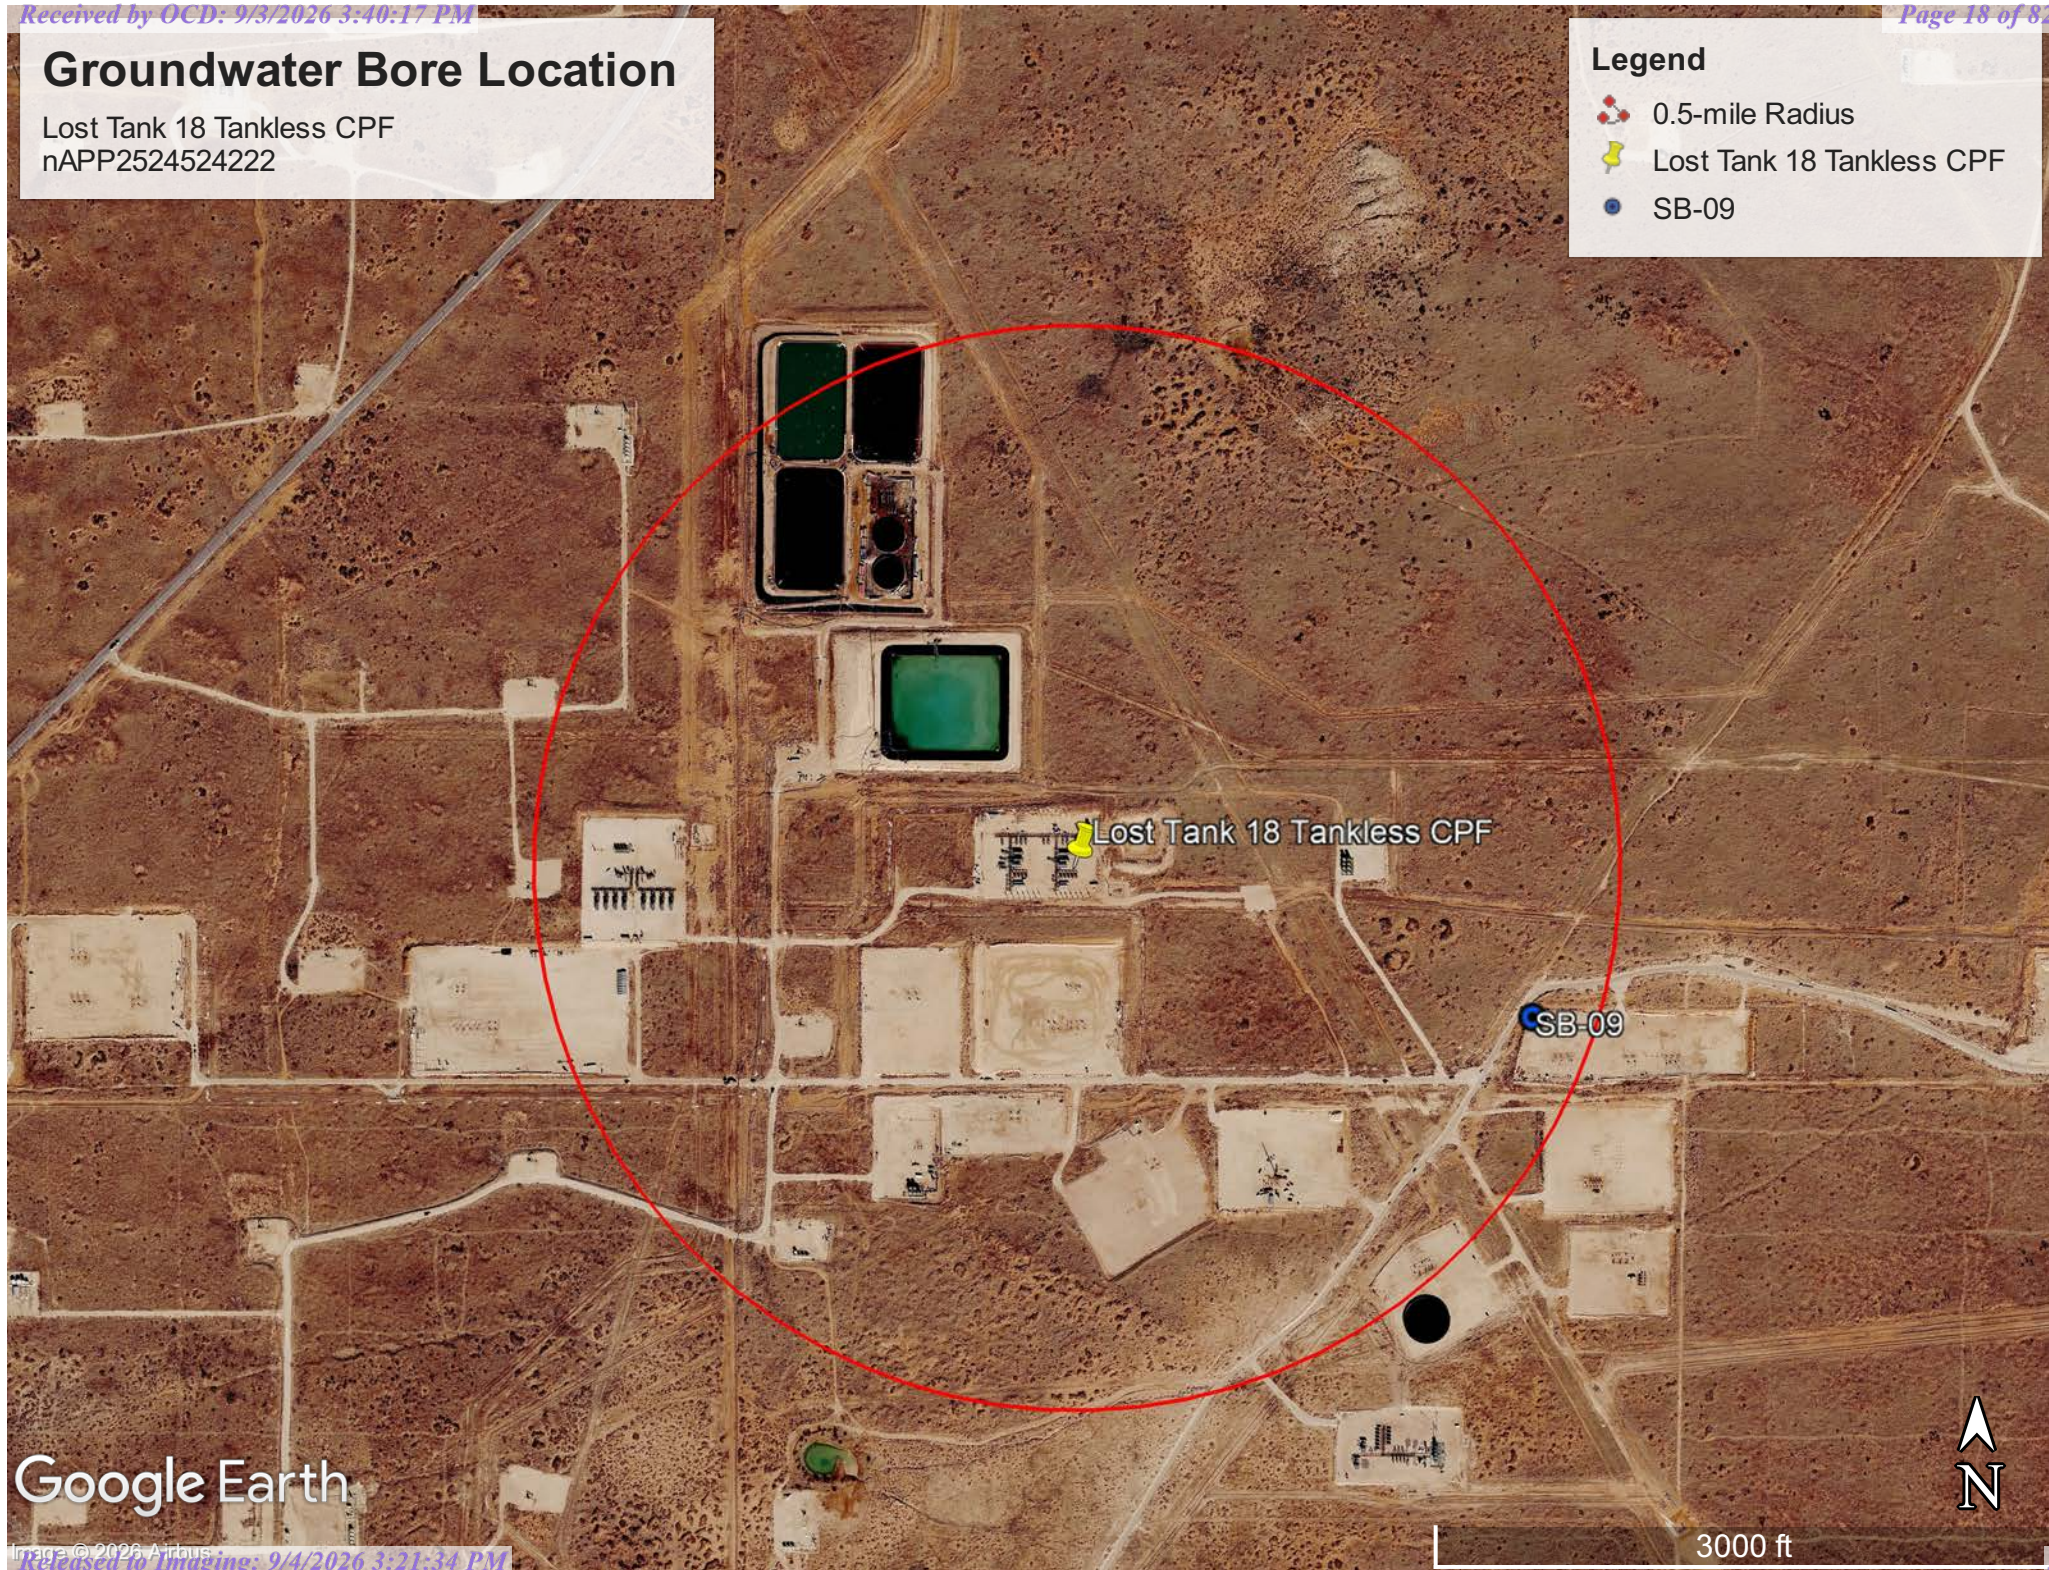

Google Earth



SOIL BORE LOG SB-09

PROJECT NAME DR. PI FEDERAL UNIT 17 8 DA #31H CLIENT OXY USA, Inc.	DRILLING DATE 11/15/2022 TOTAL DEPTH 110'	COORDINATES 32.38531930, -103.71040340 COORD SYS NAD 83 ULSTR O-18-22S-32E SURFACE ELEVATION 3670'
--	--	---

COMMENTS Spud on the Northwest corner of the DR PI FEDERAL UNIT 18 7 IPP Well Pad. Bore Hole was observed to be dry after 72 hrs.

LOGGED BY CJ
CHECKED BY DD

Depth (ft)	Moisture	Material Description	Elevation (ft)
5	D	Reddish Yellow Sandy Clay Loam. Dry	
10		Yellowish Red Sandy Clay Loam. Dry	3665
15			3660
20		Red Sandy Clay Loam. Dry	3655
25			3650
30		Red Sandy Clay. Dry	3645
35			3640
40		Reddish Brown Sandy Clay Loam. Dry	3635
45		Red Sandy Clay. Dry	3630
50			3625
55		Red Sandy Clay Loam. Dry	3620
60			3615
65		Reddish Brown Sandy Clay. Dry	3610
70			3605
75			3600
80			3595
85			3590
90		Red Clay. Dry	3585
95			3580
100			3575
105			3570
110			3565
115		Termination Depth at: 110 ft.	3560
			3555

Disclaimer This bore log is intended to evidence a depth to groundwater greater than 110'.

Page 1 of 1

National Flood Hazard Layer FIRMette



103°43'22"W 32°23'30"N



1:6,000

103°42'45"W 32°22'59"N

Legend

SEE FIS REPORT FOR DETAILED LEGEND AND INDEX MAP FOR FIRM PANEL LAYOUT

SPECIAL FLOOD HAZARD AREAS		Without Base Flood Elevation (BFE) Zone A, V, A99
		With BFE or Depth Zone AE, AO, AH, VE, AR
		Regulatory Floodway
OTHER AREAS OF FLOOD HAZARD		0.2% Annual Chance Flood Hazard, Areas of 1% annual chance flood with average depth less than one foot or with drainage areas of less than one square mile Zone X
		Future Conditions 1% Annual Chance Flood Hazard Zone X
		Area with Reduced Flood Risk due to Levee. See Notes. Zone X
		Area with Flood Risk due to Levee Zone D
OTHER AREAS		NO SCREEN Area of Minimal Flood Hazard Zone X
		Effective LOMRs
		Area of Undetermined Flood Hazard Zone D
GENERAL STRUCTURES		Channel, Culvert, or Storm Sewer
		Levee, Dike, or Floodwall
OTHER FEATURES		20.2 Cross Sections with 1% Annual Chance Water Surface Elevation
		17.5 Cross Sections with 1% Annual Chance Water Surface Elevation
		Coastal Transect
		Base Flood Elevation Line (BFE)
		Limit of Study
		Jurisdiction Boundary
		Coastal Transect Baseline
MAP PANELS		Digital Data Available
		No Digital Data Available
		Unmapped



The pin displayed on the map is an approximate point selected by the user and does not represent an authoritative property location.

This map complies with FEMA's standards for the use of digital flood maps if it is not void as described below. The basemap shown complies with FEMA's basemap accuracy standards

The flood hazard information is derived directly from the authoritative NFHL web services provided by FEMA. This map was exported on 9/8/2025 at 9:08 PM and does not reflect changes or amendments subsequent to this date and time. The NFHL and effective information may change or become superseded by new data over time.

This map image is void if the one or more of the following map elements do not appear: basemap imagery, flood zone labels, legend, scale bar, map creation date, community identifiers, FIRM panel number, and FIRM effective date. Map images for unmapped and unmodernized areas cannot be used for regulatory purposes.



U.S. Fish and Wildlife Service

National Wetlands Inventory

Lost Tank 18 Tankless CPF



September 8, 2025

Wetlands

-  Estuarine and Marine Deepwater
-  Estuarine and Marine Wetland

-  Freshwater Emergent Wetland
-  Freshwater Forested/Shrub Wetland
-  Freshwater Pond

-  Lake
-  Other
-  Riverine

This map is for general reference only. The US Fish and Wildlife Service is not responsible for the accuracy or currentness of the base data shown on this map. All wetlands related data should be used in accordance with the layer metadata found on the Wetlands Mapper web site.

Standard Safety and Supply

<https://standardtx.com/>



ATTACHMENT D: PHOTOGRAPHIC DOCUMENTATION



Photographic Log



Aerial view of area of concern



View of area of concern



Photographic Log



View of area of concern



View of area of concern



Standard Safety and Supply

<https://standardtx.com/>



ATTACHMENT E: LABORATORY ANALYTICAL METHOD WITH CHAIN- OF-CUSTODY





PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

August 06, 2026

ETHAN SESSUMS

STANDARD SAFETY & SUPPLY

PO BOX 14987

ODESSA, TX 79764

RE: LOST TANK 18 TANKLESS CPF (8/31/2025)

Enclosed are the results of analyses for samples received by the laboratory on 07/31/26 14:16.

Cardinal Laboratories is accredited through Texas NELAP under certificate number TX-C26-00106. Accreditation applies to drinking water, non-potable water and solid and chemical materials. All accredited analytes are denoted by an asterisk (*). For a complete list of accredited analytes and matrices visit the TCEQ website at www.tceq.texas.gov/field/qa/lab_accred_certif.html.

Cardinal Laboratories is accredited through the State of Colorado Department of Public Health and Environment for:

Method EPA 552.2	Haloacetic Acids (HAA-5)
Method EPA 524.2	Total Trihalomethanes (TTHM)
Method EPA 524.4	Regulated VOCs (V1, V2, V3)

Accreditation applies to public drinking water matrices.

This report meets NELAP requirements and is made up of a cover page, analytical results, and a copy of the original chain-of-custody. If you have any questions concerning this report, please feel free to contact me.

Sincerely,

A handwritten signature in black ink that reads "Celey D. Keene". The signature is written in a cursive style with a large, stylized 'C' and 'K'.

Celey D. Keene

Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

STANDARD SAFETY & SUPPLY
 ETHAN SESSUMS
 PO BOX 14987
 ODESSA TX, 79764
 Fax To: NA

Received:	07/31/2026	Sampling Date:	07/31/2026
Reported:	08/06/2026	Sampling Type:	Soil
Project Name:	LOST TANK 18 TANKLESS CPF (8/31/202	Sampling Condition:	Cool & Intact
Project Number:	NONE GIVEN	Sample Received By:	Shalyn Rodriguez
Project Location:	OXY-LEA COUNTY, NEW MEXICO		

Sample ID: V-1 0-6" (H264383-01)

BTX 8021B		mg/kg		Analyzed By: JH					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Benzene*	<0.050	0.050	08/05/2026	ND	2.10	105	2.00	1.16	
Toluene*	<0.050	0.050	08/05/2026	ND	2.13	106	2.00	1.10	
Ethylbenzene*	<0.050	0.050	08/05/2026	ND	2.16	108	2.00	0.371	
Total Xylenes*	<0.150	0.150	08/05/2026	ND	6.63	110	6.00	0.590	
Total BTX	<0.300	0.300	08/05/2026	ND					

Surrogate: 4-Bromofluorobenzene (PID) 116 % 70.7-129

Chloride, SM4500Cl-B		mg/kg		Analyzed By: KH					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Chloride	64.0	16.0	08/05/2026	ND	432	108	400	3.64	

TPH 8015M		mg/kg		Analyzed By: JF					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	<10.0	10.0	08/05/2026	ND	205	102	200	0.594	
DRO >C10-C28*	<10.0	10.0	08/05/2026	ND	215	107	200	2.29	
EXT DRO >C28-C36	<10.0	10.0	08/05/2026	ND					

Surrogate: 1-Chlorooctane 75.1 % 48-117

Surrogate: 1-Chlorooctadecane 74.0 % 39-120

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

STANDARD SAFETY & SUPPLY
 ETHAN SESSUMS
 PO BOX 14987
 ODESSA TX, 79764
 Fax To: NA

Received: 07/31/2026
 Reported: 08/06/2026
 Project Name: LOST TANK 18 TANKLESS CPF (8/31/202
 Project Number: NONE GIVEN
 Project Location: OXY-LEA COUNTY, NEW MEXICO

Sampling Date: 07/31/2026
 Sampling Type: Soil
 Sampling Condition: Cool & Intact
 Sample Received By: Shalyn Rodriguez

Sample ID: V-1 1-1.5' (H264383-02)

BTX 8021B		mg/kg		Analyzed By: JH					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Benzene*	<0.050	0.050	08/06/2026	ND	2.10	105	2.00	1.16	
Toluene*	<0.050	0.050	08/06/2026	ND	2.13	106	2.00	1.10	
Ethylbenzene*	<0.050	0.050	08/06/2026	ND	2.16	108	2.00	0.371	
Total Xylenes*	<0.150	0.150	08/06/2026	ND	6.63	110	6.00	0.590	
Total BTX	<0.300	0.300	08/06/2026	ND					

Surrogate: 4-Bromofluorobenzene (PID) 110 % 70.7-129

Chloride, SM4500CI-B		mg/kg		Analyzed By: KH					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Chloride	16.0	16.0	08/05/2026	ND	432	108	400	3.64	

TPH 8015M		mg/kg		Analyzed By: JF					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	<10.0	10.0	08/05/2026	ND	205	102	200	0.594	
DRO >C10-C28*	<10.0	10.0	08/05/2026	ND	215	107	200	2.29	
EXT DRO >C28-C36	<10.0	10.0	08/05/2026	ND					

Surrogate: 1-Chlorooctane 94.6 % 48-117

Surrogate: 1-Chlorooctadecane 95.0 % 39-120

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

STANDARD SAFETY & SUPPLY
 ETHAN SESSUMS
 PO BOX 14987
 ODESSA TX, 79764
 Fax To: NA

Received: 07/31/2026
 Reported: 08/06/2026
 Project Name: LOST TANK 18 TANKLESS CPF (8/31/202
 Project Number: NONE GIVEN
 Project Location: OXY-LEA COUNTY, NEW MEXICO

Sampling Date: 07/31/2026
 Sampling Type: Soil
 Sampling Condition: Cool & Intact
 Sample Received By: Shalyn Rodriguez

Sample ID: V-2 0-6" (H264383-03)

BTEx 8021B		mg/kg		Analyzed By: JH					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Benzene*	<0.050	0.050	08/06/2026	ND	2.10	105	2.00	1.16	
Toluene*	<0.050	0.050	08/06/2026	ND	2.13	106	2.00	1.10	
Ethylbenzene*	<0.050	0.050	08/06/2026	ND	2.16	108	2.00	0.371	
Total Xylenes*	<0.150	0.150	08/06/2026	ND	6.63	110	6.00	0.590	
Total BTEx	<0.300	0.300	08/06/2026	ND					

Surrogate: 4-Bromofluorobenzene (PID) 116 % 70.7-129

Chloride, SM4500CI-B		mg/kg		Analyzed By: KH					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Chloride	32.0	16.0	08/05/2026	ND	432	108	400	3.64	

TPH 8015M		mg/kg		Analyzed By: JF					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	<10.0	10.0	08/05/2026	ND	205	102	200	0.594	
DRO >C10-C28*	<10.0	10.0	08/05/2026	ND	215	107	200	2.29	
EXT DRO >C28-C36	<10.0	10.0	08/05/2026	ND					

Surrogate: 1-Chlorooctane 92.3 % 48-117

Surrogate: 1-Chlorooctadecane 91.9 % 39-120

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

STANDARD SAFETY & SUPPLY
 ETHAN SESSUMS
 PO BOX 14987
 ODESSA TX, 79764
 Fax To: NA

Received: 07/31/2026
 Reported: 08/06/2026
 Project Name: LOST TANK 18 TANKLESS CPF (8/31/202
 Project Number: NONE GIVEN
 Project Location: OXY-LEA COUNTY, NEW MEXICO

Sampling Date: 07/31/2026
 Sampling Type: Soil
 Sampling Condition: Cool & Intact
 Sample Received By: Shalyn Rodriguez

Sample ID: V-2 1-1.5' (H264383-04)

BTEx 8021B		mg/kg		Analyzed By: JH						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Benzene*	<0.050	0.050	08/06/2026	ND	2.10	105	2.00	1.16		
Toluene*	<0.050	0.050	08/06/2026	ND	2.13	106	2.00	1.10		
Ethylbenzene*	<0.050	0.050	08/06/2026	ND	2.16	108	2.00	0.371		
Total Xylenes*	<0.150	0.150	08/06/2026	ND	6.63	110	6.00	0.590		
Total BTEx	<0.300	0.300	08/06/2026	ND						

Surrogate: 4-Bromofluorobenzene (PID) 114 % 70.7-129

Chloride, SM4500Cl-B		mg/kg		Analyzed By: KH						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Chloride	32.0	16.0	08/05/2026	ND	432	108	400	3.64		

TPH 8015M		mg/kg		Analyzed By: JF					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	<10.0	10.0	08/05/2026	ND	205	102	200	0.594	
DRO >C10-C28*	<10.0	10.0	08/05/2026	ND	215	107	200	2.29	
EXT DRO >C28-C36	<10.0	10.0	08/05/2026	ND					

Surrogate: 1-Chlorooctane 93.8 % 48-117

Surrogate: 1-Chlorooctadecane 93.9 % 39-120

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

STANDARD SAFETY & SUPPLY
 ETHAN SESSUMS
 PO BOX 14987
 ODESSA TX, 79764
 Fax To: NA

Received:	07/31/2026	Sampling Date:	07/31/2026
Reported:	08/06/2026	Sampling Type:	Soil
Project Name:	LOST TANK 18 TANKLESS CPF (8/31/202	Sampling Condition:	Cool & Intact
Project Number:	NONE GIVEN	Sample Received By:	Shalyn Rodriguez
Project Location:	OXY-LEA COUNTY, NEW MEXICO		

Sample ID: V-3 0-6" (H264383-05)

BTEx 8021B		mg/kg		Analyzed By: JH				S-04	
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Benzene*	<0.050	0.050	08/06/2026	ND	2.10	105	2.00	1.16	
Toluene*	<0.050	0.050	08/06/2026	ND	2.13	106	2.00	1.10	GC-NC
Ethylbenzene*	0.477	0.050	08/06/2026	ND	2.16	108	2.00	0.371	GC-NC1
Total Xylenes*	5.97	0.150	08/06/2026	ND	6.63	110	6.00	0.590	GC-NC1
Total BTEX	6.44	0.300	08/06/2026	ND					GC-NC1

Surrogate: 4-Bromofluorobenzene (PID) 144 % 70.7-129

Chloride, SM4500Cl-B		mg/kg		Analyzed By: KH					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Chloride	2360	16.0	08/05/2026	ND	432	108	400	3.64	

TPH 8015M		mg/kg		Analyzed By: JF				S-04	
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	562	10.0	08/05/2026	ND	205	102	200	0.594	
DRO >C10-C28*	9050	10.0	08/05/2026	ND	215	107	200	2.29	
EXT DRO >C28-C36	1310	10.0	08/05/2026	ND					

Surrogate: 1-Chlorooctane 230 % 48-117

Surrogate: 1-Chlorooctadecane 187 % 39-120

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

STANDARD SAFETY & SUPPLY
 ETHAN SESSUMS
 PO BOX 14987
 ODESSA TX, 79764
 Fax To: NA

Received:	07/31/2026	Sampling Date:	07/31/2026
Reported:	08/06/2026	Sampling Type:	Soil
Project Name:	LOST TANK 18 TANKLESS CPF (8/31/202	Sampling Condition:	Cool & Intact
Project Number:	NONE GIVEN	Sample Received By:	Shalyn Rodriguez
Project Location:	OXY-LEA COUNTY, NEW MEXICO		

Sample ID: V-3 1-1.5' (H264383-06)

BTEx 8021B		mg/kg		Analyzed By: JH						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Benzene*	<0.050	0.050	08/06/2026	ND	2.10	105	2.00	1.16		
Toluene*	<0.050	0.050	08/06/2026	ND	2.13	106	2.00	1.10		
Ethylbenzene*	<0.050	0.050	08/06/2026	ND	2.16	108	2.00	0.371		
Total Xylenes*	<0.150	0.150	08/06/2026	ND	6.63	110	6.00	0.590		
Total BTEX	<0.300	0.300	08/06/2026	ND						

Surrogate: 4-Bromofluorobenzene (PID) 120 % 70.7-129

Chloride, SM4500Cl-B		mg/kg		Analyzed By: KH						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Chloride	480	16.0	08/05/2026	ND	432	108	400	3.64		

TPH 8015M		mg/kg		Analyzed By: JF					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	35.0	10.0	08/05/2026	ND	205	102	200	0.594	
DRO >C10-C28*	1000	10.0	08/05/2026	ND	215	107	200	2.29	
EXT DRO >C28-C36	179	10.0	08/05/2026	ND					

Surrogate: 1-Chlorooctane 88.2 % 48-117

Surrogate: 1-Chlorooctadecane 103 % 39-120

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

STANDARD SAFETY & SUPPLY
 ETHAN SESSUMS
 PO BOX 14987
 ODESSA TX, 79764
 Fax To: NA

Received:	07/31/2026	Sampling Date:	07/31/2026
Reported:	08/06/2026	Sampling Type:	Soil
Project Name:	LOST TANK 18 TANKLESS CPF (8/31/202	Sampling Condition:	Cool & Intact
Project Number:	NONE GIVEN	Sample Received By:	Shalyn Rodriguez
Project Location:	OXY-LEA COUNTY, NEW MEXICO		

Sample ID: V-4 0-6" (H264383-07)

BTEx 8021B		mg/kg		Analyzed By: JH						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Benzene*	<0.050	0.050	08/06/2026	ND	2.10	105	2.00	1.16		
Toluene*	<0.050	0.050	08/06/2026	ND	2.13	106	2.00	1.10		
Ethylbenzene*	<0.050	0.050	08/06/2026	ND	2.16	108	2.00	0.371		
Total Xylenes*	<0.150	0.150	08/06/2026	ND	6.63	110	6.00	0.590		
Total BTEx	<0.300	0.300	08/06/2026	ND						

Surrogate: 4-Bromofluorobenzene (PID) 112 % 70.7-129

Chloride, SM4500CI-B		mg/kg		Analyzed By: KH						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Chloride	2850	16.0	08/05/2026	ND	432	108	400	3.64		

TPH 8015M		mg/kg		Analyzed By: JF				S-04	
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	<10.0	10.0	08/05/2026	ND	205	102	200	0.594	
DRO >C10-C28*	1480	10.0	08/05/2026	ND	215	107	200	2.29	
EXT DRO >C28-C36	376	10.0	08/05/2026	ND					

Surrogate: 1-Chlorooctane 88.3 % 48-117

Surrogate: 1-Chlorooctadecane 140 % 39-120

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

STANDARD SAFETY & SUPPLY
 ETHAN SESSUMS
 PO BOX 14987
 ODESSA TX, 79764
 Fax To: NA

Received:	07/31/2026	Sampling Date:	07/31/2026
Reported:	08/06/2026	Sampling Type:	Soil
Project Name:	LOST TANK 18 TANKLESS CPF (8/31/202	Sampling Condition:	Cool & Intact
Project Number:	NONE GIVEN	Sample Received By:	Shalyn Rodriguez
Project Location:	OXY-LEA COUNTY, NEW MEXICO		

Sample ID: V-4 1-1.5' (H264383-08)

BTX 8021B		mg/kg		Analyzed By: JH					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Benzene*	<0.050	0.050	08/06/2026	ND	2.10	105	2.00	1.16	
Toluene*	<0.050	0.050	08/06/2026	ND	2.13	106	2.00	1.10	
Ethylbenzene*	<0.050	0.050	08/06/2026	ND	2.16	108	2.00	0.371	
Total Xylenes*	<0.150	0.150	08/06/2026	ND	6.63	110	6.00	0.590	
Total BTX	<0.300	0.300	08/06/2026	ND					

Surrogate: 4-Bromofluorobenzene (PID) 109 % 70.7-129

Chloride, SM4500CI-B		mg/kg		Analyzed By: KH						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Chloride	48.0	16.0	08/05/2026	ND	432	108	400	3.64		

TPH 8015M		mg/kg		Analyzed By: JF					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	<10.0	10.0	08/06/2026	ND	205	102	200	0.594	
DRO >C10-C28*	<10.0	10.0	08/06/2026	ND	215	107	200	2.29	
EXT DRO >C28-C36	<10.0	10.0	08/06/2026	ND					

Surrogate: 1-Chlorooctane 101 % 48-117

Surrogate: 1-Chlorooctadecane 112 % 39-120

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

STANDARD SAFETY & SUPPLY
 ETHAN SESSUMS
 PO BOX 14987
 ODESSA TX, 79764
 Fax To: NA

Received:	07/31/2026	Sampling Date:	07/31/2026
Reported:	08/06/2026	Sampling Type:	Soil
Project Name:	LOST TANK 18 TANKLESS CPF (8/31/202	Sampling Condition:	Cool & Intact
Project Number:	NONE GIVEN	Sample Received By:	Shalyn Rodriguez
Project Location:	OXY-LEA COUNTY, NEW MEXICO		

Sample ID: V-5 0-6" (H264383-09)

BTEx 8021B		mg/kg		Analyzed By: JH						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Benzene*	<0.050	0.050	08/06/2026	ND	2.10	105	2.00	1.16		
Toluene*	<0.050	0.050	08/06/2026	ND	2.13	106	2.00	1.10		
Ethylbenzene*	<0.050	0.050	08/06/2026	ND	2.16	108	2.00	0.371		
Total Xylenes*	<0.150	0.150	08/06/2026	ND	6.63	110	6.00	0.590		
Total BTEX	<0.300	0.300	08/06/2026	ND						

Surrogate: 4-Bromofluorobenzene (PID) 114 % 70.7-129

Chloride, SM4500Cl-B		mg/kg		Analyzed By: KH						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Chloride	4640	16.0	08/05/2026	ND	432	108	400	3.64		

TPH 8015M		mg/kg		Analyzed By: JF					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	<10.0	10.0	08/05/2026	ND	205	102	200	0.594	
DRO >C10-C28*	803	10.0	08/05/2026	ND	215	107	200	2.29	
EXT DRO >C28-C36	175	10.0	08/05/2026	ND					

Surrogate: 1-Chlorooctane 82.2 % 48-117

Surrogate: 1-Chlorooctadecane 103 % 39-120

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

STANDARD SAFETY & SUPPLY
 ETHAN SESSUMS
 PO BOX 14987
 ODESSA TX, 79764
 Fax To: NA

Received:	07/31/2026	Sampling Date:	07/31/2026
Reported:	08/06/2026	Sampling Type:	Soil
Project Name:	LOST TANK 18 TANKLESS CPF (8/31/202	Sampling Condition:	Cool & Intact
Project Number:	NONE GIVEN	Sample Received By:	Shalyn Rodriguez
Project Location:	OXY-LEA COUNTY, NEW MEXICO		

Sample ID: V-5 1-1.5' (H264383-10)

BTEx 8021B		mg/kg		Analyzed By: JH					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Benzene*	<0.050	0.050	08/06/2026	ND	2.10	105	2.00	1.16	
Toluene*	<0.050	0.050	08/06/2026	ND	2.13	106	2.00	1.10	
Ethylbenzene*	<0.050	0.050	08/06/2026	ND	2.16	108	2.00	0.371	
Total Xylenes*	<0.150	0.150	08/06/2026	ND	6.63	110	6.00	0.590	
Total BTEX	<0.300	0.300	08/06/2026	ND					

Surrogate: 4-Bromofluorobenzene (PID) 110 % 70.7-129

Chloride, SM4500Cl-B		mg/kg		Analyzed By: KH						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Chloride	560	16.0	08/05/2026	ND	432	108	400	3.64		

TPH 8015M		mg/kg		Analyzed By: JF					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	<10.0	10.0	08/05/2026	ND	205	102	200	0.594	
DRO >C10-C28*	88.0	10.0	08/05/2026	ND	215	107	200	2.29	
EXT DRO >C28-C36	29.8	10.0	08/05/2026	ND					

Surrogate: 1-Chlorooctane 85.7 % 48-117

Surrogate: 1-Chlorooctadecane 87.6 % 39-120

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

STANDARD SAFETY & SUPPLY
 ETHAN SESSUMS
 PO BOX 14987
 ODESSA TX, 79764
 Fax To: NA

Received: 07/31/2026
 Reported: 08/06/2026
 Project Name: LOST TANK 18 TANKLESS CPF (8/31/202
 Project Number: NONE GIVEN
 Project Location: OXY-LEA COUNTY, NEW MEXICO

Sampling Date: 07/31/2026
 Sampling Type: Soil
 Sampling Condition: Cool & Intact
 Sample Received By: Shalyn Rodriguez

Sample ID: V-6 0-6" (H264383-11)

BTEx 8021B		mg/kg		Analyzed By: JH					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Benzene*	<0.050	0.050	08/06/2026	ND	2.10	105	2.00	1.16	
Toluene*	<0.050	0.050	08/06/2026	ND	2.13	106	2.00	1.10	
Ethylbenzene*	<0.050	0.050	08/06/2026	ND	2.16	108	2.00	0.371	
Total Xylenes*	<0.150	0.150	08/06/2026	ND	6.63	110	6.00	0.590	
Total BTEX	<0.300	0.300	08/06/2026	ND					

Surrogate: 4-Bromofluorobenzene (PID) 112 % 70.7-129

Chloride, SM4500Cl-B		mg/kg		Analyzed By: KH						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Chloride	13600	16.0	08/05/2026	ND	432	108	400	3.64		

TPH 8015M		mg/kg		Analyzed By: JF					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	<10.0	10.0	08/05/2026	ND	205	102	200	0.594	
DRO >C10-C28*	163	10.0	08/05/2026	ND	215	107	200	2.29	
EXT DRO >C28-C36	66.9	10.0	08/05/2026	ND					

Surrogate: 1-Chlorooctane 81.6 % 48-117

Surrogate: 1-Chlorooctadecane 86.0 % 39-120

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

STANDARD SAFETY & SUPPLY
 ETHAN SESSUMS
 PO BOX 14987
 ODESSA TX, 79764
 Fax To: NA

Received: 07/31/2026
 Reported: 08/06/2026
 Project Name: LOST TANK 18 TANKLESS CPF (8/31/202
 Project Number: NONE GIVEN
 Project Location: OXY-LEA COUNTY, NEW MEXICO

Sampling Date: 07/31/2026
 Sampling Type: Soil
 Sampling Condition: Cool & Intact
 Sample Received By: Shalyn Rodriguez

Sample ID: V-6 1-1.5' (H264383-12)

BTEx 8021B		mg/kg		Analyzed By: JH					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Benzene*	<0.050	0.050	08/06/2026	ND	2.10	105	2.00	1.16	
Toluene*	<0.050	0.050	08/06/2026	ND	2.13	106	2.00	1.10	
Ethylbenzene*	<0.050	0.050	08/06/2026	ND	2.16	108	2.00	0.371	
Total Xylenes*	<0.150	0.150	08/06/2026	ND	6.63	110	6.00	0.590	
Total BTEX	<0.300	0.300	08/06/2026	ND					

Surrogate: 4-Bromofluorobenzene (PID) 113 % 70.7-129

Chloride, SM4500CI-B		mg/kg		Analyzed By: KH					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Chloride	224	16.0	08/05/2026	ND	432	108	400	3.64	

TPH 8015M		mg/kg		Analyzed By: JF					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	<10.0	10.0	08/05/2026	ND	205	102	200	0.594	
DRO >C10-C28*	<10.0	10.0	08/05/2026	ND	215	107	200	2.29	
EXT DRO >C28-C36	<10.0	10.0	08/05/2026	ND					

Surrogate: 1-Chlorooctane 85.4 % 48-117

Surrogate: 1-Chlorooctadecane 83.6 % 39-120

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

STANDARD SAFETY & SUPPLY
 ETHAN SESSUMS
 PO BOX 14987
 ODESSA TX, 79764
 Fax To: NA

Received: 07/31/2026
 Reported: 08/06/2026
 Project Name: LOST TANK 18 TANKLESS CPF (8/31/202
 Project Number: NONE GIVEN
 Project Location: OXY-LEA COUNTY, NEW MEXICO

Sampling Date: 07/31/2026
 Sampling Type: Soil
 Sampling Condition: Cool & Intact
 Sample Received By: Shalyn Rodriguez

Sample ID: V-7 0-6" (H264383-13)

BTEx 8021B		mg/kg		Analyzed By: JH						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Benzene*	<0.050	0.050	08/06/2026	ND	2.10	105	2.00	1.16		
Toluene*	<0.050	0.050	08/06/2026	ND	2.13	106	2.00	1.10		
Ethylbenzene*	<0.050	0.050	08/06/2026	ND	2.16	108	2.00	0.371		
Total Xylenes*	<0.150	0.150	08/06/2026	ND	6.63	110	6.00	0.590		
Total BTEX	<0.300	0.300	08/06/2026	ND						

Surrogate: 4-Bromofluorobenzene (PID) 112 % 70.7-129

Chloride, SM4500Cl-B		mg/kg		Analyzed By: KH						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Chloride	3240	16.0	08/05/2026	ND	432	108	400	3.64		

TPH 8015M		mg/kg		Analyzed By: JF				S-04	
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	<10.0	10.0	08/05/2026	ND	205	102	200	0.594	
DRO >C10-C28*	1440	10.0	08/05/2026	ND	215	107	200	2.29	
EXT DRO >C28-C36	328	10.0	08/05/2026	ND					

Surrogate: 1-Chlorooctane 85.9 % 48-117

Surrogate: 1-Chlorooctadecane 125 % 39-120

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

STANDARD SAFETY & SUPPLY
 ETHAN SESSUMS
 PO BOX 14987
 ODESSA TX, 79764
 Fax To: NA

Received: 07/31/2026
 Reported: 08/06/2026
 Project Name: LOST TANK 18 TANKLESS CPF (8/31/202
 Project Number: NONE GIVEN
 Project Location: OXY-LEA COUNTY, NEW MEXICO

Sampling Date: 07/31/2026
 Sampling Type: Soil
 Sampling Condition: Cool & Intact
 Sample Received By: Shalyn Rodriguez

Sample ID: V-7 1-1.5' (H264383-14)

BTX 8021B		mg/kg		Analyzed By: JH					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Benzene*	<0.050	0.050	08/06/2026	ND	2.10	105	2.00	1.16	
Toluene*	<0.050	0.050	08/06/2026	ND	2.13	106	2.00	1.10	
Ethylbenzene*	<0.050	0.050	08/06/2026	ND	2.16	108	2.00	0.371	
Total Xylenes*	<0.150	0.150	08/06/2026	ND	6.63	110	6.00	0.590	
Total BTX	<0.300	0.300	08/06/2026	ND					

Surrogate: 4-Bromofluorobenzene (PID) 111 % 70.7-129

Chloride, SM4500CI-B		mg/kg		Analyzed By: KH					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Chloride	80.0	16.0	08/05/2026	ND	432	108	400	3.64	

TPH 8015M		mg/kg		Analyzed By: JF					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	<10.0	10.0	08/05/2026	ND	200	100	200	0.655	
DRO >C10-C28*	29.4	10.0	08/05/2026	ND	202	101	200	2.30	
EXT DRO >C28-C36	<10.0	10.0	08/05/2026	ND					

Surrogate: 1-Chlorooctane 88.8 % 48-117

Surrogate: 1-Chlorooctadecane 82.4 % 39-120

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

STANDARD SAFETY & SUPPLY
 ETHAN SESSUMS
 PO BOX 14987
 ODESSA TX, 79764
 Fax To: NA

Received:	07/31/2026	Sampling Date:	07/31/2026
Reported:	08/06/2026	Sampling Type:	Soil
Project Name:	LOST TANK 18 TANKLESS CPF (8/31/202	Sampling Condition:	Cool & Intact
Project Number:	NONE GIVEN	Sample Received By:	Shalyn Rodriguez
Project Location:	OXY-LEA COUNTY, NEW MEXICO		

Sample ID: V-8 0-6" (H264383-15)

BTEx 8021B		mg/kg		Analyzed By: JH						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Benzene*	<0.050	0.050	08/06/2026	ND	2.10	105	2.00	1.16		
Toluene*	<0.050	0.050	08/06/2026	ND	2.13	106	2.00	1.10		
Ethylbenzene*	<0.050	0.050	08/06/2026	ND	2.16	108	2.00	0.371		
Total Xylenes*	<0.150	0.150	08/06/2026	ND	6.63	110	6.00	0.590		
Total BTEX	<0.300	0.300	08/06/2026	ND						

Surrogate: 4-Bromofluorobenzene (PID) 121 % 70.7-129

Chloride, SM4500Cl-B		mg/kg		Analyzed By: KH						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Chloride	2680	16.0	08/05/2026	ND	432	108	400	3.64		

TPH 8015M		mg/kg		Analyzed By: JF				S-06	
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	<50.0	50.0	08/06/2026	ND	200	100	200	0.655	
DRO >C10-C28*	12200	50.0	08/06/2026	ND	202	101	200	2.30	
EXT DRO >C28-C36	2280	50.0	08/06/2026	ND					

Surrogate: 1-Chlorooctane 120 % 48-117

Surrogate: 1-Chlorooctadecane 773 % 39-120

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

STANDARD SAFETY & SUPPLY
 ETHAN SESSUMS
 PO BOX 14987
 ODESSA TX, 79764
 Fax To: NA

Received: 07/31/2026
 Reported: 08/06/2026
 Project Name: LOST TANK 18 TANKLESS CPF (8/31/202
 Project Number: NONE GIVEN
 Project Location: OXY-LEA COUNTY, NEW MEXICO

Sampling Date: 07/31/2026
 Sampling Type: Soil
 Sampling Condition: Cool & Intact
 Sample Received By: Shalyn Rodriguez

Sample ID: V-8 1-1.5' (H264383-16)

BTEx 8021B		mg/kg		Analyzed By: JH					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Benzene*	<0.050	0.050	08/06/2026	ND	2.10	105	2.00	1.16	
Toluene*	<0.050	0.050	08/06/2026	ND	2.13	106	2.00	1.10	
Ethylbenzene*	<0.050	0.050	08/06/2026	ND	2.16	108	2.00	0.371	
Total Xylenes*	<0.150	0.150	08/06/2026	ND	6.63	110	6.00	0.590	
Total BTEX	<0.300	0.300	08/06/2026	ND					

Surrogate: 4-Bromofluorobenzene (PID) 114 % 70.7-129

Chloride, SM4500Cl-B		mg/kg		Analyzed By: KH					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Chloride	80.0	16.0	08/05/2026	ND	432	108	400	3.64	

TPH 8015M		mg/kg		Analyzed By: JF					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	<10.0	10.0	08/05/2026	ND	200	100	200	0.655	
DRO >C10-C28*	252	10.0	08/05/2026	ND	202	101	200	2.30	
EXT DRO >C28-C36	32.6	10.0	08/05/2026	ND					

Surrogate: 1-Chlorooctane 81.0 % 48-117

Surrogate: 1-Chlorooctadecane 81.4 % 39-120

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 • 101 E. MARLAND • HOBBS, NM 88240

Notes and Definitions

S-06	The recovery of this surrogate is outside control limits due to sample dilution required from high analyte concentration and/or matrix interference's.
S-04	The surrogate recovery for this sample is outside of established control limits due to a sample matrix effect.
GC-NC1	8260 confirmation analysis was performed; initial GC results were not supported by GC/MS analysis and are biased high with interfering compounds.
GC-NC	8260 confirmation analysis was performed; initial GC results were not supported by GC/MS analysis and are reported as ND.
ND	Analyte NOT DETECTED at or above the reporting limit
RPD	Relative Percent Difference
**	Samples not received at proper temperature of 6°C or below.
***	Insufficient time to reach temperature.
-	Chloride by SM4500Cl-B does not require samples be received at or below 6°C Samples reported on an as received basis (wet) unless otherwise noted on report

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

A handwritten signature in black ink, appearing to read "Celey D. Keene".

Celey D. Keene, Lab Director/Quality Manager

**STANDARD
&
SAFETY SUPPLY**

Contact: (432) 653-0393

Work Order Comments

Work Order Comments
PO will be sent by OXY
0408201L

71082070

Project Manager:		Ethan Sessums	Bill to: (if different)		Daniel Sparks	Work Order Comments										
Company Name:		Standard Safety & Supply	Company Name:		OXY USA INC	PO will be sent by OXY										
Address:		2425 Trunk St	Address:			04082012										
City, State ZIP:		Odessa, Texas, 79761	City, State ZIP:													
Phone:		254-266-5456	Email:		CarlsbadOffice@standardtx.com											
Project Name:		Lost Tank 18 Tankless CPF	Turn Around		Pres. Code	ANALYSIS REQUEST										
Project Number:			☒ Routine ☐ Rush													
Project Location:		Lea County, New Mexico	Due Date:													
Sampler's Name:		Josafat Aguirre	TAT may vary based on lab start time.													
PO #:																
SAMPLE RECEIPT		Temp Blank:	Yes	No	Wet Ice:	Yes	No									
Samples Received Intact:		Yes	No	Thermometer ID:	14012											
Cooler Custody Seals:		Yes	No	Correction Factor:	+0.12											
Sample Custody Seals:		Yes	No	Temperature Reading:	1.11											
Total Containers:			Corrected Temperature:	1.22												
Sample Identification		Depth	Date Sampled	Time Sampled	Matrix	Grab Com	# of Cont	Parameters								
1	V-1	0-6"	7/31/2026	9:30 AM	S	Grab	1	X	X	X	X	BTEX 8012B				
2	V-1	1-1.5'	7/31/2026	9:35 AM	S	Grab	1	X	X	X	X	TPH 8015M (GRO-DRO-MRO)				
3	V-2	0-6"	7/31/2026	9:40 AM	S	Grab	1	X	X	X	X	Chloride 4500 or EPA 300				
4	V-2	1-1.5'	7/31/2026	9:45 AM	S	Grab	1	X	X	X	X					
5	V-3	0-6"	7/31/2026	9:50 AM	S	Grab	1	X	X	X	X					
6	V-3	1-1.5'	7/31/2026	9:55 AM	S	Grab	1	X	X	X	X					
7	V-4	0-6"	7/31/2026	10:00 AM	S	Grab	1	X	X	X	X					
8	V-4	1-1.5'	7/31/2026	10:05 AM	S	Grab	1	X	X	X	X					
9	V-5	0-6"	7/31/2026	10:10 AM	S	Grab	1	X	X	X	X					
10	V-5	1-1.5'	7/31/2026	10:15 AM	S	Grab	1	X	X	X	X					
Relinquished by: (Signature)		Received by: (Signature)		Date/Time		Relinquished by: (Signature)		Received by: (Signature)		Date/Time						
Josafat Aguirre		[Signature]		7/31/26 1410						2						
										4						
										6						
Disclaimer: This document and any files transmitted with it are confidential and intended solely for the use of the individual or entity to whom they are addressed																



Chain of Custody

Project Manager:	Ethan Sessums	Bill to: (if different)	Daniel Sparks
Company Name:	Standard Safety & Supply	Company Name:	OXY USA INC
Address:	2425 Trunk St.	Address:	
City, State ZIP:	Odessa, Texas, 79761	City, State ZIP:	
Phone:	254-266-5456	Email:	CarlsbadOffice@standardtx.com

Main Office: 2524 Trunk Street, Odessa Texas 79761

Contact: (432) 653-0393

<https://standardtx.com/>

Page 2 of 2

Work Order Comments

PO will be sent by OXY

04082016

Sample Identification	Depth	Date Sampled	Time Sampled	Matrix	Grab Com	# of Cont	ANALYSIS REQUEST										Preservative Codes	Sample Comments
							BTEX 8012B	TPH 8015M (GRO-DRO-MRO)	Chloride 4500 or EPA 300									
1 V-6	0-6"	7/31/2026	10:20 AM	S	Grab	1	X	X	X								None: NO DI Water: H ₂ O	
2 V-6	1-1.5'	7/31/2026	10:25 AM	S	Grab	1	X	X	X								Cool: Cool MeOH: Me	
3 V-7	0-6"	7/31/2026	10:30 AM	S	Grab	1	X	X	X								HCL: HC HNO ₃ : HN	
4 V-7	1-1.5'	7/31/2026	10:35 AM	S	Grab	1	X	X	X								H ₂ SO ₄ : H ₂ NaOH: Na	
5 V-8	0-6"	7/31/2026	10:40 AM	S	Grab	1	X	X	X								H ₃ PO ₄ : HP	
6 V-8	1-1.5'	7/31/2026	10:45 AM	S	Grab	1	X	X	X								NaHSO ₄ : NABIS	
																	Na ₂ S ₂ O ₃ : NaSO ₃	
																	Zn Acetate+NaOH: Zn	
																	NaOH+Ascorbic Acid: SAPC	

Disclaimer: This document and any files transmitted with it are confidential and intended solely for the use of the individual or entity to whom they are addressed



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

August 06, 2026

ETHAN SESSUMS

STANDARD SAFETY & SUPPLY

PO BOX 14987

ODESSA, TX 79764

RE: LOST TANK 18 TANKLESS CPF (8/31/2025)

Enclosed are the results of analyses for samples received by the laboratory on 07/31/26 14:16.

Cardinal Laboratories is accredited through Texas NELAP under certificate number TX-C26-00106. Accreditation applies to drinking water, non-potable water and solid and chemical materials. All accredited analytes are denoted by an asterisk (*). For a complete list of accredited analytes and matrices visit the TCEQ website at www.tceq.texas.gov/field/qa/lab_accred_certif.html.

Cardinal Laboratories is accredited through the State of Colorado Department of Public Health and Environment for:

Method EPA 552.2	Haloacetic Acids (HAA-5)
Method EPA 524.2	Total Trihalomethanes (TTHM)
Method EPA 524.4	Regulated VOCs (V1, V2, V3)

Accreditation applies to public drinking water matrices.

This report meets NELAP requirements and is made up of a cover page, analytical results, and a copy of the original chain-of-custody. If you have any questions concerning this report, please feel free to contact me.

Sincerely,

A handwritten signature in black ink that reads "Celey D. Keene". The signature is written in a cursive style with a large, stylized 'C' at the beginning.

Celey D. Keene

Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

STANDARD SAFETY & SUPPLY
 ETHAN SESSUMS
 PO BOX 14987
 ODESSA TX, 79764
 Fax To: NA

Received:	07/31/2026	Sampling Date:	07/31/2026
Reported:	08/06/2026	Sampling Type:	Soil
Project Name:	LOST TANK 18 TANKLESS CPF (8/31/202	Sampling Condition:	Cool & Intact
Project Number:	NONE GIVEN	Sample Received By:	Shalyn Rodriguez
Project Location:	OXY-LEA COUNTY, NEW MEXICO		

Sample ID: H-1 0-6" (H264384-01)

BTEx 8021B		mg/kg		Analyzed By: JH					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Benzene*	<0.050	0.050	08/06/2026	ND	2.10	105	2.00	1.16	
Toluene*	<0.050	0.050	08/06/2026	ND	2.13	106	2.00	1.10	
Ethylbenzene*	<0.050	0.050	08/06/2026	ND	2.16	108	2.00	0.371	
Total Xylenes*	<0.150	0.150	08/06/2026	ND	6.63	110	6.00	0.590	
Total BTEx	<0.300	0.300	08/06/2026	ND					

Surrogate: 4-Bromofluorobenzene (PID) 110 % 70.7-129

Chloride, SM4500Cl-B		mg/kg		Analyzed By: KH						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Chloride	192	16.0	08/05/2026	ND	432	108	400	3.64		

TPH 8015M		mg/kg		Analyzed By: JF					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	<10.0	10.0	08/05/2026	ND	200	100	200	0.655	
DRO >C10-C28*	1540	10.0	08/05/2026	ND	202	101	200	2.30	
EXT DRO >C28-C36	457	10.0	08/05/2026	ND					

Surrogate: 1-Chlorooctane 81.8 % 48-117

Surrogate: 1-Chlorooctadecane 119 % 39-120

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

STANDARD SAFETY & SUPPLY
 ETHAN SESSUMS
 PO BOX 14987
 ODESSA TX, 79764
 Fax To: NA

Received:	07/31/2026	Sampling Date:	07/31/2026
Reported:	08/06/2026	Sampling Type:	Soil
Project Name:	LOST TANK 18 TANKLESS CPF (8/31/202	Sampling Condition:	Cool & Intact
Project Number:	NONE GIVEN	Sample Received By:	Shalyn Rodriguez
Project Location:	OXY-LEA COUNTY, NEW MEXICO		

Sample ID: H-2 0-6" (H264384-02)

BTEx 8021B		mg/kg		Analyzed By: JH						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Benzene*	<0.050	0.050	08/06/2026	ND	2.10	105	2.00	1.16		
Toluene*	<0.050	0.050	08/06/2026	ND	2.13	106	2.00	1.10		
Ethylbenzene*	<0.050	0.050	08/06/2026	ND	2.16	108	2.00	0.371		
Total Xylenes*	<0.150	0.150	08/06/2026	ND	6.63	110	6.00	0.590		
Total BTEX	<0.300	0.300	08/06/2026	ND						

Surrogate: 4-Bromofluorobenzene (PID) 107 % 70.7-129

Chloride, SM4500Cl-B		mg/kg		Analyzed By: ED						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Chloride	464	16.0	08/05/2026	ND	432	108	400	3.64	QM-07	

TPH 8015M		mg/kg		Analyzed By: JF					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	<10.0	10.0	08/05/2026	ND	200	100	200	0.655	
DRO >C10-C28*	<10.0	10.0	08/05/2026	ND	202	101	200	2.30	
EXT DRO >C28-C36	<10.0	10.0	08/05/2026	ND					

Surrogate: 1-Chlorooctane 82.7 % 48-117

Surrogate: 1-Chlorooctadecane 77.1 % 39-120

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

STANDARD SAFETY & SUPPLY
 ETHAN SESSUMS
 PO BOX 14987
 ODESSA TX, 79764
 Fax To: NA

Received:	07/31/2026	Sampling Date:	07/31/2026
Reported:	08/06/2026	Sampling Type:	Soil
Project Name:	LOST TANK 18 TANKLESS CPF (8/31/202	Sampling Condition:	Cool & Intact
Project Number:	NONE GIVEN	Sample Received By:	Shalyn Rodriguez
Project Location:	OXY-LEA COUNTY, NEW MEXICO		

Sample ID: H-3 0-6" (H264384-03)

BTEx 8021B		mg/kg		Analyzed By: JH						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Benzene*	<0.050	0.050	08/06/2026	ND	2.10	105	2.00	1.16		
Toluene*	<0.050	0.050	08/06/2026	ND	2.13	106	2.00	1.10		
Ethylbenzene*	<0.050	0.050	08/06/2026	ND	2.16	108	2.00	0.371		
Total Xylenes*	<0.150	0.150	08/06/2026	ND	6.63	110	6.00	0.590		
Total BTEX	<0.300	0.300	08/06/2026	ND						

Surrogate: 4-Bromofluorobenzene (PID) 111 % 70.7-129

Chloride, SM4500Cl-B		mg/kg		Analyzed By: ED						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Chloride	240	16.0	08/05/2026	ND	432	108	400	3.64		

TPH 8015M		mg/kg		Analyzed By: JF					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	<10.0	10.0	08/05/2026	ND	200	100	200	0.655	
DRO >C10-C28*	1540	10.0	08/05/2026	ND	202	101	200	2.30	
EXT DRO >C28-C36	448	10.0	08/05/2026	ND					

Surrogate: 1-Chlorooctane 72.5 % 48-117

Surrogate: 1-Chlorooctadecane 110 % 39-120

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

STANDARD SAFETY & SUPPLY
 ETHAN SESSUMS
 PO BOX 14987
 ODESSA TX, 79764
 Fax To: NA

Received:	07/31/2026	Sampling Date:	07/31/2026
Reported:	08/06/2026	Sampling Type:	Soil
Project Name:	LOST TANK 18 TANKLESS CPF (8/31/202	Sampling Condition:	Cool & Intact
Project Number:	NONE GIVEN	Sample Received By:	Shalyn Rodriguez
Project Location:	OXY-LEA COUNTY, NEW MEXICO		

Sample ID: H-4 0-6" (H264384-04)

BTEx 8021B		mg/kg		Analyzed By: JH						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Benzene*	<0.050	0.050	08/05/2026	ND	2.27	113	2.00	0.0402		
Toluene*	<0.050	0.050	08/05/2026	ND	2.16	108	2.00	0.282		
Ethylbenzene*	<0.050	0.050	08/05/2026	ND	2.07	103	2.00	0.0584		
Total Xylenes*	<0.150	0.150	08/05/2026	ND	6.03	101	6.00	0.177		
Total BTEX	<0.300	0.300	08/05/2026	ND						

Surrogate: 4-Bromofluorobenzene (PID) 94.7 % 70.7-129

Chloride, SM4500Cl-B		mg/kg		Analyzed By: ED						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Chloride	192	16.0	08/05/2026	ND	432	108	400	3.64		

TPH 8015M		mg/kg		Analyzed By: JF					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	<10.0	10.0	08/05/2026	ND	200	100	200	0.655	
DRO >C10-C28*	1230	10.0	08/05/2026	ND	202	101	200	2.30	
EXT DRO >C28-C36	362	10.0	08/05/2026	ND					

Surrogate: 1-Chlorooctane 63.8 % 48-117

Surrogate: 1-Chlorooctadecane 89.4 % 39-120

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

STANDARD SAFETY & SUPPLY
 ETHAN SESSUMS
 PO BOX 14987
 ODESSA TX, 79764
 Fax To: NA

Received:	07/31/2026	Sampling Date:	07/31/2026
Reported:	08/06/2026	Sampling Type:	Soil
Project Name:	LOST TANK 18 TANKLESS CPF (8/31/202	Sampling Condition:	Cool & Intact
Project Number:	NONE GIVEN	Sample Received By:	Shalyn Rodriguez
Project Location:	OXY-LEA COUNTY, NEW MEXICO		

Sample ID: H-5 0-6" (H264384-05)

BTEx 8021B		mg/kg		Analyzed By: JH					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Benzene*	<0.050	0.050	08/05/2026	ND	2.27	113	2.00	0.0402	
Toluene*	<0.050	0.050	08/05/2026	ND	2.16	108	2.00	0.282	
Ethylbenzene*	<0.050	0.050	08/05/2026	ND	2.07	103	2.00	0.0584	
Total Xylenes*	<0.150	0.150	08/05/2026	ND	6.03	101	6.00	0.177	
Total BTEX	<0.300	0.300	08/05/2026	ND					

Surrogate: 4-Bromofluorobenzene (PID) 94.8 % 70.7-129

Chloride, SM4500Cl-B		mg/kg		Analyzed By: ED						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Chloride	480	16.0	08/05/2026	ND	432	108	400	3.64		

TPH 8015M		mg/kg		Analyzed By: JF					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	<10.0	10.0	08/05/2026	ND	200	100	200	0.655	
DRO >C10-C28*	<10.0	10.0	08/05/2026	ND	202	101	200	2.30	
EXT DRO >C28-C36	<10.0	10.0	08/05/2026	ND					

Surrogate: 1-Chlorooctane 85.0 % 48-117

Surrogate: 1-Chlorooctadecane 77.5 % 39-120

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

STANDARD SAFETY & SUPPLY
 ETHAN SESSUMS
 PO BOX 14987
 ODESSA TX, 79764
 Fax To: NA

Received: 07/31/2026
 Reported: 08/06/2026
 Project Name: LOST TANK 18 TANKLESS CPF (8/31/202
 Project Number: NONE GIVEN
 Project Location: OXY-LEA COUNTY, NEW MEXICO

Sampling Date: 07/31/2026
 Sampling Type: Soil
 Sampling Condition: Cool & Intact
 Sample Received By: Shalyn Rodriguez

Sample ID: H-6 0-6" (H264384-06)

BTEx 8021B		mg/kg		Analyzed By: JH					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Benzene*	<0.050	0.050	08/05/2026	ND	2.27	113	2.00	0.0402	
Toluene*	<0.050	0.050	08/05/2026	ND	2.16	108	2.00	0.282	
Ethylbenzene*	<0.050	0.050	08/05/2026	ND	2.07	103	2.00	0.0584	
Total Xylenes*	<0.150	0.150	08/05/2026	ND	6.03	101	6.00	0.177	
Total BTEx	<0.300	0.300	08/05/2026	ND					

Surrogate: 4-Bromofluorobenzene (PID) 93.7 % 70.7-129

Chloride, SM4500Cl-B		mg/kg		Analyzed By: ED					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Chloride	256	16.0	08/05/2026	ND	432	108	400	3.64	

TPH 8015M		mg/kg		Analyzed By: JF					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	<10.0	10.0	08/05/2026	ND	200	100	200	0.655	
DRO >C10-C28*	1540	10.0	08/05/2026	ND	202	101	200	2.30	
EXT DRO >C28-C36	384	10.0	08/05/2026	ND					

Surrogate: 1-Chlorooctane 69.3 % 48-117

Surrogate: 1-Chlorooctadecane 109 % 39-120

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

STANDARD SAFETY & SUPPLY
 ETHAN SESSUMS
 PO BOX 14987
 ODESSA TX, 79764
 Fax To: NA

Received: 07/31/2026
 Reported: 08/06/2026
 Project Name: LOST TANK 18 TANKLESS CPF (8/31/202
 Project Number: NONE GIVEN
 Project Location: OXY-LEA COUNTY, NEW MEXICO

Sampling Date: 07/31/2026
 Sampling Type: Soil
 Sampling Condition: Cool & Intact
 Sample Received By: Shalyn Rodriguez

Sample ID: H-7 0-6" (H264384-07)

BTEx 8021B		mg/kg		Analyzed By: JH						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Benzene*	<0.050	0.050	08/05/2026	ND	2.27	113	2.00	0.0402		
Toluene*	<0.050	0.050	08/05/2026	ND	2.16	108	2.00	0.282		
Ethylbenzene*	<0.050	0.050	08/05/2026	ND	2.07	103	2.00	0.0584		
Total Xylenes*	<0.150	0.150	08/05/2026	ND	6.03	101	6.00	0.177		
Total BTEx	<0.300	0.300	08/05/2026	ND						

Surrogate: 4-Bromofluorobenzene (PID) 94.3 % 70.7-129

Chloride, SM4500CI-B		mg/kg		Analyzed By: ED						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Chloride	224	16.0	08/05/2026	ND	432	108	400	3.64		

TPH 8015M		mg/kg		Analyzed By: JF					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	<10.0	10.0	08/05/2026	ND	200	100	200	0.655	
DRO >C10-C28*	1560	10.0	08/05/2026	ND	202	101	200	2.30	
EXT DRO >C28-C36	411	10.0	08/05/2026	ND					

Surrogate: 1-Chlorooctane 66.6 % 48-117

Surrogate: 1-Chlorooctadecane 105 % 39-120

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

STANDARD SAFETY & SUPPLY
 ETHAN SESSUMS
 PO BOX 14987
 ODESSA TX, 79764
 Fax To: NA

Received: 07/31/2026
 Reported: 08/06/2026
 Project Name: LOST TANK 18 TANKLESS CPF (8/31/202
 Project Number: NONE GIVEN
 Project Location: OXY-LEA COUNTY, NEW MEXICO

Sampling Date: 07/31/2026
 Sampling Type: Soil
 Sampling Condition: Cool & Intact
 Sample Received By: Shalyn Rodriguez

Sample ID: H-8 0-6" (H264384-08)

BTEx 8021B		mg/kg		Analyzed By: JH					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Benzene*	<0.050	0.050	08/05/2026	ND	2.27	113	2.00	0.0402	
Toluene*	<0.050	0.050	08/05/2026	ND	2.16	108	2.00	0.282	
Ethylbenzene*	<0.050	0.050	08/05/2026	ND	2.07	103	2.00	0.0584	
Total Xylenes*	<0.150	0.150	08/05/2026	ND	6.03	101	6.00	0.177	
Total BTEX	<0.300	0.300	08/05/2026	ND					

Surrogate: 4-Bromofluorobenzene (PID) 95.7 % 70.7-129

Chloride, SM4500Cl-B		mg/kg		Analyzed By: ED						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Chloride	480	16.0	08/05/2026	ND	432	108	400	3.64		

TPH 8015M		mg/kg		Analyzed By: JF					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	<10.0	10.0	08/05/2026	ND	200	100	200	0.655	
DRO >C10-C28*	<10.0	10.0	08/05/2026	ND	202	101	200	2.30	
EXT DRO >C28-C36	<10.0	10.0	08/05/2026	ND					

Surrogate: 1-Chlorooctane 81.5 % 48-117

Surrogate: 1-Chlorooctadecane 75.3 % 39-120

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

STANDARD SAFETY & SUPPLY
 ETHAN SESSUMS
 PO BOX 14987
 ODESSA TX, 79764
 Fax To: NA

Received: 07/31/2026
 Reported: 08/06/2026
 Project Name: LOST TANK 18 TANKLESS CPF (8/31/202
 Project Number: NONE GIVEN
 Project Location: OXY-LEA COUNTY, NEW MEXICO

Sampling Date: 07/31/2026
 Sampling Type: Soil
 Sampling Condition: Cool & Intact
 Sample Received By: Shalyn Rodriguez

Sample ID: H-9 0-6" (H264384-09)

BTEx 8021B		mg/kg		Analyzed By: JH					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Benzene*	<0.050	0.050	08/05/2026	ND	2.27	113	2.00	0.0402	
Toluene*	<0.050	0.050	08/05/2026	ND	2.16	108	2.00	0.282	
Ethylbenzene*	<0.050	0.050	08/05/2026	ND	2.07	103	2.00	0.0584	
Total Xylenes*	<0.150	0.150	08/05/2026	ND	6.03	101	6.00	0.177	
Total BTEx	<0.300	0.300	08/05/2026	ND					

Surrogate: 4-Bromofluorobenzene (PID) 94.1 % 70.7-129

Chloride, SM4500CI-B		mg/kg		Analyzed By: ED						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Chloride	192	16.0	08/05/2026	ND	432	108	400	3.64		

TPH 8015M		mg/kg		Analyzed By: JF					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	<10.0	10.0	08/05/2026	ND	200	100	200	0.655	
DRO >C10-C28*	1650	10.0	08/05/2026	ND	202	101	200	2.30	
EXT DRO >C28-C36	461	10.0	08/05/2026	ND					

Surrogate: 1-Chlorooctane 80.6 % 48-117

Surrogate: 1-Chlorooctadecane 119 % 39-120

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

STANDARD SAFETY & SUPPLY
 ETHAN SESSUMS
 PO BOX 14987
 ODESSA TX, 79764
 Fax To: NA

Received: 07/31/2026
 Reported: 08/06/2026
 Project Name: LOST TANK 18 TANKLESS CPF (8/31/202
 Project Number: NONE GIVEN
 Project Location: OXY-LEA COUNTY, NEW MEXICO

Sampling Date: 07/31/2026
 Sampling Type: Soil
 Sampling Condition: Cool & Intact
 Sample Received By: Shalyn Rodriguez

Sample ID: H-10 0-6" (H264384-10)

BTEx 8021B		mg/kg		Analyzed By: JH						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Benzene*	<0.050	0.050	08/05/2026	ND	2.27	113	2.00	0.0402		
Toluene*	<0.050	0.050	08/05/2026	ND	2.16	108	2.00	0.282		
Ethylbenzene*	<0.050	0.050	08/05/2026	ND	2.07	103	2.00	0.0584		
Total Xylenes*	<0.150	0.150	08/05/2026	ND	6.03	101	6.00	0.177		
Total BTEx	<0.300	0.300	08/05/2026	ND						

Surrogate: 4-Bromofluorobenzene (PID) 93.8 % 70.7-129

Chloride, SM4500CI-B		mg/kg		Analyzed By: ED						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Chloride	256	16.0	08/05/2026	ND	432	108	400	3.64		

TPH 8015M		mg/kg		Analyzed By: JF					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	<10.0	10.0	08/05/2026	ND	200	100	200	0.655	
DRO >C10-C28*	1430	10.0	08/05/2026	ND	202	101	200	2.30	
EXT DRO >C28-C36	353	10.0	08/05/2026	ND					

Surrogate: 1-Chlorooctane 71.3 % 48-117

Surrogate: 1-Chlorooctadecane 108 % 39-120

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

STANDARD SAFETY & SUPPLY
 ETHAN SESSUMS
 PO BOX 14987
 ODESSA TX, 79764
 Fax To: NA

Received: 07/31/2026
 Reported: 08/06/2026
 Project Name: LOST TANK 18 TANKLESS CPF (8/31/202
 Project Number: NONE GIVEN
 Project Location: OXY-LEA COUNTY, NEW MEXICO

Sampling Date: 07/31/2026
 Sampling Type: Soil
 Sampling Condition: Cool & Intact
 Sample Received By: Shalyn Rodriguez

Sample ID: H-11 0-6" (H264384-11)

BTEx 8021B		mg/kg		Analyzed By: JH						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Benzene*	<0.050	0.050	08/05/2026	ND	2.27	113	2.00	0.0402		
Toluene*	<0.050	0.050	08/05/2026	ND	2.16	108	2.00	0.282		
Ethylbenzene*	<0.050	0.050	08/05/2026	ND	2.07	103	2.00	0.0584		
Total Xylenes*	<0.150	0.150	08/05/2026	ND	6.03	101	6.00	0.177		
Total BTEX	<0.300	0.300	08/05/2026	ND						

Surrogate: 4-Bromofluorobenzene (PID) 94.9 % 70.7-129

Chloride, SM4500CI-B		mg/kg		Analyzed By: ED						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Chloride	464	16.0	08/05/2026	ND	432	108	400	3.64		

TPH 8015M		mg/kg		Analyzed By: JF					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	<10.0	10.0	08/05/2026	ND	200	100	200	0.655	
DRO >C10-C28*	<10.0	10.0	08/05/2026	ND	202	101	200	2.30	
EXT DRO >C28-C36	<10.0	10.0	08/05/2026	ND					

Surrogate: 1-Chlorooctane 79.5 % 48-117

Surrogate: 1-Chlorooctadecane 75.5 % 39-120

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

STANDARD SAFETY & SUPPLY
 ETHAN SESSUMS
 PO BOX 14987
 ODESSA TX, 79764
 Fax To: NA

Received: 07/31/2026
 Reported: 08/06/2026
 Project Name: LOST TANK 18 TANKLESS CPF (8/31/202
 Project Number: NONE GIVEN
 Project Location: OXY-LEA COUNTY, NEW MEXICO

Sampling Date: 07/31/2026
 Sampling Type: Soil
 Sampling Condition: Cool & Intact
 Sample Received By: Shalyn Rodriguez

Sample ID: H-12 0-6" (H264384-12)

BTEx 8021B		mg/kg		Analyzed By: JH						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Benzene*	<0.050	0.050	08/05/2026	ND	2.27	113	2.00	0.0402		
Toluene*	<0.050	0.050	08/05/2026	ND	2.16	108	2.00	0.282		
Ethylbenzene*	<0.050	0.050	08/05/2026	ND	2.07	103	2.00	0.0584		
Total Xylenes*	<0.150	0.150	08/05/2026	ND	6.03	101	6.00	0.177		
Total BTEX	<0.300	0.300	08/05/2026	ND						

Surrogate: 4-Bromofluorobenzene (PID) 93.9 % 70.7-129

Chloride, SM4500Cl-B		mg/kg		Analyzed By: ED						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Chloride	240	16.0	08/05/2026	ND	432	108	400	3.64		

TPH 8015M		mg/kg		Analyzed By: JF					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	<10.0	10.0	08/05/2026	ND	200	100	200	0.655	
DRO >C10-C28*	1630	10.0	08/05/2026	ND	202	101	200	2.30	
EXT DRO >C28-C36	437	10.0	08/05/2026	ND					

Surrogate: 1-Chlorooctane 61.6 % 48-117

Surrogate: 1-Chlorooctadecane 108 % 39-120

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

STANDARD SAFETY & SUPPLY
 ETHAN SESSUMS
 PO BOX 14987
 ODESSA TX, 79764
 Fax To: NA

Received: 07/31/2026
 Reported: 08/06/2026
 Project Name: LOST TANK 18 TANKLESS CPF (8/31/202
 Project Number: NONE GIVEN
 Project Location: OXY-LEA COUNTY, NEW MEXICO

Sampling Date: 07/31/2026
 Sampling Type: Soil
 Sampling Condition: Cool & Intact
 Sample Received By: Shalyn Rodriguez

Sample ID: H-13 0-6" (H264384-13)

BTEX 8021B		mg/kg		Analyzed By: JH						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Benzene*	<0.050	0.050	08/06/2026	ND	2.27	113	2.00	0.0402		
Toluene*	<0.050	0.050	08/06/2026	ND	2.16	108	2.00	0.282		
Ethylbenzene*	<0.050	0.050	08/06/2026	ND	2.07	103	2.00	0.0584		
Total Xylenes*	<0.150	0.150	08/06/2026	ND	6.03	101	6.00	0.177		
Total BTEX	<0.300	0.300	08/06/2026	ND						

Surrogate: 4-Bromofluorobenzene (PID) 92.9 % 70.7-129

Chloride, SM4500Cl-B		mg/kg		Analyzed By: ED						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Chloride	224	16.0	08/05/2026	ND	432	108	400	3.64		

TPH 8015M		mg/kg		Analyzed By: JF					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	<10.0	10.0	08/05/2026	ND	200	100	200	0.655	
DRO >C10-C28*	1450	10.0	08/05/2026	ND	202	101	200	2.30	
EXT DRO >C28-C36	390	10.0	08/05/2026	ND					

Surrogate: 1-Chlorooctane 61.7 % 48-117

Surrogate: 1-Chlorooctadecane 96.9 % 39-120

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Notes and Definitions

- QM-07 The spike recovery was outside acceptance limits for the MS and/or MSD. The batch was accepted based on acceptable LCS recovery.
- ND Analyte NOT DETECTED at or above the reporting limit
- RPD Relative Percent Difference
- ** Samples not received at proper temperature of 6°C or below.
- *** Insufficient time to reach temperature.
- Chloride by SM4500Cl-B does not require samples be received at or below 6°C
Samples reported on an as received basis (wet) unless otherwise noted on report

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

A handwritten signature in black ink, appearing to read "C. D. Keene".

Celey D. Keene, Lab Director/Quality Manager



Chain of Custody

Project Manager:	Ethan Sessums	Bill to: (if different)	Daniel Sparks
Company Name:	Standard Safety & Supply	Company Name:	OXY USA INC
Address:	2425 Trunk St.	Address:	
City, State ZIP:	Odessa, Texas, 79761	City, State ZIP:	
Phone:	254-266-5456	Email:	CarlsbadOffice@standardtx.com

Main Office: 2524 Trunk Street, Odessa Texas 79761	
Contact: (432) 653-0393	
https://standardtx.com/	
Page 2 of 2	
Work Order Comments	
PO will be sent by OXY	

Project Name:	Lost Tank 18 Tankless CPF	Turn Around	☒ Routine ☐ Rush	Pres. Code	
Project Number:		Due Date:			
Project Location:	Lea County, New Mexico	TAT may vary based on lab start time.			
Sampler's Name:	Josafat Aguirre				
PO #:					

Sample Identification	Depth	Date Sampled	Time Sampled	Matrix	Grab Com	# of Cont	Parameters	ANALYSIS REQUEST	Preservative Codes	Sample Comments
H-1	0-6"	7/31/2026	10:50 AM	S	Grab	1	BTEX 8012B		None: NO	DI Water: H ₂ O
H-2	0-6"	7/31/2026	10:55 AM	S	Grab	1	TPH 8015M (GRO-DRO-MRO)		Cool: Cool	MeOH: Me
H-3	0-6"	7/31/2026	11:00 AM	S	Grab	1	Chloride 4500 or EPA 300		HCL: HC	HNO ₃ : HN
H-4	0-6"	7/31/2026	11:05 AM	S	Grab	1			H ₂ SO ₄ : H ₂	NaOH: Na
H-5	0-6"	7/31/2026	11:10 AM	S	Grab	1			H ₃ PO ₄ : HP	
H-6	0-6"	7/31/2026	11:15 AM	S	Grab	1			NaHSO ₄ : NABIS	
H-7	0-6"	7/31/2026	11:20 AM	S	Grab	2			Na ₂ S ₂ O ₃ : NaSO ₃	
H-8	0-6"	7/31/2026	11:25 AM	S	Grab	3			Zn Acetate+NaOH: Zn	
H-9	0-6"	7/31/2026	11:30 AM	S	Grab	4			NaOH+Ascorbic Acid: SACP	
H-10	0-6"	7/31/2026	11:35 AM	S	Grab	5				

Relinquished by: (Signature)	Received by: (Signature)	Date/Time	Relinquished by: (Signature)	Received by: (Signature)	Date/Time
Josafat Aguirre	<i>Josafat Aguirre</i>	7/31/2026 14:16			
		4			
		6			

Disclaimer: This document and any files transmitted with it are confidential and intended solely for the use of the individual or entity to whom they are addressed



Main Office: 2524 Trunk Street, Odessa Texas 79761

Contact: (432) 653-0393

Page 2 of 2

Work Order Comments

PO will be sent by OXY

Work Order Comments
PO will be sent by OXY

QUEST						Preservative Codes
						None: NO
						Cool: Cool
						HCL: HC
						H ₂ SO ₄ : H ₂
						H ₃ PO ₄ : HP
						NaHSO ₄ : NABIS
						Na ₂ S ₂ O ₃ : NaSO ₃
						Zn Acetate+NaOH: Zn
						NaOH+Ascorbic Acid: SAPC

[illegible]

Disclaimer: This document and any files transmitted with it are confidential and intended solely for the use of the individual or entity to whom they are addressed.



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

August 19, 2026

ETHAN SESSUMS

STANDARD SAFETY & SUPPLY

PO BOX 14987

ODESSA, TX 79764

RE: LOST TANK 18 CPF (6/17/2026)

Enclosed are the results of analyses for samples received by the laboratory on 08/13/26 11:01.

Cardinal Laboratories is accredited through Texas NELAP under certificate number TX-C26-00106. Accreditation applies to drinking water, non-potable water and solid and chemical materials. All accredited analytes are denoted by an asterisk (*). For a complete list of accredited analytes and matrices visit the TCEQ website at www.tceq.texas.gov/field/qa/lab_accred_certif.html.

Cardinal Laboratories is accredited through the State of Colorado Department of Public Health and Environment for:

Method EPA 552.2	Haloacetic Acids (HAA-5)
Method EPA 524.2	Total Trihalomethanes (TTHM)
Method EPA 524.4	Regulated VOCs (V1, V2, V3)

Accreditation applies to public drinking water matrices.

This report meets NELAP requirements and is made up of a cover page, analytical results, and a copy of the original chain-of-custody. If you have any questions concerning this report, please feel free to contact me.

Sincerely,

A handwritten signature in black ink that reads "Celey D. Keene". The signature is written in a cursive style with a large, stylized 'C' at the beginning.

Celey D. Keene

Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

STANDARD SAFETY & SUPPLY
 ETHAN SESSUMS
 PO BOX 14987
 ODESSA TX, 79764
 Fax To: NA

Received: 08/13/2026
 Reported: 08/19/2026
 Project Name: LOST TANK 18 CPF (6/17/2026)
 Project Number: NONE GIVEN
 Project Location: OXY-LEA COUNTY, NEW MEXICO

Sampling Date: 08/11/2026
 Sampling Type: Soil
 Sampling Condition: Cool & Intact
 Sample Received By: Shalyn Rodriguez

Sample ID: H - 1A 0-6" (H264737-01)

BTX 8021B		mg/kg		Analyzed By: JH					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Benzene*	<0.050	0.050	08/18/2026	ND	2.20	110	2.00	2.86	
Toluene*	<0.050	0.050	08/18/2026	ND	2.00	99.8	2.00	0.447	
Ethylbenzene*	<0.050	0.050	08/18/2026	ND	2.02	101	2.00	0.107	
Total Xylenes*	<0.150	0.150	08/18/2026	ND	6.10	102	6.00	0.219	
Total BTX	<0.300	0.300	08/18/2026	ND					

Surrogate: 4-Bromofluorobenzene (PID) 95.9 % 70.7-129

Chloride, SM4500Cl-B		mg/kg		Analyzed By: ED						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Chloride	64.0	16.0	08/18/2026	ND	432	108	400	3.64		

TPH 8015M		mg/kg		Analyzed By: MS					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	<10.0	10.0	08/17/2026	ND	207	103	200	0.0585	
DRO >C10-C28*	<10.0	10.0	08/17/2026	ND	224	112	200	0.146	
EXT DRO >C28-C36	<10.0	10.0	08/17/2026	ND					

Surrogate: 1-Chlorooctane 73.4 % 48-117

Surrogate: 1-Chlorooctadecane 68.4 % 39-120

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

STANDARD SAFETY & SUPPLY
 ETHAN SESSUMS
 PO BOX 14987
 ODESSA TX, 79764
 Fax To: NA

Received: 08/13/2026
 Reported: 08/19/2026
 Project Name: LOST TANK 18 CPF (6/17/2026)
 Project Number: NONE GIVEN
 Project Location: OXY-LEA COUNTY, NEW MEXICO

Sampling Date: 08/11/2026
 Sampling Type: Soil
 Sampling Condition: Cool & Intact
 Sample Received By: Shalyn Rodriguez

Sample ID: H - 3A 0-6" (H264737-02)

BTX 8021B		mg/kg		Analyzed By: JH					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Benzene*	<0.050	0.050	08/18/2026	ND	2.20	110	2.00	2.86	
Toluene*	<0.050	0.050	08/18/2026	ND	2.00	99.8	2.00	0.447	
Ethylbenzene*	<0.050	0.050	08/18/2026	ND	2.02	101	2.00	0.107	
Total Xylenes*	<0.150	0.150	08/18/2026	ND	6.10	102	6.00	0.219	
Total BTX	<0.300	0.300	08/18/2026	ND					

Surrogate: 4-Bromofluorobenzene (PID) 99.6 % 70.7-129

Chloride, SM4500CI-B		mg/kg		Analyzed By: ED						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Chloride	480	16.0	08/18/2026	ND	432	108	400	3.64		

TPH 8015M		mg/kg		Analyzed By: MS					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	<10.0	10.0	08/17/2026	ND	207	103	200	0.0585	
DRO >C10-C28*	87.5	10.0	08/17/2026	ND	224	112	200	0.146	
EXT DRO >C28-C36	22.8	10.0	08/17/2026	ND					

Surrogate: 1-Chlorooctane 76.5 % 48-117

Surrogate: 1-Chlorooctadecane 74.6 % 39-120

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

STANDARD SAFETY & SUPPLY
 ETHAN SESSUMS
 PO BOX 14987
 ODESSA TX, 79764
 Fax To: NA

Received: 08/13/2026
 Reported: 08/19/2026
 Project Name: LOST TANK 18 CPF (6/17/2026)
 Project Number: NONE GIVEN
 Project Location: OXY-LEA COUNTY, NEW MEXICO

Sampling Date: 08/11/2026
 Sampling Type: Soil
 Sampling Condition: Cool & Intact
 Sample Received By: Shalyn Rodriguez

Sample ID: H - 4A 0-6" (H264737-03)

BTEx 8021B		mg/kg		Analyzed By: JH					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Benzene*	<0.050	0.050	08/18/2026	ND	2.20	110	2.00	2.86	
Toluene*	<0.050	0.050	08/18/2026	ND	2.00	99.8	2.00	0.447	
Ethylbenzene*	<0.050	0.050	08/18/2026	ND	2.02	101	2.00	0.107	
Total Xylenes*	<0.150	0.150	08/18/2026	ND	6.10	102	6.00	0.219	
Total BTEX	<0.300	0.300	08/18/2026	ND					

Surrogate: 4-Bromofluorobenzene (PID) 104 % 70.7-129

Chloride, SM4500Cl-B		mg/kg		Analyzed By: ED						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Chloride	464	16.0	08/18/2026	ND	432	108	400	3.64		

TPH 8015M		mg/kg		Analyzed By: MS					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	<10.0	10.0	08/18/2026	ND	207	103	200	0.0585	
DRO >C10-C28*	68.0	10.0	08/18/2026	ND	224	112	200	0.146	
EXT DRO >C28-C36	31.5	10.0	08/18/2026	ND					

Surrogate: 1-Chlorooctane 82.9 % 48-117

Surrogate: 1-Chlorooctadecane 79.2 % 39-120

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

STANDARD SAFETY & SUPPLY
 ETHAN SESSUMS
 PO BOX 14987
 ODESSA TX, 79764
 Fax To: NA

Received: 08/13/2026
 Reported: 08/19/2026
 Project Name: LOST TANK 18 CPF (6/17/2026)
 Project Number: NONE GIVEN
 Project Location: OXY-LEA COUNTY, NEW MEXICO

Sampling Date: 08/11/2026
 Sampling Type: Soil
 Sampling Condition: Cool & Intact
 Sample Received By: Shalyn Rodriguez

Sample ID: H - 6A 0-6" (H264737-04)

BTEx 8021B		mg/kg		Analyzed By: JH					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Benzene*	<0.050	0.050	08/18/2026	ND	2.20	110	2.00	2.86	
Toluene*	<0.050	0.050	08/18/2026	ND	2.00	99.8	2.00	0.447	
Ethylbenzene*	<0.050	0.050	08/18/2026	ND	2.02	101	2.00	0.107	
Total Xylenes*	<0.150	0.150	08/18/2026	ND	6.10	102	6.00	0.219	
Total BTEX	<0.300	0.300	08/18/2026	ND					

Surrogate: 4-Bromofluorobenzene (PID) 103 % 70.7-129

Chloride, SM4500Cl-B		mg/kg		Analyzed By: ED					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Chloride	304	16.0	08/18/2026	ND	432	108	400	3.64	

TPH 8015M		mg/kg		Analyzed By: MS					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	<10.0	10.0	08/18/2026	ND	207	103	200	0.0585	
DRO >C10-C28*	28.2	10.0	08/18/2026	ND	224	112	200	0.146	
EXT DRO >C28-C36	11.2	10.0	08/18/2026	ND					

Surrogate: 1-Chlorooctane 74.7 % 48-117

Surrogate: 1-Chlorooctadecane 72.5 % 39-120

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

STANDARD SAFETY & SUPPLY
 ETHAN SESSUMS
 PO BOX 14987
 ODESSA TX, 79764
 Fax To: NA

Received: 08/13/2026
 Reported: 08/19/2026
 Project Name: LOST TANK 18 CPF (6/17/2026)
 Project Number: NONE GIVEN
 Project Location: OXY-LEA COUNTY, NEW MEXICO

Sampling Date: 08/11/2026
 Sampling Type: Soil
 Sampling Condition: Cool & Intact
 Sample Received By: Shalyn Rodriguez

Sample ID: H - 7A 0-6" (H264737-05)

BTEx 8021B		mg/kg		Analyzed By: JH					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Benzene*	<0.050	0.050	08/18/2026	ND	2.20	110	2.00	2.86	
Toluene*	<0.050	0.050	08/18/2026	ND	2.00	99.8	2.00	0.447	
Ethylbenzene*	<0.050	0.050	08/18/2026	ND	2.02	101	2.00	0.107	
Total Xylenes*	<0.150	0.150	08/18/2026	ND	6.10	102	6.00	0.219	
Total BTEX	<0.300	0.300	08/18/2026	ND					

Surrogate: 4-Bromofluorobenzene (PID) 99.4 % 70.7-129

Chloride, SM4500Cl-B		mg/kg		Analyzed By: ED						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Chloride	144	16.0	08/18/2026	ND	432	108	400	3.64		

TPH 8015M		mg/kg		Analyzed By: MS					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	<10.0	10.0	08/18/2026	ND	207	103	200	0.0585	
DRO >C10-C28*	<10.0	10.0	08/18/2026	ND	224	112	200	0.146	
EXT DRO >C28-C36	<10.0	10.0	08/18/2026	ND					

Surrogate: 1-Chlorooctane 82.0 % 48-117

Surrogate: 1-Chlorooctadecane 75.7 % 39-120

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

STANDARD SAFETY & SUPPLY
 ETHAN SESSUMS
 PO BOX 14987
 ODESSA TX, 79764
 Fax To: NA

Received: 08/13/2026
 Reported: 08/19/2026
 Project Name: LOST TANK 18 CPF (6/17/2026)
 Project Number: NONE GIVEN
 Project Location: OXY-LEA COUNTY, NEW MEXICO

Sampling Date: 08/11/2026
 Sampling Type: Soil
 Sampling Condition: Cool & Intact
 Sample Received By: Shalyn Rodriguez

Sample ID: H - 9A 0-6" (H264737-06)

BTEx 8021B		mg/kg		Analyzed By: JH						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Benzene*	<0.050	0.050	08/18/2026	ND	2.20	110	2.00	2.86		
Toluene*	<0.050	0.050	08/18/2026	ND	2.00	99.8	2.00	0.447		
Ethylbenzene*	<0.050	0.050	08/18/2026	ND	2.02	101	2.00	0.107		
Total Xylenes*	<0.150	0.150	08/18/2026	ND	6.10	102	6.00	0.219		
Total BTEX	<0.300	0.300	08/18/2026	ND						

Surrogate: 4-Bromofluorobenzene (PID) 99.5 % 70.7-129

Chloride, SM4500Cl-B		mg/kg		Analyzed By: ED						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Chloride	160	16.0	08/18/2026	ND	432	108	400	3.64		

TPH 8015M		mg/kg		Analyzed By: MS					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	<10.0	10.0	08/18/2026	ND	207	103	200	0.0585	
DRO >C10-C28*	<10.0	10.0	08/18/2026	ND	224	112	200	0.146	
EXT DRO >C28-C36	<10.0	10.0	08/18/2026	ND					

Surrogate: 1-Chlorooctane 83.0 % 48-117

Surrogate: 1-Chlorooctadecane 76.7 % 39-120

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

STANDARD SAFETY & SUPPLY
 ETHAN SESSUMS
 PO BOX 14987
 ODESSA TX, 79764
 Fax To: NA

Received: 08/13/2026
 Reported: 08/19/2026
 Project Name: LOST TANK 18 CPF (6/17/2026)
 Project Number: NONE GIVEN
 Project Location: OXY-LEA COUNTY, NEW MEXICO

Sampling Date: 08/11/2026
 Sampling Type: Soil
 Sampling Condition: Cool & Intact
 Sample Received By: Shalyn Rodriguez

Sample ID: H - 10 A 0-6" (H264737-07)

BTX 8021B		mg/kg		Analyzed By: JH						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Benzene*	<0.050	0.050	08/18/2026	ND	2.20	110	2.00	2.86		
Toluene*	<0.050	0.050	08/18/2026	ND	2.00	99.8	2.00	0.447		
Ethylbenzene*	<0.050	0.050	08/18/2026	ND	2.02	101	2.00	0.107		
Total Xylenes*	<0.150	0.150	08/18/2026	ND	6.10	102	6.00	0.219		
Total BTX	<0.300	0.300	08/18/2026	ND						

Surrogate: 4-Bromofluorobenzene (PID) 99.5 % 70.7-129

Chloride, SM4500CI-B		mg/kg		Analyzed By: ED						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Chloride	368	16.0	08/18/2026	ND	432	108	400	3.64		

TPH 8015M		mg/kg		Analyzed By: MS					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	<10.0	10.0	08/18/2026	ND	207	103	200	0.0585	
DRO >C10-C28*	35.4	10.0	08/18/2026	ND	224	112	200	0.146	
EXT DRO >C28-C36	16.6	10.0	08/18/2026	ND					

Surrogate: 1-Chlorooctane 87.1 % 48-117

Surrogate: 1-Chlorooctadecane 82.0 % 39-120

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

STANDARD SAFETY & SUPPLY
 ETHAN SESSUMS
 PO BOX 14987
 ODESSA TX, 79764
 Fax To: NA

Received: 08/13/2026
 Reported: 08/19/2026
 Project Name: LOST TANK 18 CPF (6/17/2026)
 Project Number: NONE GIVEN
 Project Location: OXY-LEA COUNTY, NEW MEXICO

Sampling Date: 08/11/2026
 Sampling Type: Soil
 Sampling Condition: Cool & Intact
 Sample Received By: Shalyn Rodriguez

Sample ID: H - 12 A 0-6" (H264737-08)

BTX 8021B		mg/kg		Analyzed By: JH						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Benzene*	<0.050	0.050	08/18/2026	ND	2.04	102	2.00	1.51		
Toluene*	<0.050	0.050	08/18/2026	ND	2.07	103	2.00	4.34		
Ethylbenzene*	<0.050	0.050	08/18/2026	ND	2.00	99.8	2.00	5.36		
Total Xylenes*	<0.150	0.150	08/18/2026	ND	6.06	101	6.00	5.27		
Total BTX	<0.300	0.300	08/18/2026	ND						

Surrogate: 4-Bromofluorobenzene (PID) 111 % 70.7-129

Chloride, SM4500CI-B		mg/kg		Analyzed By: ED						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Chloride	96.0	16.0	08/18/2026	ND	432	108	400	3.64		

TPH 8015M		mg/kg		Analyzed By: MS					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	<10.0	10.0	08/18/2026	ND	207	103	200	0.0585	
DRO >C10-C28*	<10.0	10.0	08/18/2026	ND	224	112	200	0.146	
EXT DRO >C28-C36	<10.0	10.0	08/18/2026	ND					

Surrogate: 1-Chlorooctane 84.5 % 48-117

Surrogate: 1-Chlorooctadecane 79.5 % 39-120

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

STANDARD SAFETY & SUPPLY
 ETHAN SESSUMS
 PO BOX 14987
 ODESSA TX, 79764
 Fax To: NA

Received: 08/13/2026
 Reported: 08/19/2026
 Project Name: LOST TANK 18 CPF (6/17/2026)
 Project Number: NONE GIVEN
 Project Location: OXY-LEA COUNTY, NEW MEXICO

Sampling Date: 08/11/2026
 Sampling Type: Soil
 Sampling Condition: Cool & Intact
 Sample Received By: Shalyn Rodriguez

Sample ID: H - 13 A 0-6" (H264737-09)

BTEx 8021B		mg/kg		Analyzed By: JH						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Benzene*	<0.050	0.050	08/18/2026	ND	2.04	102	2.00	1.51		
Toluene*	<0.050	0.050	08/18/2026	ND	2.07	103	2.00	4.34		
Ethylbenzene*	<0.050	0.050	08/18/2026	ND	2.00	99.8	2.00	5.36		
Total Xylenes*	<0.150	0.150	08/18/2026	ND	6.06	101	6.00	5.27		
Total BTEx	<0.300	0.300	08/18/2026	ND						

Surrogate: 4-Bromofluorobenzene (PID) 108 % 70.7-129

Chloride, SM4500CI-B		mg/kg		Analyzed By: ED						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Chloride	224	16.0	08/18/2026	ND	432	108	400	3.64		

TPH 8015M		mg/kg		Analyzed By: MS					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	<10.0	10.0	08/18/2026	ND	207	103	200	0.0585	
DRO >C10-C28*	49.7	10.0	08/18/2026	ND	224	112	200	0.146	
EXT DRO >C28-C36	31.1	10.0	08/18/2026	ND					

Surrogate: 1-Chlorooctane 83.4 % 48-117

Surrogate: 1-Chlorooctadecane 78.1 % 39-120

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Analytical Results For:

STANDARD SAFETY & SUPPLY
 ETHAN SESSUMS
 PO BOX 14987
 ODESSA TX, 79764
 Fax To: NA

Received: 08/13/2026
 Reported: 08/19/2026
 Project Name: LOST TANK 18 CPF (6/17/2026)
 Project Number: NONE GIVEN
 Project Location: OXY-LEA COUNTY, NEW MEXICO

Sampling Date: 08/11/2026
 Sampling Type: Soil
 Sampling Condition: Cool & Intact
 Sample Received By: Shalyn Rodriguez

Sample ID: V - 3 2-2.5' (H264737-10)

BTEx 8021B		mg/kg		Analyzed By: JH					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
Benzene*	<0.050	0.050	08/18/2026	ND	2.04	102	2.00	1.51	
Toluene*	<0.050	0.050	08/18/2026	ND	2.07	103	2.00	4.34	
Ethylbenzene*	<0.050	0.050	08/18/2026	ND	2.00	99.8	2.00	5.36	
Total Xylenes*	<0.150	0.150	08/18/2026	ND	6.06	101	6.00	5.27	
Total BTEx	<0.300	0.300	08/18/2026	ND					

Surrogate: 4-Bromofluorobenzene (PID) 109 % 70.7-129

Chloride, SM4500CI-B		mg/kg		Analyzed By: ED						
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier	
Chloride	80.0	16.0	08/18/2026	ND	432	108	400	3.64		

TPH 8015M		mg/kg		Analyzed By: MS					
Analyte	Result	Reporting Limit	Analyzed	Method Blank	BS	% Recovery	True Value QC	RPD	Qualifier
GRO C6-C10*	<10.0	10.0	08/18/2026	ND	207	103	200	0.0585	
DRO >C10-C28*	16.1	10.0	08/18/2026	ND	224	112	200	0.146	
EXT DRO >C28-C36	<10.0	10.0	08/18/2026	ND					

Surrogate: 1-Chlorooctane 100 % 48-117

Surrogate: 1-Chlorooctadecane 96.5 % 39-120

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

Celey D. Keene, Lab Director/Quality Manager



PHONE (575) 393-2326 ° 101 E. MARLAND ° HOBBS, NM 88240

Notes and Definitions

ND	Analyte NOT DETECTED at or above the reporting limit
RPD	Relative Percent Difference
**	Samples not received at proper temperature of 6°C or below.
***	Insufficient time to reach temperature.
-	Chloride by SM4500Cl-B does not require samples be received at or below 6°C Samples reported on an as received basis (wet) unless otherwise noted on report

Cardinal Laboratories

*=Accredited Analyte

PLEASE NOTE: Liability and Damages. Cardinal's liability and client's exclusive remedy for any claim arising, whether based in contract or tort, shall be limited to the amount paid by client for analyses. All claims, including those for negligence and any other cause whatsoever shall be deemed waived unless made in writing and received by Cardinal within thirty (30) days after completion of the applicable service. In no event shall Cardinal be liable for incidental or consequential damages, including, without limitation, business interruptions, loss of use, or loss of profits incurred by client, its subsidiaries, affiliates or successors arising out of or related to the performance of the services hereunder by Cardinal, regardless of whether such claim is based upon any of the above stated reasons or otherwise. Results relate only to the samples identified above. This report shall not be reproduced except in full with written approval of Cardinal Laboratories.

A handwritten signature in cursive script, appearing to read "Celey D. Keene", written in black ink.

Celey D. Keene, Lab Director/Quality Manager



Chain of Custody

Project Manager:	Ethan Sessums	Bill to: (if different)	Daniel Sparks
Company Name:	Standard Safety & Supply	Company Name:	Occidental Petroleum
Address:	2425 Trunk St.	Address:	
City, State ZIP:	Odessa, Texas, 79761	City, State ZIP:	
Phone:	254-266-5456	Email:	Carlsbadoffice@standardtx.com

Main Office: 2524 Trunk Street, Odessa Texas 79761
 Contact: (432) 653-0393
<https://standardtx.com/>
 Page 1 of 1

Work Order Comments
 PO # will be provided by oxy

H2104737

Page 13 of 13

Project Name:				Turn Around		Pres. Code	ANALYSIS REQUEST										Preservative Codes			
Project Number:				☒ Routine	☐ Rush															
Project Location:				Due Date:		5 Day														
Sampler's Name:				TAI may vary based on lab start time.																
PO #:																				
Project Name:				Lost Tank 18 CPF- 6/17/2026													None: NO		DI Water: H ₂ O	
Project Number:																	Cool: Cool		MeOH: Me	
Project Location:				Lea County, New Mexico													HCL: HC		HNO ₃ : HN	
Sampler's Name:				Edward Bartlett													H ₂ SO ₄ : H ₂		NaOH: Na	
SAMPLE RECEIPT				Temp Blank:	Yes ☒ No ☐	Wet Ice:	Yes ☒ No ☐											H ₃ PO ₄ : HP		
Samples Received Intact:				Yes ☒ No ☐	Thermometer ID:													NaHSO ₄ : NABIS		
Cooler Custody Seals:				Yes ☒ No ☐	Correction Factor:													Na ₂ S ₂ O ₃ : NaSO ₃		
Sample Custody Seals:				Yes ☒ No ☐	Temperature Reading:													Zn Acetate+NaOH: Zn		
Total Containers:				10	Corrected Temperature:													NaOH+Ascorbic Acid: SAPC		
Sample Identification		Depth	Date Sampled	Time Sampled	Matrix	Grab Com	# of Cont	Parameters										Sample Comments		
H-1A		0-6"	11/8/2026	8:00	S	Grab	1	BTEX 8021B										1		
H-3A		0-6"	11/8/2026	8:10	S	Grab	1	TPH 8015M (GRO-DRO-MRO)										3		
H-4A		0-6"	11/8/2026	8:20	S	Grab	1	Chloride 4500 or EPA 300										4		
H-6A		0-6"	11/8/2026	8:30	S	Grab	1											5		
H-7A		0-6"	11/8/2026	8:40	S	Grab	1											6		
H-9A		0-6"	11/8/2026	8:50	S	Grab	1											7		
H-10A		0-6"	11/8/2026	9:00	S	Grab	1											8		
H-12A		0-6"	11/8/2026	9:10	S	Grab	1											9		
H-13A		0-6"	11/8/2026	9:20	S	Grab	1											10		
V-3		2-2.5	11/8/2026	9:30	S	Grab	1													
Relinquished by: (Signature)		Received by: (Signature)		Date/Time		Relinquished by: (Signature)		Received by: (Signature)		Date/Time										
Edward Bartlett		<i>Edward Bartlett</i>		8/13/2011																

Disclaimer: This document and any files transmitted with it are confidential and intended solely for the use of the individual or entity to whom they are addressed

200-04082011

Sante Fe Main Office
Phone: (505) 476-3441

General Information
Phone: (505) 629-6116

Online Phone Directory
<https://www.emnrd.nm.gov/ocd/contact-us>

State of New Mexico
Energy, Minerals and Natural Resources
Oil Conservation Division
1220 S. St Francis Dr.
Santa Fe, NM 87505

QUESTIONS

Action 621333

QUESTIONS

Operator: OXY USA INC P.O. Box 4294 Houston, TX 772104294	OGRID: 16696
	Action Number: 621333
	Action Type: [C-141] Site Char./Remediation Plan C-141 (C-141-v-Plan)

QUESTIONS

Prerequisites	
Incident ID (n#)	nAPP2618354985
Incident Name	NAPP2618354985 LOST TANK 18 TANKLESS CPF @ N-18-22S-32E
Incident Type	Produced Water Release
Incident Status	Remediation Plan Received

Location of Release Source

Please answer all the questions in this group.

Site Name	LOST TANK 18 TANKLESS CPF
Date Release Discovered	06/17/2026
Surface Owner	Federal

Incident Details

Please answer all the questions in this group.

Incident Type	Produced Water Release
Did this release result in a fire or is the result of a fire	No
Did this release result in any injuries	No
Has this release reached or does it have a reasonable probability of reaching a watercourse	No
Has this release endangered or does it have a reasonable probability of endangering public health	No
Has this release substantially damaged or will it substantially damage property or the environment	No
Is this release of a volume that is or may with reasonable probability be detrimental to fresh water	No

Nature and Volume of Release

Material(s) released, please answer all that apply below. Any calculations or specific justifications for the volumes provided should be attached to the follow-up C-141 submission.

Crude Oil Released (bbls) Details	Cause: Corrosion Separator Crude Oil Released: 10 BBL Recovered: 0 BBL Lost: 10 BBL.
Produced Water Released (bbls) Details	Cause: Corrosion Separator Produced Water Released: 10 BBL Recovered: 0 BBL Lost: 10 BBL.
Is the concentration of chloride in the produced water >10,000 mg/l	Yes
Condensate Released (bbls) Details	Not answered.
Natural Gas Vented (Mcf) Details	Not answered.
Natural Gas Flared (Mcf) Details	Not answered.
Other Released Details	Not answered.
Are there additional details for the questions above (i.e. any answer containing Other, Specify, Unknown, and/or Fire, or any negative lost amounts)	Not answered.

Sante Fe Main Office
Phone: (505) 476-3441

General Information
Phone: (505) 629-6116

Online Phone Directory
<https://www.emnrd.nm.gov/ocd/contact-us>

State of New Mexico
Energy, Minerals and Natural Resources
Oil Conservation Division
1220 S. St Francis Dr.
Santa Fe, NM 87505

QUESTIONS, Page 2

Action 621333

QUESTIONS (continued)

Operator: OXY USA INC P.O. Box 4294 Houston, TX 772104294	OGRID: 16696
	Action Number: 621333
	Action Type: [C-141] Site Char./Remediation Plan C-141 (C-141-v-Plan)

QUESTIONS

Nature and Volume of Release (continued)	
Is this a gas only submission (i.e. only significant Mcf values reported)	No, according to supplied volumes this does not appear to be a "gas only" report.
Was this a major release as defined by Subsection A of 19.15.29.7 NMAC	No
Reasons why this would be considered a submission for a notification of a major release	Unavailable.
With the implementation of the 19.15.27 NMAC (05/25/2021), venting and/or flaring of natural gas (i.e. gas only) are to be submitted on the C-129 form.	

Initial Response

The responsible party must undertake the following actions immediately unless they could create a safety hazard that would result in injury.

The source of the release has been stopped	True
The impacted area has been secured to protect human health and the environment	True
Released materials have been contained via the use of berms or dikes, absorbent pads, or other containment devices	True
All free liquids and recoverable materials have been removed and managed appropriately	True
If all the actions described above have not been undertaken, explain why	Not answered.

Per Paragraph (4) of Subsection B of 19.15.29.8 NMAC the responsible party may commence remediation immediately after discovery of a release. If remediation has begun, please prepare and attach a narrative of actions to date in the follow-up C-141 submission. If remedial efforts have been successfully completed or if the release occurred within a lined containment area (see Subparagraph (a) of Paragraph (5) of Subsection A of 19.15.29.11 NMAC), please prepare and attach all information needed for closure evaluation in the follow-up C-141 submission.

I hereby certify that the information given above is true and complete to the best of my knowledge and understand that pursuant to OCD rules and regulations all operators are required to report and/or file certain release notifications and perform corrective actions for releases which may endanger public health or the environment. The acceptance of a C-141 report by the OCD does not relieve the operator of liability should their operations have failed to adequately investigate and remediate contamination that pose a threat to groundwater, surface water, human health or the environment. In addition, OCD acceptance of a C-141 report does not relieve the operator of responsibility for compliance with any other federal, state, or local laws and/or regulations.

I hereby agree and sign off to the above statement	Name: Standard Company Email: CarlsbadOffice@standardtx.com Date: 09/03/2026
--	---

Sante Fe Main Office
Phone: (505) 476-3441

General Information
Phone: (505) 629-6116

Online Phone Directory
<https://www.emnrd.nm.gov/ocd/contact-us>

State of New Mexico
Energy, Minerals and Natural Resources
Oil Conservation Division
1220 S. St Francis Dr.
Santa Fe, NM 87505

QUESTIONS, Page 3

Action 621333

QUESTIONS (continued)

Operator: OXY USA INC P.O. Box 4294 Houston, TX 772104294	OGRID: 16696
	Action Number: 621333
	Action Type: [C-141] Site Char./Remediation Plan C-141 (C-141-v-Plan)

QUESTIONS

Site Characterization	
<i>Please answer all the questions in this group (only required when seeking remediation plan approval and beyond). This information must be provided to the appropriate district office no later than 90 days after the release discovery date.</i>	
What is the shallowest depth to groundwater beneath the area affected by the release in feet below ground surface (ft bgs)	Between 100 and 500 (ft.)
What method was used to determine the depth to ground water	Attached Document
Did this release impact groundwater or surface water	No
What is the minimum distance, between the closest lateral extents of the release and the following surface areas:	
A continuously flowing watercourse or any other significant watercourse	Between ½ and 1 (mi.)
Any lakebed, sinkhole, or playa lake (measured from the ordinary high-water mark)	Between ½ and 1 (mi.)
An occupied permanent residence, school, hospital, institution, or church	Greater than 5 (mi.)
A spring or a private domestic fresh water well used by less than five households for domestic or stock watering purposes	Between ½ and 1 (mi.)
Any other fresh water well or spring	Between 1 and 5 (mi.)
Incorporated municipal boundaries or a defined municipal fresh water well field	Greater than 5 (mi.)
A wetland	Between ½ and 1 (mi.)
A subsurface mine	Greater than 5 (mi.)
An (non-karst) unstable area	Greater than 5 (mi.)
Categorize the risk of this well / site being in a karst geology	Low
A 100-year floodplain	Between 1 and 5 (mi.)
Did the release impact areas not on an exploration, development, production, or storage site	No

Remediation Plan	
<i>Please answer all the questions that apply or are indicated. This information must be provided to the appropriate district office no later than 90 days after the release discovery date.</i>	
Requesting a remediation plan approval with this submission	Yes
<i>Attach a comprehensive report demonstrating the lateral and vertical extents of soil contamination associated with the release have been determined, pursuant to 19.15.29.11 NMAC and 19.15.29.13 NMAC.</i>	
Have the lateral and vertical extents of contamination been fully delineated	Yes
Was this release entirely contained within a lined containment area	No
Soil Contamination Sampling: (Provide the highest observable value for each, in milligrams per kilograms.)	
Chloride (EPA 300.0 or SM4500 Cl B)	13600
TPH (GRO+DRO+MRO) (EPA SW-846 Method 8015M)	14480
GRO+DRO (EPA SW-846 Method 8015M)	12200
BTEX (EPA SW-846 Method 8021B or 8260B)	6.4
Benzene (EPA SW-846 Method 8021B or 8260B)	0
<i>Per Subsection B of 19.15.29.11 NMAC unless the site characterization report includes completed efforts at remediation, the report must include a proposed remediation plan in accordance with 19.15.29.12 NMAC, which includes the anticipated timelines for beginning and completing the remediation.</i>	
On what estimated date will the remediation commence	10/26/2026
On what date will (or did) the final sampling or liner inspection occur	12/04/2026
On what date will (or was) the remediation complete(d)	12/18/2026
What is the estimated surface area (in square feet) that will be reclaimed	0
What is the estimated volume (in cubic yards) that will be reclaimed	0
What is the estimated surface area (in square feet) that will be remediated	7500
What is the estimated volume (in cubic yards) that will be remediated	337
<i>These estimated dates and measurements are recognized to be the best guess or calculation at the time of submission and may (be) change(d) over time as more remediation efforts are completed.</i>	
<i>The OCD recognizes that proposed remediation measures may have to be minimally adjusted in accordance with the physical realities encountered during remediation. If the responsible party has any need to significantly deviate from the remediation plan proposed, then it should consult with the division to determine if another remediation plan submission is required.</i>	

Sante Fe Main Office
Phone: (505) 476-3441

General Information
Phone: (505) 629-6116

Online Phone Directory
<https://www.emnrd.nm.gov/ocd/contact-us>

State of New Mexico
Energy, Minerals and Natural Resources
Oil Conservation Division
1220 S. St Francis Dr.
Santa Fe, NM 87505

QUESTIONS, Page 4

Action 621333

QUESTIONS (continued)

Operator: OXY USA INC P.O. Box 4294 Houston, TX 772104294	OGRID: 16696
	Action Number: 621333
	Action Type: [C-141] Site Char./Remediation Plan C-141 (C-141-v-Plan)

QUESTIONS

Remediation Plan (continued)	
<i>Please answer all the questions that apply or are indicated. This information must be provided to the appropriate district office no later than 90 days after the release discovery date.</i>	
This remediation will (or is expected to) utilize the following processes to remediate / reduce contaminants:	
<i>(Select all answers below that apply.)</i>	
(Ex Situ) Excavation and off-site disposal (i.e. dig and haul, hydrovac, etc.)	Yes
Which OCD approved facility will be used for off-site disposal	fEEM0112342028 LEA LAND LANDFILL
OR which OCD approved well (API) will be used for off-site disposal	Not answered.
OR is the off-site disposal site, to be used, out-of-state	Not answered.
OR is the off-site disposal site, to be used, an NMED facility	Not answered.
(Ex Situ) Excavation and on-site remediation (i.e. On-Site Land Farms)	Not answered.
(In Situ) Soil Vapor Extraction	Not answered.
(In Situ) Chemical processing (i.e. Soil Shredding, Potassium Permanganate, etc.)	Not answered.
(In Situ) Biological processing (i.e. Microbes / Fertilizer, etc.)	Not answered.
(In Situ) Physical processing (i.e. Soil Washing, Gypsum, Disking, etc.)	Not answered.
Ground Water Abatement pursuant to 19.15.30 NMAC	Not answered.
OTHER (Non-listed remedial process)	Not answered.
<i>Per Subsection B of 19.15.29.11 NMAC unless the site characterization report includes completed efforts at remediation, the report must include a proposed remediation plan in accordance with 19.15.29.12 NMAC, which includes the anticipated timelines for beginning and completing the remediation.</i>	
I hereby certify that the information given above is true and complete to the best of my knowledge and understand that pursuant to OCD rules and regulations all operators are required to report and/or file certain release notifications and perform corrective actions for releases which may endanger public health or the environment. The acceptance of a C-141 report by the OCD does not relieve the operator of liability should their operations have failed to adequately investigate and remediate contamination that pose a threat to groundwater, surface water, human health or the environment. In addition, OCD acceptance of a C-141 report does not relieve the operator of responsibility for compliance with any other federal, state, or local laws and/or regulations.	
I hereby agree and sign off to the above statement	Name: Standard Company Email: CarlsbadOffice@standardtx.com Date: 09/03/2026
<i>The OCD recognizes that proposed remediation measures may have to be minimally adjusted in accordance with the physical realities encountered during remediation. If the responsible party has any need to significantly deviate from the remediation plan proposed, then it should consult with the division to determine if another remediation plan submission is required.</i>	

Sante Fe Main Office
Phone: (505) 476-3441

General Information
Phone: (505) 629-6116

Online Phone Directory
<https://www.emnrd.nm.gov/ocd/contact-us>

State of New Mexico
Energy, Minerals and Natural Resources
Oil Conservation Division
1220 S. St Francis Dr.
Santa Fe, NM 87505

QUESTIONS, Page 5

Action 621333

QUESTIONS (continued)

Operator: OXY USA INC P.O. Box 4294 Houston, TX 772104294	OGRID: 16696
	Action Number: 621333
	Action Type: [C-141] Site Char./Remediation Plan C-141 (C-141-v-Plan)

QUESTIONS

Deferral Requests Only	
Only answer the questions in this group if seeking a deferral upon approval this submission. Each of the following items must be confirmed as part of any request for deferral of remediation.	
Requesting a deferral of the remediation closure due date with the approval of this submission	No

Sante Fe Main Office
Phone: (505) 476-3441

General Information
Phone: (505) 629-6116

Online Phone Directory
<https://www.emnrd.nm.gov/ocd/contact-us>

State of New Mexico
Energy, Minerals and Natural Resources
Oil Conservation Division
1220 S. St Francis Dr.
Santa Fe, NM 87505

QUESTIONS, Page 6

Action 621333

QUESTIONS (continued)

Operator: OXY USA INC P.O. Box 4294 Houston, TX 772104294	OGRID: 16696
	Action Number: 621333
	Action Type: [C-141] Site Char./Remediation Plan C-141 (C-141-v-Plan)

QUESTIONS

Sampling Event Information	
Last sampling notification (C-141N) recorded	{Unavailable.}

Remediation Closure Request

Only answer the questions in this group if seeking remediation closure for this release because all remediation steps have been completed.

Requesting a remediation closure approval with this submission	No
--	----

Sante Fe Main Office
Phone: (505) 476-3441

General Information
Phone: (505) 629-6116

Online Phone Directory
<https://www.emnrd.nm.gov/ocd/contact-us>

State of New Mexico
Energy, Minerals and Natural Resources
Oil Conservation Division
1220 S. St Francis Dr.
Santa Fe, NM 87505

CONDITIONS

Action 621333

CONDITIONS

Operator: OXY USA INC P.O. Box 4294 Houston, TX 772104294	OGRID: 16696
	Action Number: 621333
	Action Type: [C-141] Site Char./Remediation Plan C-141 (C-141-v-Plan)

CONDITIONS

Created By	Condition	Condition Date
scwells	Remediation plan approved with the following conditions:	9/4/2026
scwells	1) Excavation must continue past the proposed depths of excavation if confirmation samples do not meet the applicable Table I Closure Criteria.	9/4/2026
scwells	2) OCD requires that any base or wall that is exposed during excavation, even due to benching and sloping, have samples collected pursuant to 19.15.29 NMAC. Ensure sidewall samples are collected between varying depths of excavation. These must be clearly shown on the Figures in the submitted closure report.	9/4/2026
scwells	3) Submit a complete and accurate report to the OCD by 12/3/2026.	9/4/2026