

District I
1625 N. French Dr., Hobbs, NM 88240
District II
811 S. First St., Artesia, NM 88210
District III
1000 Rio Brazos Road, Aztec, NM 87410
District IV
1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico
Energy Minerals and Natural Resources
Department
Oil Conservation Division
1220 South St. Francis Dr.
Santa Fe, NM 87505

Form C-144
Revised April 3, 2017

For temporary pits, below-grade tanks, and multi-well fluid management pits, submit to the appropriate NMOCD District Office.
For permanent pits submit to the Santa Fe Environmental Bureau office and provide a copy to the appropriate NMOCD District Office.

BGT 1 Pit, Below-Grade Tank, or Proposed Alternative Method Permit or Closure Plan Application

- Type of action: Below grade tank registration
 Permit of a pit or proposed alternative method
 Closure of a pit, below-grade tank, or proposed alternative method
 Modification to an existing permit/or registration
 Closure plan only submitted for an existing permitted or non-permitted pit, below-grade tank, or proposed alternative method

Instructions: Please submit one application (Form C-144) per individual pit, below-grade tank or alternative request

Please be advised that approval of this request does not relieve the operator of liability should operations result in pollution of surface water, ground water or the environment. Nor does approval relieve the operator of its responsibility to comply with any other applicable governmental authority's rules, regulations or ordinances.

1.
Operator: Hilcorp Energy Company OGRID #: 372171
 Address: 382 Road 3100 Aztec, NM 87410
 Facility or well name: Huerfano Unit Com 518
 API Number: 30-045-29175 OCD Permit Number: #13251
 U/L or Qtr/Qtr N Section 16 Township 26N Range 09W County: San Juan
 Center of Proposed Design: Latitude 36.483272 Longitude -107.797547 NAD83
 Surface Owner: Federal State Private Tribal Trust or Indian Allotment

2.
 Pit: Subsection F, G or J of 19.15.17.11 NMAC
 Temporary: Drilling Workover
 Permanent Emergency Cavitation P&A Multi-Well Fluid Management Low Chloride Drilling Fluid yes no
 Lined Unlined Liner type: Thickness _____ mil LLDPE HDPE PVC Other _____
 String-Reinforced
 Liner Seams: Welded Factory Other _____ Volume: _____ bbl Dimensions: L _____ x W _____ x D _____

3.
 Below-grade tank: Subsection I of 19.15.17.11 NMAC
 Volume: 120 bbl Type of fluid: Produced Water
 Tank Construction material: Metal
 Secondary containment with leak detection Visible sidewalls, liner, 6-inch lift and automatic overflow shut-off
 Visible sidewalls and liner Visible sidewalls only Other _____
 Liner type: Thickness _____ mil HDPE PVC Other Unspecified

4.
 Alternative Method:
 Submittal of an exception request is required. Exceptions must be submitted to the Santa Fe Environmental Bureau office for consideration of approval.

5.
Fencing: Subsection D of 19.15.17.11 NMAC (*Applies to permanent pits, temporary pits, and below-grade tanks*)
 Chain link, six feet in height, two strands of barbed wire at top (*Required if located within 1000 feet of a permanent residence, school, hospital, institution or church*)
 Four foot height, four strands of barbed wire evenly spaced between one and four feet
 Alternate. Please specify _____

6.
Netting: Subsection E of 19.15.17.11 NMAC (*Applies to permanent pits and permanent open top tanks*)
 Screen Netting Other _____
 Monthly inspections (If netting or screening is not physically feasible)

7.
Signs: Subsection C of 19.15.17.11 NMAC
 12"x 24", 2" lettering, providing Operator's name, site location, and emergency telephone numbers
 Signed in compliance with 19.15.16.8 NMAC

8.
Variations and Exceptions:
 Justifications and/or demonstrations of equivalency are required. Please refer to 19.15.17 NMAC for guidance.
Please check a box if one or more of the following is requested, if not leave blank:
 Variance(s): Requests must be submitted to the appropriate division district for consideration of approval.
 Exception(s): Requests must be submitted to the Santa Fe Environmental Bureau office for consideration of approval.

9.
Siting Criteria (regarding permitting): 19.15.17.10 NMAC
Instructions: The applicant must demonstrate compliance for each siting criteria below in the application. Recommendations of acceptable source material are provided below. Siting criteria does not apply to drying pads or above-grade tanks.

| <u>General siting</u> | |
|---|--|
| <u>Ground water is less than 25 feet below the bottom of a low chloride temporary pit or below-grade tank.</u> - <input type="checkbox"/> NM Office of the State Engineer - iWATERS database search; <input type="checkbox"/> USGS; <input type="checkbox"/> Data obtained from nearby wells | <input type="checkbox"/> Yes <input type="checkbox"/> No <input checked="" type="checkbox"/> NA |
| <u>Ground water is less than 50 feet below the bottom of a Temporary pit, permanent pit, or Multi-Well Fluid Management pit .</u> NM Office of the State Engineer - iWATERS database search; USGS; Data obtained from nearby wells | <input type="checkbox"/> Yes <input type="checkbox"/> No <input checked="" type="checkbox"/> NA |
| Within incorporated municipal boundaries or within a defined municipal fresh water well field covered under a municipal ordinance adopted pursuant to NMSA 1978, Section 3-27-3, as amended. (Does not apply to below grade tanks) - Written confirmation or verification from the municipality; Written approval obtained from the municipality | <input type="checkbox"/> Yes <input type="checkbox"/> No |
| Within the area overlying a subsurface mine. (Does not apply to below grade tanks) - Written confirmation or verification or map from the NM EMNRD-Mining and Mineral Division | <input type="checkbox"/> Yes <input type="checkbox"/> No |
| Within an unstable area. (Does not apply to below grade tanks) - Engineering measures incorporated into the design; NM Bureau of Geology & Mineral Resources; USGS; NM Geological Society; Topographic map | <input type="checkbox"/> Yes <input type="checkbox"/> No |
| Within a 100-year floodplain. (Does not apply to below grade tanks) - FEMA map | <input type="checkbox"/> Yes <input type="checkbox"/> No |
| <u>Below Grade Tanks</u> | |
| Within 100 feet of a continuously flowing watercourse, significant watercourse, lake bed, sinkhole, wetland or playa lake (measured from the ordinary high-water mark). - Topographic map; Visual inspection (certification) of the proposed site | <input type="checkbox"/> Yes <input checked="" type="checkbox"/> No |
| Within 200 horizontal feet of a spring or a fresh water well used for public or livestock consumption;. - NM Office of the State Engineer - iWATERS database search; Visual inspection (certification) of the proposed site | <input type="checkbox"/> Yes <input checked="" type="checkbox"/> No |
| <u>Temporary Pit using Low Chloride Drilling Fluid</u> (maximum chloride content 15,000 mg/liter) | |
| Within 100 feet of a continuously flowing watercourse, or any other significant watercourse or within 200 feet of any lakebed, sinkhole, or playa lake (measured from the ordinary high-water mark). (Applies to low chloride temporary pits.) - Topographic map; Visual inspection (certification) of the proposed site | <input type="checkbox"/> Yes <input type="checkbox"/> No |
| Within 300 feet from a occupied permanent residence, school, hospital, institution, or church in existence at the time of initial application. - Visual inspection (certification) of the proposed site; Aerial photo; Satellite image | <input type="checkbox"/> Yes <input type="checkbox"/> No |
| Within 200 horizontal feet of a spring or a private, domestic fresh water well used by less than five households for domestic or stock watering purposes, or 300feet of any other fresh water well or spring, in existence at the time of the initial application. NM Office of the State Engineer - iWATERS database search; Visual inspection (certification) of the proposed site | <input type="checkbox"/> Yes <input type="checkbox"/> No |

Within 100 feet of a wetland.
 - US Fish and Wildlife Wetland Identification map; Topographic map; Visual inspection (certification) of the proposed site Yes No

Temporary Pit Non-low chloride drilling fluid

Within 300 feet of a continuously flowing watercourse, or any other significant watercourse, or within 200 feet of any lakebed, sinkhole, or playa lake (measured from the ordinary high-water mark).
 - Topographic map; Visual inspection (certification) of the proposed site Yes No

Within 300 feet from a permanent residence, school, hospital, institution, or church in existence at the time of initial application.
 - Visual inspection (certification) of the proposed site; Aerial photo; Satellite image Yes No

Within 500 horizontal feet of a spring or a private, domestic fresh water well used by less than five households for domestic or stock watering purposes, or 1000 feet of any other fresh water well or spring, in the existence at the time of the initial application;
 - NM Office of the State Engineer - iWATERS database search; Visual inspection (certification) of the proposed site Yes No

Within 300 feet of a wetland.
 - US Fish and Wildlife Wetland Identification map; Topographic map; Visual inspection (certification) of the proposed site Yes No

Permanent Pit or Multi-Well Fluid Management Pit

Within 300 feet of a continuously flowing watercourse, or 200 feet of any other significant watercourse, or lakebed, sinkhole, or playa lake (measured from the ordinary high-water mark).
 - Topographic map; Visual inspection (certification) of the proposed site Yes No

Within 1000 feet from a permanent residence, school, hospital, institution, or church in existence at the time of initial application.
 - Visual inspection (certification) of the proposed site; Aerial photo; Satellite image Yes No

Within 500 horizontal feet of a spring or a fresh water well used for domestic or stock watering purposes, in existence at the time of initial application.
 - NM Office of the State Engineer - iWATERS database search; Visual inspection (certification) of the proposed site Yes No

Within 500 feet of a wetland.
 - US Fish and Wildlife Wetland Identification map; Topographic map; Visual inspection (certification) of the proposed site Yes No

10. Temporary Pits, Emergency Pits, and Below-grade Tanks Permit Application Attachment Checklist: Subsection B of 19.15.17.9 NMAC
Instructions: Each of the following items must be attached to the application. Please indicate, by a check mark in the box, that the documents are attached.

- Hydrogeologic Report (Below-grade Tanks) - based upon the requirements of Paragraph (4) of Subsection B of 19.15.17.9 NMAC
 - Hydrogeologic Data (Temporary and Emergency Pits) - based upon the requirements of Paragraph (2) of Subsection B of 19.15.17.9 NMAC
 - Siting Criteria Compliance Demonstrations - based upon the appropriate requirements of 19.15.17.10 NMAC
 - Design Plan - based upon the appropriate requirements of 19.15.17.11 NMAC
 - Operating and Maintenance Plan - based upon the appropriate requirements of 19.15.17.12 NMAC
 - Closure Plan (Please complete Boxes 14 through 18, if applicable) - based upon the appropriate requirements of Subsection C of 19.15.17.9 NMAC and 19.15.17.13 NMAC
- Previously Approved Design (attach copy of design) API Number: _____ or Permit Number: _____

11. Multi-Well Fluid Management Pit Checklist: Subsection B of 19.15.17.9 NMAC
Instructions: Each of the following items must be attached to the application. Please indicate, by a check mark in the box, that the documents are attached.

- Design Plan - based upon the appropriate requirements of 19.15.17.11 NMAC
 - Operating and Maintenance Plan - based upon the appropriate requirements of 19.15.17.12 NMAC
 - A List of wells with approved application for permit to drill associated with the pit.
 - Closure Plan (Please complete Boxes 14 through 18, if applicable) - based upon the appropriate requirements of Subsection C of 19.15.17.9 NMAC and 19.15.17.13 NMAC
 - Hydrogeologic Data - based upon the requirements of Paragraph (4) of Subsection B of 19.15.17.9 NMAC
 - Siting Criteria Compliance Demonstrations - based upon the appropriate requirements of 19.15.17.10 NMAC
- Previously Approved Design (attach copy of design) API Number: _____ or Permit Number: _____

12.

Permanent Pits Permit Application Checklist: Subsection B of 19.15.17.9 NMAC

Instructions: Each of the following items must be attached to the application. Please indicate, by a check mark in the box, that the documents are attached.

- Hydrogeologic Report - based upon the requirements of Paragraph (1) of Subsection B of 19.15.17.9 NMAC
- Siting Criteria Compliance Demonstrations - based upon the appropriate requirements of 19.15.17.10 NMAC
- Climatological Factors Assessment
- Certified Engineering Design Plans - based upon the appropriate requirements of 19.15.17.11 NMAC
- Dike Protection and Structural Integrity Design - based upon the appropriate requirements of 19.15.17.11 NMAC
- Leak Detection Design - based upon the appropriate requirements of 19.15.17.11 NMAC
- Liner Specifications and Compatibility Assessment - based upon the appropriate requirements of 19.15.17.11 NMAC
- Quality Control/Quality Assurance Construction and Installation Plan
- Operating and Maintenance Plan - based upon the appropriate requirements of 19.15.17.12 NMAC
- Freeboard and Overtopping Prevention Plan - based upon the appropriate requirements of 19.15.17.11 NMAC
- Nuisance or Hazardous Odors, including H₂S, Prevention Plan
- Emergency Response Plan
- Oil Field Waste Stream Characterization
- Monitoring and Inspection Plan
- Erosion Control Plan
- Closure Plan - based upon the appropriate requirements of Subsection C of 19.15.17.9 NMAC and 19.15.17.13 NMAC

13.

Proposed Closure: 19.15.17.13 NMAC

Instructions: Please complete the applicable boxes, Boxes 14 through 18, in regards to the proposed closure plan.

- Type: Drilling Workover Emergency Cavitation P&A Permanent Pit Below-grade Tank Multi-well Fluid Management Pit
 Alternative
- Proposed Closure Method: Waste Excavation and Removal
 Waste Removal (Closed-loop systems only)
 On-site Closure Method (Only for temporary pits and closed-loop systems)
 In-place Burial On-site Trench Burial
 Alternative Closure Method

14.

Waste Excavation and Removal Closure Plan Checklist: (19.15.17.13 NMAC) **Instructions:** Each of the following items must be attached to the closure plan. Please indicate, by a check mark in the box, that the documents are attached.

- Protocols and Procedures - based upon the appropriate requirements of 19.15.17.13 NMAC
- Confirmation Sampling Plan (if applicable) - based upon the appropriate requirements of Subsection C of 19.15.17.13 NMAC
- Disposal Facility Name and Permit Number (for liquids, drilling fluids and drill cuttings)
- Soil Backfill and Cover Design Specifications - based upon the appropriate requirements of Subsection H of 19.15.17.13 NMAC
- Re-vegetation Plan - based upon the appropriate requirements of Subsection H of 19.15.17.13 NMAC
- Site Reclamation Plan - based upon the appropriate requirements of Subsection H of 19.15.17.13 NMAC

15.

Siting Criteria (regarding on-site closure methods only): 19.15.17.10 NMAC

Instructions: Each siting criteria requires a demonstration of compliance in the closure plan. Recommendations of acceptable source material are provided below. Requests regarding changes to certain siting criteria require justifications and/or demonstrations of equivalency. Please refer to 19.15.17.10 NMAC for guidance.

| | |
|---|---|
| Ground water is less than 25 feet below the bottom of the buried waste. - NM Office of the State Engineer - iWATERS database search; USGS; Data obtained from nearby wells | <input type="checkbox"/> Yes <input type="checkbox"/> No <input type="checkbox"/> NA |
| Ground water is between 25-50 feet below the bottom of the buried waste - NM Office of the State Engineer - iWATERS database search; USGS; Data obtained from nearby wells | <input type="checkbox"/> Yes <input type="checkbox"/> No <input type="checkbox"/> NA |
| Ground water is more than 100 feet below the bottom of the buried waste. - NM Office of the State Engineer - iWATERS database search; USGS; Data obtained from nearby wells | <input type="checkbox"/> Yes <input type="checkbox"/> No <input type="checkbox"/> NA |
| Within 100 feet of a continuously flowing watercourse, or 200 feet of any other significant watercourse, lakebed, sinkhole, or playa lake (measured from the ordinary high-water mark). - Topographic map; Visual inspection (certification) of the proposed site | <input type="checkbox"/> Yes <input type="checkbox"/> No |
| Within 300 feet from a permanent residence, school, hospital, institution, or church in existence at the time of initial application. - Visual inspection (certification) of the proposed site; Aerial photo; Satellite image | <input type="checkbox"/> Yes <input type="checkbox"/> No |
| Within 300 horizontal feet of a private, domestic fresh water well or spring used for domestic or stock watering purposes, in existence at the time of initial application. - NM Office of the State Engineer - iWATERS database; Visual inspection (certification) of the proposed site | <input type="checkbox"/> Yes <input type="checkbox"/> No |
| Written confirmation or verification from the municipality; Written approval obtained from the municipality | <input type="checkbox"/> Yes <input type="checkbox"/> No |
| Within 300 feet of a wetland. US Fish and Wildlife Wetland Identification map; Topographic map; Visual inspection (certification) of the proposed site | <input type="checkbox"/> Yes <input type="checkbox"/> No |
| Within incorporated municipal boundaries or within a defined municipal fresh water well field covered under a municipal ordinance | <input type="checkbox"/> Yes <input type="checkbox"/> No |

| | |
|---|--|
| adopted pursuant to NMSA 1978, Section 3-27-3, as amended. - Written confirmation or verification from the municipality; Written approval obtained from the municipality | <input type="checkbox"/> Yes <input type="checkbox"/> No |
| Within the area overlying a subsurface mine. - Written confirmation or verification or map from the NM EMNRD-Mining and Mineral Division | <input type="checkbox"/> Yes <input type="checkbox"/> No |
| Within an unstable area. - Engineering measures incorporated into the design; NM Bureau of Geology & Mineral Resources; USGS; NM Geological Society; Topographic map | <input type="checkbox"/> Yes <input type="checkbox"/> No |
| Within a 100-year floodplain. - FEMA map | <input type="checkbox"/> Yes <input type="checkbox"/> No |

16. **On-Site Closure Plan Checklist:** (19.15.17.13 NMAC) *Instructions: Each of the following items must be attached to the closure plan. Please indicate, by a check mark in the box, that the documents are attached.*

- Siting Criteria Compliance Demonstrations - based upon the appropriate requirements of 19.15.17.10 NMAC
- Proof of Surface Owner Notice - based upon the appropriate requirements of Subsection E of 19.15.17.13 NMAC
- Construction/Design Plan of Burial Trench (if applicable) based upon the appropriate requirements of Subsection K of 19.15.17.11 NMAC
- Construction/Design Plan of Temporary Pit (for in-place burial of a drying pad) - based upon the appropriate requirements of 19.15.17.11 NMAC
- Protocols and Procedures - based upon the appropriate requirements of 19.15.17.13 NMAC
- Confirmation Sampling Plan (if applicable) - based upon the appropriate requirements of 19.15.17.13 NMAC
- Waste Material Sampling Plan - based upon the appropriate requirements of 19.15.17.13 NMAC
- Disposal Facility Name and Permit Number (for liquids, drilling fluids and drill cuttings or in case on-site closure standards cannot be achieved)
- Soil Cover Design - based upon the appropriate requirements of Subsection H of 19.15.17.13 NMAC
- Re-vegetation Plan - based upon the appropriate requirements of Subsection H of 19.15.17.13 NMAC
- Site Reclamation Plan - based upon the appropriate requirements of Subsection H of 19.15.17.13 NMAC

17. **Operator Application Certification:**

I hereby certify that the information submitted with this application is true, accurate and complete to the best of my knowledge and belief.

Name (Print): _____ Title: _____

Signature: _____ Date: _____

e-mail address: _____ Telephone: _____

18. **OCD Approval:** Permit Application (including closure plan) Closure ~~Plan (only)~~ OCD Conditions (see attachment)

OCD Representative Signature:  Approval Date: 3/30/2021

Title: Environmental Specialist OCD Permit Number: BGT 1

19. **Closure Report (required within 60 days of closure completion):** 19.15.17.13 NMAC

Instructions: Operators are required to obtain an approved closure plan prior to implementing any closure activities and submitting the closure report. The closure report is required to be submitted to the division within 60 days of the completion of the closure activities. Please do not complete this section of the form until an approved closure plan has been obtained and the closure activities have been completed.

Closure Completion Date: 07/16/2020

20. **Closure Method:**

Waste Excavation and Removal On-Site Closure Method Alternative Closure Method Waste Removal (Closed-loop systems only)

If different from approved plan, please explain.

21. **Closure Report Attachment Checklist:** *Instructions: Each of the following items must be attached to the closure report. Please indicate, by a check mark in the box, that the documents are attached.*

- Proof of Closure Notice (surface owner and division)
- Proof of Deed Notice (required for on-site closure for private land only)
- Plot Plan (for on-site closures and temporary pits)
- Confirmation Sampling Analytical Results (if applicable)
- Waste Material Sampling Analytical Results (required for on-site closure)
- Disposal Facility Name and Permit Number
- Soil Backfilling and Cover Installation
- Re-vegetation Application Rates and Seeding Technique
- Site Reclamation (Photo Documentation)

On-site Closure Location: Latitude _____ Longitude _____ NAD: 1927 1983

22.

Operator Closure Certification:

I hereby certify that the information and attachments submitted with this closure report is true, accurate and complete to the best of my knowledge and belief. I also certify that the closure complies with all applicable closure requirements and conditions specified in the approved closure plan.

Name (Print): Cherylene Weston Title: Operations/Regulatory Technician-Sr.

Signature: Cherylene Weston Date: 08/19/2020

e-mail address: cweston@hilcorp.com Telephone: 505-564-0779

Hilcorp Energy Company
San Juan Basin: New Mexico Assets
Below Grade Tank Closure Report

Lease Name: Huerfano Unit Com 518
API No.: 30-045-29175

In accordance with Rule 19.15.17.13 NMAC, the following information describes the closure of the below-grade tank referenced above. All proper documentation regarding closure activities is being included with the C-144.

General Plan Requirements:

1. Prior to initiating any BGT closure, except in the case of an emergency, HILCORP will notify the surface owner of the intent to close the BGT by certified mail no later than 72 hours or one week before closure and a copy of this notification will be included in the closure report. In the case of an emergency, the surface owner will be notified as soon as practical.

The surface owner was notified by email of the closure process and the notification is attached.

2. Notice of closure will be given to the District Division office between 72 hours and one week of the scheduled closure via email or phone. The notification of closure will include the following:
 - a. Operators Name
 - b. Well Name and API Number
 - c. Location

Notification is attached.

3. All liquids will be removed from the BGT following cessation of operation. Produced water will be disposed of at one of HILCORP's approved Salt Water Disposal facilities or at a District Division approved facility.

All recovered liquids were disposed of at an approved SWD facility or an approved District Division facility within 60 days of cessation of operation.

4. Solids and sludge's will be shoveled and/or vacuumed out for disposal at one of the District Division approved facilities, depending on the proximity of the BGT site: Envirotech Land Farm (Permit #NM-01-011), JFJ Land Farm % Industrial Ecosystems Inc. (Permit #NM-01-0010B), and Basin Disposal (Permit #NM-01-005).

Any sludge or soil required to be removed to facilitate closure was transported to Envirotech Land Farm (Permit # NM-01-011) and/or JFJ Landfarm % IEI (Permit# NM-01-0010B).

Revised 10/14/2015

5. HILCORP will obtain prior approval from District Division to dispose, recycle, reuse, or reclaim the BGT and provide documentation of the disposition of the BGT in the closure report. Steel materials will be recycled or reused as approved by the District Division. Fiberglass tanks will be empty, cut up or shredded, and EPA cleaned for disposal as solid waste. Liner materials will be cleaned without soils or contaminated material for disposal as solid waste. Fiberglass tanks and liner materials will meet the conditions of 19.15.35 NMAC. Disposal will be at a licensed disposal facility, presently San Juan County Landfill operated by Waste Management under NMED Permit SWM-052426.

The below-grade tank was disposed of in a division-approved manner. The liner was cleaned per 19.15.35.8.C(1)(m) NMAC and disposed of at the San Juan County Regional Landfill located on CR 3100.

6. Any equipment associated with the BGT that is no longer required for some other purpose, following the closure, will be removed.

All on-site equipment associated with the below-grade tank was removed.

7. Following removal of the tank and any liner material, HILCORP will test the soils beneath the BGT as follows:
 - a. At a minimum, a five-point composite sample will be taken to include any obvious stained or wet soils or any other evidence of contamination.
 - b. The laboratory sample shall be analyzed for the constituents listed in Table I of 19.15.17.13.

A five point composite sample was taken of the below-grade tank using sampling tools and all samples tested per Table I of 19.15.17.13 and the results are attached.

8. If the District Division and/or HILCORP determine there is a release, HILCORP will comply with 19.15.17.13.C.3b.

A release was not determined for the above referenced well.

9. Upon completion of the tank removal, pursuant to 19.15.17.13.C.3c, if all contaminant concentrations are less than or equal to the parameters listed in Table I of 19.15.17.13 NMAC, the excavation will be backfilled with non-waste earthen material compacted and covered with a minimum of one foot top soil or background thickness whichever is greater and to existing grade. The surface will be re-contoured to match the native grade and to prevent ponding.

The tank removal area passed all requirements of Table I of 19.15.17.13 NMAC and was backfilled with compacted, non-waste containing, earthen material which included at least one foot of suitable material to establish vegetation at the site.

Revised 10/14/2015

10. For those portions of the former BGT area no longer required for production activities, HILCORP will seed the disturbed area the first favorable growing season after the BGT is covered. Seeding will be accomplished via drilling on the contour whenever practical, or by other District Division-approved methods. HILCORP will notify the District Division when reclamation and re-vegetation is complete.

Reclamation of the BGT shall be considered complete when:

- Vegetative cover reflects a life form ratio of +/- 50% of pre disturbance levels.
- Total percent plant cover of at least 70% of pre-disturbance levels (Excluding noxious weeds) OR
- Pursuant to 19.15.17.13.H.5d HILCORP will comply with obligations imposed by other applicable federal or tribal agencies in which there re-vegetation and reclamation requirements provide equal or better protection of fresh water, human health and the environment.

Provision 10 will be accomplished pursuant to 19.15.17.H.5d and notification will be submitted upon completion.

11. For those portions of the former BGT area required for production activities, reseeding will be done at well abandonment, and following the procedure noted above.

The former BGT area is required for production activities and reseeding will be completed upon plug and abandonment, per the procedure noted above.

Closure Report:

All closure activities will include proper documentation and will be submitted to OCD within 60 days of the BGT closure on a Closure Report using District Division Form C-144. The Report will include the following:

- Proof of Closure Notice (surface owner and District Division) **(Attached)**
- Backfilling & cover installation **(See Report)**
- Confirmation Sampling Analytical Results **(Attached)**
- Application Rate & Seeding techniques **(See Report)**
- Photo Documentation of Reclamation **(Attached)**

Revised 10/14/2015

Cheryl Weston

From: Cheryl Weston
Sent: Wednesday, July 1, 2020 9:43 AM
To: 'Smith, Cory, EMNRD'; 'dvstrang@slo.state.nm.us'
Cc: Kandis Roland; Kurt Hoekstra; Curtis House; Clara Cardoza; Cary Green
Subject: 72 Hour notification - Huerfano Unit Com 518 (API 30-045-29175)

Subject: 72 Hour BGT Closure Notification

Anticipated Start Date: Monday, July 6, 2020 at approximately 11:00 a.m.

The subject well has **one** below-grade tank that will begin the closure process between 72 hours and one week from this notification. Please contact me at any time if you have any questions or concerns.

Well Name: Huerfano Unit Com 518

API#: 30-045-29175

Location: Unit N (SESW), Section 16, T26N, R09W

Footages: 890' FSL & 1545' FWL

Operator: Hilcorp Energy **Surface Owner: State (Lease B-9320-10)**

Reason: Fiberglass tank was permitted as 120 bbl metal by previous operator; OCD requested closure.

Thanks,

Cheryl Weston
San Juan South Regulatory
505-564-0779
cweston@hilcorp.com



District I
1625 N. French Dr., Hobbs, NM 88240
District II
811 S. First St., Artesia, NM 88210
District III
1000 Rio Brazos Road, Aztec, NM 87410
District IV
1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico
Energy Minerals and Natural
Resources Department

Oil Conservation Division
1220 South St. Francis Dr.
Santa Fe, NM 87505

Form C-141
Revised August 24, 2018
Submit to appropriate OCD District office

| | |
|----------------|--|
| Incident ID | |
| District RP | |
| Facility ID | |
| Application ID | |

Release Notification

Responsible Party

| | | | |
|-------------------------|------------------------------|-------------------|-------------------|
| Responsible Party | Hilcorp Energy Company | OGRID | 372171 |
| Contact Name | Cherylene Weston | Contact Telephone | (505) 564-0779 |
| Contact email | cweston@hilcorp.com | Incident # | (assigned by OCD) |
| Contact mailing address | 382 Road 3100 Aztec NM 87410 | | |

Location of Release Source

Latitude 36.483272 Longitude -107.797547
(NAD 83 in decimal degrees to 5 decimal places)

| | | | |
|-------------------------|------------------------|----------------------|--------------|
| Site Name | Huerfano Unit Com #518 | Site Type | Gas Well |
| Date Release Discovered | N/A | API# (if applicable) | 30-045-29175 |

| Unit Letter | Section | Township | Range | County |
|-------------|---------|----------|-------|----------|
| N | 16 | 26N | 9W | SAN JUAN |
| | | | | |

Surface Owner: State Federal Tribal Private (Name: _____)

Nature and Volume of Release

Material(s) Released (Select all that apply and attach calculations or specific justification for the volumes provided below)

| | | |
|---|--|--|
| <input type="checkbox"/> Crude Oil | Volume Released (bbls) | Volume Recovered (bbls) |
| <input type="checkbox"/> Produced Water | Volume Released (bbls) | Volume Recovered (bbls) |
| | Is the concentration of dissolved chloride in the produced water >10,000 mg/l? | <input type="checkbox"/> Yes <input type="checkbox"/> No |
| <input type="checkbox"/> Condensate | Volume Released (bbls) | Volume Recovered (bbls) |
| <input type="checkbox"/> Natural Gas | Volume Released (Mcf) | Volume Recovered (Mcf) |
| <input type="checkbox"/> Other (describe) | Volume/Weight Released (provide units) | Volume/Weight Recovered (provide units) |

Cause of Release

No release was encountered during the BGT Closure.

State of New Mexico
Oil Conservation Division

Page 2

| | |
|----------------|--|
| Incident ID | |
| District RP | |
| Facility ID | |
| Application ID | |

| | |
|---|---|
| Was this a major release as defined by 19.15.29.7(A) NMAC? <input type="checkbox"/> Yes <input checked="" type="checkbox"/> No | If YES, for what reason(s) does the responsible party consider this a major release? N/A |
| If YES, was immediate notice given to the OCD? By whom? To whom? When and by what means (phone, email, etc)? Not Required | |

Initial Response

The responsible party must undertake the following actions immediately unless they could create a safety hazard that would result in injury

| |
|--|
| <input type="checkbox"/> The source of the release has been stopped. <input type="checkbox"/> The impacted area has been secured to protect human health and the environment. <input type="checkbox"/> Released materials have been contained via the use of berms or dikes, absorbent pads, or other containment devices. <input type="checkbox"/> All free liquids and recoverable materials have been removed and managed appropriately. |
| If all the actions described above have <u>not</u> been undertaken, explain why: |
| Per 19.15.29.8 B. (4) NMAC the responsible party may commence remediation immediately after discovery of a release. If remediation has begun, please attach a narrative of actions to date. If remedial efforts have been successfully completed or if the release occurred within a lined containment area (see 19.15.29.11(A)(5)(a) NMAC), please attach all information needed for closure evaluation. |
| I hereby certify that the information given above is true and complete to the best of my knowledge and understand that pursuant to OCD rules and regulations all operators are required to report and/or file certain release notifications and perform corrective actions for releases which may endanger public health or the environment. The acceptance of a C-141 report by the OCD does not relieve the operator of liability should their operations have failed to adequately investigate and remediate contamination that pose a threat to groundwater, surface water, human health or the environment. In addition, OCD acceptance of a C-141 report does not relieve the operator of responsibility for compliance with any other federal, state, or local laws and/or regulations. |
| Printed Name: <u>Cherylene Weston</u> Title: <u>Operations/Regulatory Technician – Sr.</u> Signature: <u>Cherylene Weston</u> Date: <u>08/19/2020</u> email: <u>cweston@hilcorp.com</u> Telephone: <u>(505) 564-0779</u> |
| <u>OCD Only</u> Received by: _____ Date: _____ |



ANALYTICAL REPORT

July 14, 2020

- 1 Cp
- 2 Tc
- 3 Ss
- 4 Cn
- 5 Sr
- 6 Qc
- 7 Gl
- 8 Al
- 9 Sc

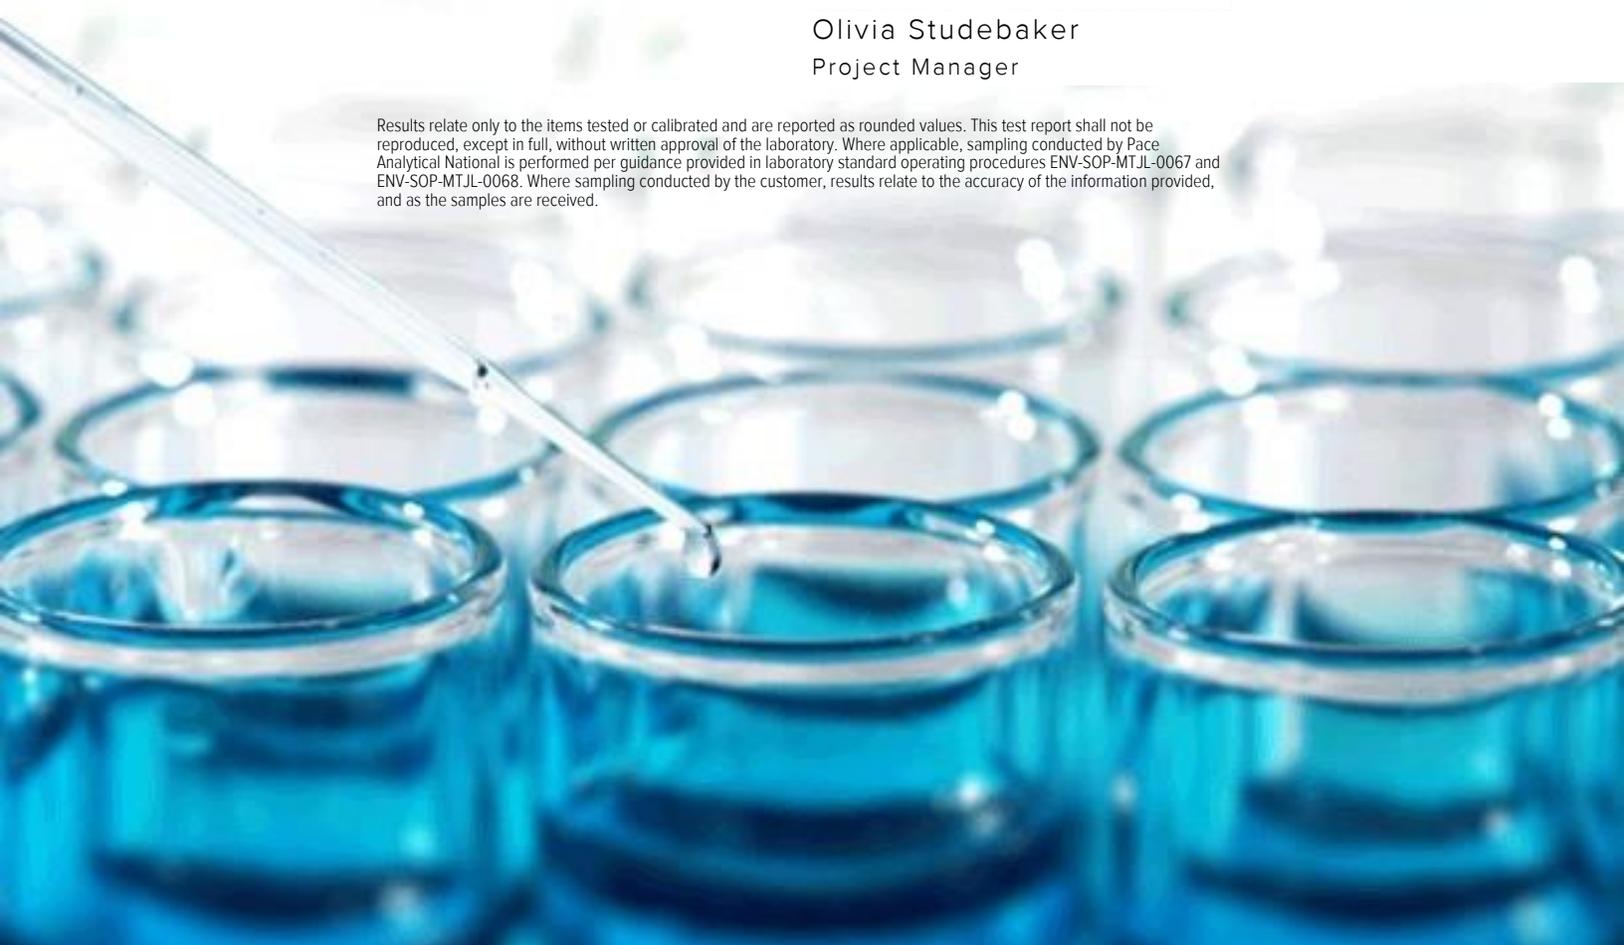
HilCorp-Farmington, NM

| | | |
|------------------------|-----------------|-----------------------|
| Sample Delivery Group: | L1237010 | Huerfano Unit Com 518 |
| Samples Received: | 07/07/2020 | API# 30-045-29175 |
| Project Number: | | |
| Description: | BGT Samples | |
| Site: | MULTIPLE | |
| Report To: | Clara Cardoza | |
| | 382 Road 3100 | |
| | Aztec, NM 87410 | |

Entire Report Reviewed By:

Olivia Studebaker
Project Manager

Results relate only to the items tested or calibrated and are reported as rounded values. This test report shall not be reproduced, except in full, without written approval of the laboratory. Where applicable, sampling conducted by Pace Analytical National is performed per guidance provided in laboratory standard operating procedures ENV-SOP-MTJL-0067 and ENV-SOP-MTJL-0068. Where sampling conducted by the customer, results relate to the accuracy of the information provided, and as the samples are received.



| | | |
|--|-----------|---|
| Cp: Cover Page | 1 |  |
| Tc: Table of Contents | 2 | |
| Ss: Sample Summary | 3 |  |
| Cn: Case Narrative | 4 | |
| Sr: Sample Results | 5 |  |
| HUEFRANO UNIT COM 518 L1237010-01 | 5 |  |
| Qc: Quality Control Summary | 6 | |
| Wet Chemistry by Method 300.0 | 6 |  |
| Volatile Organic Compounds (GC) by Method 8015/8021 | 7 | |
| Semi-Volatile Organic Compounds (GC) by Method 8015 | 9 |  |
| Gl: Glossary of Terms | 10 |  |
| Al: Accreditations & Locations | 11 | |
| Sc: Sample Chain of Custody | 12 |  |
| | |  |

SAMPLE SUMMARY

HUEFRANO UNIT COM 518 L1237010-01 Solid

| | | |
|--------------|---------------------|--------------------|
| Collected by | Collected date/time | Received date/time |
| C. Cardoza | 07/06/20 11:25 | 07/07/20 08:45 |

| Method | Batch | Dilution | Preparation date/time | Analysis date/time | Analyst | Location |
|---|-----------|----------|-----------------------|--------------------|---------|----------------|
| Wet Chemistry by Method 300.0 | WG1505529 | 1 | 07/09/20 16:09 | 07/10/20 04:02 | MSP | Mt. Juliet, TN |
| Volatile Organic Compounds (GC) by Method 8015/8021 | WG1507239 | 1 | 07/08/20 09:51 | 07/10/20 21:40 | ADM | Mt. Juliet, TN |
| Semi-Volatile Organic Compounds (GC) by Method 8015 | WG1506144 | 1 | 07/09/20 06:46 | 07/10/20 03:28 | JN | Mt. Juliet, TN |

- 1 Cp
- 2 Tc
- 3 Ss
- 4 Cn
- 5 Sr
- 6 Qc
- 7 Gl
- 8 Al
- 9 Sc

All sample aliquots were received at the correct temperature, in the proper containers, with the appropriate preservatives, and within method specified holding times, unless qualified or notated within the report. Where applicable, all MDL (LOD) and RDL (LOQ) values reported for environmental samples have been corrected for the dilution factor used in the analysis. All Method and Batch Quality Control are within established criteria except where addressed in this case narrative, a non-conformance form or properly qualified within the sample results. By my digital signature below, I affirm to the best of my knowledge, all problems/anomalies observed by the laboratory as having the potential to affect the quality of the data have been identified by the laboratory, and no information or data have been knowingly withheld that would affect the quality of the data.

Olivia Studebaker
Project Manager

- ¹ Cp
- ² Tc
- ³ Ss
- ⁴ Cn
- ⁵ Sr
- ⁶ Qc
- ⁷ Gl
- ⁸ Al
- ⁹ Sc

Collected date/time: 07/06/20 11:25

L1237010

Wet Chemistry by Method 300.0

| Analyte | Result | Qualifier | RDL | Dilution | Analysis date / time | Batch |
|----------|--------|-----------|------|----------|----------------------|---------------------------|
| Chloride | ND | | 20.0 | 1 | 07/10/2020 04:02 | WG1505529 |

- 1 Cp
- 2 Tc
- 3 Ss
- 4 Cn
- 5 Sr
- 6 Qc
- 7 Gl
- 8 Al
- 9 Sc

Volatile Organic Compounds (GC) by Method 8015/8021

| Analyte | Result | Qualifier | RDL | Dilution | Analysis date / time | Batch |
|---------------------------------|--------|-----------|----------|----------|----------------------|---------------------------|
| Benzene | ND | | 0.000500 | 1 | 07/10/2020 21:40 | WG1507239 |
| Toluene | ND | | 0.00500 | 1 | 07/10/2020 21:40 | WG1507239 |
| Ethylbenzene | ND | | 0.000500 | 1 | 07/10/2020 21:40 | WG1507239 |
| Total Xylene | ND | | 0.00150 | 1 | 07/10/2020 21:40 | WG1507239 |
| TPH (GC/FID) Low Fraction | ND | | 0.100 | 1 | 07/10/2020 21:40 | WG1507239 |
| (S) a,a,a-Trifluorotoluene(FID) | 103 | | 77.0-120 | | 07/10/2020 21:40 | WG1507239 |
| (S) a,a,a-Trifluorotoluene(PID) | 99.1 | | 72.0-128 | | 07/10/2020 21:40 | WG1507239 |

Semi-Volatile Organic Compounds (GC) by Method 8015

| Analyte | Result | Qualifier | RDL | Dilution | Analysis date / time | Batch |
|----------------------|--------|-----------|----------|----------|----------------------|---------------------------|
| C10-C28 Diesel Range | ND | | 4.00 | 1 | 07/10/2020 03:28 | WG1506144 |
| C28-C40 Oil Range | ND | | 4.00 | 1 | 07/10/2020 03:28 | WG1506144 |
| (S) o-Terphenyl | 67.4 | | 18.0-148 | | 07/10/2020 03:28 | WG1506144 |

Wet Chemistry by Method 300.0

[L1237010-01](#)

Method Blank (MB)

(MB) R3548287-1 07/09/20 17:21

| Analyte | MB Result | MB Qualifier | MB MDL | MB RDL |
|----------|-----------|--------------|--------|--------|
| Chloride | U | | 9.20 | 20.0 |

¹ Cp

² Tc

³ Ss

⁴ Cn

⁵ Sr

⁶ Qc

⁷ Gl

⁸ Al

⁹ Sc

L1236490-01 Original Sample (OS) • Duplicate (DUP)

(OS) L1236490-01 07/09/20 19:38 • (DUP) R3548287-3 07/09/20 20:01

| Analyte | Original Result | DUP Result | Dilution | DUP RPD | DUP Qualifier | DUP RPD Limits |
|----------|-----------------|------------|----------|---------|---------------|----------------|
| Chloride | ND | ND | 1 | 0.000 | | 20 |

L1236514-04 Original Sample (OS) • Duplicate (DUP)

(OS) L1236514-04 07/10/20 02:54 • (DUP) R3548287-6 07/10/20 03:16

| Analyte | Original Result | DUP Result | Dilution | DUP RPD | DUP Qualifier | DUP RPD Limits |
|----------|-----------------|------------|----------|---------|---------------|----------------|
| Chloride | ND | ND | 1 | 0.000 | | 20 |

Laboratory Control Sample (LCS)

(LCS) R3548287-2 07/09/20 17:43

| Analyte | Spike Amount | LCS Result | LCS Rec. | Rec. Limits | LCS Qualifier |
|----------|--------------|------------|----------|-------------|---------------|
| Chloride | 200 | 196 | 98.1 | 90.0-110 | |

L1236490-09 Original Sample (OS) • Matrix Spike (MS) • Matrix Spike Duplicate (MSD)

(OS) L1236490-09 07/09/20 23:50 • (MS) R3548287-4 07/10/20 00:13 • (MSD) R3548287-5 07/10/20 00:36

| Analyte | Spike Amount | Original Result | MS Result | MSD Result | MS Rec. | MSD Rec. | Dilution | Rec. Limits | MS Qualifier | MSD Qualifier | RPD | RPD Limits |
|----------|--------------|-----------------|-----------|------------|---------|----------|----------|-------------|--------------|---------------|------|------------|
| Chloride | 500 | 122 | 659 | 668 | 107 | 109 | 1 | 80.0-120 | | | 1.36 | 20 |

Volatile Organic Compounds (GC) by Method 8015/8021

[L1237010-01](#)

Method Blank (MB)

(MB) R3548500-3 07/10/20 16:22

| Analyte | MB Result | MB Qualifier | MB MDL | MB RDL |
|------------------------------------|-----------|--------------|----------|----------|
| | mg/kg | | mg/kg | mg/kg |
| Benzene | U | | 0.000120 | 0.000500 |
| Toluene | U | | 0.000150 | 0.00500 |
| Ethylbenzene | U | | 0.000110 | 0.000500 |
| Total Xylene | U | | 0.000460 | 0.00150 |
| TPH (GC/FID) Low Fraction | U | | 0.0217 | 0.100 |
| (S) a,a,a-Trifluorotoluene(FID) | 106 | | | 77.0-120 |
| (S) a,a,a-Trifluorotoluene(PID) | 104 | | | 72.0-128 |

1 Cp

2 Tc

3 Ss

4 Cn

5 Sr

6 Qc

Laboratory Control Sample (LCS)

(LCS) R3548500-1 07/10/20 15:20

| Analyte | Spike Amount | LCS Result | LCS Rec. | Rec. Limits | LCS Qualifier |
|------------------------------------|--------------|------------|----------|-------------|---------------|
| | mg/kg | mg/kg | % | % | |
| Benzene | 0.0500 | 0.0505 | 101 | 76.0-121 | |
| Toluene | 0.0500 | 0.0542 | 108 | 80.0-120 | |
| Ethylbenzene | 0.0500 | 0.0553 | 111 | 80.0-124 | |
| Total Xylene | 0.150 | 0.164 | 109 | 37.0-160 | |
| (S) a,a,a-Trifluorotoluene(FID) | | | 107 | 77.0-120 | |
| (S) a,a,a-Trifluorotoluene(PID) | | | 102 | 72.0-128 | |

7 Gl

8 Al

9 Sc

Laboratory Control Sample (LCS) • Laboratory Control Sample Duplicate (LCSD)

(LCS) R3548500-2 07/10/20 15:41 • (LCSD) R3548500-4 07/10/20 17:11

| Analyte | Spike Amount | LCS Result | LCSD Result | LCS Rec. | LCSD Rec. | Rec. Limits | LCS Qualifier | LCSD Qualifier | RPD | RPD Limits |
|------------------------------------|--------------|------------|-------------|----------|-----------|-------------|---------------|----------------|------|------------|
| | mg/kg | mg/kg | mg/kg | % | % | % | | | % | % |
| TPH (GC/FID) Low Fraction | 5.50 | 6.09 | 5.26 | 111 | 95.6 | 72.0-127 | | | 14.6 | 20 |
| (S) a,a,a-Trifluorotoluene(FID) | | | | 101 | 98.0 | 77.0-120 | | | | |
| (S) a,a,a-Trifluorotoluene(PID) | | | | 110 | 107 | 72.0-128 | | | | |

Volatile Organic Compounds (GC) by Method 8015/8021

[L1237010-01](#)

L1236065-04 Original Sample (OS) • Matrix Spike (MS) • Matrix Spike Duplicate (MSD)

(OS) L1236065-04 07/10/20 19:36 • (MS) R3548500-5 07/11/20 04:14 • (MSD) R3548500-6 07/11/20 04:35

| Analyte | Spike Amount mg/kg | Original Result mg/kg | MS Result mg/kg | MSD Result mg/kg | MS Rec. % | MSD Rec. % | Dilution | Rec. Limits % | MS Qualifier | MSD Qualifier | RPD % | RPD Limits % |
|------------------------------------|-----------------------|--------------------------|--------------------|---------------------|--------------|---------------|----------|------------------|--------------|---------------|----------|-----------------|
| Benzene | 1.31 | ND | 1.13 | 1.11 | 99.8 | 98.1 | 25 | 10.0-155 | | | 1.79 | 32 |
| Toluene | 1.31 | ND | 1.20 | 1.18 | 106 | 104 | 25 | 10.0-160 | | | 1.68 | 34 |
| Ethylbenzene | 1.31 | ND | 1.22 | 1.19 | 109 | 106 | 25 | 10.0-160 | | | 2.49 | 32 |
| Total Xylene | 3.91 | ND | 3.54 | 3.46 | 106 | 103 | 25 | 10.0-160 | | | 2.29 | 32 |
| (S) a,a,a-Trifluorotoluene(FID) | | | | | 107 | 106 | | 77.0-120 | | | | |
| (S) a,a,a-Trifluorotoluene(PID) | | | | | 99.5 | 100 | | 72.0-128 | | | | |

1 Cp

2 Tc

3 Ss

4 Cn

5 Sr

6 Qc

7 Gl

8 Al

9 Sc

Semi-Volatile Organic Compounds (GC) by Method 8015

[L1237010-01](#)

Method Blank (MB)

(MB) R3548075-1 07/10/20 00:06

| Analyte | MB Result | MB Qualifier | MB MDL | MB RDL |
|----------------------|-----------|--------------|--------|----------|
| | mg/kg | | mg/kg | mg/kg |
| C10-C28 Diesel Range | U | | 1.61 | 4.00 |
| C28-C40 Oil Range | 0.425 | J | 0.274 | 4.00 |
| (S) o-Terphenyl | 73.1 | | | 18.0-148 |

Laboratory Control Sample (LCS)

(LCS) R3548075-2 07/10/20 00:20

| Analyte | Spike Amount | LCS Result | LCS Rec. | Rec. Limits | LCS Qualifier |
|----------------------|--------------|------------|----------|-------------|---------------|
| | mg/kg | mg/kg | % | % | |
| C10-C28 Diesel Range | 50.0 | 34.3 | 68.6 | 50.0-150 | |
| (S) o-Terphenyl | | | 70.1 | 18.0-148 | |

L1236971-06 Original Sample (OS) • Matrix Spike (MS) • Matrix Spike Duplicate (MSD)

(OS) L1236971-06 07/10/20 01:13 • (MS) R3548075-3 07/10/20 01:26 • (MSD) R3548075-4 07/10/20 01:40

| Analyte | Spike Amount | Original Result | MS Result | MSD Result | MS Rec. | MSD Rec. | Dilution | Rec. Limits | MS Qualifier | MSD Qualifier | RPD | RPD Limits |
|----------------------|--------------|-----------------|-----------|------------|---------|----------|----------|-------------|--------------|---------------|------|------------|
| | mg/kg | mg/kg | mg/kg | mg/kg | % | % | | % | | | % | % |
| C10-C28 Diesel Range | 50.0 | ND | 39.3 | 36.3 | 74.9 | 68.9 | 1 | 50.0-150 | | | 7.94 | 20 |
| (S) o-Terphenyl | | | | | 70.4 | 67.6 | | 18.0-148 | | | | |

1 Cp

2 Tc

3 Ss

4 Cn

5 Sr

6 Qc

7 Gl

8 Al

9 Sc

Guide to Reading and Understanding Your Laboratory Report

The information below is designed to better explain the various terms used in your report of analytical results from the Laboratory. This is not intended as a comprehensive explanation, and if you have additional questions please contact your project representative.

Results Disclaimer - Information that may be provided by the customer, and contained within this report, include Permit Limits, Project Name, Sample ID, Sample Matrix, Sample Preservation, Field Blanks, Field Spikes, Field Duplicates, On-Site Data, Sampling Collection Dates/Times, and Sampling Location. Results relate to the accuracy of this information provided, and as the samples are received.

Abbreviations and Definitions

| | |
|------------------------------|--|
| MDL | Method Detection Limit. |
| ND | Not detected at the Reporting Limit (or MDL where applicable). |
| RDL | Reported Detection Limit. |
| Rec. | Recovery. |
| RPD | Relative Percent Difference. |
| SDG | Sample Delivery Group. |
| (S) | Surrogate (Surrogate Standard) - Analytes added to every blank, sample, Laboratory Control Sample/Duplicate and Matrix Spike/Duplicate; used to evaluate analytical efficiency by measuring recovery. Surrogates are not expected to be detected in all environmental media. |
| U | Not detected at the Reporting Limit (or MDL where applicable). |
| Analyte | The name of the particular compound or analysis performed. Some Analyses and Methods will have multiple analytes reported. |
| Dilution | If the sample matrix contains an interfering material, the sample preparation volume or weight values differ from the standard, or if concentrations of analytes in the sample are higher than the highest limit of concentration that the laboratory can accurately report, the sample may be diluted for analysis. If a value different than 1 is used in this field, the result reported has already been corrected for this factor. |
| Limits | These are the target % recovery ranges or % difference value that the laboratory has historically determined as normal for the method and analyte being reported. Successful QC Sample analysis will target all analytes recovered or duplicated within these ranges. |
| Original Sample | The non-spiked sample in the prep batch used to determine the Relative Percent Difference (RPD) from a quality control sample. The Original Sample may not be included within the reported SDG. |
| Qualifier | This column provides a letter and/or number designation that corresponds to additional information concerning the result reported. If a Qualifier is present, a definition per Qualifier is provided within the Glossary and Definitions page and potentially a discussion of possible implications of the Qualifier in the Case Narrative if applicable. |
| Result | The actual analytical final result (corrected for any sample specific characteristics) reported for your sample. If there was no measurable result returned for a specific analyte, the result in this column may state "ND" (Not Detected) or "BDL" (Below Detectable Levels). The information in the results column should always be accompanied by either an MDL (Method Detection Limit) or RDL (Reporting Detection Limit) that defines the lowest value that the laboratory could detect or report for this analyte. |
| Uncertainty (Radiochemistry) | Confidence level of 2 sigma. |
| Case Narrative (Cn) | A brief discussion about the included sample results, including a discussion of any non-conformances to protocol observed either at sample receipt by the laboratory from the field or during the analytical process. If present, there will be a section in the Case Narrative to discuss the meaning of any data qualifiers used in the report. |
| Quality Control Summary (Qc) | This section of the report includes the results of the laboratory quality control analyses required by procedure or analytical methods to assist in evaluating the validity of the results reported for your samples. These analyses are not being performed on your samples typically, but on laboratory generated material. |
| Sample Chain of Custody (Sc) | This is the document created in the field when your samples were initially collected. This is used to verify the time and date of collection, the person collecting the samples, and the analyses that the laboratory is requested to perform. This chain of custody also documents all persons (excluding commercial shippers) that have had control or possession of the samples from the time of collection until delivery to the laboratory for analysis. |
| Sample Results (Sr) | This section of your report will provide the results of all testing performed on your samples. These results are provided by sample ID and are separated by the analyses performed on each sample. The header line of each analysis section for each sample will provide the name and method number for the analysis reported. |
| Sample Summary (Ss) | This section of the Analytical Report defines the specific analyses performed for each sample ID, including the dates and times of preparation and/or analysis. |

Qualifier Description

| | |
|---|---|
| J | The identification of the analyte is acceptable; the reported value is an estimate. |
|---|---|

1 Cp

2 Tc

3 Ss

4 Cn

5 Sr

6 Qc

7 Gl

8 Al

9 Sc

Pace National is the only environmental laboratory accredited/certified to support your work nationwide from one location. One phone call, one point of contact, one laboratory. No other lab is as accessible or prepared to handle your needs throughout the country. Our capacity and capability from our single location laboratory is comparable to the collective totals of the network laboratories in our industry. The most significant benefit to our one location design is the design of our laboratory campus. The model is conducive to accelerated productivity, decreasing turn-around time, and preventing cross contamination, thus protecting sample integrity. Our focus on premium quality and prompt service allows us to be YOUR LAB OF CHOICE.

* Not all certifications held by the laboratory are applicable to the results reported in the attached report.
* Accreditation is only applicable to the test methods specified on each scope of accreditation held by Pace National.

State Accreditations

| | | | |
|-------------------------|-------------|-----------------------------|------------------|
| Alabama | 40660 | Nebraska | NE-OS-15-05 |
| Alaska | 17-026 | Nevada | TN-03-2002-34 |
| Arizona | AZ0612 | New Hampshire | 2975 |
| Arkansas | 88-0469 | New Jersey-NELAP | TN002 |
| California | 2932 | New Mexico ¹ | n/a |
| Colorado | TN00003 | New York | 11742 |
| Connecticut | PH-0197 | North Carolina | Env375 |
| Florida | E87487 | North Carolina ¹ | DW21704 |
| Georgia | NELAP | North Carolina ³ | 41 |
| Georgia ¹ | 923 | North Dakota | R-140 |
| Idaho | TN00003 | Ohio-VAP | CL0069 |
| Illinois | 200008 | Oklahoma | 9915 |
| Indiana | C-TN-01 | Oregon | TN200002 |
| Iowa | 364 | Pennsylvania | 68-02979 |
| Kansas | E-10277 | Rhode Island | LA000356 |
| Kentucky ^{1,6} | 90010 | South Carolina | 84004 |
| Kentucky ² | 16 | South Dakota | n/a |
| Louisiana | AI30792 | Tennessee ^{1,4} | 2006 |
| Louisiana ¹ | LA180010 | Texas | T104704245-18-15 |
| Maine | TN0002 | Texas ⁵ | LAB0152 |
| Maryland | 324 | Utah | TN00003 |
| Massachusetts | M-TN003 | Vermont | VT2006 |
| Michigan | 9958 | Virginia | 460132 |
| Minnesota | 047-999-395 | Washington | C847 |
| Mississippi | TN00003 | West Virginia | 233 |
| Missouri | 340 | Wisconsin | 9980939910 |
| Montana | CERT0086 | Wyoming | A2LA |


Third Party Federal Accreditations

| | | | |
|-------------------------------|---------|--------------------|---------------|
| A2LA – ISO 17025 | 1461.01 | AIHA-LAP,LLC EMLAP | 100789 |
| A2LA – ISO 17025 ⁵ | 1461.02 | DOD | 1461.01 |
| Canada | 1461.01 | USDA | P330-15-00234 |
| EPA-Crypto | TN00003 | | |

¹ Drinking Water ² Underground Storage Tanks ³ Aquatic Toxicity ⁴ Chemical/Microbiological ⁵ Mold ⁶ Wastewater n/a Accreditation not applicable

Our Locations

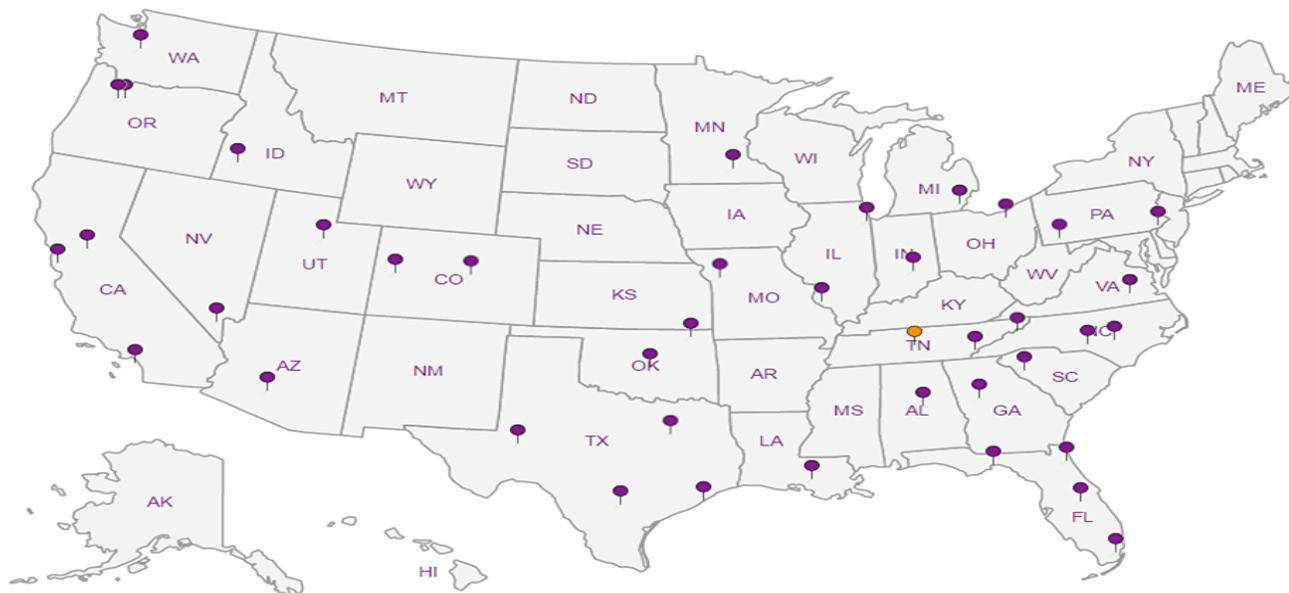Pace National has sixty-four client support centers that provide sample pickup and/or the delivery of sampling supplies. If you would like assistance from one of our support offices, please contact our main office. Pace National performs all testing at our central laboratory.



1 Cp

2 Tc

3 Ss

4 Cn

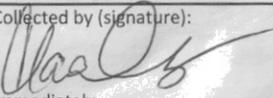
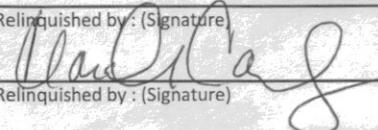
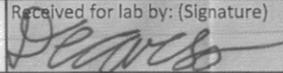
5 Sr

6 Qc

7 Gl

8 Al

9 Sc

| Billing Information: ATTN: Clara Cardoza | | | | Analysis / Container / Preservative | | | | Chain of Custody Page ___ of ___ | | | | | | | | | | | | | | | |
|--|---------------------------------------|--|-------|--|-------|--------------------------|---|--|---------------------|--------------|--|--|--|----------------------|--|--|--|---------------------------------------|-----|--|--|--|--|
| Report to: Clara Cardoza | | | | Email To: ccardoza@hilcorp.com; | | | |  12065 Lebanon Rd. Mount Juliet, TN 37122 Phone: 615-758-5858 Phone: 800-767-5859 Fax: 615-758-5859  L# L1237610 J230 Acctnum: HILCORANM Template: Prelogin: TSR: PB: Shipped Via: | | | | | | | | | | | | | | | |
| Project Description: BGT Samples | | City/State Collected: Aztec, NM | | TPH - MRO/GRO/DRO 8015M BTEX 8021B Chlorides 300.0 | | | | | | | | | | | | | | | | | | | |
| Phone: 5055640733 Fax: | Client Project # | Lab Project # | | | | | | | | | | | | | | | | | | | | | |
| Collected by (print): C Cardoza | Site/Facility ID # Multiple | P.O. # | | | | | | | | | | | | | | | | | | | | | |
| Collected by (signature):  Immediately Packed on Ice N ___ Y <input checked="" type="checkbox"/> | | Rush? (Lab MUST Be Notified) ___ Same Day <input checked="" type="checkbox"/> Five Day ___ Next Day ___ 5 Day (Rad Only) ___ Two Day ___ 10 Day (Rad Only) ___ Three Day | | | | | | Quote # | Date Results Needed | No. of Cntrs | | | | | | | | | | | | | |
| Sample ID | Comp/Grab | Matrix * | Depth | Date | Time | | | | | | | | | | | | | | | | | | |
| Huefrano Unit Com 518 | Comp | SS | | 7/6/00 | 11:25 | 1 | X | X | X | | | | | | | | | | -01 | | | | |
| Huerfano Unit 520 | Comp | SS | | 7/6/00 | 11:52 | 1 | X | X | X | | | | | | | | | | | | | | |
| Ballard 7 | Comp | SS | | 7/6/00 | 10:43 | 1 | X | X | X | | | | | | | | | | | | | | |
| Lodwick 13 | Comp | SS | | 7/6/00 | 9:02 | 1 | X | X | X | | | | | | | | | | | | | | |
| * Matrix: SS - Soil AIR - Air F - Filter GW - Groundwater B - Bioassay WW - WasteWater DW - Drinking Water OT - Other | | | | | | | | | | | | | | | | Remarks: Seperate Reports Please! | | pH ___ Temp ___ Flow ___ Other ___ | | Sample Receipt Checklist COC Seal Present/Intact: <input checked="" type="checkbox"/> NP Y N COC Signed/Accurate: <input checked="" type="checkbox"/> Y N Bottles arrive intact: <input checked="" type="checkbox"/> Y N Correct bottles used: <input checked="" type="checkbox"/> Y N Sufficient volume sent: <input checked="" type="checkbox"/> Y N If Applicable VOA Zero Headspace: ___ Y N Preservation Correct/Checked: ___ Y N RAD SCREEN: <0.5 mR/hr | | | |
| Samples returned via: ___ UPS ___ FedEx ___ Courier ___ | | | | Tracking # 4430 3422 7191 | | | | Trip Blank Received: Yes / No HCL / MeOH TBR | | | | If preservation required by Login: Date/Time | | | | | | | | | | | |
| Relinquished by: (Signature)  | | Date: 7/6/20 | | Time: 3:02pm | | Received by: (Signature) | | Date: | | Time: | | Received for lab by: (Signature)  | | Date: 7/21/20 | | Time: 8:45 | | Hold: | | Condition: NCF / <input checked="" type="checkbox"/> OK | | | |

Huerfano Unit Com 518

API#: 30-045-29175

Lease: B-9320-10

The above well's fiberglass below grade tank was registered as a metal tank in 2015 by the previous Operator. NMOCD requested closure of the BGT permit. The tank was reset above grade.







District I
 1625 N. French Dr., Hobbs, NM 88240
 Phone:(575) 393-6161 Fax:(575) 393-0720

District II
 811 S. First St., Artesia, NM 88210
 Phone:(575) 748-1283 Fax:(575) 748-9720

District III
 1000 Rio Brazos Rd., Aztec, NM 87410
 Phone:(505) 334-6178 Fax:(505) 334-6170

District IV
 1220 S. St Francis Dr., Santa Fe, NM 87505
 Phone:(505) 476-3470 Fax:(505) 476-3462

State of New Mexico
Energy, Minerals and Natural Resources
Oil Conservation Division
1220 S. St Francis Dr.
Santa Fe, NM 87505

CONDITIONS

Action 9786

CONDITIONS OF APPROVAL

| | | | | | | | | | |
|-----------|------------------------|--------------------|------------------|--------|--------|----------------|------|--------------|-------|
| Operator: | HILCORP ENERGY COMPANY | 1111 Travis Street | Houston, TX77002 | OGRID: | 372171 | Action Number: | 9786 | Action Type: | C-144 |
|-----------|------------------------|--------------------|------------------|--------|--------|----------------|------|--------------|-------|

| | |
|--------------|--|
| OCD Reviewer | Condition |
| csmith | Closure Report Approved. Operator reset Fiberglass BGT to be above grade. If the tank is not above grade and meets the requires of a BGT per 19.15.17 NMAC operator maybe required to reregister the tank. |