

Well Name: EAGLE 33 N FEDERAL	Well Location: T17S / R27E / SEC 33 / SESW /	County or Parish/State: EDDY / NM
Well Number: 26	Type of Well: OIL WELL	Allottee or Tribe Name:
Lease Number: NMLC026874B	Unit or CA Name:	Unit or CA Number:
US Well Number: 300154121400X1	Well Status: Abandoned	Operator: REDWOOD OPERATING LLC

Subsequent Report

Sundry ID: 2642925

Type of Submission: Subsequent Report

Date Sundry Submitted: 11/04/2021

Date Operation Actually Began: 10/25/2021

Type of Action: Plug and Abandonment

Time Sundry Submitted: 07:25

**Actual Procedure:** 10/25/21 MIRU plugging equipment, dug out cellar. Pump'd 65 BBLS Brine H2O down tbg. ND well head, NU BOP. 10/26/21 RU Rotary Wireline, tagged @ 1124'. Cut tbg @1100'. RD wireline. POH w/ 34 jts of tbg. Set 5 1/2" CICR @1014'. Stung into CICR & sqz'd 100 sx class C cmt from 1014-2025' +/- . Stung out of retainer. 10/27/21 Stung into CICR. Tried to pressure test plug, held 0 PSI. Re-squeezed 100 sx class C cmt w/ 3% CACL from 1014-2025' +/- . WOC. Pressure tested plug, held 500 PSI. Stung out. Circ'd hole w/ MLF. Pressure tested csg, held 500 PSI. Spotted 25 sx class C cmt @ 1014-767'. ND BOP. Spotted 50 sx class C cmt @ 490 & circulated to surface. 10/28/21 Rigged down & moved off. 10/29/21 moved backhoe & welder to location. Stopped job to bleed out residual gas. 11/1/21 moved backhoe & welder to location. Dug out cellar. Stopped job, needs remedial cmt @ surface. 11/2/21 cut off anchors. Pump'd remedial cmt @ surface. Chase Messer w/ BLM verified cmt @ surface via picture text message. Welded on "Above Ground Dry Hole Marker". Backfilled cellar, cut off deadman, cleaned location, & moved off.

Well Number: 26

Type of Well: OIL WELL

Allottee or Tribe Name:

Lease Number: NMLC026874B

Unit or CA Name:

Unit or CA Number:

US Well Number: 300154121400X1

Well Status: Abandoned

Operator: REDWOOD OPERATING LLC

Operator Certification

I certify that the foregoing is true and correct. Title 18 U.S.C. Section 1001 and Title 43 U.S.C. Section 1212, make it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction. Electronic submission of Sundry Notices through this system satisfies regulations requiring a submission of Form 3160-5 or a Sundry Notice.

Operator Electronic Signature: DELILAH FLORES

Signed on: NOV 04, 2021 07:25 AM

Name: REDWOOD OPERATING LLC

Title: Regulatory Technician 1

Street Address: 11344 LOVINGTON HWY

City: ARTESIA

State: NM

Phone: (575) 748-1288

Email address: DELILAH@MEC.COM

Field Representative

Representative Name:

Street Address:

City:

State:

Zip:

Phone:

Email address:

BLM Point of Contact

BLM POC Name: JAMES A AMOS

BLM POC Title: Acting Assistant Field Manager

BLM POC Phone: 5752345927

BLM POC Email Address: jamos@blm.gov

Disposition: Accepted


Disposition Date: 11/04/2021

Signature: James A. Amos

Redwood		Plugged	
Author:	Abby @ BCM	Well No.	#26
Well Name	Eagle 33 N Fed	API #:	30-015-41214
Field/Pool	Red Lake;Qn-GRBG-SA	Location:	Sec 33 T17S, R27E
County	Eddy		330FSL & 1750 FWL
State	New Mexico	GL:	3548'
Spud Date	4/21/2013		

Description	O.D.	Grade	Weight	Depth	Hole	Cmt Sx	TOC
Surface Csg	8 5/8	J55	24#	437	12 1/4	280	0
Prod Csg	5 1/2	J55	17#	4,585	7 7/8	1,000	0

Formation	Top
7 Rvs	292
Queen	817
Grbg	1236
San Andres	1462
Glorieta	2790
Yeso	2881
Tubb	4264

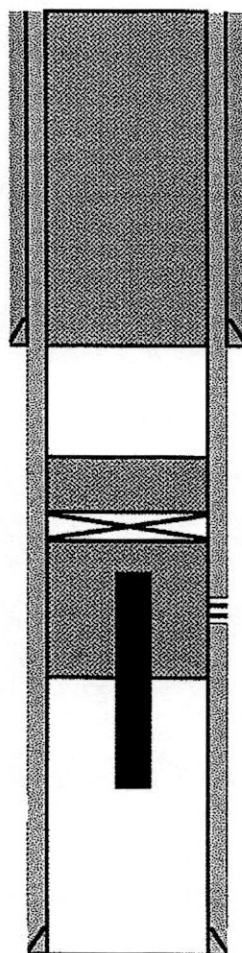

8 5/8 24# CSG @ 437  
Hole Size: 12 1/4

4. Spotted 50 sx class C cmt @ 490' & circulated to surface. Pumped remedial cmt @ surface before DHM.

3. Spotted 25 sx class C cmt @ 1014-767'.

2. Set 5 1/2" CICR @ 1014'. Stung into CICR & sqz'd 100 sx class C cmt from 1014 to 2025' +/- . Tried to pressure test plug, held 0 PSI. Re-Squeezed 100 sx class C cmt w/ 3% CACL from 1014-2025' +/- . WOC. Pressture tested plug, held 500 PSI.

1. Cut tbg @ 1100'. POH w/ 34 Stands.  
Perfs @ 1430-4452'

2 7/8 L80 tbg @ 2688'

5 1/2 17# CSG @ 4,585  
Hole Size: 7 7/8

**District I**  
1625 N. French Dr., Hobbs, NM 88240  
Phone:(575) 393-6161 Fax:(575) 393-0720  
**District II**  
811 S. First St., Artesia, NM 88210  
Phone:(575) 748-1283 Fax:(575) 748-9720  
**District III**  
1000 Rio Brazos Rd., Aztec, NM 87410  
Phone:(505) 334-6178 Fax:(505) 334-6170  
**District IV**  
1220 S. St Francis Dr., Santa Fe, NM 87505  
Phone:(505) 476-3470 Fax:(505) 476-3462

**State of New Mexico**  
**Energy, Minerals and Natural Resources**  
**Oil Conservation Division**  
**1220 S. St Francis Dr.**  
**Santa Fe, NM 87505**

CONDITIONS  
  
Action 60996

CONDITIONS

Operator: Redwood Operating LLC PO Box 1370 Artesia, NM 88211370	OGRID: 330211
	Action Number: 60996
	Action Type: [C-103] Sub. Plugging (C-103P)

CONDITIONS

Created By	Condition	Condition Date
gcordero	None	11/16/2021