

Well Name: OMLER A	Well Location: T28N / R10W / SEC 35 / NWNW / 36.62347 / -107.87032	County or Parish/State: SAN JUAN / NM
Well Number: 2E	Type of Well: CONVENTIONAL GAS WELL	Allottee or Tribe Name:
Lease Number: NMSF077085	Unit or CA Name:	Unit or CA Number:
US Well Number: 3004524116	Well Status: Producing Gas Well	Operator: HILCORP ENERGY COMPANY

Notice of Intent

Sundry ID: 2724625

Type of Submission: Notice of Intent	Type of Action: Workover Operations
Date Sundry Submitted: 04/06/2023	Time Sundry Submitted: 06:34
Date proposed operation will begin: 06/01/2023	

Procedure Description: Hilcorp Energy is requesting approval to repair the packer in the subject well per the attached procedure and wellbore diagram.

Surface Disturbance

Is any additional surface disturbance proposed?: No

NOI Attachments

Procedure Description

Omler_A_2E__Packer_Repair_2023_20230406063401.pdf

Received by OCD: 4/6/2023 1:26:00 PM

Well Name: OMLER A

Well Location: T28N / R10W / SEC 35 / NWNW / 36.62347 / -107.87032

County or Parish/State: SAN JUAN / NM

Well Number: 2E

Type of Well: CONVENTIONAL GAS WELL

Allottee or Tribe Name:

Lease Number: NMSF077085

Unit or CA Name:

Unit or CA Number:

US Well Number: 3004524116

Well Status: Producing Gas Well

Operator: HILCORP ENERGY COMPANY

Operator

I certify that the foregoing is true and correct. Title 18 U.S.C. Section 1001 and Title 43 U.S.C. Section 1212, make it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction. Electronic submission of Sundry Notices through this system satisfies regulations requiring a

Operator Electronic Signature: TAMMY JONES

Signed on: APR 06, 2023 06:34 AM

Name: HILCORP ENERGY COMPANY

Title: Regulatory Compliance Specialist

Street Address: 382 ROAD 3100

City: AZTECState: NM

Phone: (505) 324-5185

Email address: tajones@hilcorp.com

Field

Representative Name:

Street Address:

City:State:Zip:

Phone:

Email address:

BLM Point of Contact

BLM POC Name: KENNETH G RENNICK

BLM POC Title: Petroleum Engineer

BLM POC Phone: 5055647742

BLM POC Email Address: krennick@blm.gov

Disposition: Approved

Disposition Date: 04/06/2023

Signature: Kenneth Rennick

Omler A 2 E

D-35-28N-10W 890 FNL 890 FWL

API#: 300 45 24116

Packer Repair – Failed Packer Test


3/17/2023


As a result of the failed packer test performed on 3/15/2023 Hilcorp intends to:

- Fish existing Model F Permanent Packer
- Set new AS1X Packer
- RTP well as a dual completion

Packer Repair Procedure:

1. MIRU workover rig
2. Unseat 2 3/8" DK production string out of Model F packer seal assembly at 6257'
3. RIH with fishing BHA, burn over and fish Model F Packer
4. Set new AS1X packer at +/- 6250'.
5. Conduct packer test following rig work to confirm zone isolation.
6. RTP DK production on 2 3/8" Plunger lift

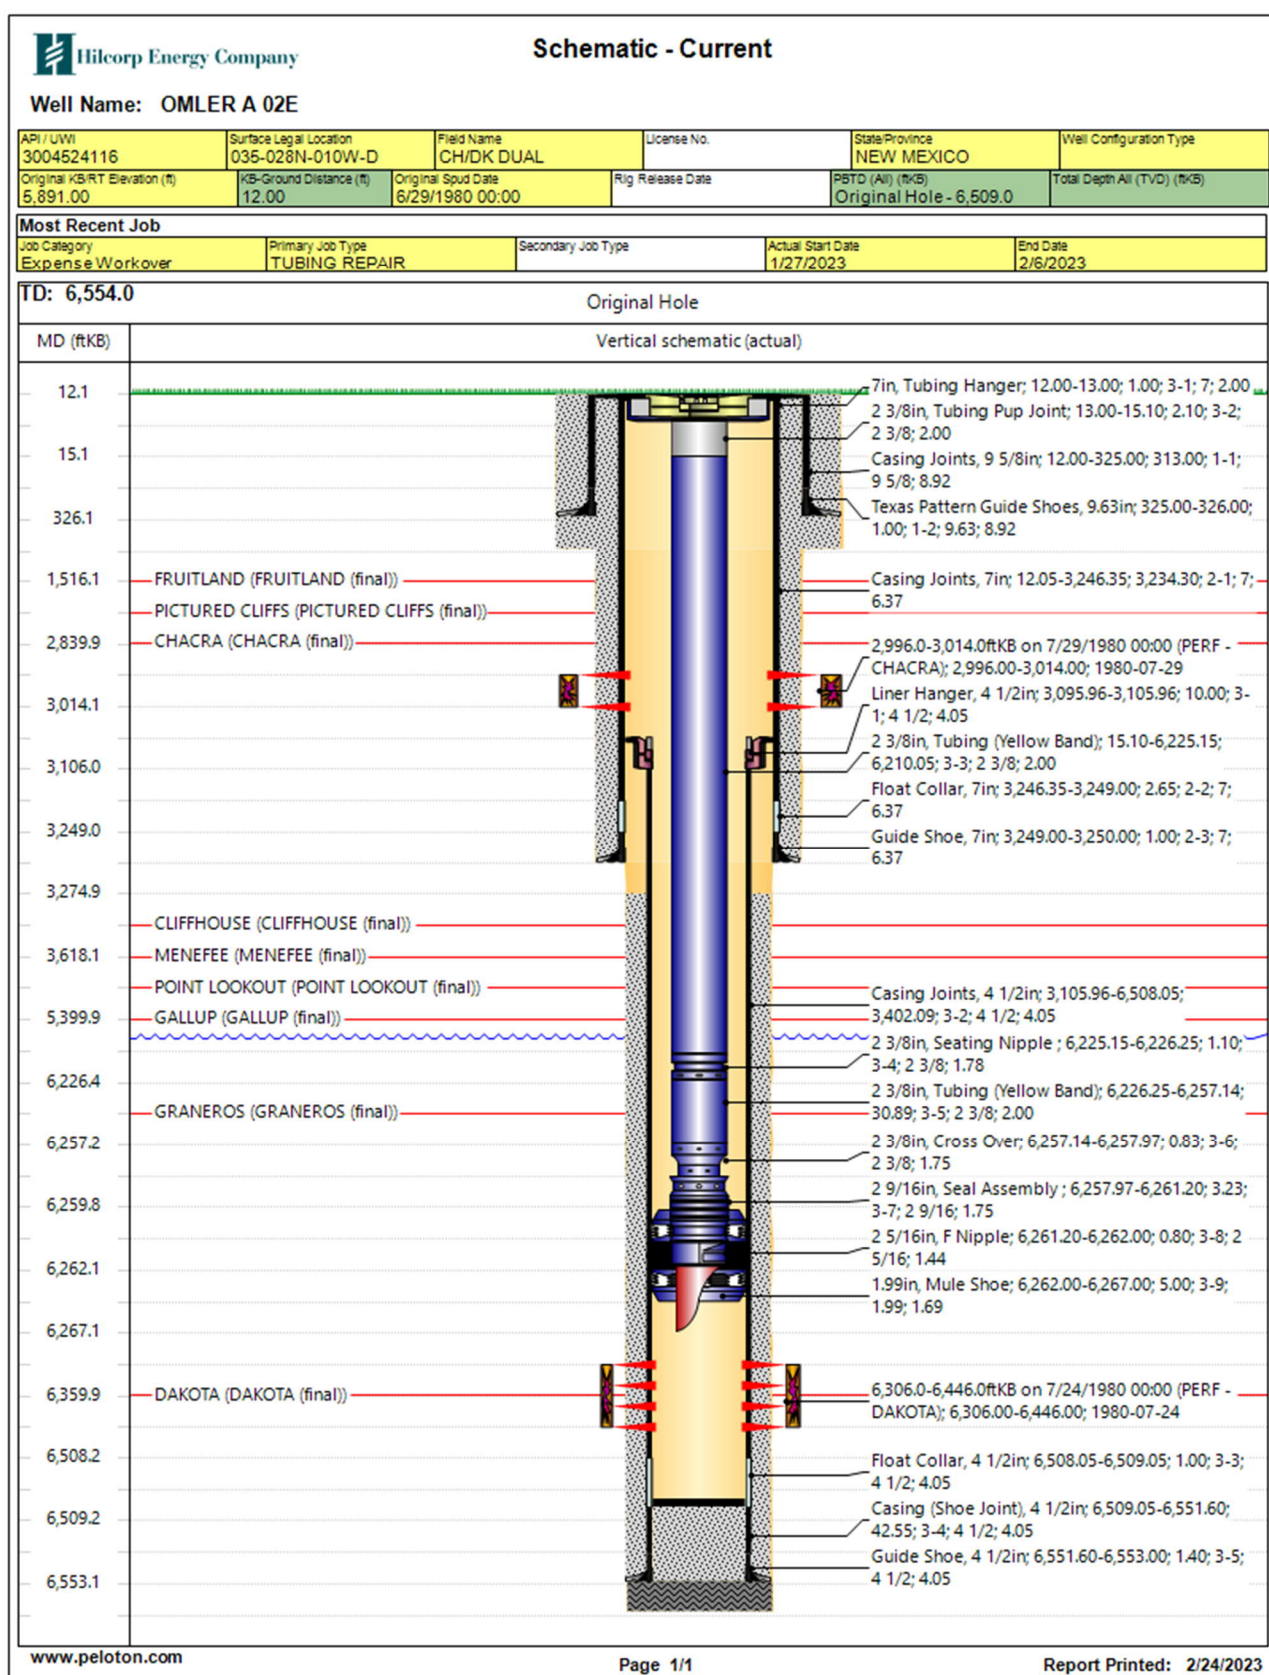

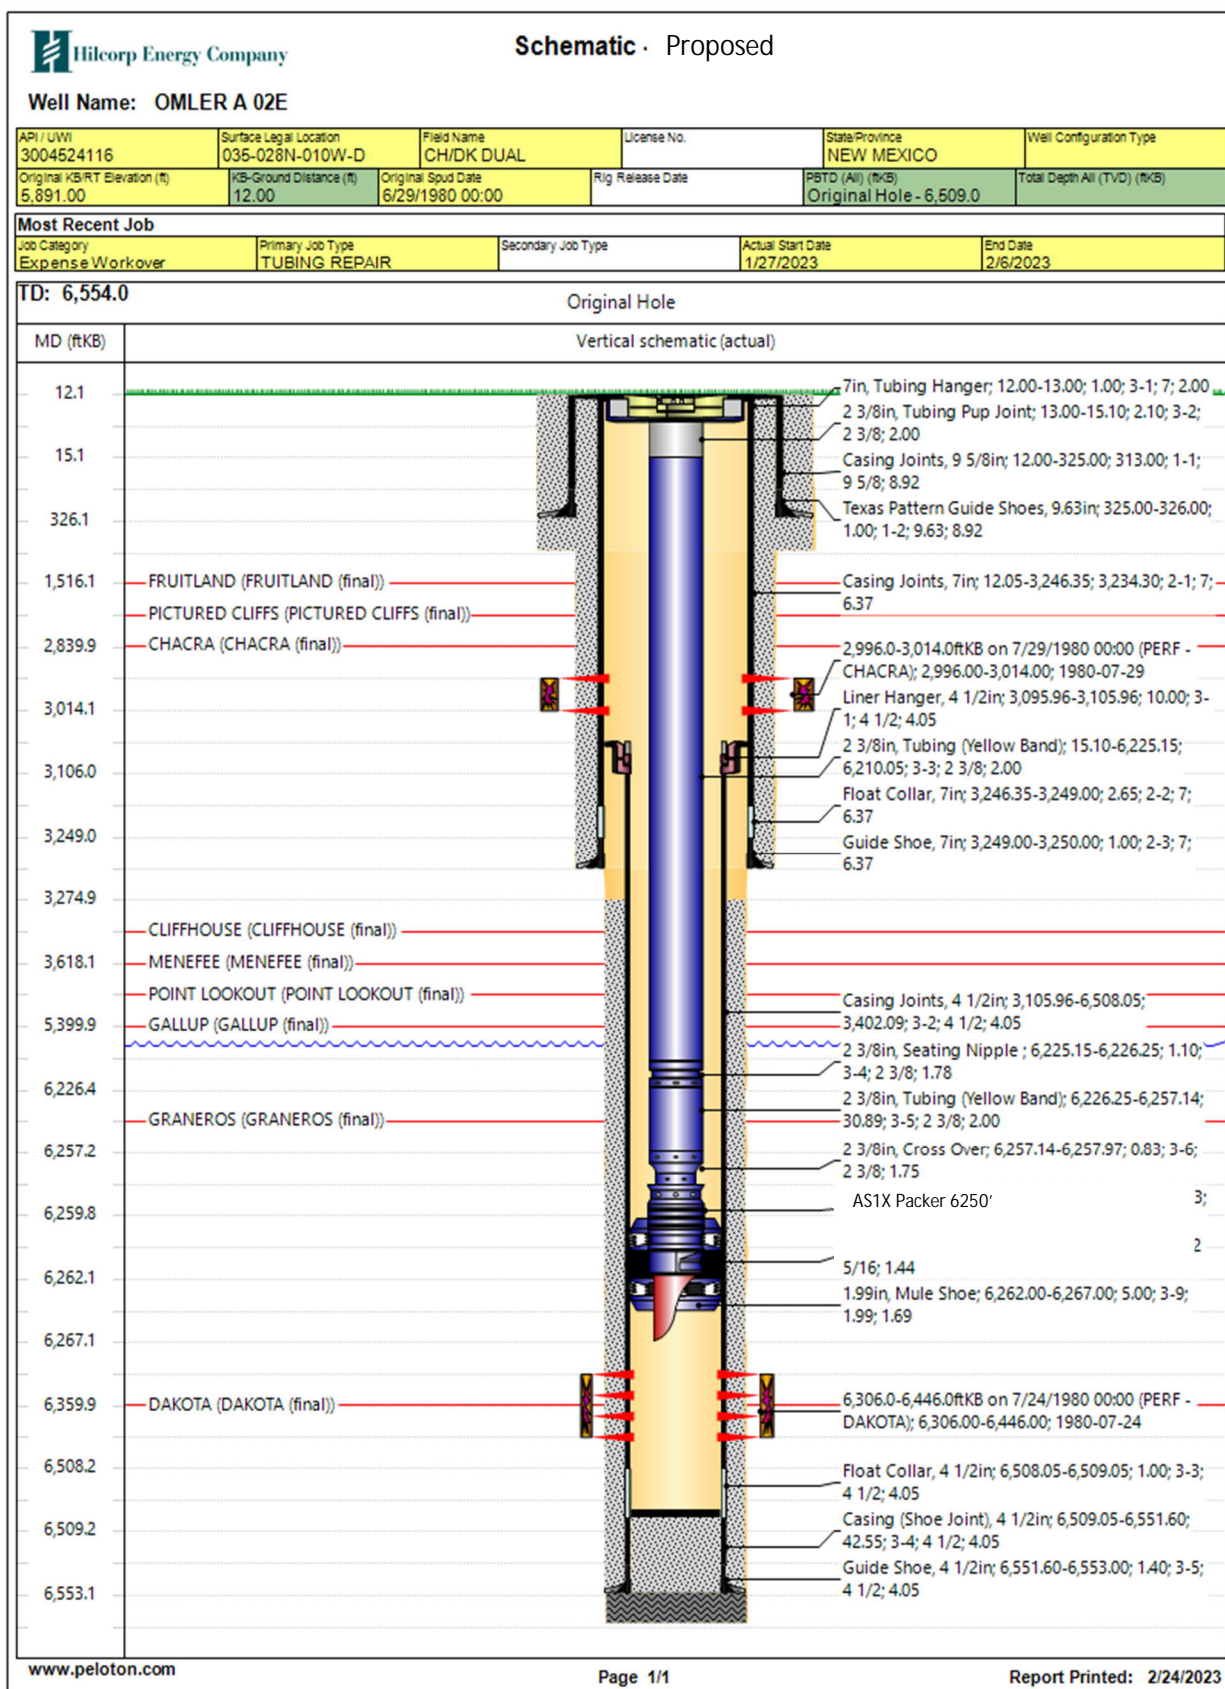

District I
1625 N. French Dr., Hobbs, NM 88240
Phone:(575) 393-6161 Fax:(575) 393-0720
District II
811 S. First St., Artesia, NM 88210
Phone:(575) 748-1283 Fax:(575) 748-9720
District III
1000 Rio Brazos Rd., Aztec, NM 87410
Phone:(505) 334-6178 Fax:(505) 334-6170
District IV
1220 S. St Francis Dr., Santa Fe, NM 87505
Phone:(505) 476-3470 Fax:(505) 476-3462

State of New Mexico
Energy, Minerals and Natural Resources
Oil Conservation Division
1220 S. St Francis Dr.
Santa Fe, NM 87505

CONDITIONS

Action 204843

CONDITIONS

Operator: HILCORP ENERGY COMPANY 1111 Travis Street Houston, TX 77002	OGRID: 372171
	Action Number: 204843
	Action Type: [C-103] NOI Workover (C-103G)

CONDITIONS

Created By	Condition	Condition Date
mkuehling	None	4/6/2023