

Bratcher, Mike, EMNRD

From: Jacob Kamplain <jkamplain@rice-ecs.com>
Sent: Thursday, August 01, 2013 11:12 AM
To: 'Burton, Michael'; Bratcher, Mike, EMNRD
Cc: bwall@linnenergy.com; hconder@riceswd.com; 'Lara Weinheimer'
Subject: Linn Energy skelly unit #2 ad
Attachments: Linn Energy Skelly Unit #2 AD - Vertical and SB Installation.jpg; Linn Energy Skelly Unit #2 AD - Excavations.jpg

Gentlemen, attached is the vertical and SB data as well as the excavaion data for the Skelly unit #2ad. As per the corrective action plan approved on may 3rd, 2013 , the site has been excavated to a depth of 4 ft bgs or to a laboratory chloride level of 1,000 mg/kg. If no further actions are deemed necessary, we would like permission to backfill the site.

We appreciate the opportunity to work with you on this project. If you have any questions or concerns, please contact Hack Conder at (575) 631-6432 or me at the number below.

Jacob Kamplain
Project Leader
RECS
419 W. Cain
Hobbs, NM 88240
575-942-8221

Excavation Lab Sampling

	Cl	GRO	DRO	B	T	E	EX	BTEX
North Wall Center	<10	<10	<0.05	<0.05	<0.05	<0.05	<0.05	<0.05
East Wall Center	<10	<10	<0.05	<0.05	<0.05	<0.05	<0.05	<0.05
South Wall Center	45	<10	<10	<0.05	<0.05	<0.05	<0.05	<0.05
West Wall Center	128	<10	<10	<0.05	<0.05	<0.05	<0.05	<0.05
Bottom Center @ 4'	27.00	778	15.00	0.152	3.43	10.3	46.4	40.5

Excavation
28' x 31' x 4'

E Wall
S Wall
Bottom Center
NW Wall
W Wall

Legend

- △ FINAL SAMPLE POINTS
- EXCAVATION
- - - POSSIBLE ROW CHEVRON
- - - SURFACE ELECTRICAL LINE
- SURFACE PIPELINE
- STAIN (267 sq ft)

Landowner = BLM

DGW = 188 ft

bing




**LINN ENERGY
SKELLY UNIT**

#2 AD

LEGALS: UL/C sec. 22

T-17-S R-31-E

EDDY COUNTY, NM

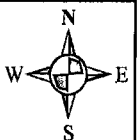


0 30 60
Feet

GPS date: 5/16/13 DH
Drawing date: 5/17/13
Drafted by: L. Weinheimer

Vertical and SB Installation Data

Vertical											SB-1										
Depth	CI	PID	GRO	DRO	B	T	E	X	BTEX		Depth	CI	PID	Lab CI	GRO	DRO	B	T	E	X	BTEX
4.5	7736	179.2									4	89	0.2								
5	4966	393.6									6	845	19.6								
5.5	5607	419.5									9	2941	1026								
6	5570	826.3									12	4805	3358								
6.5	4390	509.6									15	4619	1817								
7	5760	1467	1860	16700	0.615	15.3	22.2	57.9	96		18	2468	1011								
7.5	9235	363.1									21	299	137.8								
8	7364	380.5									24	250	197.7								
8.5	8834	357									27	235	121.9								
9	7690	427.5									30	256	149								
9.5	5925	576.1									33	260	149.3								
10	3881	644.7									36	148	69.1								
11	3963	749.2									39	115	26.5	64	<10	11.3	<0.05	<0.05	<0.05	<0.15	<0.3
12	4632	524.5																			
13	3299	754.2																			
14	3904	667.7																			
15	5069	1035																			
16	4743	652.2																			
17	7440	288.1	72.5	2040	<0.05	0.16	0.505	1.68	2.34												

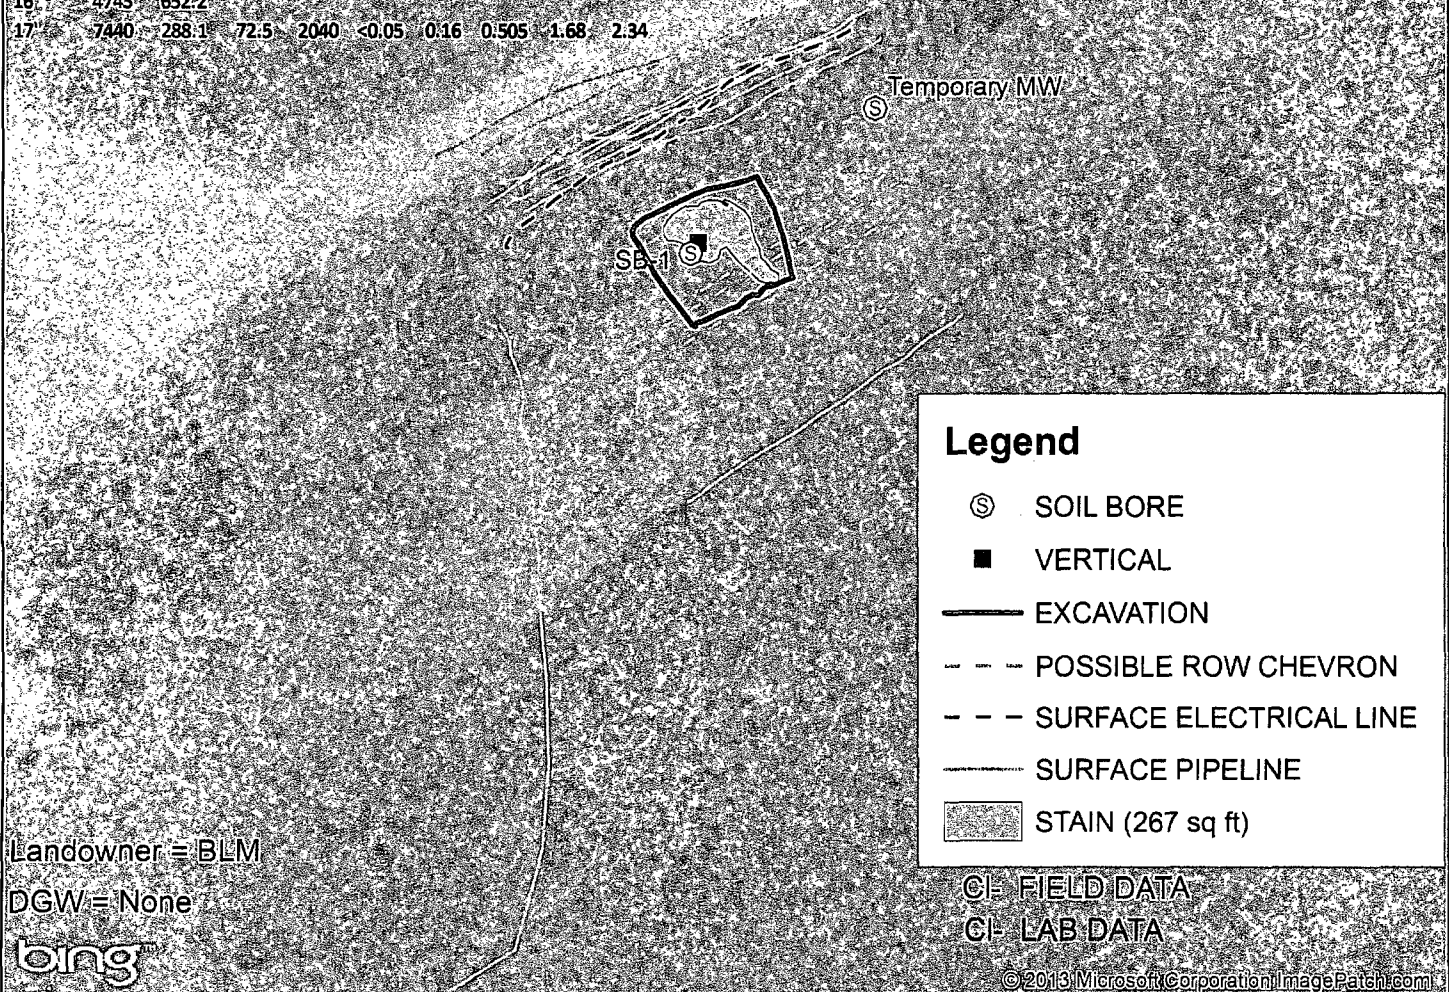

LINN ENERGY SKELLY UNIT

#2 AD

LEGALS: UL/C sec. 22

T-17-S R-31-E

EDDY COUNTY, NM



0 30 60
Feet

GPS date: 6/4/13 KL
Drawing date: 6/7/13
Drafted by: L. Weinheimer

Bratcher, Mike, EMNRD

From: Bratcher, Mike, EMNRD
Sent: Thursday, August 15, 2013 5:47 PM
To: 'Jacob Kamplain'; 'Burton, Michael'
Cc: bwall@linnenergy.com; hconder@riceswd.com; 'Lara Weinheimer'
Subject: RE: Linn Energy skelly unit #2 ad

Jacob,

As we discussed, a liner will be installed at the 4' bgs interval and then backfilled. OCD concurs with BLM and approves the request to backfill at this site. NMOCD tracking number: **2RP-1293**

OCD approval does not relieve the operator of liability should their operations fail to adequately investigate and remediate contamination that may pose a threat to ground water, surface water, human health or the environment. In addition, OCD approval does not relieve the operator of responsibility for compliance with any other federal, state, local laws and/or regulations.

Mike Bratcher
NMOCD District 2
811 S. First Street
Artesia, NM 88210
O: 575-748-1283 X108
C: 575-626-0857
F: 575-748-9720

From: Jacob Kamplain [<mailto:jkamplain@rice-ecs.com>]
Sent: Thursday, August 01, 2013 11:12 AM
To: 'Burton, Michael'; Bratcher, Mike, EMNRD
Cc: bwall@linnenergy.com; hconder@riceswd.com; 'Lara Weinheimer'
Subject: Linn Energy skelly unit #2 ad

Gentlemen, attached is the vertical and SB data as well as the excavation data for the Skelly unit #2ad. As per the corrective action plan approved on May 3rd, 2013, the site has been excavated to a depth of 4 ft bgs or to a laboratory chloride level of 1,000 mg/kg. If no further actions are deemed necessary, we would like permission to backfill the site.

We appreciate the opportunity to work with you on this project. If you have any questions or concerns, please contact Hack Conder at (575) 631-6432 or me at the number below.

Jacob Kamplain
Project Leader
RECS
419 W. Cain
Hobbs, NM 88240
575-942-8221

Bratcher, Mike, EMNRD

From: Microsoft Outlook
To: Jacob Kamplain; 'Burton, Michael'; bwall@linnenergy.com; hconder@riceswd.com; 'Lara Weinheimer'
Sent: Thursday, August 15, 2013 5:47 PM
Subject: Relayed: RE: Linn Energy skelly unit #2 ad

Delivery to these recipients or groups is complete, but no delivery notification was sent by the destination server:

Jacob Kamplain (jkamplain@rice-ecs.com)

'Burton, Michael' (mburton@blm.gov)

bwall@linnenergy.com (bwall@linnenergy.com)

hconder@riceswd.com (hconder@riceswd.com)

'Lara Weinheimer' (lweinheimer@rice-ecs.com)

Subject: RE: Linn Energy skelly unit #2 ad

Bratcher, Mike, EMNRD

From: Jacob Kamplain <jkamplain@rice-ecs.com>
Sent: Friday, August 16, 2013 8:49 AM
To: 'Burton, Michael'; Bratcher, Mike, EMNRD
Cc: 'Lara Weinheimer'; hconder@riceswd.com
Subject: Linn Skelly #2

Gentlemen, we will begin key setting liner and backfilling the Linn Skelly #2 AD on 8/20/13 as per Mike Bratcher with NMOCD's approval 8/15/13, and Mike Burton with BLM's approval 8/16/13. Let me know if there are any issues with this. Thank you.

We appreciate the opportunity to work with you on this project. If you have any questions or concerns, please contact Hack Conder at (575) 631-6432 or me at the number below.

Jacob Kamplain
Project Leader
RECS
419 W. Cain
Hobbs, NM 88240
575-942-8221