



Remediation Plan

@

Woolworth 12"

Project # 2008-017

Unit ltr."l" Section 28 Twns. 24S Range 37E

Lea County, New Mexico

Site Remediation Plan

Southern Union Gas Services
Woolworth 12"
2008-017

Unit ltr. I Section 28, Twns. 24S, Range 37E

Waste Management and Remediation Specialist

Signature Tony Savoie

Date: 6/4/08

Tony Savoie
P.O. Box 1226
Jal, New Mexico 88252
575-631-9376
E-mail: tony.savoie@sug.com

District I
1625 N French Dr., Hobbs, NM 88240
District II
1301 W. Grand Avenue, Artesia, NM 88210
District III
1000 Rio Brazos Road, Aztec, NM 87410
District IV
1220 S. St Francis Dr., Santa Fe, NM 87505

State of New Mexico
Energy Minerals and Natural Resources
Oil Conservation Division
1220 South St. Francis Dr.
Santa Fe, NM 87505

Form C-141
Revised October 10, 2003

Submit 2 Copies to appropriate
District Office in accordance
with Rule 116 on back
side of form

Release Notification and Corrective Action

OPERATOR

Initial Report Final Report

Name of Company	Southern Union Gas Services, Ltd.	Contact	Tony Savoie
Address	P.O. Box 1226 Jal, N.M. 88252	Telephone No.	575-395-2116
Facility Name	Lea County Field Dept.	Facility Type	Natural Gas Gathering

Surface Owner: Woolworth "Jal Library"	Mineral Owner: Fee	Lease No. 30-025-23258
--	--------------------	------------------------

LOCATION OF RELEASE

Unit Letter	Section	Township	Range	Feet from the	North/South Line	Feet from the	East/West Line	County
I	28	24S	37E					Lea

Latitude N32 11.137 Longitude W103 09.778

NATURE OF RELEASE

Type of Release : Natural Gas and crude oil	Volume of Release: 17 mcf natural gas and 12 Bbls crude oil	Volume Recovered / None
Source of Release : 12" Natural Gas Pipeline	Date and Hour of Occurrence Unknown	Date and Hour of Discovery 3/1/08 Time: 8:00 a.m.
Was Immediate Notice Given? <input type="checkbox"/> Yes <input checked="" type="checkbox"/> No <input type="checkbox"/> Not Required	If YES, To Whom?	
By Whom?	Date and Hour:	
Was a Watercourse Reached? <input type="checkbox"/> Yes <input checked="" type="checkbox"/> No	If YES, Volume Impacting the Watercourse.	

If a Watercourse was Impacted, Describe Fully.*

Describe Cause of Problem and Remedial Action Taken.*
A 12" Natural gas pipeline operating at approximately 15 p.s.i. developed a leak, a repair crew excavated the leak area and installed a temporary repair clamp on 3/1/08. The line was permanently repaired on 3/20/08 by inserting approximately 500 ft. of 8" poly-pipe inside the existing 12" steel line

Describe Area Affected and Cleanup Action Taken. The leak site was discovered by Tony Savoie on 6/4/08 an ESA was performed and a remediation plan was prepared. Approximately 1580 Sq. ft. of pasture was affected by the release and repair activities. All remediation activities will follow the NMOCD guidelines.

I hereby certify that the information given above is true and complete to the best of my knowledge and understand that pursuant to NMOCD rules and regulations all operators are required to report and/or file certain release notifications and perform corrective actions for releases which may endanger public health or the environment. The acceptance of a C-141 report by the NMOCD marked as "Final Report" does not relieve the operator of liability should their operations have failed to adequately investigate and remediate contamination that pose a threat to ground water, surface water, human health or the environment. In addition, NMOCD acceptance of a C-141 report does not relieve the operator of responsibility for compliance with any other federal, state, or local laws and/or regulations.

Signature: <i>Tony Savoie</i>	OIL CONSERVATION DIVISION	
Printed Name: John A. Savoie	Approved by District Supervisor: <i>J. Johnson</i> ENVIRONMENTAL ENGINEER	
Title: Remediation Supervisor	Approval Date: 6.8.08	Expiration Date: 8.8.08
E-mail Address: tony.savoie@sug.com	Conditions of Approval:	
Date: 6/4/08 Phone: 575-395-2116	Attached <input type="checkbox"/> <i>1 RP # 1875</i>	


* Attach Additional Sheets If Necessary

FCOHO 816 237878

RECEIVED

JUN 06 2008

HOBBS OCD

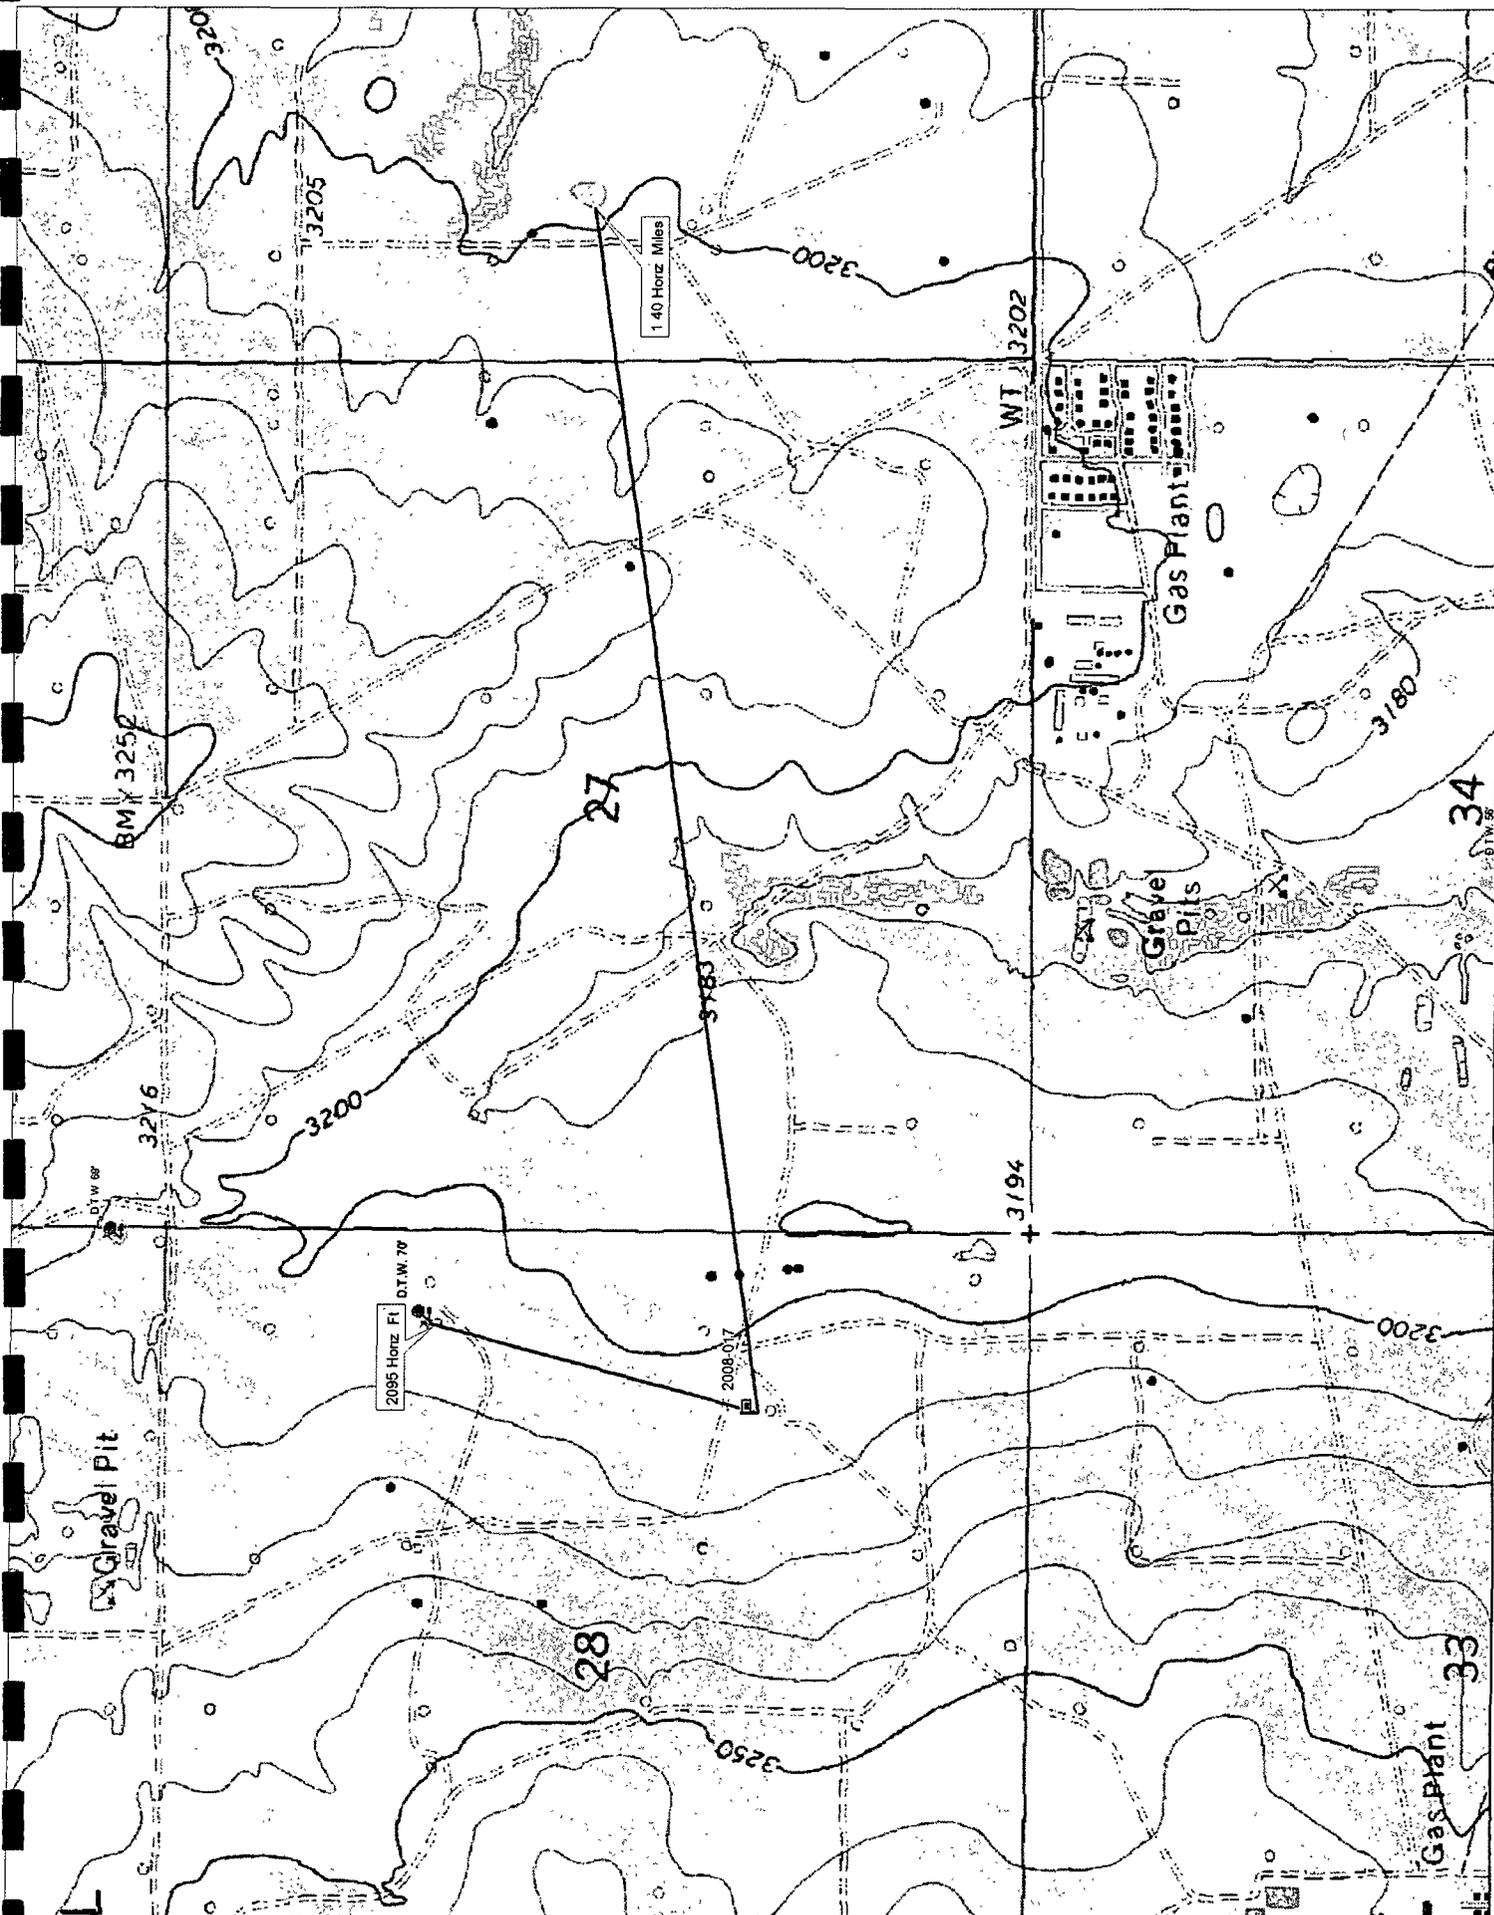

© 2002 Delorme, 3-D TopoQuads®. Data copyright of content owner.
www.delorme.com

**New Mexico Office of the State Engineer
POD Reports and Downloads**

Township: 24S Range: 37E Sections: 28

NAD27 X: Y: Zone: Search Radius: _____

County: Basin: Number: Suffix:

Owner Name: (First) (Last) Non-Domestic Domestic
 All

AVERAGE DEPTH OF WATER REPORT 06/04/2008

Bsn	Tws	Rng	Sec	Zone	X	Y	Wells	(Depth Water in Feet)		
								Min	Max	Avg
CP	24S	37E	28				1	70	70	70

Record Count: 1

STATE LAND OFFICE DATA ACCESS

[Home](#)
[Select a different page.....](#)
[Go Tech](#)
**NM State Land
and Office**

land details

 * Section: * Township: * Range:

Example: 33 09S 26E

16 Records found.

No Links

Unit Letter	Lot	Tract	Qtr/Qtr	Surface Owner	Sub Surface Owner	Acreage	Lease Number	Lease Type	County	Land Restriction	Land Rema
A			NE4NE4	Federal	Fee	40.00	--	--	Lea		
B			NW4NE4	Fee	Fee	40.00	--	--	Lea		
C			NE4NW4	Fee	Fee	40.00	--	--	Lea		
D			NW4NW4	Fee	Fee	40.00	--	--	Lea		
E			SW4NW4	Fee	Fee	40.00	--	--	Lea		
F			SE4NW4	Fee	Fee	40.00	--	--	Lea		
G			SW4NE4	Fee	Fee	40.00	--	--	Lea		
H			SE4NE4	Fee	Fee	40.00	--	--	Lea		
I			NE4SE4	Fee	Fee	40.00	--	--	Lea		
J			NW4SE4	Fee	Fee	40.00	--	--	Lea		
K			NE4SW4	Fee	Fee	40.00	--	--	Lea		
L			NW4SW4	Fee	Fee	40.00	--	--	Lea		
M			SW4SW4	Fee	Fee	40.00	--	--	Lea		
N			SE4SW4	Fee	Fee	40.00	--	--	Lea		
O			SW4SE4	Fee	Fee	40.00	--	--	Lea		
P			SE4SE4	Fee	Fee	40.00	--	--	Lea		

If you have any questions about the data or this site please contact Joe Mraz (jmraz@slo.state.nm.us) of t State Land Office.

Site maintained by the PRRC, webmaster gotech_prcc@yahoo.com

Woolworth 12"

Job # 2008-017


Ranking Analysis

NMOCD Standards			Points
Depth to Ground Water	Greater than 100 ft.		0
Depth to Ground Water	Less than 100 ft. but greater than 50 ft.		10
Depth to Ground Water	Less than 50 ft.		20
Well Head Protection	Less than 1000 ft. from a water source, or;	Yes	20
	Less than 200 ft. from private domestic water source	No	0
Distance to Surface water body	Less than 200 Horizontal. ft.		20
Distance to Surface water body	200 to 1000 Horizontal ft.		10
Distance to Surface water body	Greater than 1000 Horizontal ft.		0
Action levels	>19	10-19	0-9
Benzene (mg/kg)	10	10	10
BTEX (mg/kg)	50	50	50
TPH (mg/kg)	100	1000	5000

Site Ranking			Points
Depth to Ground Water	70 Ft.		10
Well Head Protection	2095 Horizontal ft.		0
Surface Water Body	1.40 Horiz. Miles		0
Total Ranking Score			10

Site Closure Objective	
Benzene (mg/kg)	10
BTEX (mg/kg)	50
TPH (mg/kg) "Surface"	1000

Remediation Plan:
All affected soil will be excavated and sampled for the presence of Hydrocarbons EPA method (8015M)
Soil with TPH values greater than 1000 mg/kg will be transported to the S.U.G.S. Landfarm or remediated on-site.
Soil samples will be collected from the excavation and analyzed for Hydrocarbons EPA method (8015M)
All samples will be field screened with a "PID" The soil sample with the highest PID reading will be analyzed separately and tested for BTEX.

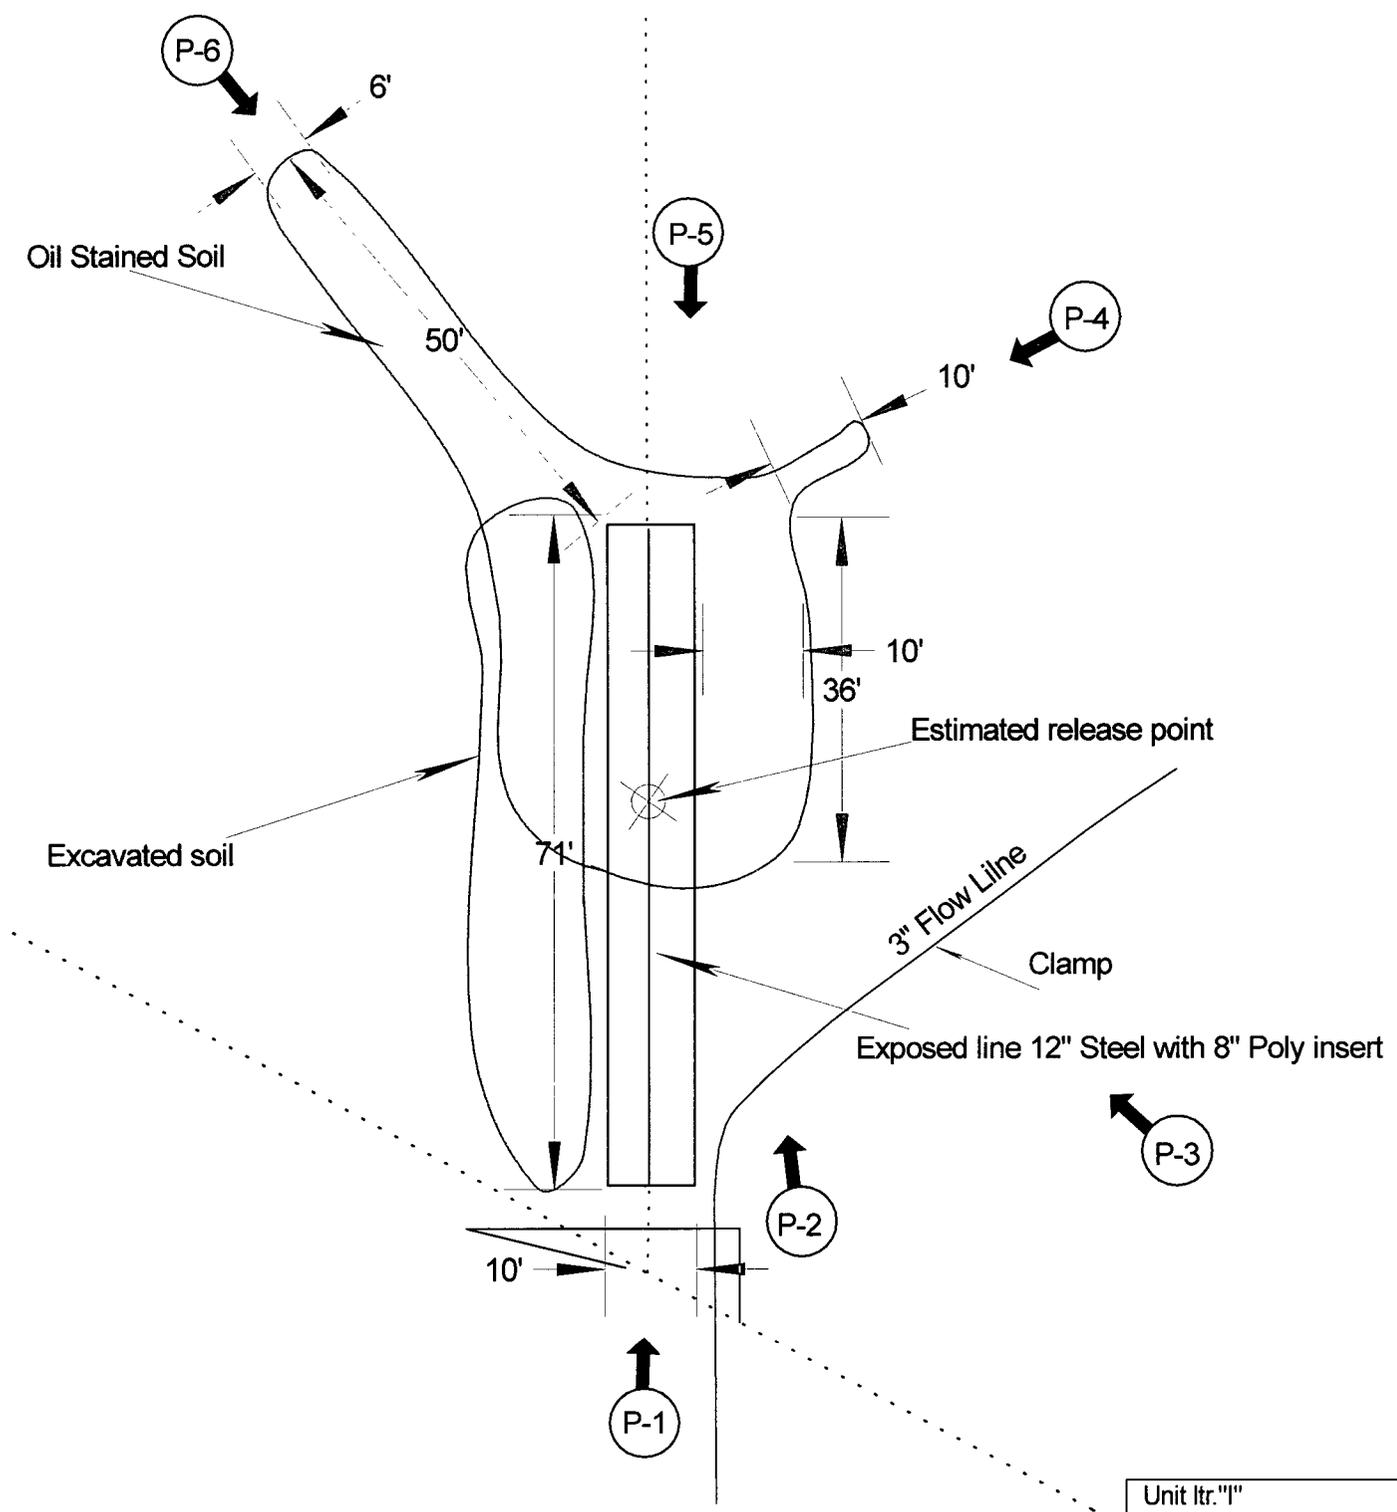

Approximate
Scale 1"= 20'

N

Unit ltr. "l"
 Section 28
 Twns.-24 S
 Range 37E
 County-Lea, N.M.
 GPS
 Lat- 32-11.137N
 Long-103-09.778W

	Site Plan-Woolworth 12"	2008-017
	Lea County Area Jal, N.M.	Figure 1



Photo 1



Photo 2

Southern Union Gas Services Site: Woolworth 12"
Job # 2008-017
Site Assessment 6/4/08

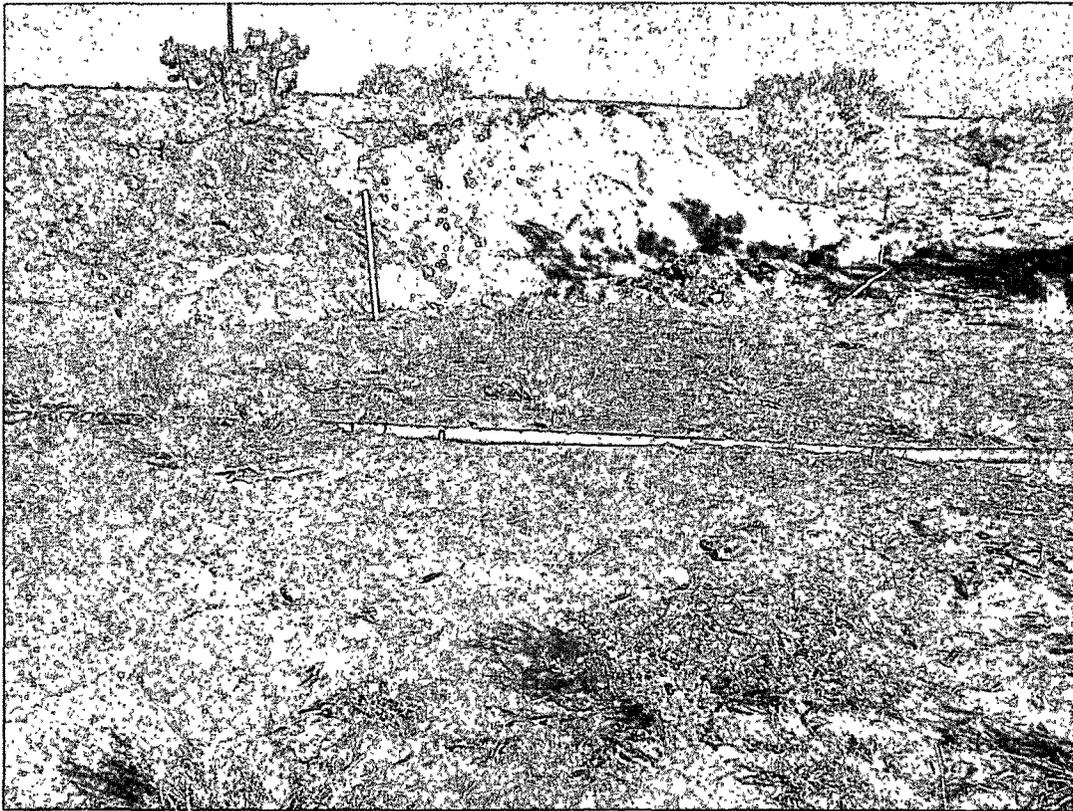


Photo 3

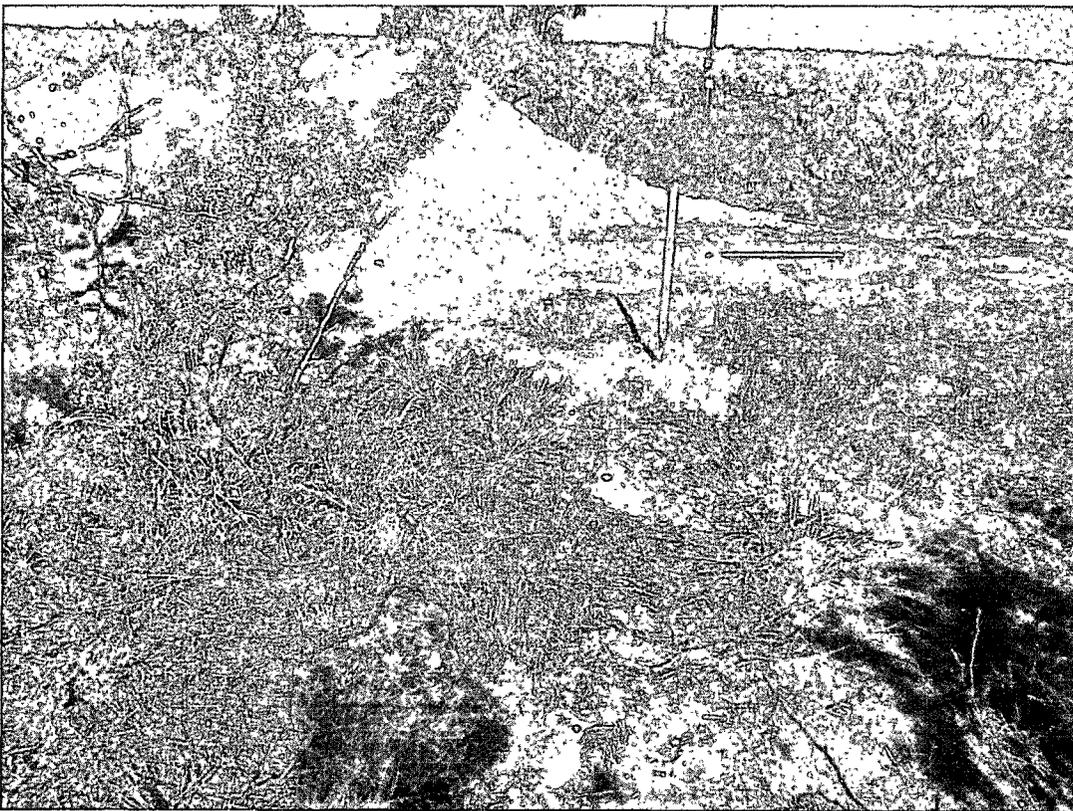


Photo 4

Southern Union Gas Services Site: Woolworth 12"
Job # 2008-017
Site Assessment 6/4/08



Photo 5



Photo 6

Southern Union Gas Services Site: Woolworth 12"
Job # 2008-017
Site Assessment 6/4/08