


SAN JUAN COUNTY NEW MEXICO

BALLARD P.C.

TOWNSHIP 26 N RANGE 8 & 9 W

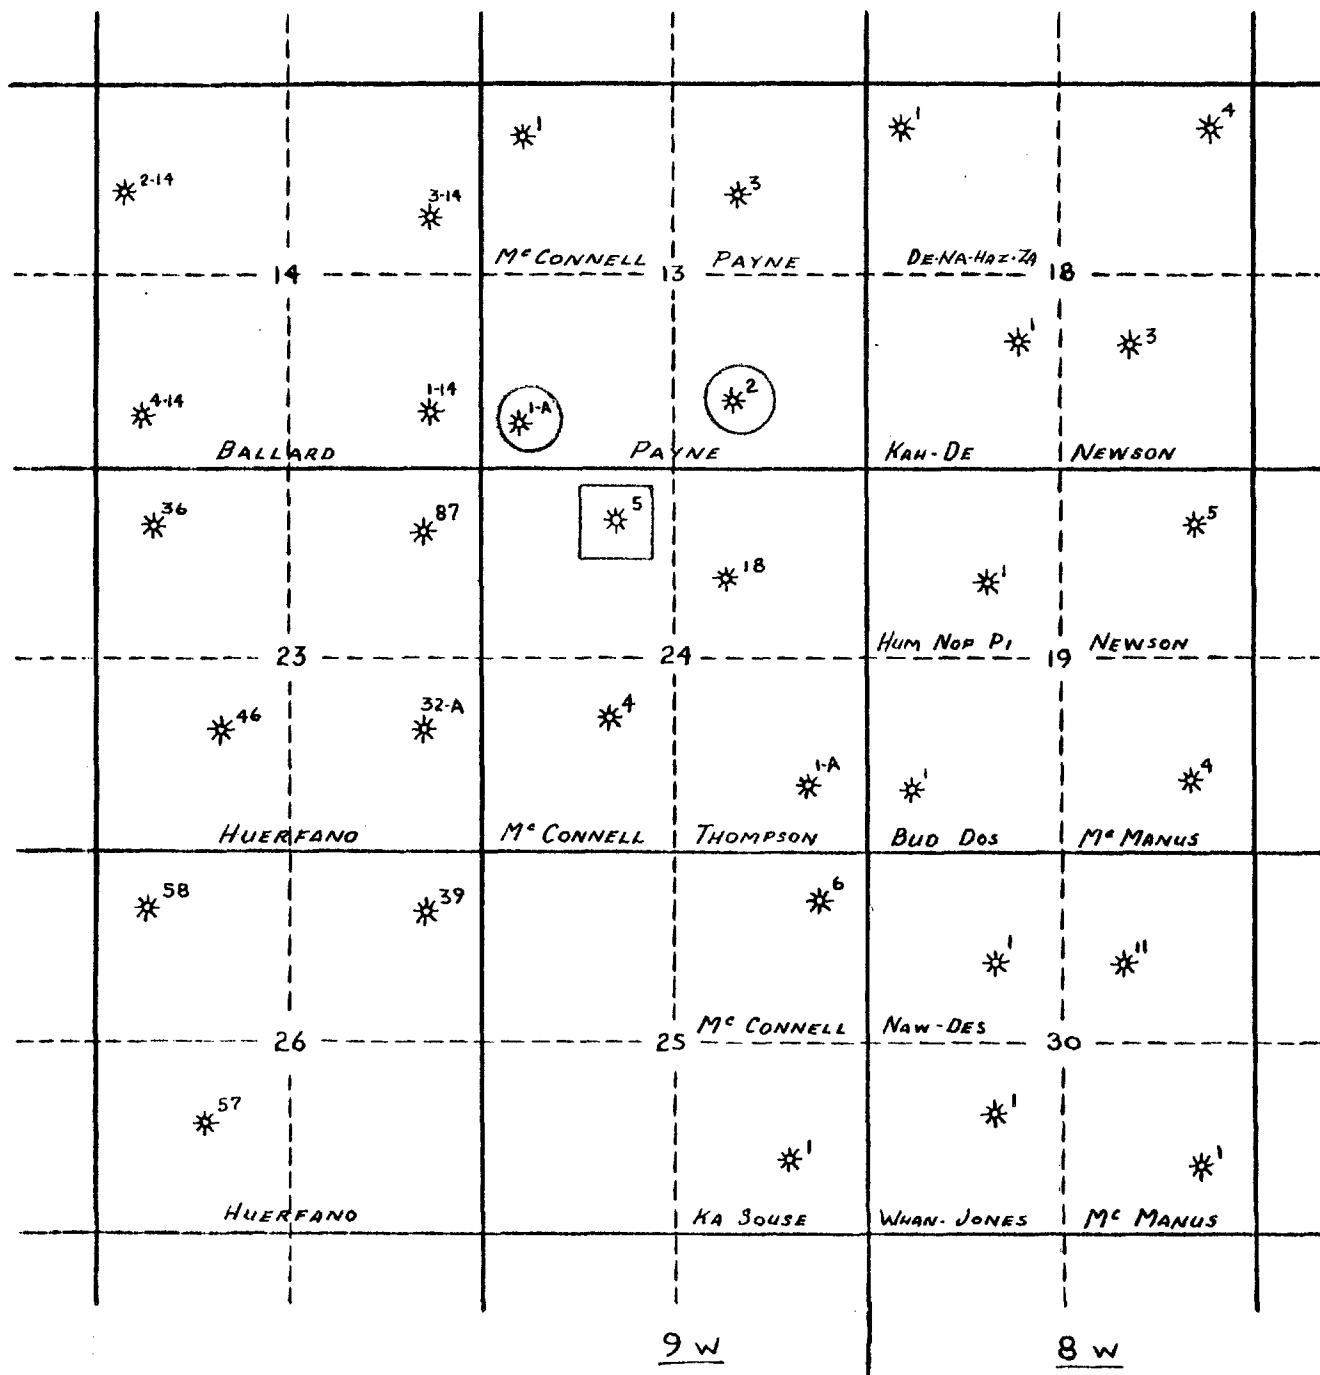

M^c CONNELL #5

EPNG PRESSURE BUILD-UP TEST

TEST WELL DATA Ballard Pictured Cliffs POOL

Date: _____

TEST WELL: Operator: El Paso Natural Gas Company Well Name & No. McManus # 10

Location: 1059 fr. N, 1154 fr. E lines, A Sec. 4 T. 25 N., R. 8 W

TD: 2418' Casing: 5 1/2"@ 2361' Tubing: 1" @ 2393'

Completed: June 21, 1955 First Delivery: September 13, 1955

Pay Zone: Open Hole Interval: _____ or Perforations: 2356' to 2418'

Stimulation: Sand Oil Fractured

SIPC: 662 SIPT: 662 DAYS SI: 14

I. P. Test: 2506 MCF, 3 hrs. _____ Choke: _____ MCF AOF thru ~~tubing~~ or casing

Current Deliverability: 1010 MCF, Date Tested: April 15, 1957

WELLS ON SAME BASIC LEASE

<u>Name</u>	<u>Location</u>	<u>Deliverability</u>	<u>Date of Test</u>
McManus #2	F 4-25-8	443	1957
McManus #3	J 33-26-8	169	1957
McManus #5	J 4-25-8	636	1957
McManus #9	M 33-26-8	807	1957
McManus #13	N 4-25-8	282	1957


B-3

Proration Department.

SAN JUAN COUNTY NEW MEXICO

BALLARD P.C.

TOWNSHIP 25 & 26 N RANGE 8 W

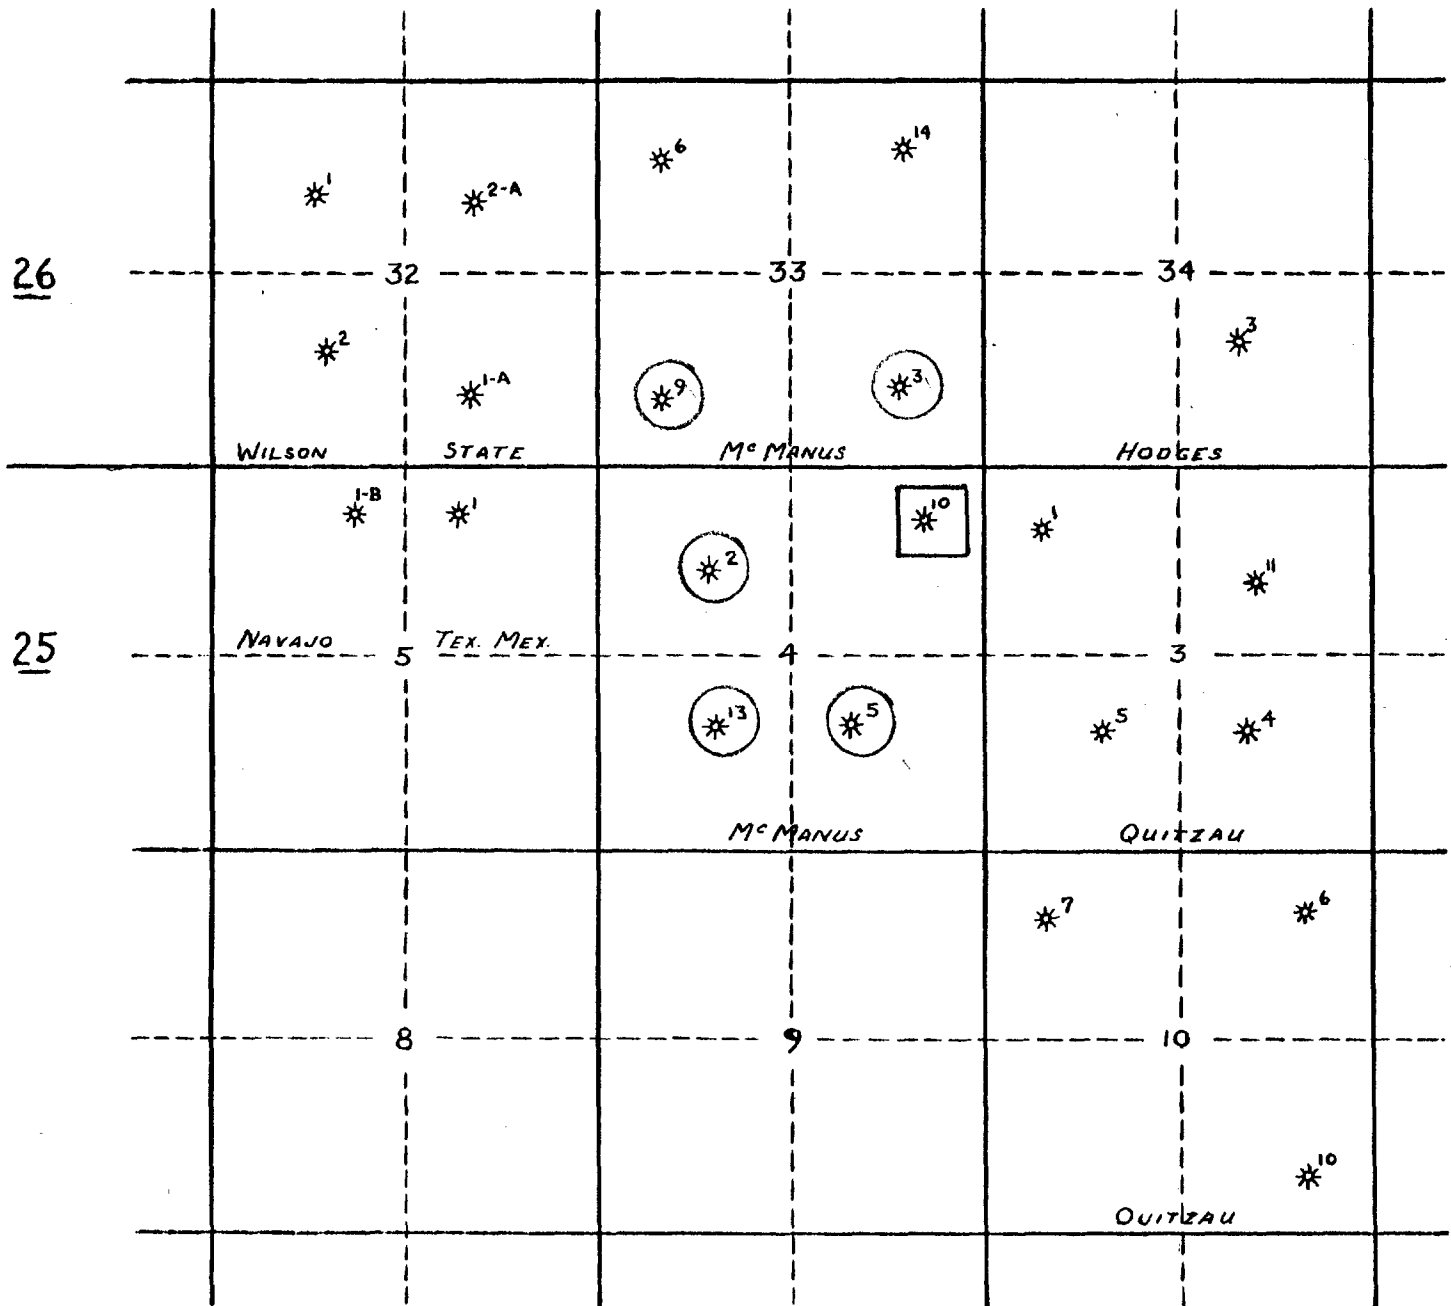

McMANUS # 10

EPNG PRESSURE BUILD-UP TEST

TEST WELL DATA Blanco Mesa Verde POOL
Date: _____

TEST WELL: Operator: El Paso Natural Gas Company Well Name & No. Atlantic #5
Location: 990 fr. N, 990 fr. E lines, A Sec. 22 T. 31 N., R. 10 W
TD: 5475' Casing: 7" @ 4725' Tubing: 2" @ 5393'
Completed: June 24, 1953 First Delivery: September 16, 1953
Pay Zone: Open Hole Interval: _____ or Perforations: 4775' to 5475'
Stimulation: Shot w/1700 Qt. S. N. G.
SIPC: 1086 SIPT: 1082 DAYS SI: 10
I. P. Test: 7408 MCF, 3 hrs. _____ Choke: _____ MCF AOF thru tubing or casing
Current Deliverability: 1552 MCF, Date Tested: December 23, 1957

WELLS ON SAME BASIC LEASE

<u>Name</u>	<u>Location</u>	<u>Deliverability</u>	<u>Date of Test</u>
Atlantic #6	L 22-31-10	715	1957
Atlantic #8	M 23-31-10	746	1957
Atlantic #7	G 23-31-10	1297	1957


B-4

Proration Department

SAN JUAN COUNTY NEW MEXICO

BLANCO M.V.

TOWNSHIP 31 N RANGE 10 W

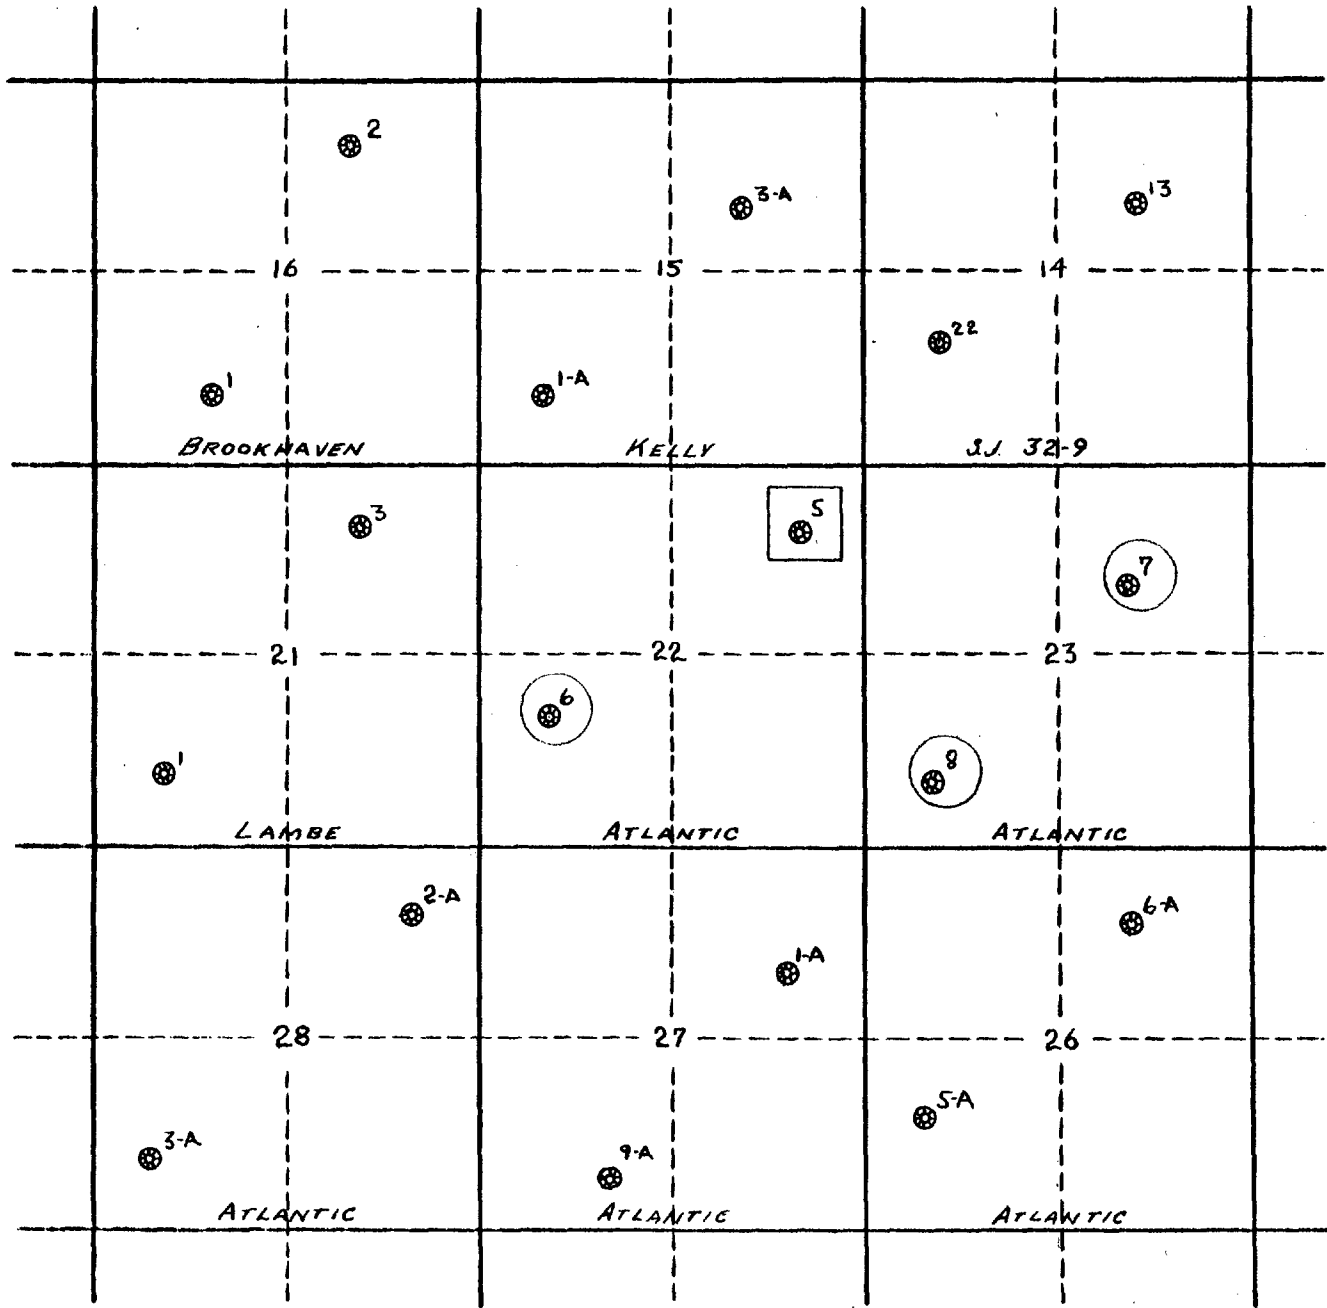

ATLANTIC 5

EPNG PRESSURE BUILD-UP TEST

TEST WELL DATA Blanco Mesa Verde POOL
Date: _____

TEST WELL: Operator: El Paso Natural Gas Company Well Name & No. Field #1
Location: 990 fr. N, 990 fr. E lines, A Sec. 25 T. 32 N., R. 11 W
TD: 5458' Casing: 7" @ 4705' Tubing: 2" @ 5375'
Completed: May 12, 1953 First Delivery: October 26, 1953
Pay Zone: Open Hole Interval: _____ or Perforations: 4798' to 5458'
Stimulation: Shot w/1440 Qt. S. N. G.
SIPC: 1088 SIPT: 1078 DAYS SI: 8
I. P. Test: 3780 MCF, 3 hrs. _____ Choke: _____ MCF AOF thru tubing or casing
Current Deliverability: 272 MCF, Date Tested: May 8, 1957

WELLS ON SAME BASIC LEASE


<u>Name</u>	<u>Location</u>	<u>Deliverability</u>	<u>Date of Test</u>
Fields #2	N 25-32-11	333	1957

Proration Department

SAN JUAN COUNTY NEW MEXICO

BLANCO M.V.

TOWNSHIP 32 N RANGE 10 & 11 W

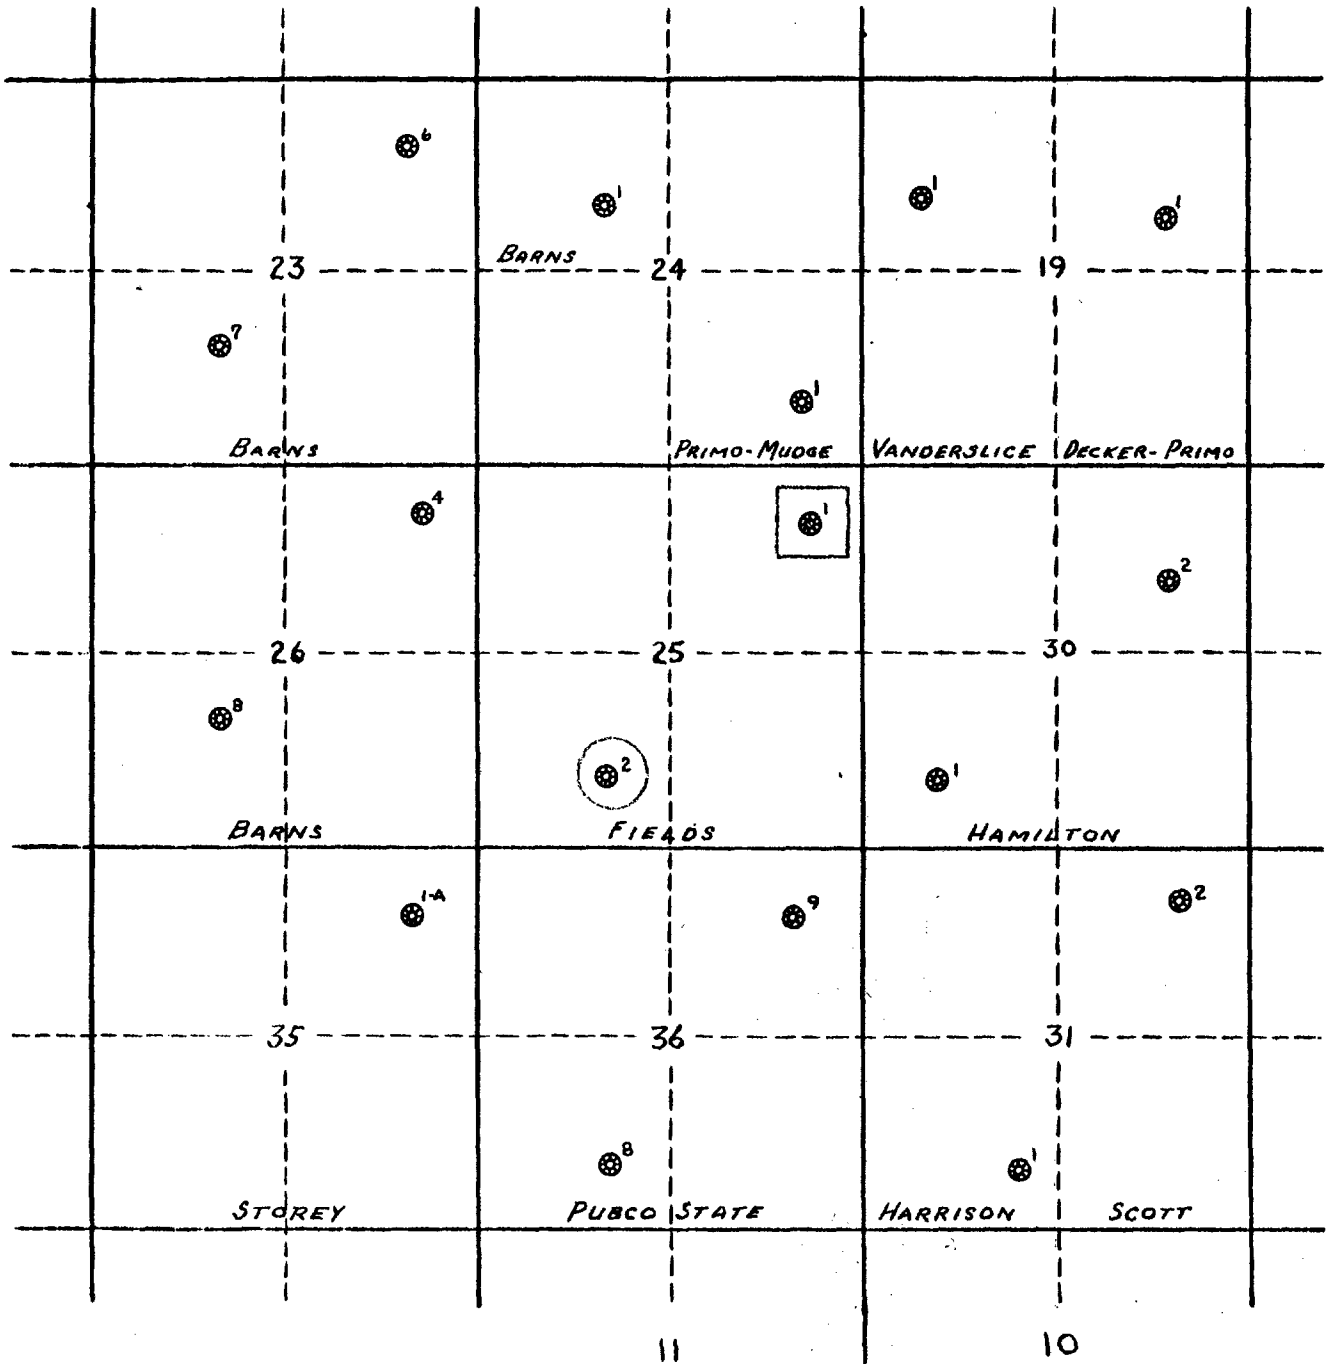

FIELDS #1

EPNG PRESSURE BUILD-UP TEST

TEST WELL DATA Blanco Mesa Verde POOL

Date: _____

TEST WELL: Operator: El Paso Natural Gas Company Well Name & No. Field #5

Location: 1847' fr. S, 790 fr. W lines, L Sec. 28 T. 32 N., R. 11 W

TD: 5610' Casing: 5 1/2" @ 5610' Tubing: 2" @ 5571'

Completed: March 8, 1956 First Delivery: March 27, 1956

Pay Zone: Open Hole Interval: _____ or Perforations: 4830' to 5590'

Stimulation: Sand Water Fractured

SIPC: 1053 SIPT: 1042 DAYS SI: 93

I.P. Test: 24,390 MCF, 3 hrs. 3/4" Choke: 5920 MCF AOF thru tubing or casing

Current Deliverability: 1167 MCF, Date Tested: May 8, 1957

WELLS ON SAME BASIC LEASE

<u>Name</u>	<u>Location</u>	<u>Deliverability</u>	<u>Date of Test</u>
Fields #1	G 29-32-11	234	1957
Fields #4	G 28-32-11	1250	1957
Horton #1	K 29-32-11	475	1957


B-6

Proration Department

SAN JUAN COUNTY NEW MEXICO

BLANCO M.V.

TOWNSHIP 32 N RANGE 11 W

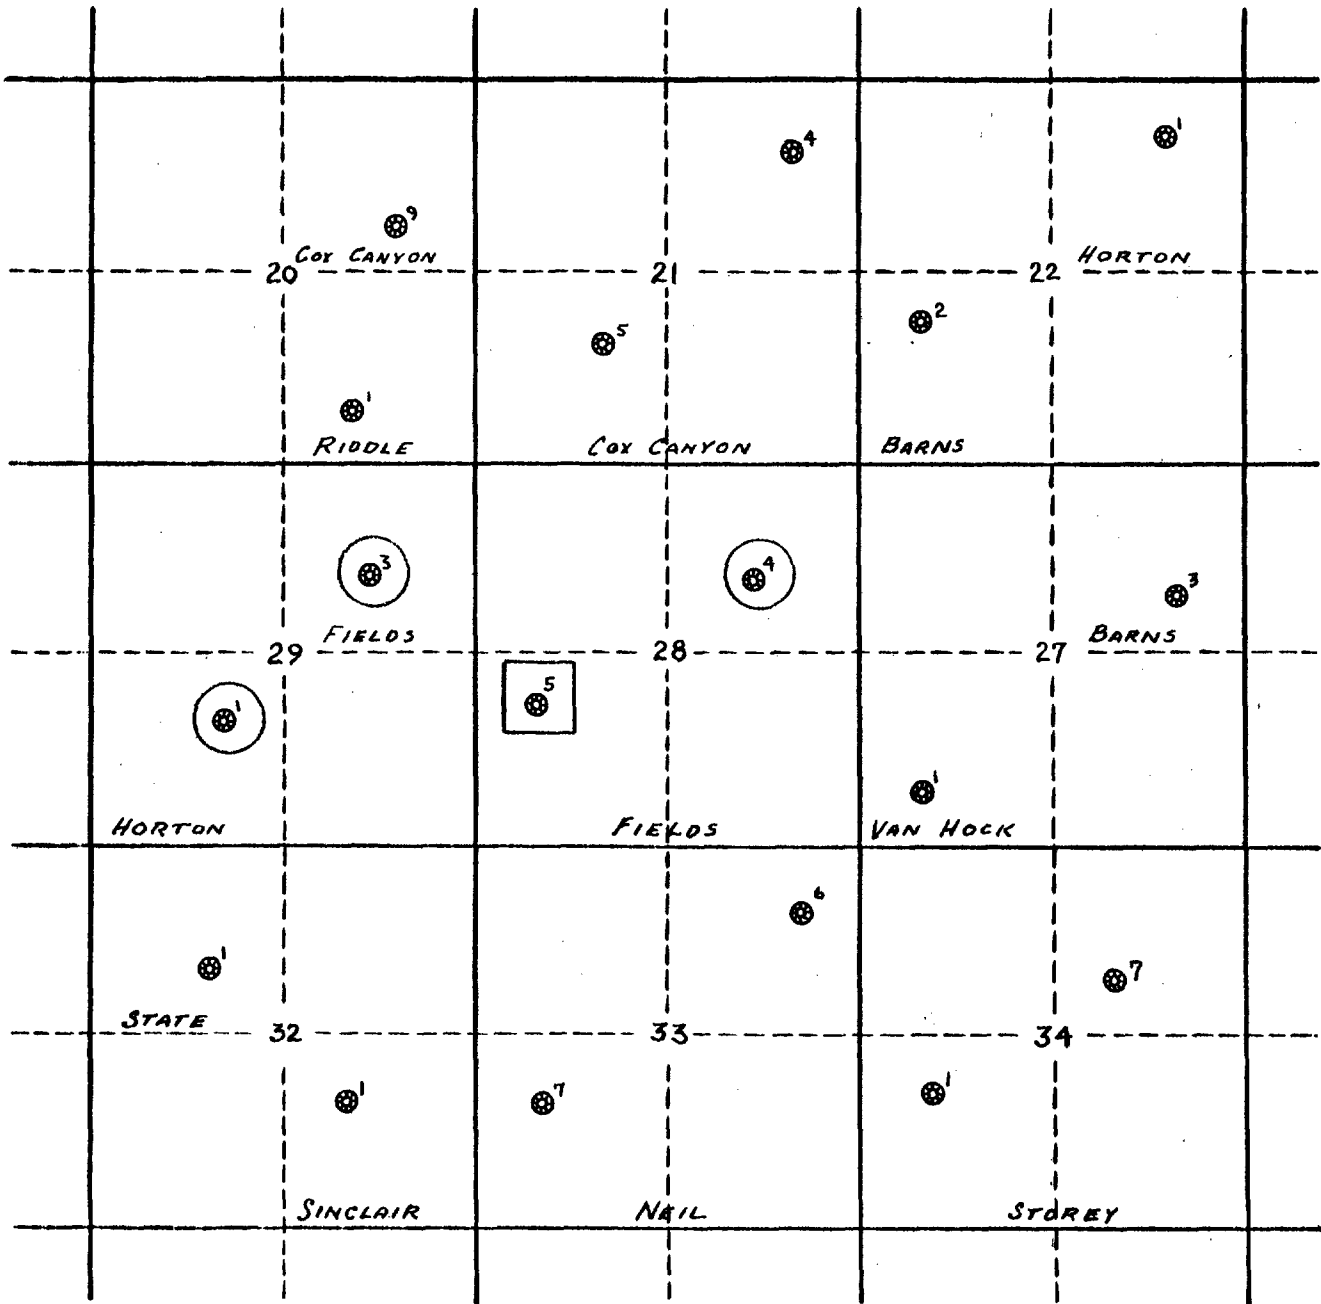

FIELDS #5

EPNG PRESSURE BUILD-UP TEST

TEST WELL DATA Blanco Mesa Verde POOL

Date: _____

TEST WELL: Operator: El Paso Natural Gas Company Well Name & No. Gartner #4

Location: 1650 fr. N, 1090 fr. E lines, H Sec. 33 T. 30 N., R. 8 W

TD: 5457' Casing: 7" @ 4677' Tubing: 2 1/2" @ 5438'

Completed: December 5, 1952 First Delivery: August 27, 1953

Pay Zone: Open Hole Interval: _____ or Perforations: 4757' to 5457'

Stimulation: _____ Shot w/1635 Qt. S. N. G.

SIPC: 1099 SIPT: _____ DAYS SI: 44

I. P. Test: 8656 MCF, 6 hrs. _____ Choke: _____ MCF AOF thru tubing or casing

Current Deliverability: 1839 MCF, Date Tested: July 24, 1957

WELLS ON SAME BASIC LEASE

<u>Name</u>	<u>Location</u>	<u>Deliverability</u>	<u>Date of Test</u>
Gartner #1	N 28-30-8	1691	1957
Gartner #3	N 33-30-8	2424	1957
Gartner #5	M 27-30-8	2081	1957


15-7

Proration Department

SAN JUAN COUNTY NEW MEXICO

BLANCO MESA VERDE

TOWNSHIP 29 & 30 RANGE 8

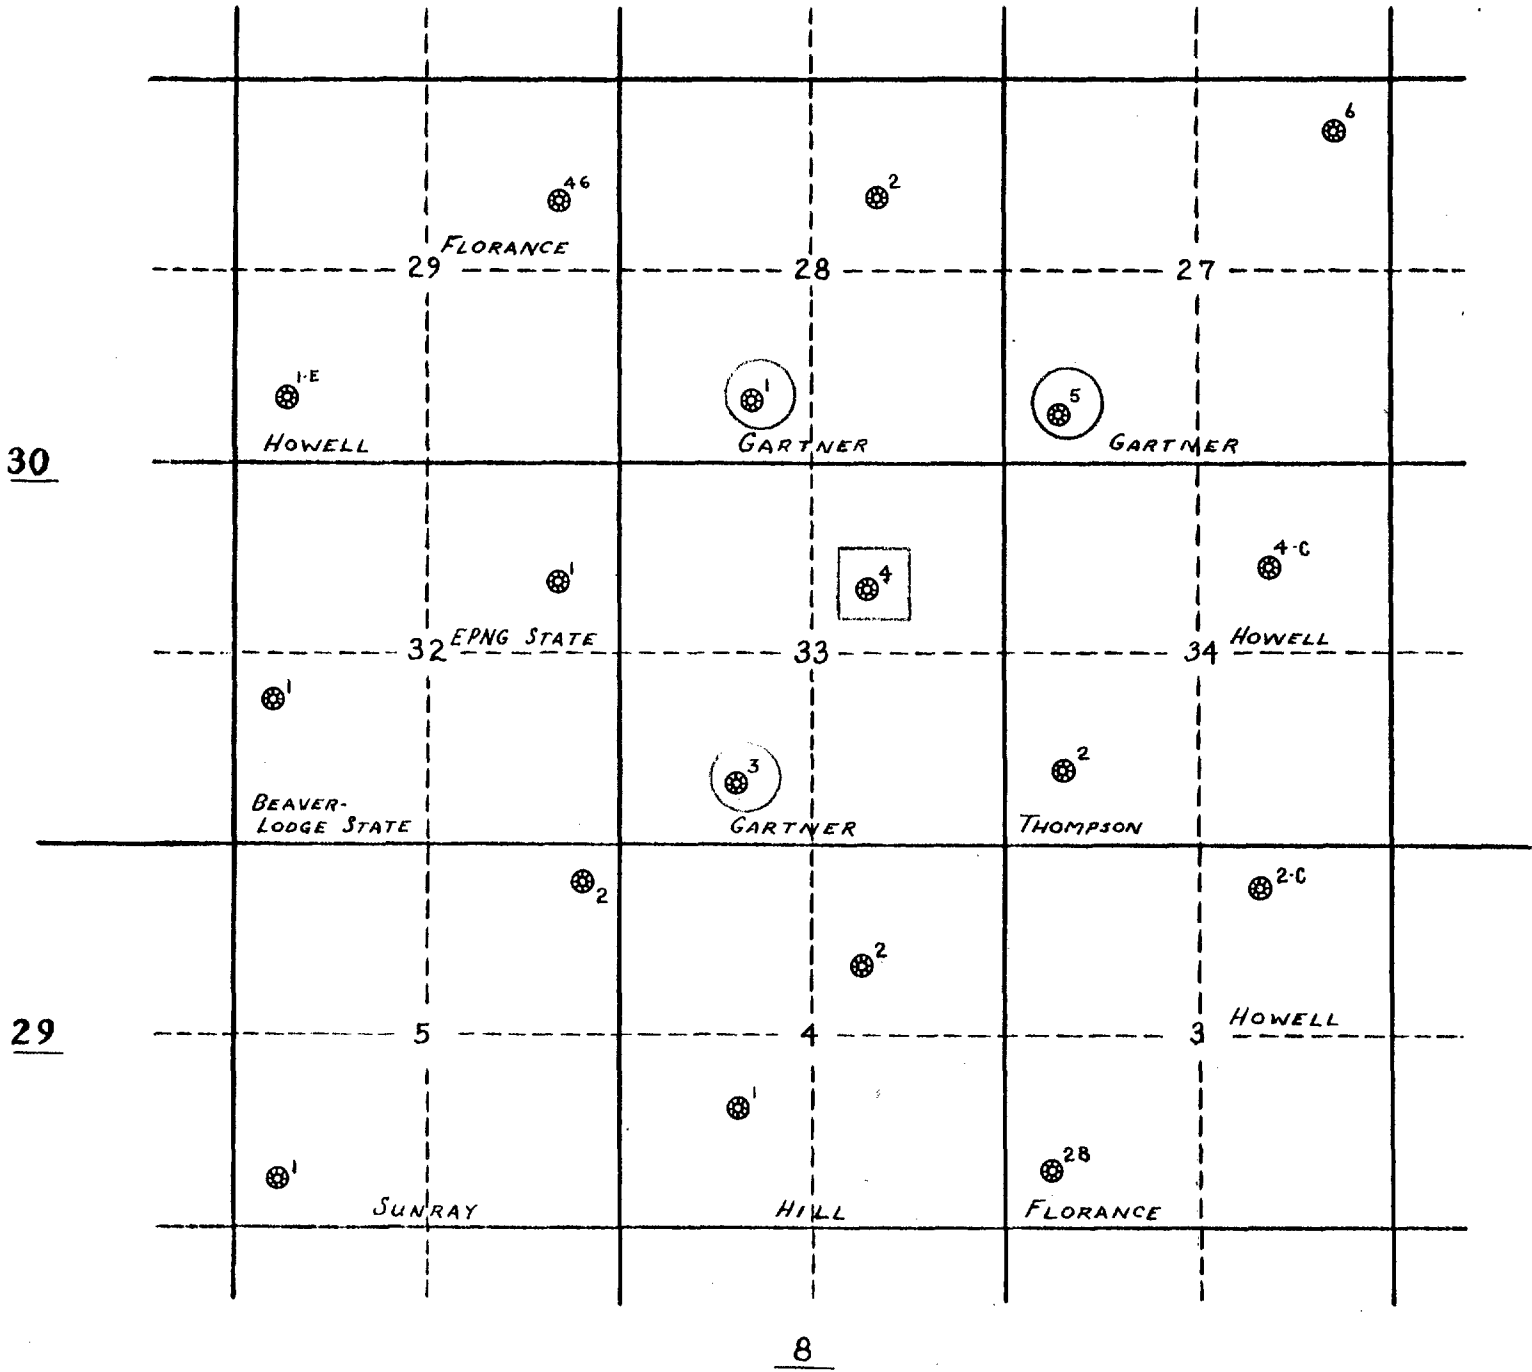

GARTNER #4

EPNG PRESSURE BUILD-UP TEST

TEST WELL DATA Blanco Mesa Verde POOL

Date: _____

TEST WELL: Operator: El Paso Natural Gas Company Well Name & No. Grambling 3

Location: 990 fr. S, 1650 fr. W lines, N Sec. 22 T. 29 N., R. 9 W

TD: 4368' Casing: 7" @ 3725' Tubing: 2" @ 4168'

Completed: August 1, 1951 First Delivery: August 20, 1951

Pay Zone: Open Hole Interval: _____ or Perforations: 3778' to 4310'

Stimulation: _____ Shot w/1420 Qt. of S. N. G.

SIPC: 1100 SIPT: 1100 DAYS SI: 13

I. P. Test: 700 MCF, 3 hrs. _____ Choke: _____ MCF AOF thru tubing or casing

Current Deliverability: 677 MCF, Date Tested: September 24, 1957

WELLS ON SAME BASIC LEASE


<u>Name</u>	<u>Location</u>	<u>Deliverability</u>	<u>Date of Test</u>
Grambling 1	G 28-29-9	483	1957
Grambling 2	G 27-29-9	875	1957

B-8

Proration Department

SAN JUAN COUNTY NEW MEXICO
BLANCO M.V.

TOWNSHIP 29 N RANGE 9 W

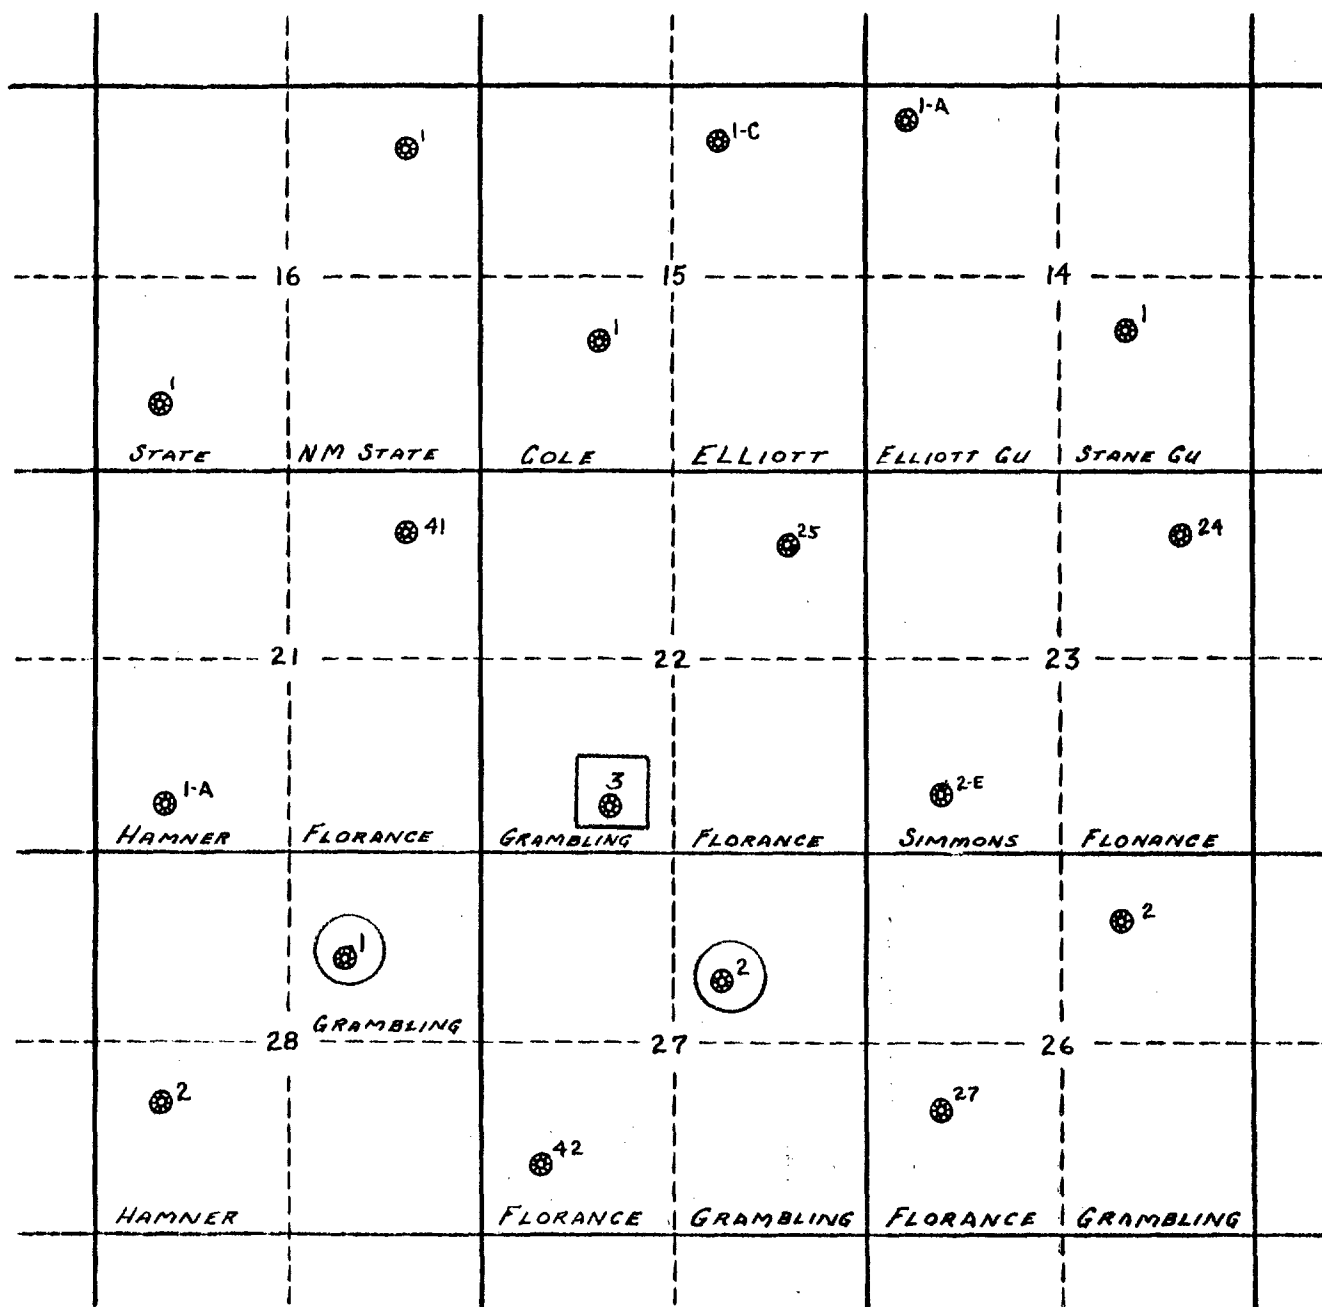

GRAMBLING * 3

EPNG PRESSURE BUILD-UP TEST

TEST WELL DATA Blanco Mesa Verde POOL

Date: _____

TEST WELL: Operator: El Paso Natural Gas Company Well Name & No. Howell 3-A

Location: 890 fr. S, 890 fr. W lines, M Sec. 4 T. 30 N., R. 8 W

TD: 5404' Casing: 7" @ 4763' Tubing: 2" @ 5237'

Completed: June 21, 1951 First Delivery: August 29, 1951

Pay Zone: Open Hole Interval: _____ or Perforations: 4858' to 5378'

Stimulation: Shot w/1050 Qt. S. N. G.

SIPC: 1088 SIPT: 1088 DAYS SI: 34

I. P. Test: 3970 MCF, 6 hrs. _____ Choke: _____ MCF AOF thru tubing or casing

Current Deliverability: 525 MCF, Date Tested: July 4, 1957

WELLS ON SAME BASIC LEASE

<u>Name</u>	<u>Location</u>	<u>Deliverability</u>	<u>Date of Test</u>
Howell 1-A	G 8-30-8	2325	1957
Howell 2-A	N 5-30-8	382	1957
Woodriver 2	G 9-30-8	4672	1957


B-9

Proration Department

SAN JUAN COUNTY NEW MEXICO

BLANCO M.V.

TOWNSHIP 30 & 31 N RANGE 8 W

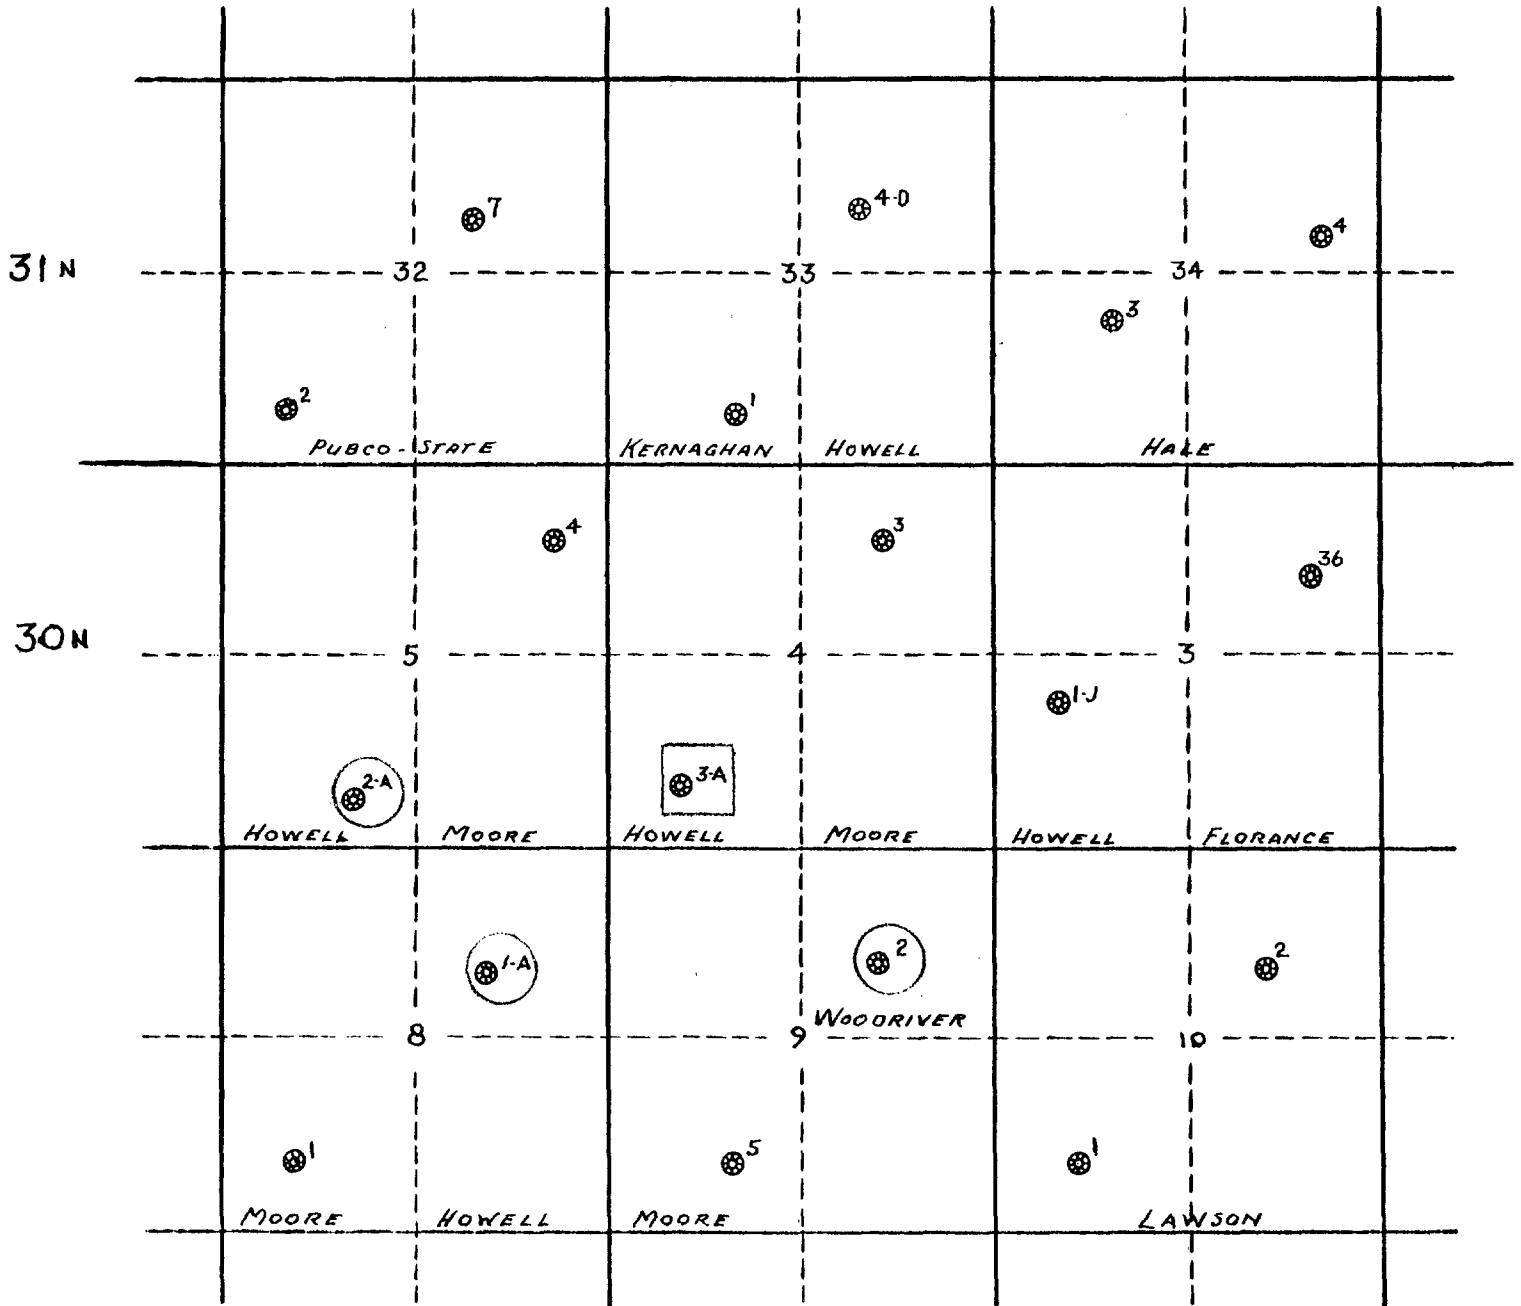

Howell # A-3

EPNG PRESSURE BUILD-UP TEST

TEST WELL DATA Blanco Mesa Verde POOL

Date: _____

Operator: El Paso Natural Gas Company Well Name & No. Mansfield 4

9/7 fr. N, 330 fr. E lines, A Sec. 29 T. 30 N., R. 9 W

TB: 5002' Casing: 5 1/2 @ 5002' Tubing: 2 1/2" @ 4912'

Completed: January 12, 1951 First Delivery: December 1, 1951

or Perforations: 4218' to 4940'

Initial Flow: _____

SIPT: 1032 SIPT: 1069 DAYS SI: _____

I. P. Test: 4070 MCF, 3 hrs. _____ Choke: _____ MCF AOF thru tubing or casing

Current Deliverability: 1627 MCF, Date Tested: May 23, 1957

WELLS ON SAME BASIC LEASE

<u>Name</u>	<u>Location</u>	<u>Deliverability</u>	<u>Date of Test</u>
-------------	-----------------	-----------------------	---------------------

None


B-10

Proration Department

SAN JUAN COUNTY NEW MEXICO

BLANCO M.V.

TOWNSHIP 30 N RANGE 9 W

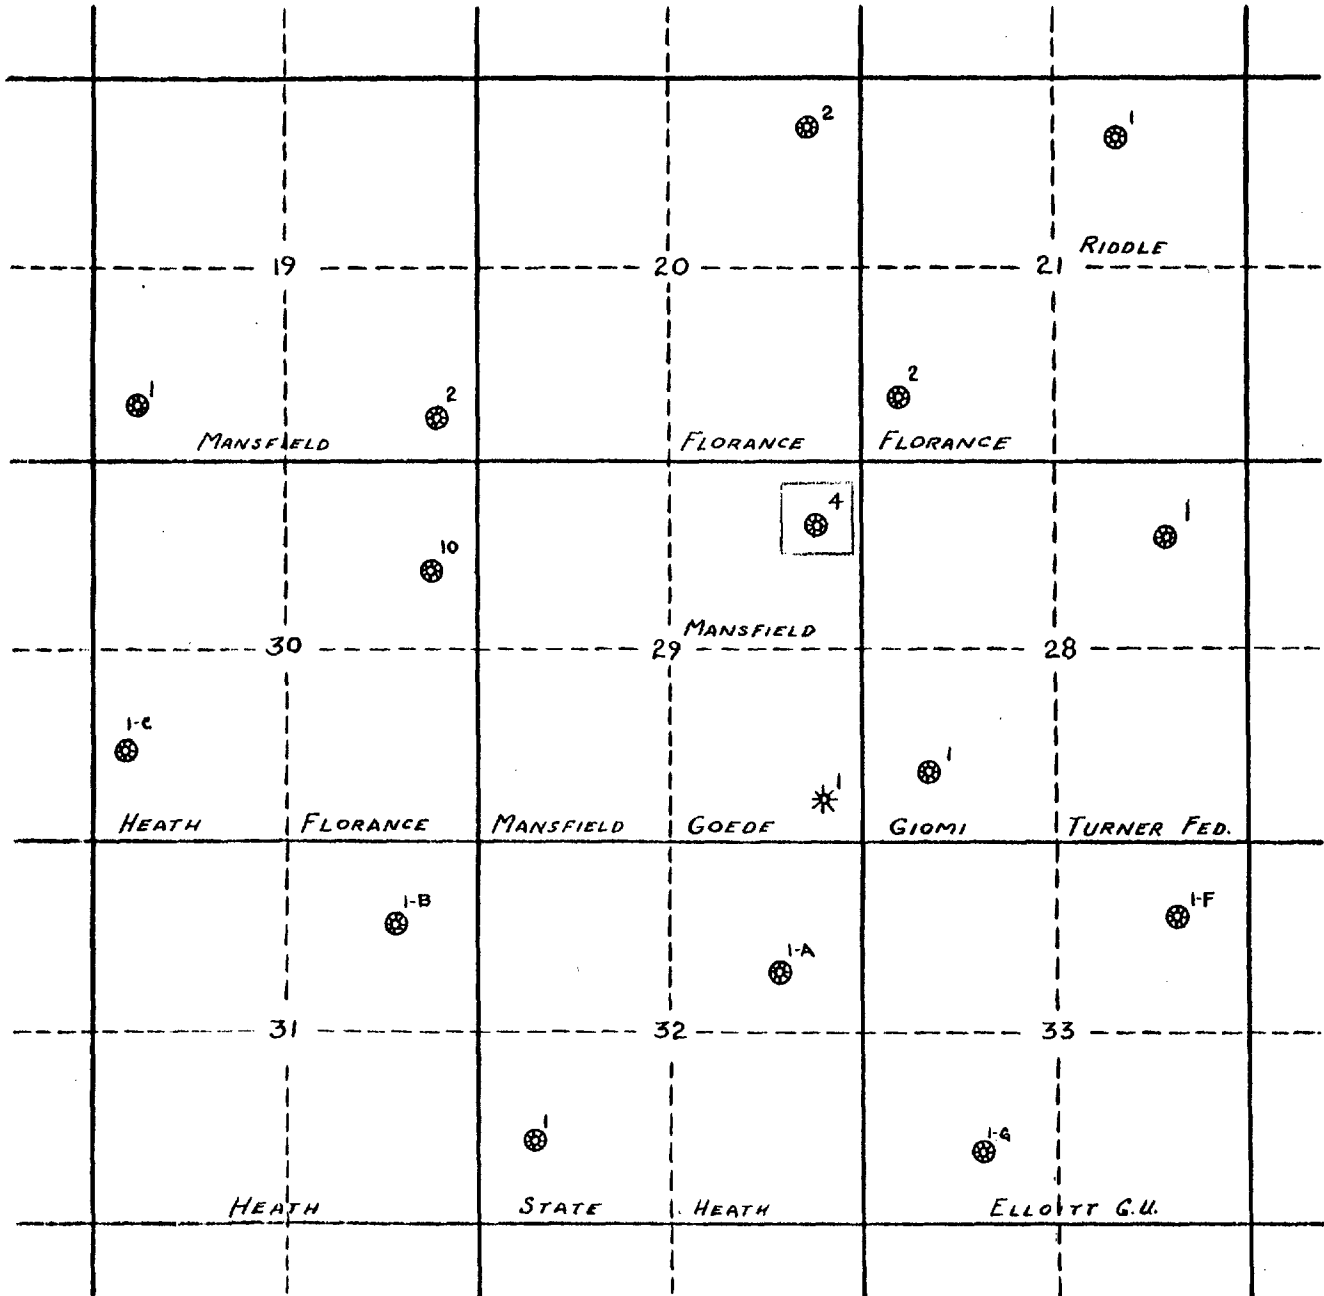

MANSFIELD #4

EPNG PRESSURE BUILD-UP TEST

TEST WELL DATA Blanco Mesa Verde POOL
Date: _____

TEST WELL: Operator: El Paso Natural Gas Company Well Name & No. Prichard 2-1

Location: 1180 fr. N, 1850 fr. E lines, B Sec. 34 T. 31 N., R. 9 W

TD: 5272' Casing: 7" @ 4507' Tubing: 2" @ 5222'

Completed: July 24, 1952 First Delivery: August 4, 1952

Pay Zone: Open Hole Interval: _____ or Perforations: 4604' to 5272'

Stimulation: Shot w/1470 Qt. S. N. G.

SIPC: 1101 SIPT: 1099 DAYS SI: 53

I. P. Test: 5122 MCF, 6 hrs. _____ Choke: _____ MCF AOF thru tubing or casing

Current Deliverability: 1030 MCF, Date Tested: May 23, 1957

WELLS ON SAME BASIC LEASE


<u>Name</u>	<u>Location</u>	<u>Deliverability</u>	<u>Date of Test</u>
Prichard 3-2	K 34-31-9	1373	1957

64.
P-11

SAN JUAN COUNTY NEW MEXICO

BLANCO M.V.

TOWNSHIP 30 & 31 N RANGE 9 W

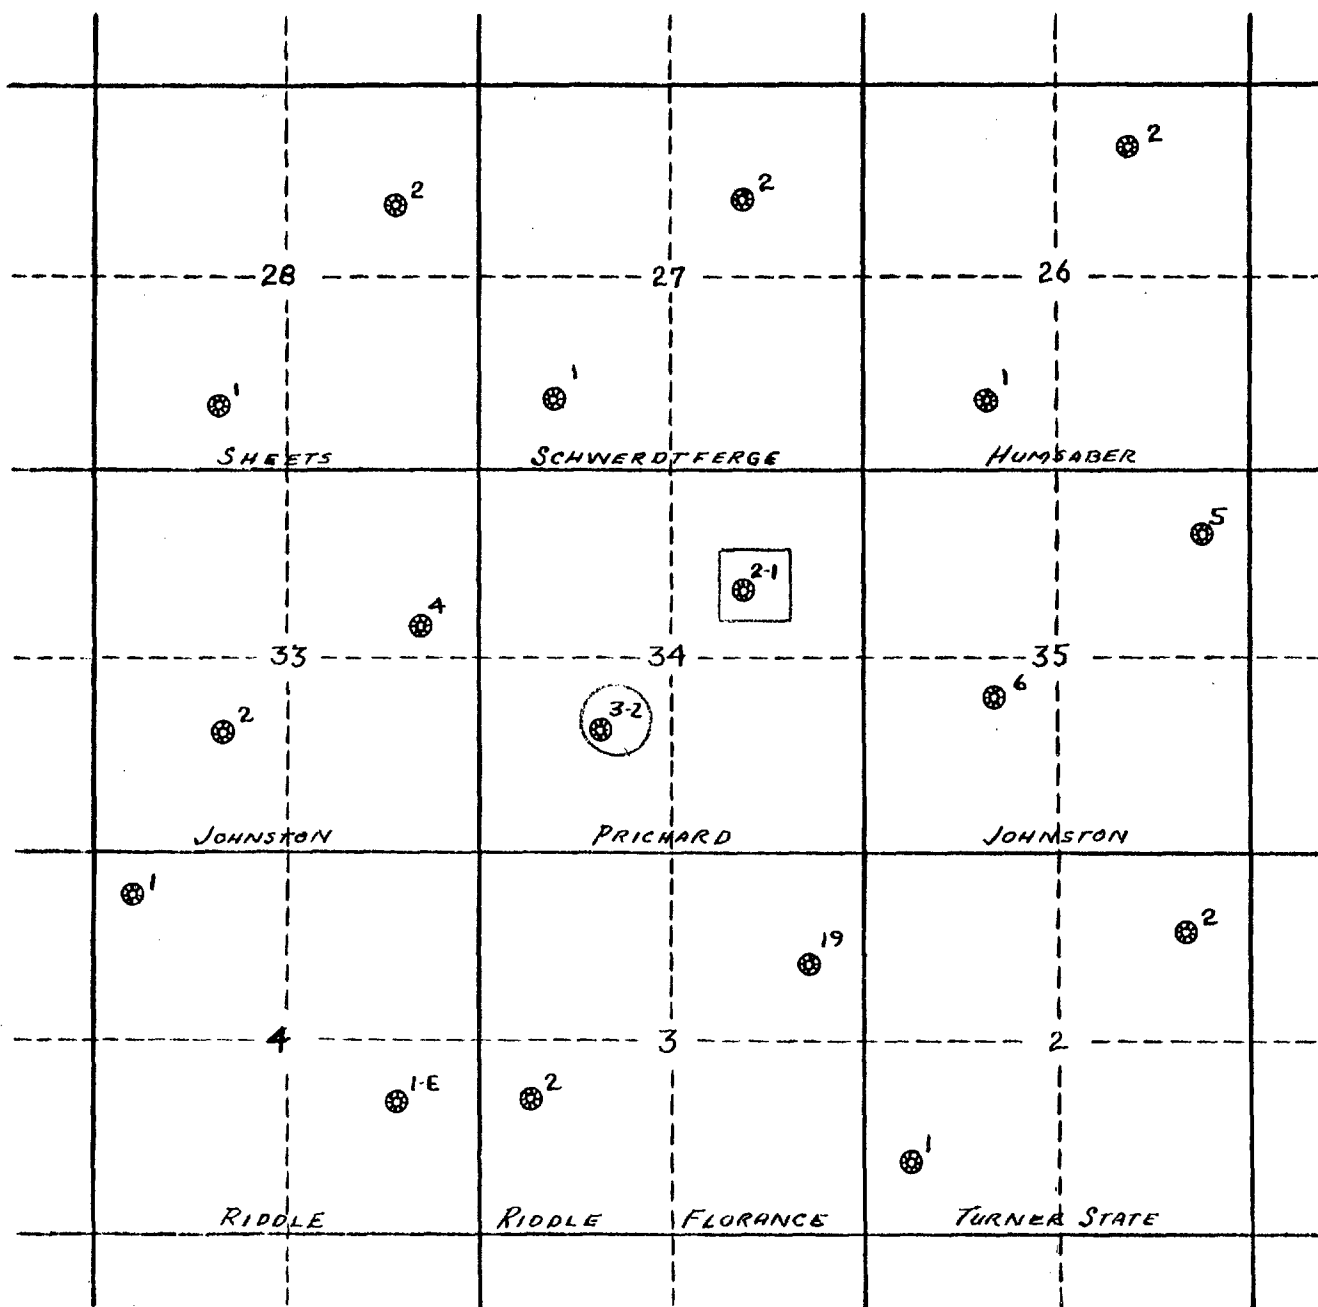

PRICHARD * 2-1

EPNG PRESSURE BUILD-UP TEST

TEST WELL DATA Blanco Mesa Verde POOL

Date: _____

TEST WELL: Operator: El Paso Natural Gas Company Well Name & No. San Juan Ut. 28-7 #49

Location: 969 fr. N, 1550 fr. E lines, B Sec. 21 T. 28 N., R. 7 W

TD: 5245' Casing: 5 1/2 @ 5245' Tubing: 2" @ 5149'

Completed: September 7, 1956 First Delivery: March 21, 1957

Pay Zone: Open Hole Interval: _____ or Perforations: 4426' to 5064'

Stimulation: Sand Water Fractured

SIPC: 1076 SIPT: 1068 DAYS SI: 7

I. P. Test: 7240 MCF, 3 hrs. 3/4 Choke: 4333 MCF AOF thru tubing or ~~casing~~

Current Deliverability: 994 MCF, Date Tested: April 24, 1957

WELLS ON SAME BASIC LEASE

<u>Name</u>	<u>Location</u>	<u>Deliverability</u>	<u>Date of Test</u>
S. J. 28-7 #6	N 16-28-7	83	1957
S. J. 28-7 #47	A 20-28-7	876	1957
S. J. 28-7 #48	L 21-28-7	297	1957


Ex B-12

Proration Department

SAN JUAN COUNTY NEW MEXICO

BLANCO M.V.

TOWNSHIP 28 N RANGE 7 W

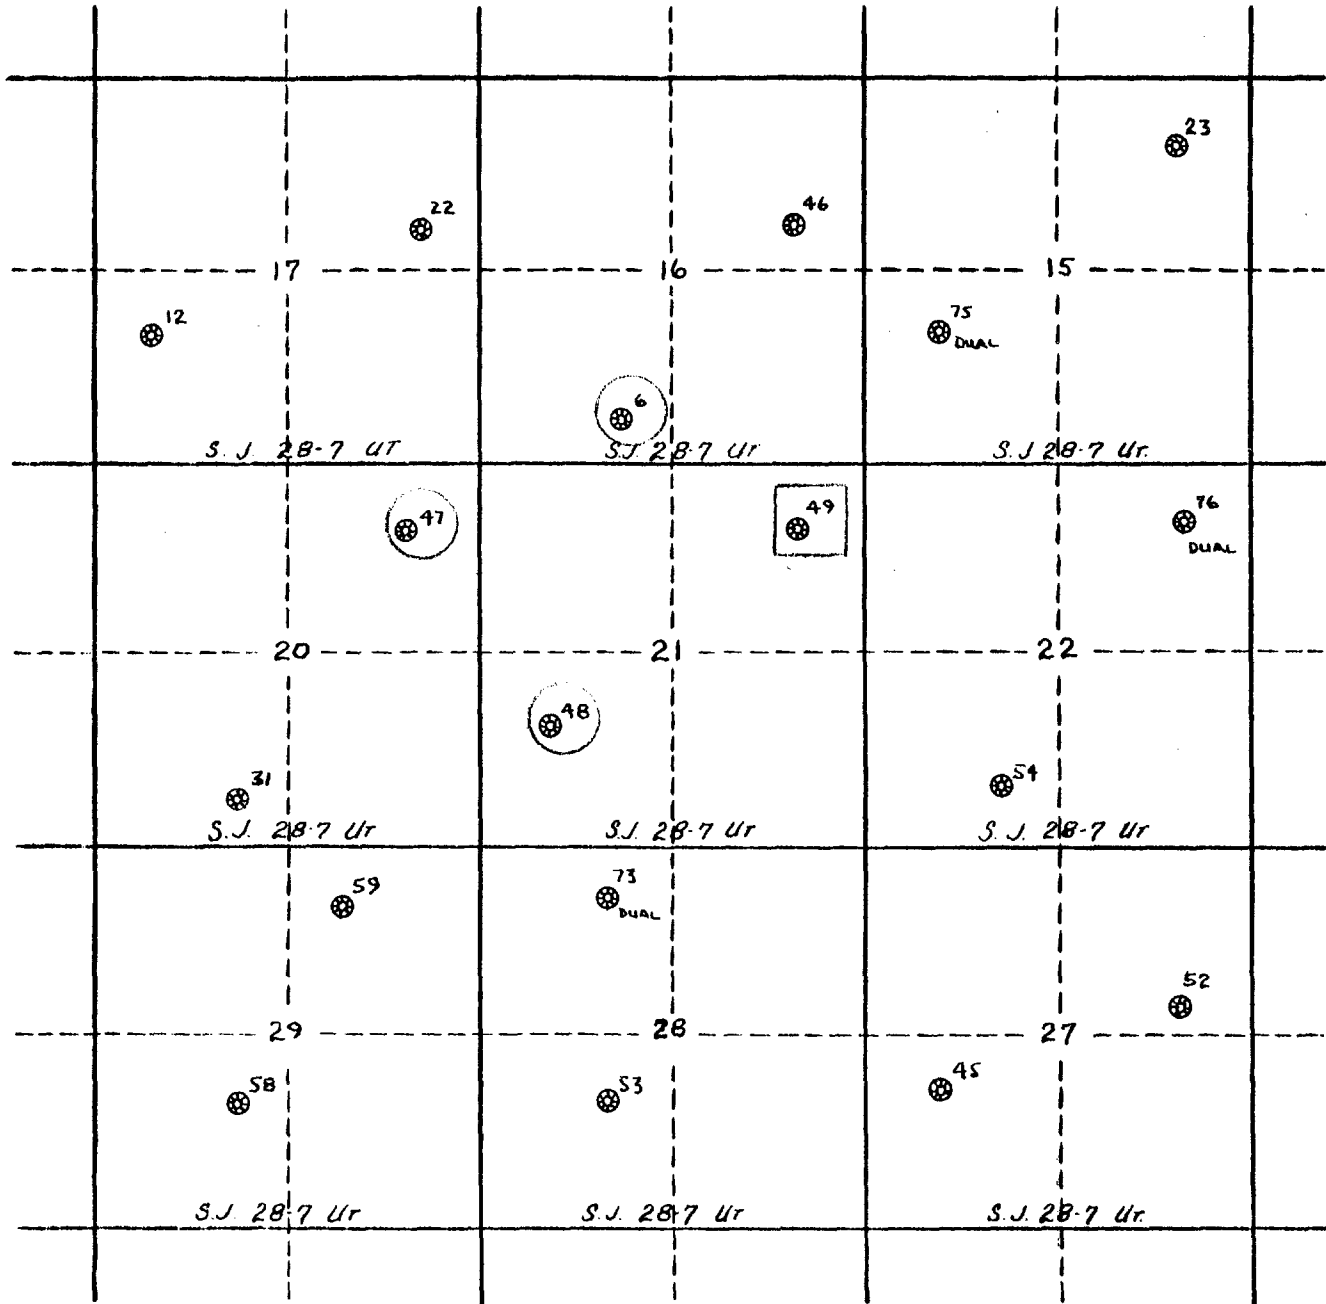

S.J. 28-7 Ur. # 49

EPNG PRESSURE BUILD-UP TEST

TEST WELL DATA Blanco Mesa Verde POOL

Date: _____

TEST WELL: Operator: El Paso Natural Gas Company Well Name & No. S. J. 32-9 #29

Location: 1140 fr. S, 850 fr. W lines, M Sec. 36 T. 32 N., R. 10 W

TD: 5920' Casing: 7" @ 5371' Tubing: 2" @ 5886'

Completed: August 23, 1955 First Delivery: January 26, 1956

Pay Zone: Open Hole Interval: _____ or Perforations: 5371' to 5515'

Stimulation: Sand Oil Fractured

SIPC: 1037 SIPT: 1038 DAYS SI: 20

I. P. Test: 19, 529 MCF, 3 hrs. _____ Choke: _____ MCF AOF thru tubing or casing

Current Deliverability: 2454 MCF, Date Tested: November 16, 1957

WELLS ON SAME BASIC LEASE

<u>Name</u>	<u>Location</u>	<u>Deliverability</u>	<u>Date of Test</u>
S. J. 32-9 #9	N 25-32-10	314	1957
S. J. 32-9 #38	B 35-32-10	1574	1957
S. J. 32-9 #34	K 35-32-10	698	1957
S. J. 32-9 #25	G 2-31-10	2304	1957
S. J. 32-9 #26	L 1-31-10	1307	1957
S. J. 32-9 #3	A 1-31-10	1820	1957
S. J. 32-9 #32	M 31-32-9	678	1957
S. J. 32-9 #30	H 36-32-10	599	1957


B-12

Proration Department

SAN JUAN COUNTY NEW MEXICO

BLANCO M.V.

TOWNSHIP 31 & 32 N RANGE 9 & 10 W

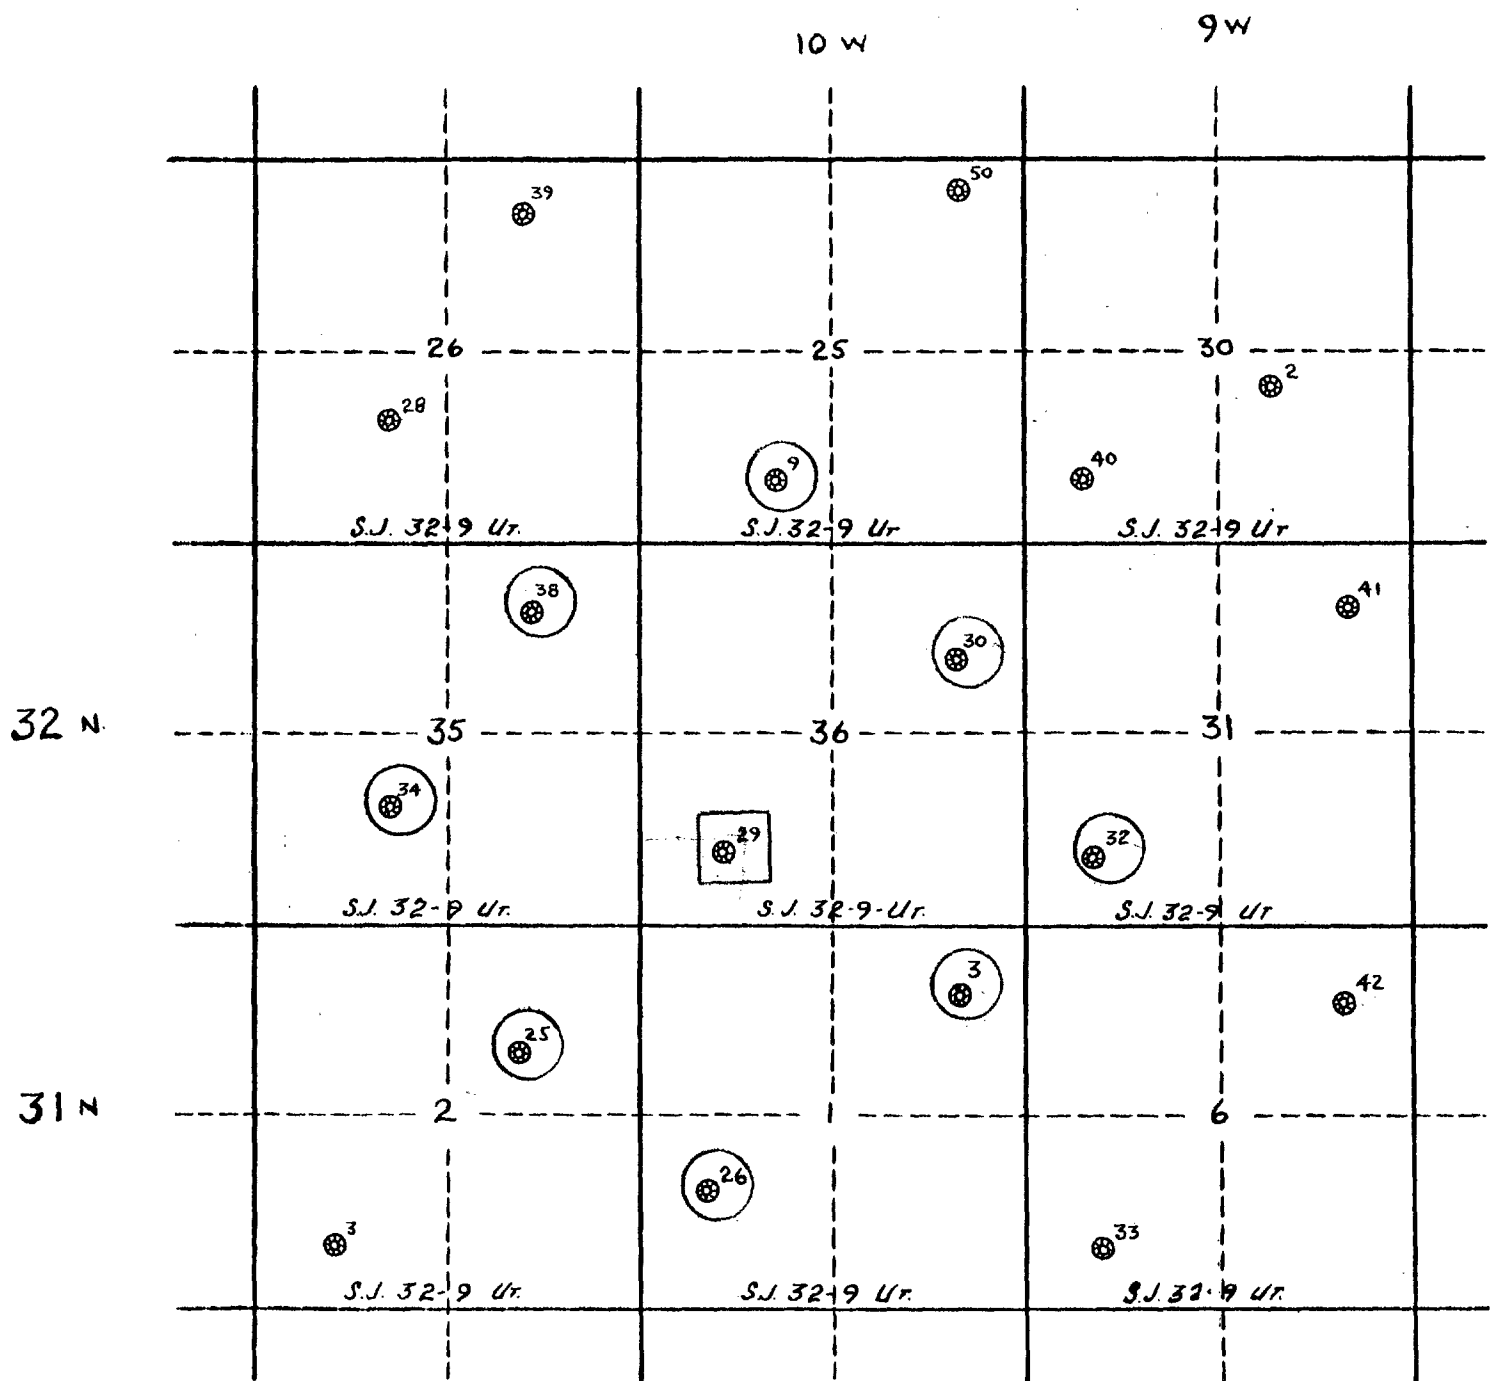

S.J. 32-9 Ur. # 29

EPNG PRESSURE BUILD-UP TEST

TEST WELL DATA Blanco Mesa Verde POOL

Date: _____

TEST WELL: Operator: El Paso Natural Gas Company Well Name & No. Stewart # 4

Location: 1485 fr. S, 1460 fr. W lines, K Sec. 28 T. 30 N., R. 10 W

TD: 5158' Casing: 5 1/2" @ 5158' Tubing: 2" @ 5016'

Completed: March 29, 1956 First Delivery: August 7, 1956

Pay Zone: Open Hole Interval: _____ or Perforations: 4716' to 5158'

Stimulation: Sand Water Fractured

SIPC: 1065 SIPT: 1066 DAYS SI: 9

I. P. Test: 4594 MCF, 3 hrs. 3/4 Choke: 3602 MCF AOF thru tubing or casing

Current Deliverability: 186 MCF, Date Tested: July 15, 1957

WELLS ON SAME BASIC LEASE

<u>Name</u>	<u>Location</u>	<u>Deliverability</u>	<u>Date of Test</u>
Stewart # 3	A 28-30-10	200	1957


B-14

Proration Department

SAN JUAN COUNTY NEW MEXICO

BLANCO M.V.

TOWNSHIP 30 N RANGE 10 W

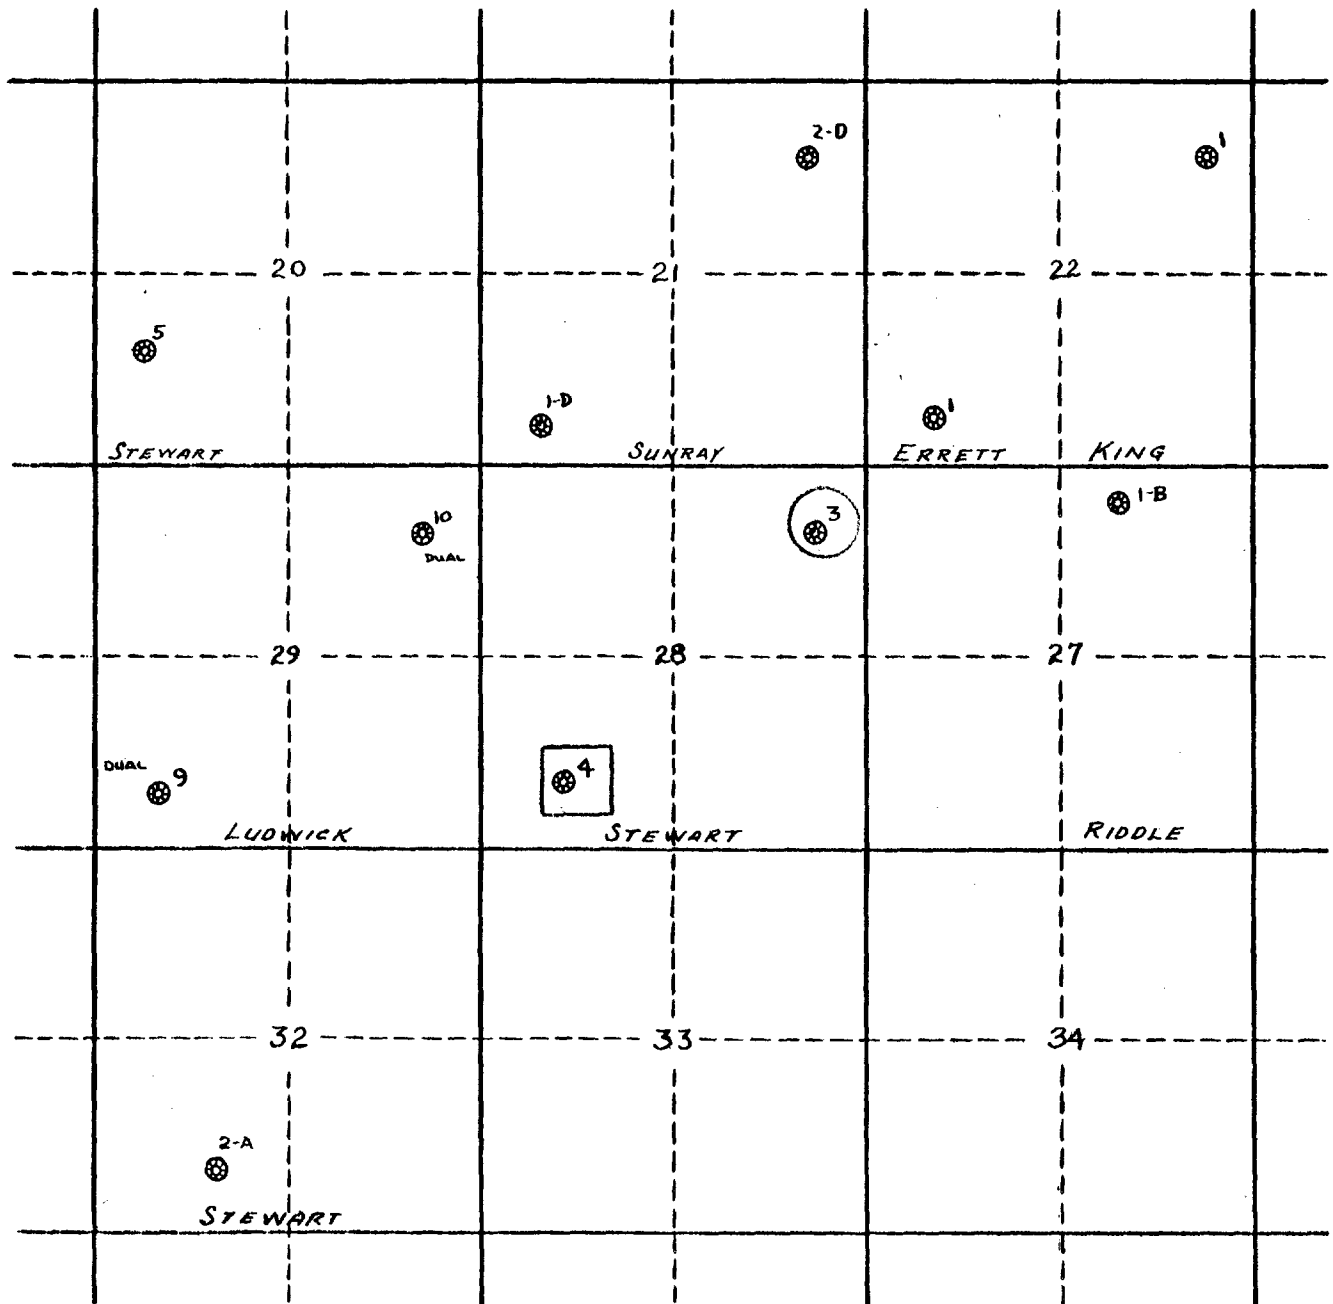

STEWART *4

EPNG PRESSURE BUILD-UP TEST

TEST WELL DATA Blanco Mesa Verde POOL

Date: _____

TEST WELL: Operator: El Paso Natural Gas Company Well Name & No. Wilson 30-6 #6

Location: 890 fr. S, 1750 fr. W lines, N Sec. 35 T. 30 N., R. 7 W

TD: 6033' Casing: 5 1/2" @ 6033' Tubing: 2" @ 5980'

Completed: December 19, 1955 First Delivery: April 6, 1956

Pay Zone: Open Hole Interval: _____ or Perforations: From 5532' to 6004'

Stimulation: Water Fractured

SIPC: 1076 SIPT: 1067 DAYS SI: 17

I. P. Test: 5190 MCF, 3 hrs. _____ Choke: _____ MCF AOF thru tubing or ~~choking~~

Current Deliverability: 971 MCF, Date Tested: October 15, 1957

WELLS ON SAME BASIC LEASE

<u>Name</u>	<u>Location</u>	<u>Deliverability</u>	<u>Date of Test</u>
Wilson 30-6 #1	M 26-30-7	193	1957
Wilson 30-6 #4	G 34-30-7	324	1957
Wilson 30-6 #5	M 34-30-7	231	1957
Wilson 30-6 #7	H 35-30-7	700	1957


6x B-15

Proration Department

SAN JUAN COUNTY NEW MEXICO

BLANCO M.V.

TOWNSHIP 29 & 30 N RANGE 7 W

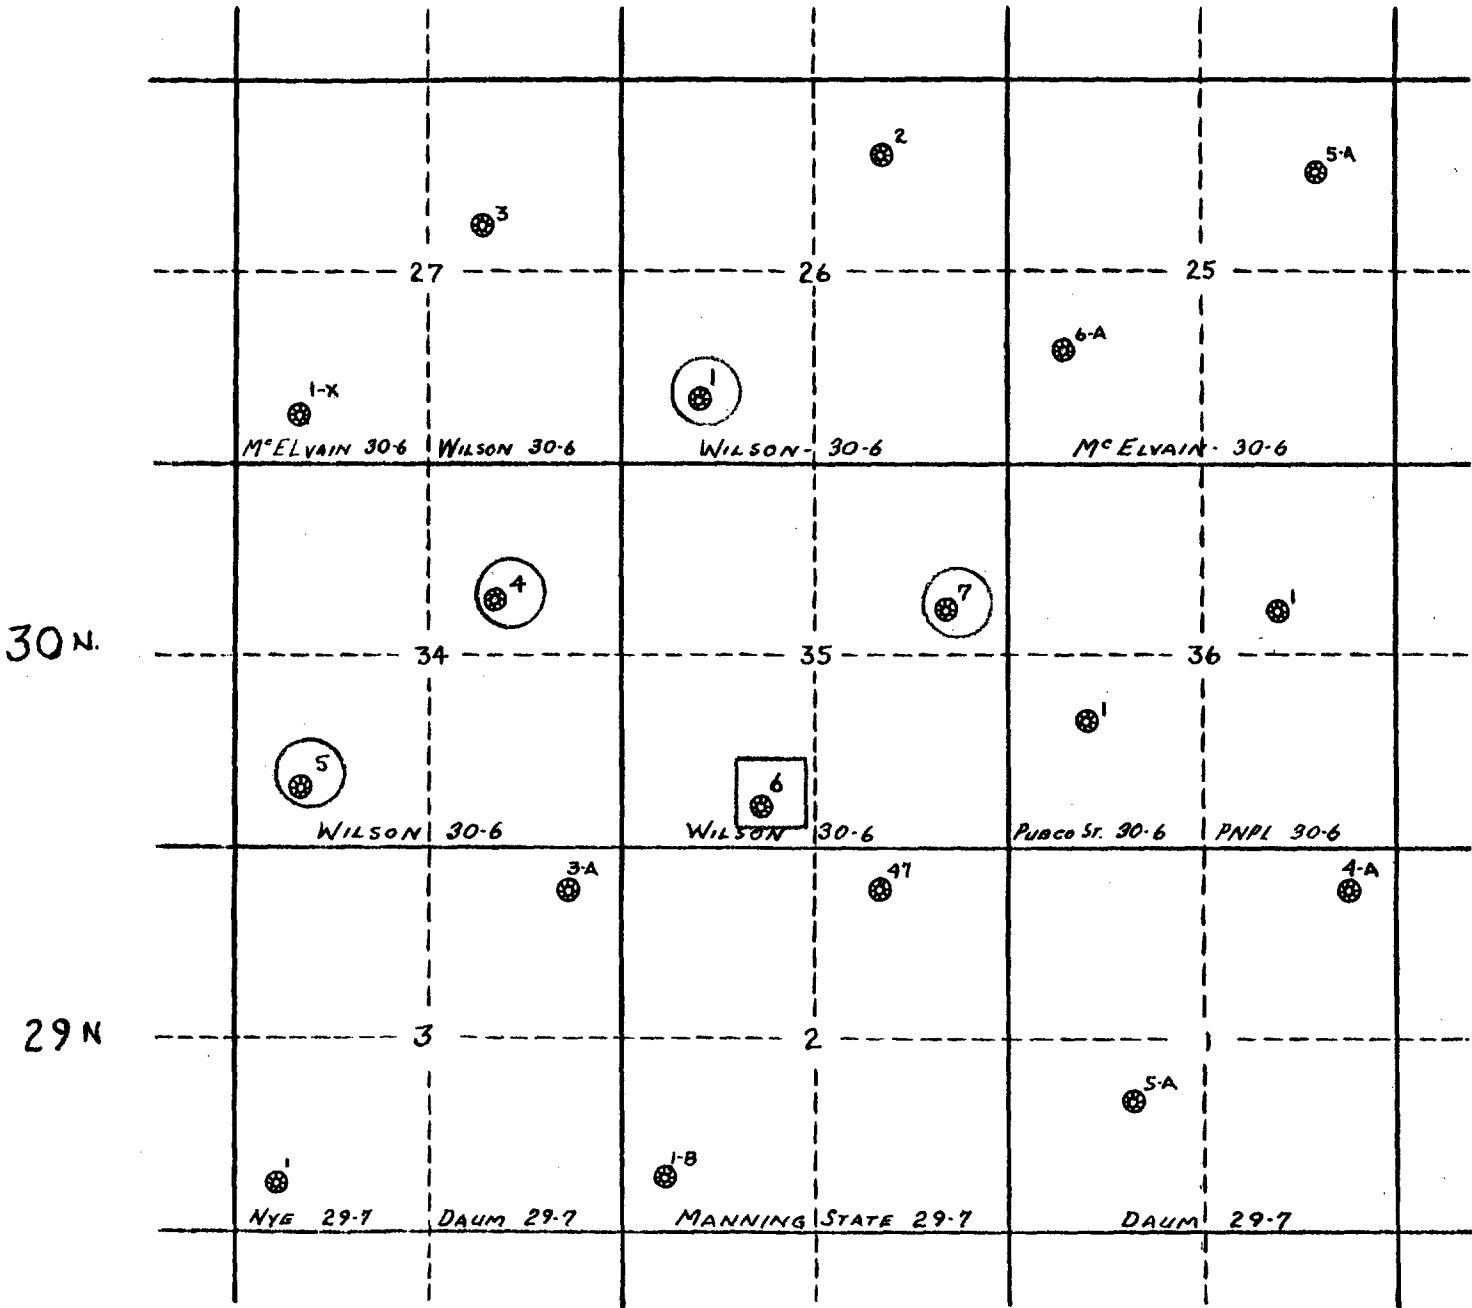

Wilson 30-6 *6

EPNG PRESSURE BUILD-UP TEST

TEST WELL DATA Fulcher Kutz Pictured Cliffs POOL

Date: _____

TEST WELL: Operator: El Paso Natural Gas Company Well Name & No. Rowley # 4

Location: 1650 fr. N, 890 fr. W lines, E Sec. 17 T. 27 N., R. 10 W

TD: 1878' Casing: 5 1/2" @ 1785' Tubing: 1" @ 1860'

Completed: January 1, 1953 First Delivery: April 16, 1953

Pay Zone: Open Hole Interval: _____ or Perforations: 1795'to 1885'

Stimulation: Shot w/220 Qt. S. N. G.

SIPC: 475 SIPT: _____ DAYS SI: 8

I. P. Test: 324 MCF, 3 hrs. _____ Choke: _____ MCF AOF thru tubing or casing

Current Deliverability: 120 MCF, Date Tested: October 23, 1957

WELLS ON SAME BASIC LEASE

<u>Name</u>	<u>Location</u>	<u>Deliverability</u>	<u>Date of Test</u>
Rowley #2	L 8-27-10	21	1957
Rowley #3	I 7-27-10	23	1957
Rowley #5	K 17-27-10	23	1957
Rowley #6	I 18-27-10	45	1957
Pipkin #3	A 17-27-10	29	1957
Pipkin #4	A 18-27-10	36	1957


EX B-16

Proration Department

SAN JUAN COUNTY NEW MEXICO

FULCHER KUTZ P.C.

TOWNSHIP 27 N RANGE 10 W

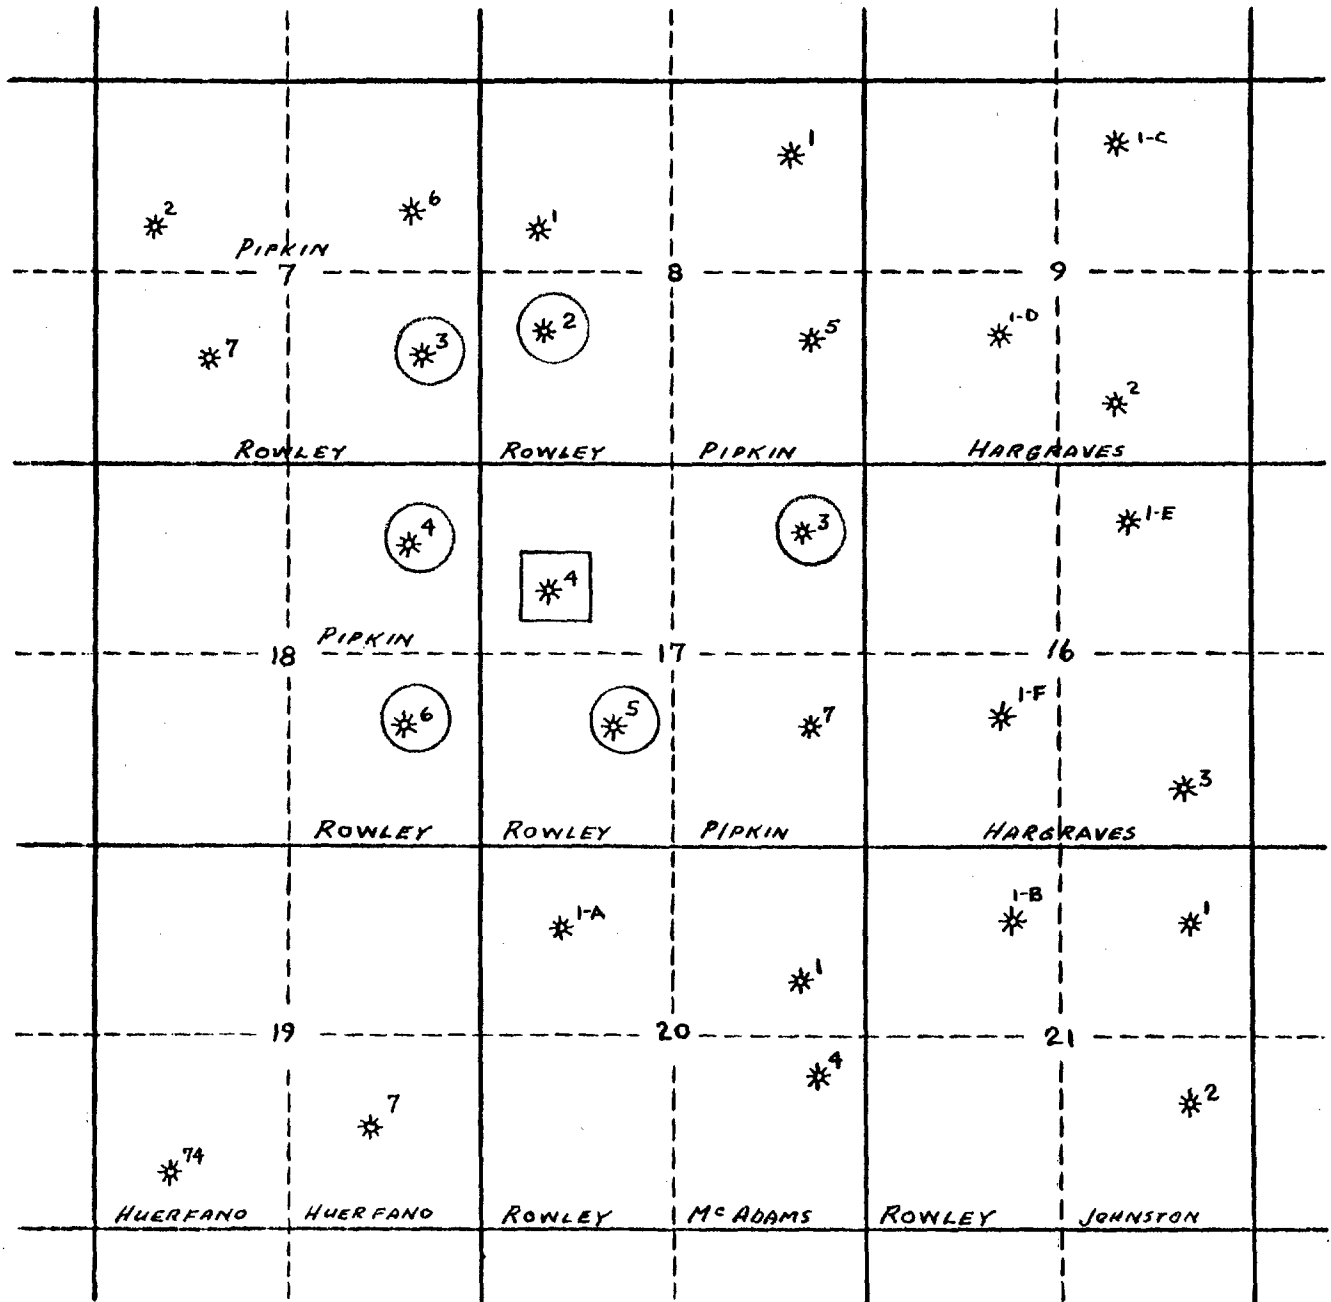

ROWLEY #4

EPNG PRESSURE BUILD-UP TEST

TEST WELL DATA South Blanco Pictured Cliffs POOL

Date: _____

TEST WELL: Operator: El Paso Natural Gas Company Well Name & No. Jicarilla 5-B

Location: 950 fr. S, 925 fr. W lines, M Sec. 27 T. 25 N., R. 4 W

TD: 3270' Casing: 5 1/2" @ 3270' Tubing: 2" @ 3093'

Completed: April 24, 1957 First Delivery: December 14, 1957

Pay Zone: Open Hole Interval: _____ or Perforations: 3160' to 3198'

Stimulation: Sand Water Fractured

SIPC: 994 SIPT: 994 DAYS SI: 17

I. P. Test: 12, 108 MCF, 3 hrs. 3/4" Choke: 4427 MCF AOF thru tubing or casing

Current Deliverability: 1768 MCF, Date Tested: July 17, 1957

WELLS ON SAME BASIC LEASE

<u>Name</u>	<u>Location</u>	<u>Deliverability</u>	<u>Date of Test</u>
Jicarilla #1-B	F 28-25-4	1966	1957
Jicarilla #2-B	G 34-25-4	2185	1957
Jicarilla #3-B	O 28-25-4	1819	1957
Jicarilla #4-B	D 34-25-4	7575	1957
Jicarilla #6-B	B 33-25-4	6181	1957
Jicarilla #7-B	J 27-25-4	482	1957


Ex B-17

Proration Department

SAN JUAN COUNTY NEW MEXICO

SOUTH BLANCO PC

TOWNSHIP 25 N RANGE 4 W

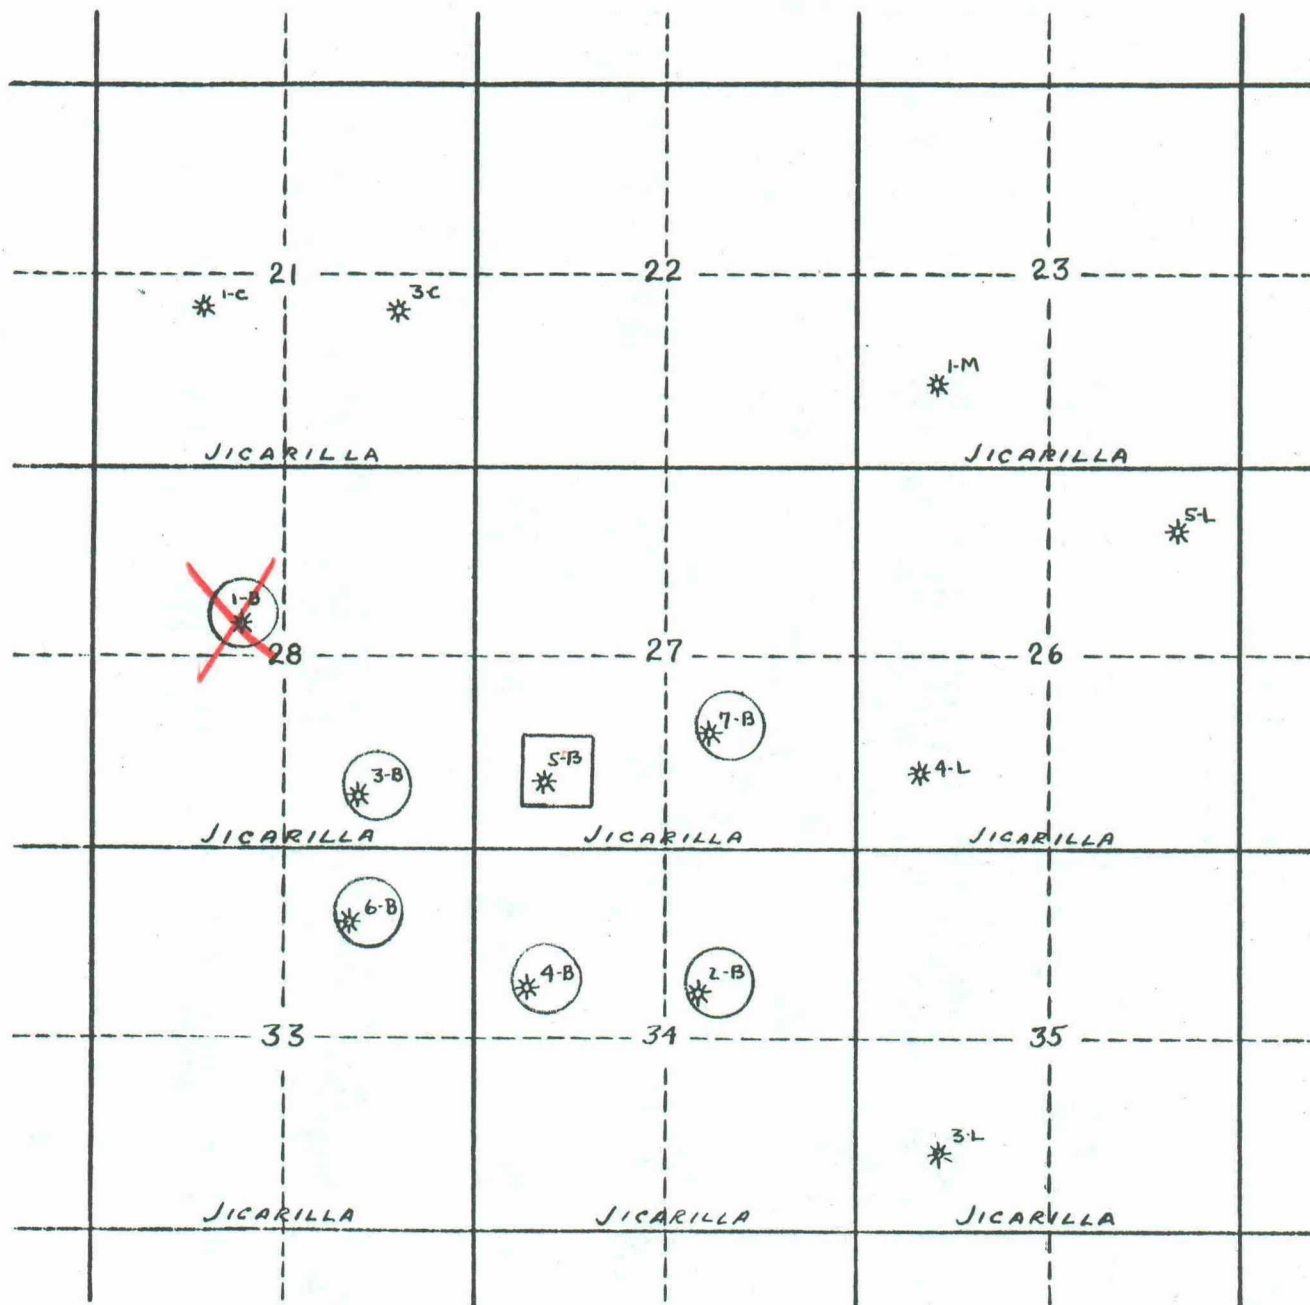

JICARILLA #5-B