



AERIAL SOURCE: © HIGH-ELEVATION AERIAL IMAGING AND AES,LLC., AERIAL DATE: NOVEMBER 12, 2019.


FIGURE 3


**SOIL BORING AND SAMPLE
LOCATIONS MAP**
HARVEST MIDSTREAM
TRUNK S RELEASE LOCATION
INCIDENT NUMBER: NCS1931842879
RELEASE ID: 373888
NE¼ SE¼, SEC. 7, T25N, R3W
RIO ARriba COUNTY, NEW MEXICO
N36.41180, W107.18085



DRAWN BY: C. Lameman	DATE DRAWN: April 8, 2020
REVISIONS BY: C. Lameman	DATE REVISED: April 23, 2020
CHECKED BY: E. McNally	DATE CHECKED: April 23, 2020
APPROVED BY: E. McNally	DATE APPROVED: April 23, 2020

- LEGEND**
- SOIL BORING/ SVE WELL LOCATIONS WITH RIG (WITHIN EXCAVATION AREA)
 - SOIL BORING LOCATIONS WITH RIG (OUTSIDE EXCAVATION AREA)
 - SOIL BORING LOCATIONS WITH HAND AUGER
 - COMPOSITE SOIL SAMPLE LOCATION
 - PID-OVM PHOTO IONIZATION DETECTOR-ORGANIC VAPOR METER
 - B BTEX
 - T TOLUENE
 - E ETHYLBENZENE
 - X XYLENE
 - GRO GASOLINE RANGE ORGANICS
 - DRO DIESEL RANGE ORGANICS
 - MRO MOTOR-OIL RANGE ORGANICS
 - Cl- CHLORIDE
 - ppm PARTS PER MILLION
 - mg/kg MILLIGRAMS PER KILOGRAM
 - < BELOW LABORATORY DETECTION LIMITS
- NOTE: ONLY CONCENTRATIONS ABOVE ACTION LEVELS ARE INCLUDED. ALL RESULTS TABULATED IN TABLE 1. SAMPLES ANALYZED PER EPA METHOD 8021, 8015, AND 300.0.

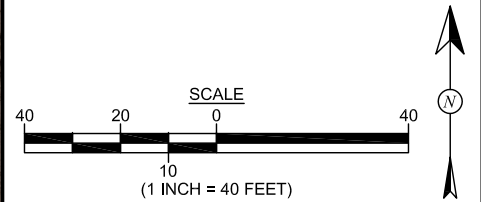

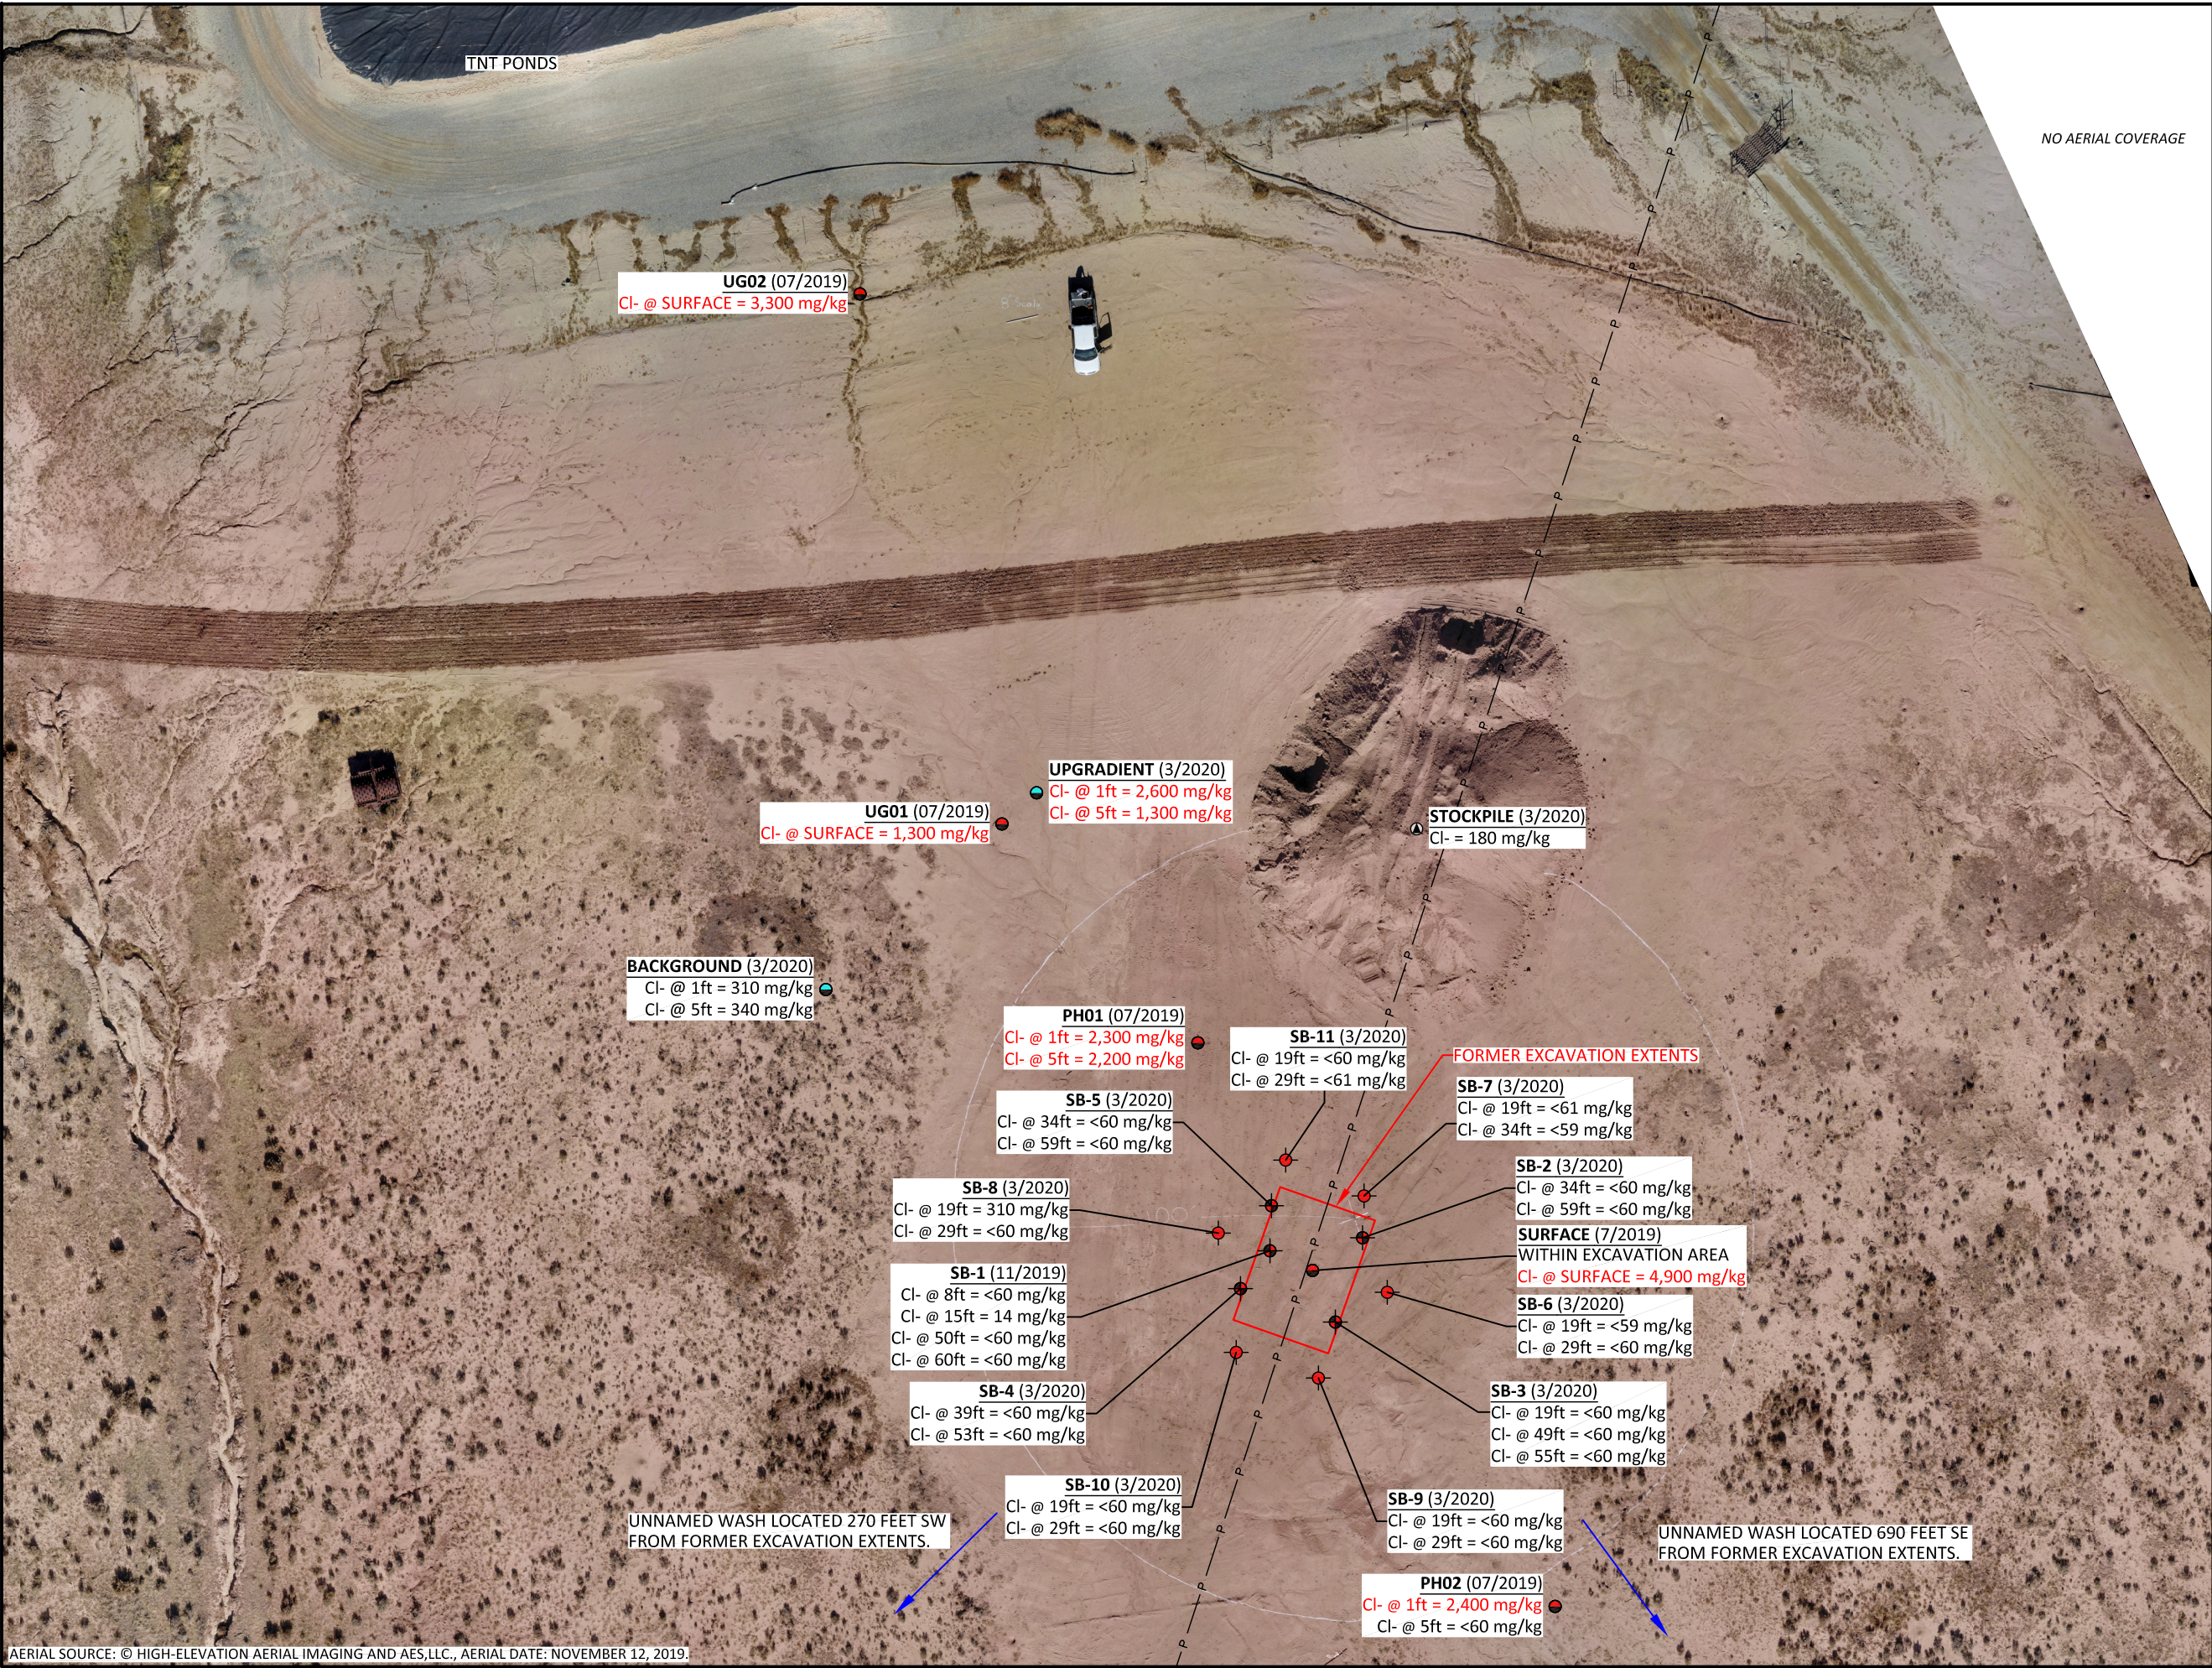

AERIAL SOURCE: © HIGH-ELEVATION AERIAL IMAGING AND AES,LLC., AERIAL DATE: NOVEMBER 12, 2019.

FIGURE 3A

SOIL BORING AND SAMPLE
LOCATIONS MAP - CHLORIDES

HARVEST MIDSTREAM
TRUNK S RELEASE LOCATION
INCIDENT NUMBER: NCS1931842879
RELEASE ID: 373888
NE¼ SE¼, SEC. 7, T25N, R3W
RIO ARriba COUNTY, NEW MEXICO
N36.41180, W107.18085



DRAWN BY: C. Lameman	DATE DRAWN: April 8, 2020
REVISIONS BY: C. Lameman	DATE REVISED: April 23, 2020
CHECKED BY: E. McNally	DATE CHECKED: April 23, 2020
APPROVED BY: E. McNally	DATE APPROVED: April 23, 2020

- LEGEND**
- LTE SAMPLE LOCATIONS
 - SOIL BORING/ SVE WELL LOCATIONS WITH RIG (WITHIN EXCAVATION AREA)
 - SOIL BORING LOCATIONS WITH RIG (OUTSIDE EXCAVATION AREA)
 - SOIL BORING LOCATIONS WITH HAND AUGER
 - COMPOSITE SOIL SAMPLE LOCATION
 - PID-OVM PHOTO IONIZATION DETECTOR-ORGANIC VAPOR METER
 - Cl- CHLORIDE
 - mg/kg MILLIGRAMS PER KILOGRAM
 - < BELOW LABORATORY DETECTION LIMITS
- NOTE: ALL RESULTS TABULATED IN TABLE 1. SAMPLES ANALYZED PER EPA METHOD 300.0.

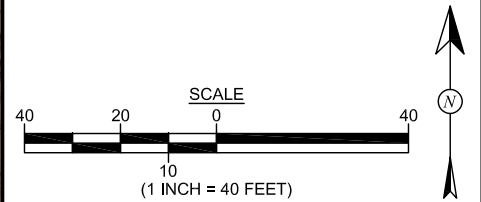


FIGURE 4A


GEOLOGIC CROSS SECTION
AND CHLORIDES

HARVEST MIDSTREAM
TRUNK S RELEASE LOCATION
INCIDENT NUMBER: NCS1931842879
RELEASE ID: 373888
NE¼ SE¼, SEC. 7, T25N, R3W
RIO ARriba COUNTY, NEW MEXICO
N36.41180, W107.18085






DRAWN BY: C. Lameman	DATE DRAWN: April 27, 2020
REVISIONS BY: C. Lameman	DATE REVISED: April 27, 2020
CHECKED BY: E. McNally	DATE CHECKED: April 27, 2020
APPROVED BY: E. McNally	DATE APPROVED: April 27, 2020


- LEGEND**
- LTE SAMPLE LOCATION
 - SOIL BORING/SVE WELL LOCATIONS WITH RIG (WITHIN EXCAVATION AREA)
 - SOIL BORING LOCATIONS WITH RIG (OUTSIDE EXCAVATION AREA)
 - APPROXIMATE BURIED PIPELINE

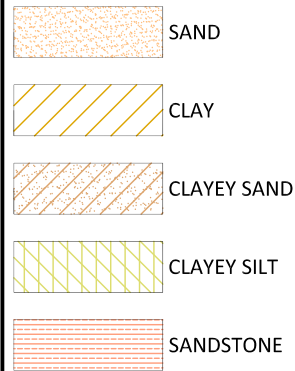


FIELD CHLORIDE mg/L (ppm)
(LAB CHLORIDE) mg/kg (ppm)
NOTE: ALL RESULTS TABULATED IN TABLE 1.
SAMPLES ANALYZED PER EPA METHOD 300.0.

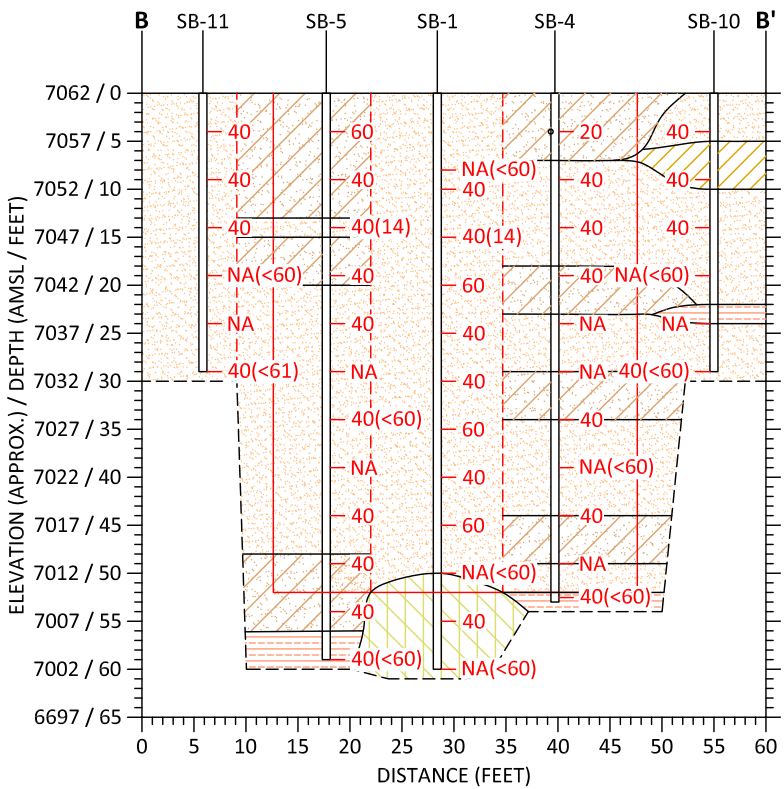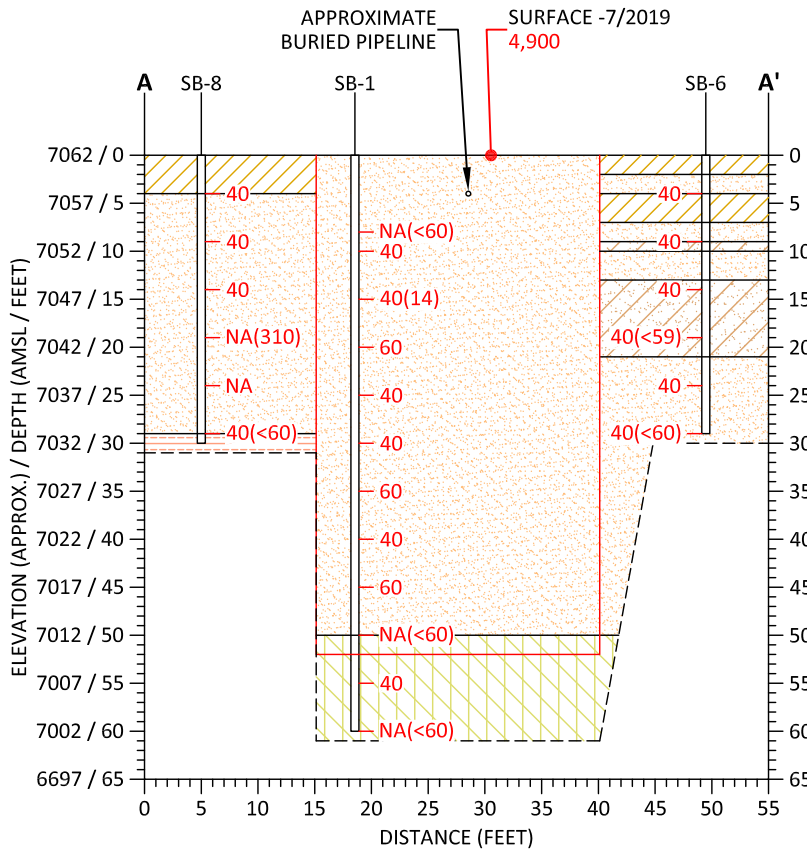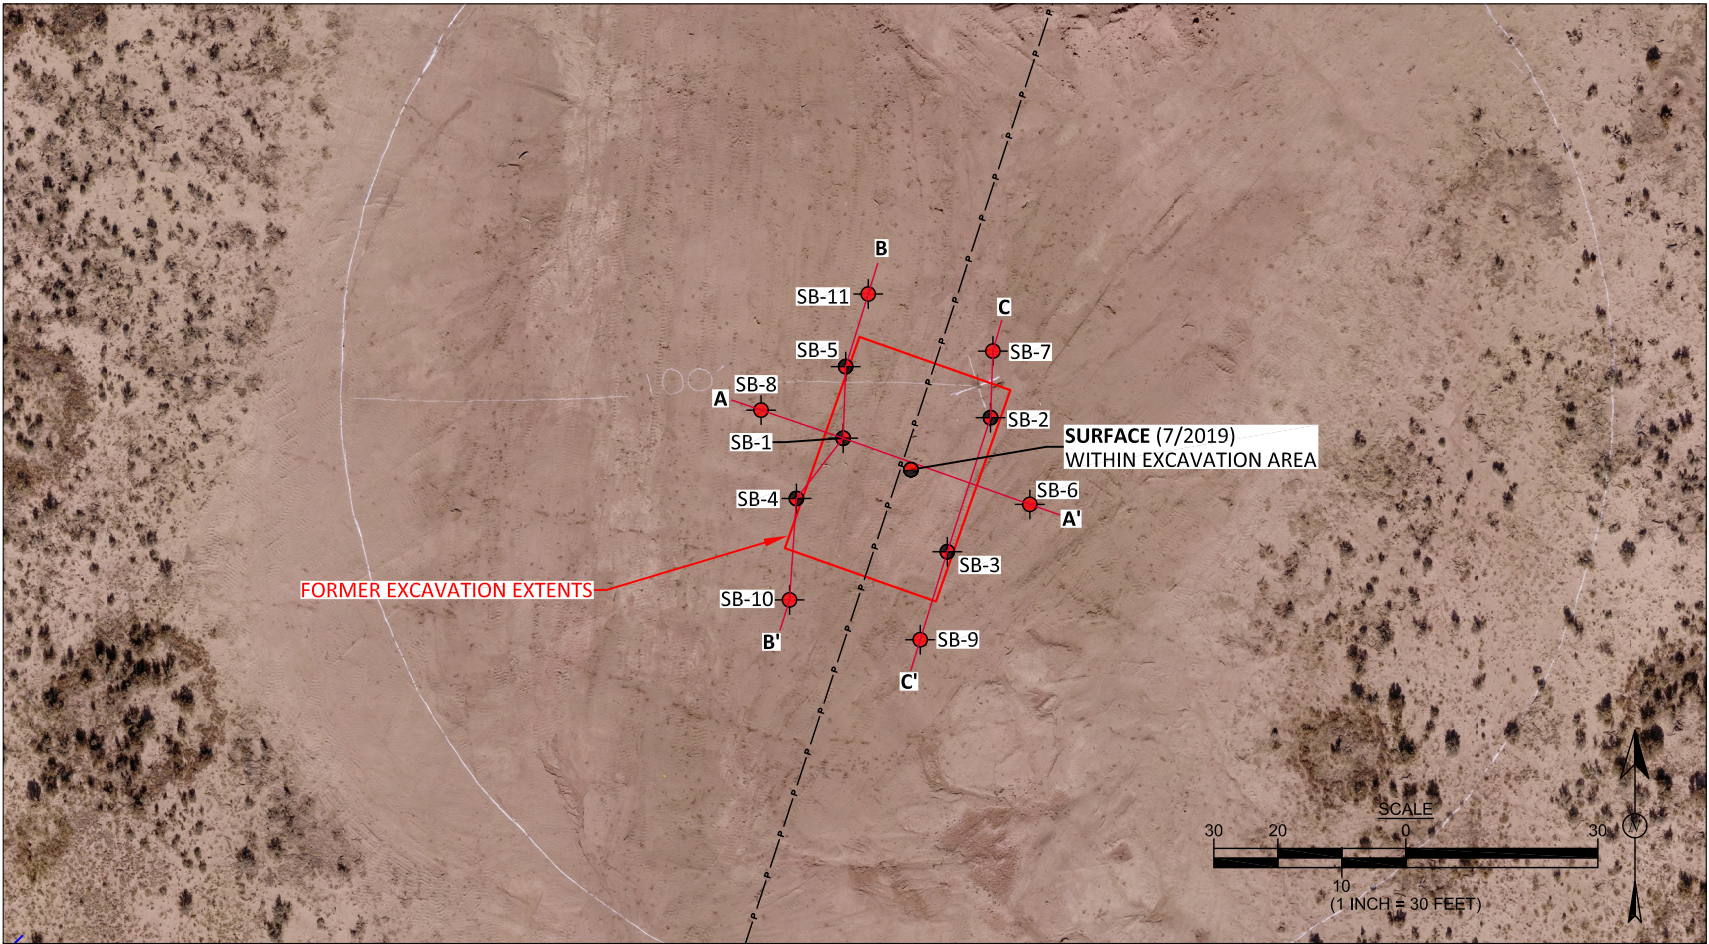

NOTE: SB-4 AND SB-5 MAY BE OUTSIDE OF EXCAVATION AREA.

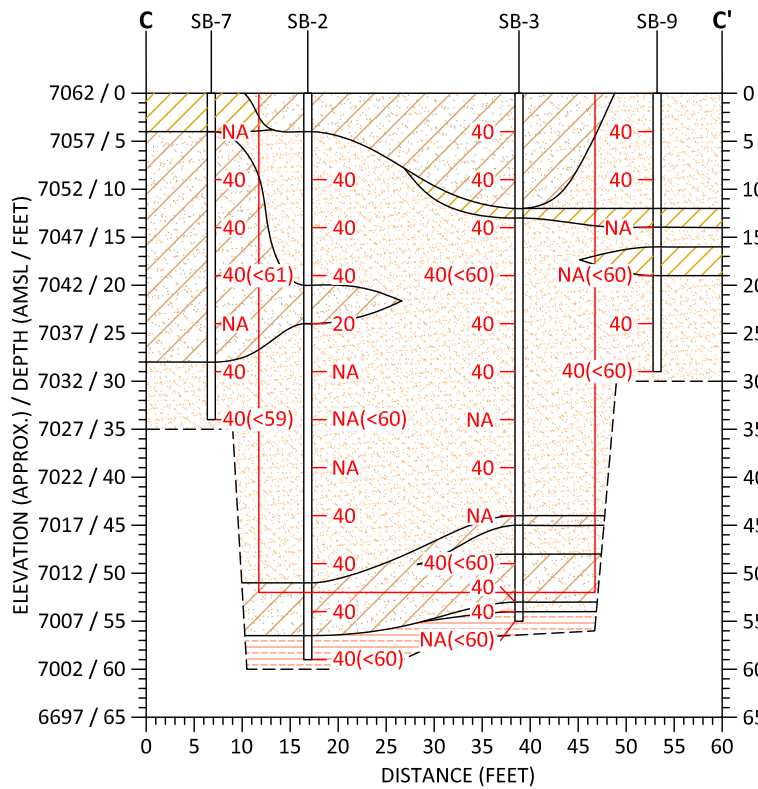

NOT TO SCALE

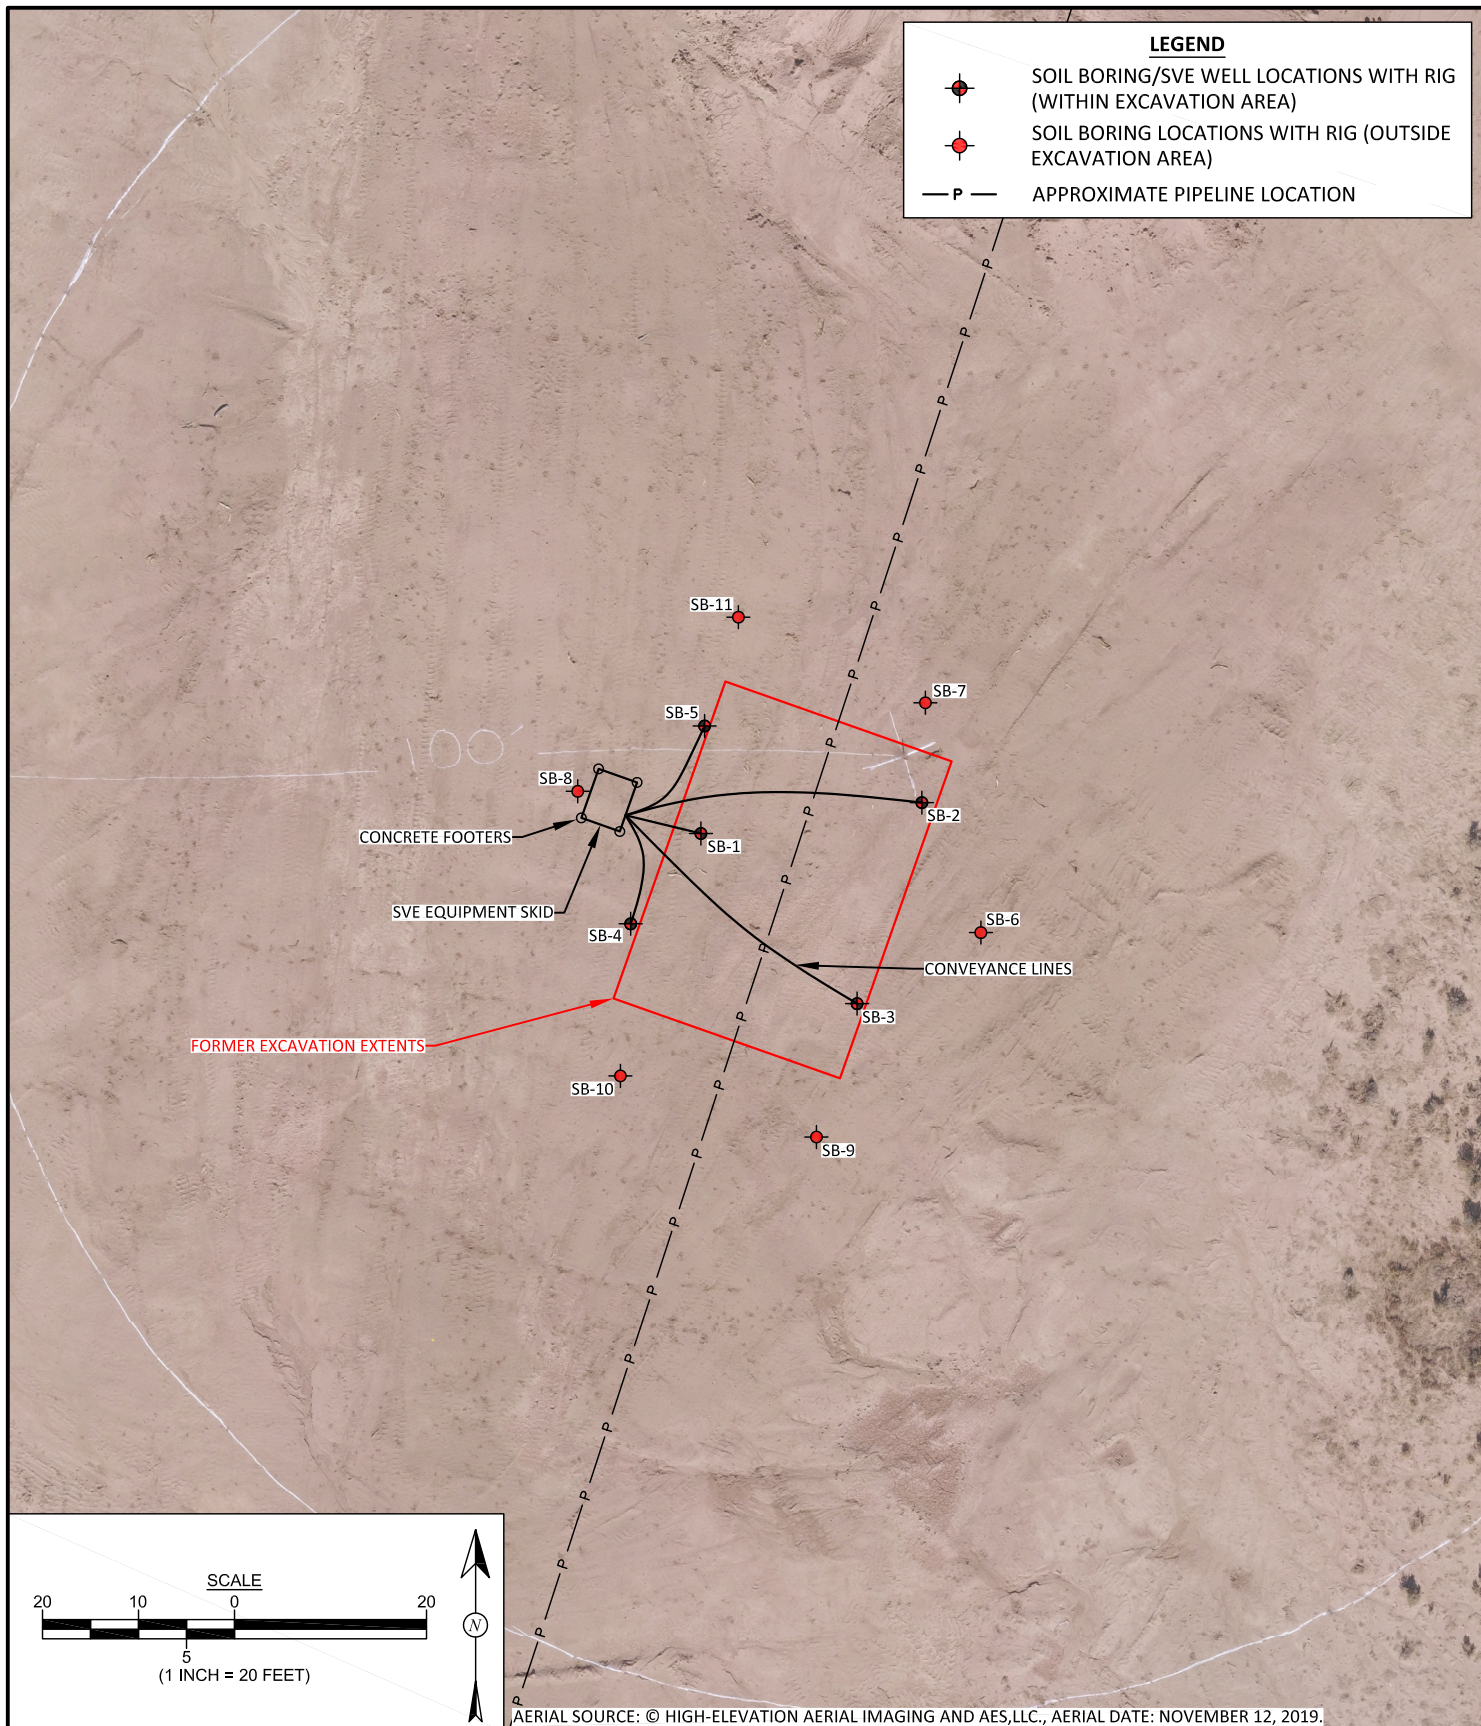

 animas environmental services Farmington, NM • Durango, CO animasenvironmental.com	DRAWN BY: C. Lameman	DATE DRAWN: April 23, 2020	FIGURE 5 PROPOSED SITE REMEDIATION LAYOUT HARVEST MIDSTREAM TRUNK S RELEASE LOCATION INCIDENT NUMBER: NCS1931842879 RELEASE ID: 373888 NE¼ SE¼, SEC. 7, T25N, R3W RIO ARriba COUNTY, NEW MEXICO N36.41180, W107.18085
	REVISIONS BY: C. Lameman	DATE REVISED: April 23, 2020	
	CHECKED BY: D. Reese	DATE CHECKED: April 23, 2020	
	APPROVED BY: E. McNally	DATE APPROVED: April 23, 2020	