District I

1625 N. French Dr., Hobbs, NM 88240

District II

1301 W. Grand Ave., Artesia, NM 88210

District III

1000 Rio Brazos Rd., Aztec, NM 87410

District IV

1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico Energy Minerals and Natural Resources

Department
Oil Conservation Division
1220 South St. Francis Dr.
Santa Fe, NM 87505

July 21, 2008

For temporary pits, closed-loop sytems, and below-grade
tanks, submit to the appropriate NMOCD District Office.

Form C-144

For permanent pits and exceptions submit to the Santa Fe Environmental Bureau office and provide a copy to the appropriate NMOCD District Office.

Pit, Closed-Loop System, Below-Grade Tank, or Proposed Alternative Method Permit or Closure Plan Application

Type of action:	X Permit of a pit, closed-loop system, below-grade tank, or proposed alternative method
	Closure of a pit, closed-loop system, below-grade tank, or proposed alternative method
	Modification to an existing permit
	Closure plan only submitted for an existing permitted or non-permitted pit, closed-loop system, below-grade tank, or proposed alternative method

Instructions: Please submit one application (Form C-144) per individual pit, closed-loop system, below-grade tank or alternative request

Please be advised that approval of this request does not relieve the operator of liability should operations result in pollution of surface water, ground water or the environment. Nor does approval relieve the operator of its responsibility to comply with any other applicable governmental authority's rules, regulations or ordinances.

Operator: Burlington Resources Oil & Gas Company, LP	OGRID#: 14538
Address: PO Box 4289, Farmington, NM 87499	OGRID#: 14538
Facility or well name: SAN JUAN 30-6 UNIT 429	2000
	D Permit Number:
U/L or Qtr/Qtr: A Section: 32 Township: 30N	Range: 7W County: Rio Arriba
	ongitude: -107.58796°W NAD: X 1927 1983
	Trust or Indian Allotment
Pit: Subsection F or G of 19.15.17.11 NMAC	
Temporary: Drilling Workover	
Permanent Emergency Cavitation P&A	
Lined Unlined Liner type: Thickness mil	LLDPE HDPE PVC Other
String-Reinforced	
Liner Seams: Welded Factory Other	folume: bbl Dimensions L x W x D
3 Closed-loop System: Subsection H of 19.15.17.11 NMAC Type of Operation: P&A Drilling a new well Workover or Drinotice of intent)	illing (Applies to activities which require prior approval of a permit or
	OtherOther
4 X Below-grade tank: Subsection I of 19.15.17.11 NMAC Volume: 120 bbl Type of fluid: Produced Water	TEN III Venine
Tank Construction material: Metal	
Secondary containment with leak detection X Visible sidewalls, liner, 6	inch lift and automatic overflow shut-off
Visible sidewalls and liner Visible sidewalls only Other	
Liner Type: Thicknessmil HDPE PVC	X Other Unspecified
5 Alternative Method:	
Submittal of an exception request is required. Exceptions must be submitted to the	Santa Fe Environmental Bureau office for consideration of approval.

6 Fencing: Subsection D of 19.15.17.11 NMAC (Applies to permanent pit, temporary pits, and below-grade tanks)		
Chain link, six feet in height, two strands of barbed wire at top (Required if located within 1000 feet of a permanent residence, school, hospital, is	nstitution or el	hurch)
Four foot height, four strands of barbed wire evenly spaced between one and four feet		
X Alternate. Please specify 4' hog wire fencing topped with two strands barbed wire.		
7 Netting: Subsection E of 19.15.17.11 NMAC (Applies to permanent pits and permanent open top tanks) X Screen Netting Other Monthly inspections (If netting or screening is not physically feasible)		
8		
Signs: Subsection C of 19.15.17.11 NMAC		
12" X 24", 2" lettering, providing Operator's name, site location, and emergency telephone numbers		
X Signed in compliance with 19.15.3.103 NMAC		
9		
Administrative Approvals and Exceptions: Justifications and/or demonstrations of equivalency are required. Please refer to 19.15.17 NMAC for guidance.		
Please check a box if one or more of the following is requested, if not leave blank:		
X Administrative approval(s): Requests must be submitted to the appropriate division district of the Santa Fe Environmental Bureau office for con (Fencing/BGT Liner)	nsideration of	approval.
Exception(s): Requests must be submitted to the Santa Fe Environmental Bureau office for consideration of approval.		
10		
Siting Criteria (regarding permitting): 19.15.17.10 NMAC Instructions: The applicant must demonstrate compliance for each siting criteria below in the application. Recommendations of acceptable source material are provided below. Requests regarding changes to certain siting criteria may require administrative approval from the appropriate district office or may be considered an exception which must be submitted to the Santa Fe Environmental Bureau Office for consideration of approval. Applicant must attach justification for request. Please refer to 19.15.17.10 NMAC for guidance. Siting criteria does not apply to drying pads or above grade-tanks associated with a closed-loop system.		
Ground water is less than 50 feet below the bottom of the temporary pit, permanent pit, or below-grade tank. - NM Office of the State Engineer - iWATERS database search; USGS; Data obtained from nearby wells	Yes	XNo
Within 300 feet of a continuously flowing watercourse, or 200 feet of any other watercourse, lakebed, sinkhole, or playa lake (measured from the ordinary high-water mark). - Topographic map; Visual inspection (certification) of the proposed site	Yes	XNo
Within 300 feet from a permanent residence, school, hospital, institution, or church in existence at the time of initial application.	Yes	XNo
(Applies to temporary, emergency, or cavitation pits and below-grade tanks)	□NA	
 Visual inspection (certification) of the proposed site; Aerial photo; Satellite image 		
Within 1000 feet from a permanent residence, school, hospital, institution, or church in existence at the time of initial application.	∏Yes	□No
(Applied to permanent pits)	XNA	Ш
- Visual inspection (certification) of the proposed site; Aerial photo; Satellite image		
Within 500 horizonal feet of a private, domestic fresh water well or spring that less than five households use for domestic or stock watering purposes, or within 1000 horizontal feet of any other fresh water well or spring, in existence at the time of initial application.	Yes	XNo
- NM Office of the State Engineer - iWATERS database search; Visual inspection (certification) of the proposed site.		
Within incorporated municipal boundaries or within a defined municipal fresh water well field covered under a municipal ordinance adopted pursuant to NMSA 1978, Section 3-27-3, as amended	Yes	XNo
- Written confirmation or verification from the municipality; Written approval obtained from the municipality		
Within 500 feet of a wetland. - US Fish and Wildlife Wetland Identification map; Topographic map; Visual inspection (certification) of the proposed site	Yes	XNo
Within the area overlying a subsurface mine.	Yes	XNo
- Written confirmation or verification or map from the NM EMNRD - Mining and Mineral Division	""	AIW
Within an unstable area. - Engineering measures incorporated into the design; NM Bureau of Geology & Mineral Resources; USGS; NM Geological Society; Topographic map	Yes	XNo
Within a 100-year floodplain	П.,	.
- FEMA map	Yes	X No

1100		
Waste Removal Closure For Closed-loop Systems That Utilize Above Ground Instructions: Please identify the facility or facilities for the disposal of liquids, dr.	d Steel Tanks or Haul-off Bins Only: (19.15.17.13.D NMAC) illing fluids and drill cuttings. Use attachment if more than two) facilities
are required,		
Disposal Facility Name:	Disposal Facility Permit #:	
Disposal Facility Name: Will any of the proposed closed loan system operations and associated associated as		
Will any of the proposed closed-loop system operations and associated acts Yes (If yes, please provide the information No		service and operations?
Required for impacted areas which will not be used for future service and operation Soil Backfill and Cover Design Specification - based upon the appr	ions:	
Re-vegetation Plan - based upon the appropriate requirements of Su	absection I of 19.15.17.13 NMAC	AC
Site Reclamation Plan - based upon the appropraite requirements of	Subsection G of 19.15.17.13 NMAC	
Siting Criteria (Regarding on-site closure methods only: 19.15.17,10 N Instructions: Each siting criteria requires a demonstration of compliance in the closure pl certain string criteria may require administrative approval from the appropriate district of for consideration of approval. Justifications and/or demonstrations of equivalency are re-	lan. Recommendations of acceptable source material are provided be	low: Requests regarding changes to te Santa Fe Environmental Bureau office
Ground water is less than 50 feet below the bottom of the buried waste.	4.4.46	Yes No
 NM Office of the State Engineer - iWATERS database search; USGS: Data 	•	N/A
Ground water is between 50 and 100 feet below the bottom of the buried w		Yes No
- NM Office of the State Engineer - iWATERS database search; USGS, Data	obtained from nearby wells	N/A
Ground water is more than 100 feet below the bottom of the buried waste,		Yes No
NM Office of the State Engineer - iWATERS database search; USGS; Data of the State Engineer - iWATERS database search; US	obtained from nearby wells	N/A
Within 300 feet of a continuously flowing watercourse, or 200 feet of any other sig (measured from the ordinary high-water mark).	nificant watercourse or lakebed, sinkhole, or playa lake	Yes No
- Topographic map: Visual inspection (certification) of the proposed site		
Within 300 feet from a permanent residence, school, hospital, institution, or church - Visual inspection (certification) of the proposed site; Aerial photo; satellite im	i in existence at the time of initial application. nage	Yes No
Within 500 horizontal feet of a private, domestic fresh water well or spring that less purposes, or within 1000 horizontal fee of any other fresh water well or spring, in e - NM Office of the State Engineer - iWATERS database; Visual inspection (cer	existence at the time of the initial application	Yes No
Within incorporated municipal boundaries or within a defined municipal fresh water pursuant to NMSA 1978, Section 3-27-3, as amended.	er well field covered under a municipal ordinance adopted	Yes No
 Written confirmation or verification from the municipality; Written approval Within 500 feet of a wetland 	obtained from the municipality	
- US Fish and Wildlife Wetland Identification map; Topographic map; Visual i	inspection (certification) of the proposed site	Yes No
Within the area overlying a subsurface mine.		□Yes □No
- Written confiramtion or verification or map from the NM EMNRD-Mining an	d Mineral Division	
Within an unstable area. - Engineering measures incorporated into the design; NM Bureau of Geology &	: Mineral Resources: USGS: NM Geological Society	Yes No
Topographic map		
Within a 100-year floodplain FEMA map		Yes No
On-Site Closure Plan Checklist: (19.15.17.13 NMAC) Instructions: Each	ch of the following items must bee attached to the closur	e plan. Please indicate,
by a check mark in the box, that the documents are attached. Siting Criteria Compliance Demonstrations - based upon the appropriate the compliance Demonstrations - based upon the appropriate the compliance Demonstrations		
Siting Criteria Compliance Demonstrations - based upon the appropria	mer requirements of 19.15.17.10 NMAC	
Construction/Design Plan of Burial Trench (if applicable) based upon		
Construction/Design Plan of Temporary Pit (for in place burial of a di		15 17 11 10 4 4 4
Protocols and Procedures - based upon the appropriate requirements of	of 19.15.17.13 NMAC	7.15.17.11 NMAC
Confirmation Sampling Plan (if applicable) - based upon the appropri		
Waste Material Sampling Plan - based upon the appropriate requirement		
Disposal Facility Name and Permit Number (for liquids, drilling fluids		not be achieved)
Soil Cover Design - based upon the appropriate requirements of Subst	ection H of 19.15.17.13 NMAC	
Re-vegetation Plan - based upon the appropriate requirements of Subs	ection I of 19.15.17.13 NMAC	
Site Reclamation Plan - based upon the appropriate requirements of S	ubsection G of 19.15.17.13 NMAC	

Clearry Method: Compared within 50 plants of clasure completion of the clasure and complete to the level of the period compared within 50 plants of the completion of the clasure of the form and complete of the clasure of the form and complete of the clasure of the form and complete of the clasure of the form and the clasure of the form of the clasure of the form and the clasure of the fo	[9]			
Thereby critisy that the information submitted with this application is time, accurate and complete on the best of any knowledge and larked		1 Certification:		
Same (Piral): Cynal Eddyrg. Title: Regulatory Technician Spignature: Land Mires: Spignature: Land Mires: Spignature: Approval Date: Spignature: Approval Date: Spignature: Approval Date: Spignature: Approval Date: Spignature: Spignatur			curate and complete to the	best of my knowledge and belief.
Systematics:				
20 Department Permit Application (including closure plan) Closure Plan (only) OCD Conditions (see attachment)	Signature:	Custel Jalana	Date	
DED. Approval: Permit Application (including closure plan) Closure Plan (only) OCD Conditions (see attachment) OCD Representative Signature: Approval Date: CREATER Segment Tregulared within 60 days of closure completion; See-con K of Vt 3.7 1) 200.00 Closure Report I required within 60 days of closure completion; See-con K of Vt 3.7 1) 200.00 Closure Report I required within 60 days of closure completion; See-con K of Vt 3.7 1) 200.00 Closure Report I required within 60 days of closure completion; See-con K of Vt 3.7 1) 200.00 Closure Method: Closure Completion Closure completion Closure completion Closure complete this section of the funn until on approved closure plan has been admined and the cionare articulus have been completed. Closure Completion Date: Closure Method: Closure Method Maste Econoval (Closed-loop systems only) Closure Method Maste Econoval (Closed-loop systems only) Closure Method Maste Econoval (Closed-loop systems only) Closure Method Closure Met	e-mail address:			
OCD Permit Approval Permit Application (including closure plan) Closure Plan (only) OCD Conditions (see attachment) OCD Representative Signature:		- 1	текрине.	303-320-9037
OCD Representative Nignature: Approval Date: OCD Permit Number:	20			
OCD Representative Signature: Approval Date: Cleasure Report Irecognized within 60 days of closure completion; Subsective R of 93 FI DISMAC Internations. Operators are required to iduation in approach (name plan prior is implementing any closure artificial and submitting the closure report. The closure Prior is required to the admitted of the closure artificial for the closure artificial. Please do not complete this section of the furna motif on prior is implementing any closure artificial. Please do not complete this section of the furna motif on prior is required to the admitted of the closure artificial for the closure artificial. Please do not complete this section of the furna motif on prior is required in the closure for a prior to the closure for the furnation of the closure for a prior to the closure for the furnation of the furnation of the closure for the furnation of the furnation o	OCD Approval:	Permit Application (including closure plan)	Closure Plan (only)	OCD Conditions (see attachment)
These Report (resulted within 60 days of closure completion); Substitute (Port Permit Number:	OCD Representative	Signature:		
Closure Report (required within 60 days of closure completion); Subsection K of 1913 (13 to 1913 MAC) Closure Report (required within 60 days of closure plan prore in uniformising my closure activities and submining the closure report. The closure report is required to about not under inclinate within 60 days of the completion of the closure report is required to about not under inclinate within 60 days of the completion of the closure report and closure plan has been abouted and the closure artificials have been completed. Closure Completion Date: Closur				Approval Date:
Clesser Report (required within 60 days of closure commelsion); Subsection & et 19.13 ITEMAN instruments: Operatures are required to obtain an approach closure plan prior to implementing my closure aristics and submitting the closure report. The closure report is required to the division within 60 days of the completion of the closure carrivities. Please do not complete this section of the form until an approved plan has been obtained and the closure artivities have been completed. Closure Completion Date: Closure Completion Date: Closure Method: Waste Exercation and Removal On-site Closure Method Alternative Closure Method Waste Removal (Closed-loop systems only)	Title:		OCD Perm	ait Number:
Cleasure Remort (required within 80 days of Gooder completion); Soverous R of 19.5 IT IS BAAC interactive (reported are equated to adobtion an approved cleasure plan prior to implementing my cleanure activities and submitting the cleasure report. The cleanure report is required in the submitted to the distinct within all of sixts of the completion of the clians are within to the sixts of the completion of the clians are within to the distinct of the clians are activities have been completed. Closure Completion Date: Closure Completion Date:				
Instructions: Operatures are required to obtain an approach closure plan pine to implementing on chostne articlies and submitting the chostne report. The closure report is required to be submitted to the division within 60 days of the completion of the closure activities. Please do not complete this section of the form notif on approach closure plan has been chiadined and the closure activities have been completed. Closure Completion Date: Closure Completion Date: Closure Method; Waste Excavation and Removal On-site Closure Method Alternative Closure Method Waste Removal (Closed-loop systems only) If different from approved plan, please explain. The plant of the following process of the following the closure for Closed-loop Systems That Utility Above Ground Steel Tanks or Haul-off Bias Only: surreding Waste Removal Closure For Closed-loop Systems That Utility Above Ground Steel Tanks or Haul-off Bias Only: surreding Waste Removal Closure for Closed-loop Systems That Utility Above Ground Steel Tanks or Haul-off Bias Only: surreding Waste Closure of Closure for Closed-loop Systems That Utility Above Ground Steel Tanks or Haul-off Bias Only: surreding Waste Closure of Closure for Closed-loop Systems That Utility Above Ground Steel Tanks or Haul-off Bias Only: surreding Waste Closed on the Steel of the Steel of Systems That Utility Above Ground Steel Tanks or Haul-off Bias Only: surreding Waste Closure Closed System or Facility Permit Number: Disposal Facility Name: Disposal Facility Name: Disposal Facility Permit Number: Week the Closed of Dop system operations and associated activities performed on or in areas that will not be used for future service and upeartions? Yes (If yes, please demonstrate compiliane to the litens below) No Repaired for impacted areas which will not be used for future service and application Rayle and permit Number: Size Rectanation (Proto Documental Closed) Proto of Deed Notic (requiremental and division)				
report or required in the saturated in the division within 60 days of the completion of the tonare artivities. Please do not complete this section of the form until an appropriate diviner plan has been obtained and the clearer artivities have been completed. Closure Completion Date:	Instructions: Operators a	ired within 60 days of closure completion); Su	disection K of 19 15 17 13 NMAC	
Closure Completion Date: Closure Completion Date: Closure Method	report is required to be si	ibinitted to the division within 60 days of the complet	tion of the closure activities	re activities and submitting the closure report. The closure 6. Please do not complete this section of the form until an
Closure Method: Waste Escavation and Removal On-site Closure Method Alternative Closure Method Waste Removal (Closed-loop systems only) If different from approved plan, please explain.	approved closure plan ha	s been obtained and the closure activities have been	completed.	the second section of the second the
Closure Method: Waste Escavation and Removal On-site Closure Method Alternative Closure Method Waste Removal (Closed-loop systems only) If different from approved plan, please explain.			Closure	Completion Date:
Cleasure Method:	21			
Waste Excavation and Removal On-site Closure Method Ahernative Closure Method Waste Removal (Closed-loop systems only)	Closure Method:			
If different from approved plan, please explain. Toure Repart Regarding Waste Removal Closure For Closed-loop Systems That Utilize Above Ground Steel Tanks or Houl-off Bias Only: Institutions: Please Identify the facility or facilities for where the liquids, drilling fluids and drill cutings were disposed. Use attachment if more than two facilities rere utilized. Disposal Facility Permit Number:		and Removal On-site Closure Method	Alternative Closure	Method Wasta Bannon (Claud Inc.)
Stature Report Regarding Waste Removal Closure For Closed-loop Systems That Utilize Above Ground Steel Tanks or Houl-off Bins Only: Institution: Please identify the facility or facilities for where the liquids, drilling fluids and drill cuttings were disposed. Use attachment if more than two facilities series utilized. Disposal Facility Name:	_			waste Removal (Closed-loop systems only)
Closure Report Attachment Checklist: Instructions: Each of the following items must be attached to the closure report. Please indicate, by a check mark in the behalf of on-site closures and delivision) Proof of Dead Notice (required for on-site closure) Proof of Dead Notice (required for on-site closure) Disposal Facility Name and Permit Number:		pproved plant please explain.		
Interestions: Please identify the facility or facilities for where the liquids, drilling fluids and drill cuntings were disposed. Use attachment if more than two facilities revere utilized. Disposal Facility Permit Number: Disposal Facility Name and Permit Number: Disposal Facility Permit	23 Cheura Ponnet Beauelle	ng Warts Domainal Classes E. Cl. 11. C.	-	
Disposal Facility Name: Disposal Facility Permit Number: Disposal Facility Name: Disposal Facility Permit Number: Were the closed-loop system operations and associated activities performed on or in areas that will not be used for future service and operations? Yest If yes, please demonstrate compliance to the items below) No Required for impacted areas which will not be used for future service and operations: Site Reclamation (Photo Documenation) Soil Backfilling and Cover Installation Re-evegetation Application Rates and Seeding Technique Closure Report Attachment Checklist: Instructions: Each of the following items must be attached to the closure report. Please indicate, by a check mark in the box, that the documents are attached. Proof of Closure Notice (surface owner and division) Proof of Deed Notice (required for on-site closure) Plot Plan (for on-site closures and temporary pits) Confirmation Sampling Analytical Results (if applicable) Disposal Facility Name and Permit Number Soil Backfilling and Cover Installation Revegetation Application Rates and Seeding Technique Site Reclamation (Photo Documentation) On-site Closure Location: Latitude: Longitude: NAD 1927 1983 Derutor Closure Certification: Latitude: Longitude: NAD 1927 1983 Derutor Closure Certification: Title: Title: Title: Date: Da	Instructions: Please iden	tify the facility or facilities for where the liquide dri	ns That Utilize Above Gro	and Steel Tanks or Haul-off Bins Only:
Disposal Facility Name: Disposal Facility Permit Number: Were the closed-loop system operations and associated activities performed on or in areas that will not be used for future service and operations? Yes (If yes, please demonstrate complitant to the items below) No Required fire impacted areas which will not be used for future service and operations: Site Reclamation (Photo Documentation) Soil Backfilling and Cover Installation Re-wegetation Application Rates and Seeding Technique Closure Report Attachment Checklist: Instructions: Each of the following items must be attached to the closure report. Please indicate, by a check mark in the box, that the documents are attached. Proof of Closure Notice (surface owner and division) Proof of Deed Notice (required for on-site closure) Plot Plan (for on-site closures and temporary pits) Confirmation Sampling Analytical Results (if applicable) Waste Material Sampling Analytical Results (if applicable) Disposal Facility Name and Permit Number Soil Backfilling and Cover Installation Re-wegetation Application Rates and Seeding Technique Site Reclamation (Photo Documentation) On-site Closure Location: Latitude: Longitude: NAD 1927 1983	were utilized.	gy y y y y mile significations as a	ming Jumas and arm Chilli	gs were aisposed. Use attachment if more than two facilities
Were the closed-loop system operations and associated activities performed on or in areas that will not be used for future service and operations? Yes II yes, please demonstrate compiliance to the items below)	Disposal Facility Name	e:	Disposal Facility I	Permit Number:
Yes III yes, please demonstrate complitane to the items below) No Required for impacted areas which will not be used for future service and operations: Site Reclamation (Photo Documentation) Soil Backfilling and Cover Installation Re-vegetation Application Rates and Seeding Technique			Disposal Facility I	Permit Number:
Required for impacted areas which will not be used for future service and operations: Site Reclamation (Photo Documentation)	Were the closed-loop s	ystem operations and associated activities performed		be used for future service and opeartions?
Site Reclamation (Photo Documentation) Soil Backfilling and Cover Installation Re-vegetation Application Rates and Seeding Technique Closure Report Attachment Checklist: Instructions: Each of the following items must be attached to the closure report. Please indicate, by a check mark in the box, that the documents are attached. Proof of Closure Notice (surface owner and division) Proof of Closure Notice (trequired for on-site closure) Plot Plan (for on-site closures and temporary pits) Confirmation Sampling Analytical Results (if applicable) Waste Material Sampling Analytical Results (if applicable) Disposal Facility Name and Permit Number Soil Backfilling and Cover Installation Re-vegetation Application Rates and Seeding Technique Site Reclamation (Photo Documentation) On-site Closure Location: Latitude:		•		
Soil Backfilling and Cover Installation Re-vegetation Application Rates and Seeding Technique			perations:	
Re-vegetation Application Rates and Seeding Technique Closure Report Attachment Checklist: Instructions: Each of the following items must be attached to the closure report. Please indicate, by a check mark in the box, that the documents are attached. Proof of Closure Notice (surface owner and division) Proof of Deed Notice (required for on-site closure) Plot Plan (for on-site closures and temporary pits) Confirmation Sampling Analytical Results (if applicable) Waste Material Sampling Analytical Results (if applicable) Disposal Facility Name and Permit Number Soil Backfilling and Cover Installation Re-vegetation Application Rates and Seeding Technique Site Reclamation (Photo Documentation) On-site Closure Location: Latitude: Longitude: NAD 1927 1983				
Closure Report Attachment Checklist: Instructions: Each of the following items must be attached to the closure report. Please indicate, by a check mark in the box, that the documents are attached. Proof of Closure Notice (surface owner and division) Proof of Deed Notice (required for on-site closure) Plot Plan (for on-site closures and temporary pits) Confirmation Sampling Analytical Results (if applicable) Waste Material Sampling Analytical Results (if applicable) Disposal Facility Name and Permit Number Soil Backfilling and Cover Installation Re-vegetation Application Rates and Seeding Technique Site Reclamation (Photo Documentation) On-site Closure Location: Latitude: Longitude: NAD 1927 1983 Perulor Closure Certification: Perulor Closure Certification: Proof of Closure Plans (Print) 1983 Provided Closure Plans (Print) 1984 Proof of Closure Plans (Print) 1985 Proof of Closure Plans (Print) 1985 Proof of Closure Plans (Print) 1986 Proof of Closure Plans (Print) 1987 Proof of Closure Plans (Print) 1988 Proof of Closure Plans (_			
Closure Report Attachment Checklist: Instructions: Each of the following items must be attached to the closure report. Please indicate, by a check mark in the box, that the documents are attached. Proof of Closure Notice (surface owner and division) Proof of Deed Notice (required for on-site closure) Plot Plan (for on-site closures and temporary pits) Confirmation Sampling Analytical Results (if applicable) Waste Material Sampling Analytical Results (if applicable) Disposal Facility Name and Permit Number Soil Backfilling and Cover Installation Re-vegetation Application Rates and Seeding Technique Site Reclamation (Photo Documentation) On-site Closure Location: Latitude: Longitude: NAD 1927 1983 Perulor Closure Location: Latitude: Longitude: NAD 1927 1983 Perulor Closure Certification: Perulor Closure requirements and conditions specified in the approved closure plan. Same (Print): Title: Date:		The state of the s		
Proof of Closure Notice (surface owner and division) Proof of Closure Notice (required for on-site closure) Plot Plan (for on-site closures and temporary pits) Confirmation Sampling Analytical Results (if applicable) Waste Material Sampling Analytical Results (if applicable) Disposal Facility Name and Permit Number Soil Backfilling and Cover Installation Re-vegetation Application Rates and Seeding Technique Site Reclamation (Photo Documentation) On-site Closure Location: Latitude: Longitude: NAD 1927 1983 Decretor Closure Certification: Proof of Closure Certification: Proof of Deed Notice (requirements and second division) Longitude: NAD 1927 1983	24 Closure Report Atta	chment Checklist: Instructions: Each of the foll	lowing itama must be asset	had had a land a
Proof of Deed Notice (required for on-site closure) Plot Plan (for on-site closures and temporary pits) Confirmation Sampling Analytical Results (if applicable) Waste Material Sampling Analytical Results (if applicable) Disposal Facility Name and Permit Number Soil Backfilling and Cover Installation Re-vegetation Application Rates and Seeding Technique Site Reclamation (Photo Documentation) On-site Closure Location: Latitude: Longitude: NAD 1927 1983 Peralor Closure Certification: Perently certify that the information and attachments submitted with this closure report is ture, accurate and complete to the best of my knowledge and belief. I also certify that the closure complies with all applicable closure requirements and conditions specified in the approved closure plan. Title: gnature: Date:	ine oux, inai ine aocun	ienis are aliached.	owing news wast be midel	nea to the closure report. Please indicate, by a check mark in
Plot Plan (for on-site closures and temporary pits) Confirmation Sampling Analytical Results (if applicable) Waste Material Sampling Analytical Results (if applicable) Disposal Facility Name and Permit Number Soil Backfilling and Cover Installation Re-vegetation Application Rates and Seeding Technique Site Reclamation (Photo Documentation) On-site Closure Location: Latitude: Longitude: NAD 1427 1983 Department Closure Certification: Waste Material Sampling Analytical Results (if applicable) Disposal Facility Name and Permit Number Soil Backfilling and Cover Installation Re-vegetation Application Rates and Seeding Technique Site Reclamation (Photo Documentation) On-site Closure Location: Latitude: Longitude: NAD 1427 1983 Department Closure Certification: Waster Consumer Certification: Waster Consumer Complete to the best of my knowledge and belief. I also certify that the closure complies with all applicable closure requirements and conditions specified in the approved closure plan. Title: gnature: Date:				
Confirmation Sampling Analytical Results (if applicable) Waste Material Sampling Analytical Results (if applicable) Disposal Facility Name and Permit Number Soil Backfilling and Cover Installation Re-vegetation Application Rates and Seeding Technique Site Reclamation (Photo Documentation) On-site Closure Location: Latitude: Longitude: NAD 1927 1983 Perulor Closure Certification: wereby certify that the information and attachments submitted with this closure report is ture, accurate and complete to the best of my knowledge and belief. I also certify that the consure complies with all applicable closure requirements and conditions specified in the approved closure plan. Title: gnature: Date:				
Waste Material Sampling Analytical Results (if applicable) Disposal Facility Name and Permit Number Soil Backfilling and Cover Installation Re-vegetation Application Rates and Seeding Technique Site Reclamation (Photo Documentation) On-site Closure Location: Latitude: Longitude: NAD 1927 1983 Departure Closure Certification: Bereby certify that the information and attachments submitted with this closure report is ture, accurate and complete to the best of my knowledge and belief. I also certify that the colosure complies with all applicable closure requirements and conditions specified in the approved closure plan. Title: gnature: Date;	Plot Plan (for on-	site closures and temporary pits)		
Disposal Facility Name and Permit Number Soil Backfilling and Cover Installation Re-vegetation Application Rates and Seeding Technique Site Reclamation (Photo Documentation) On-site Closure Location: Latitude: Longitude: NAD 1927 1983 Departure Certification: Bereby verify that the information and attachments submitted with this closure report is ture, accurate and complete to the best of my knowledge and belief. I also certify that cosure complies with all applicable closure requirements and conditions specified in the approved closure plan. Title: gnature: Date:	Confirmation San	npling Analytical Results (if applicable)		
Soil Backfilling and Cover Installation Re-vegetation Application Rates and Seeding Technique Site Reclamation (Photo Documentation) On-site Closure Location: Latitude: Longitude: NAD 1927 1983 perutor Closure Certification: tereby certify that the information and attachments submitted with this closure report is ture, accurate and complete to the best of my knowledge and belief. I also certify that the closure complies with all applicable closure requirements and conditions specified in the approved closure plan. Title: gnature: Date:	Waste Material Sa	ampling Analytical Results (if applicable)		
Re-vegetation Application Rates and Seeding Technique Site Reclamation (Photo Documentation) On-site Closure Location: Latitude: Longitude: NAD 1927 1983	Disposal Facility	Name and Permit Number		
Site Reclamation (Photo Documentation) On-site Closure Location: Latitude: Longitude: NAD 1927 1983 perutor Closure Certification: wereby certify that the information and attachments submitted with this closure report is ture, accurate and complete to the best of my knowledge and belief. I also certify that eclosure complies with all applicable closure requirements and conditions specified in the approved closure plan. Title: gnature: Date:	Soil Backfilling a	nd Cover Installation		
On-site Closure Location: Latitude: Longitude: NAD 1927 1983 perutor Closure Certification:	Re-vegetation App	plication Rates and Seeding Technique		
perutor Closure Certification: wereby certify that the information and attachments submitted with this closure report is ture, accurate and complete to the best of my knowledge and belief. I also certify that eclosure complies with all applicable closure requirements and conditions specified in the approved closure plan. Title: gnature: Date:	Site Reclamation	(Photo Documentation)		
perutor Closure Certification: wereby certify that the information and attachments submitted with this closure report is ture, accurate and complete to the best of my knowledge and belief. I also certify that the closure complies with all applicable closure requirements and conditions specified in the approved closure plan. Title: gnature: Date:	On-site Closure L	ocation: Latitude:	Longitude:	NAD 1927 1983
perutor Closure Certification: sereby certify that the information and attachments submitted with this closure report is ture, accurate and complete to the best of my knowledge and belief. I also certify that the closure complies with all applicable closure requirements and conditions specified in the approved closure plan. Title: gnature: Date:				
ereby certify that the information and attachments submitted with this closure report is ture, accurate and complete to the best of my knowledge and belief. I also certify that closure complies with all applicable closure requirements and conditions specified in the approved closure plan. Title: gnature: Date:	15			
Title: gnature: Date:				
Title: gnature: Date:	hereby certify that the info	ormation and attachments submitted with this closure	report is ture, accurate an	d complete to the best of my knowledge and belief. I also certify that
gnature: Date:	ю самите стприцез with ai	a appacable closure requirements and conditions spe	ecified in the approved clos	ure plan.
	ame (Print):		Title:	
	ionature:			
nail address: Telephone:	·b·········		Date:	
· vie viewie	-mail address:		Telephone:	

New Mexico Office of the State Engineer POD Reports and Downloads

Township: 30N Range	e: 07W Sections:	
NAD27 X: Y:	Zone: Sear	rch Radius:
County: Basin:	Number:	Suffix:
Owner Name: (First)	(Last) C Non-	Domestic O Domestic O All
POD / Surface Data Report	Avg Depth to Water Report	Water Column Report
Clear	Form iWATERS Menu Help	

WATER COLUMN REPORT 08/21/2008

	(quarter	B ar	∌ T=	MM	4=	=NE	3=5W	C=SE)						
	(quarter	s are	e bi	gge	est	t to	smal:	lest)		Depth	Depth	Water	(in	feet)
POD Number	Tws	Rng	Sec	q	P	Ţ	Zone	x	Y	Well	Water	Column		
SJ 02698	30N	07W	15	3	1					402	255	147		
SJ 02366	30N	07W	15	3	1		C	114800	2117300	345	225	120		
SJ 03640	30N	07W	15	3	1	1				433	241	192		
SJ 00837	30N	07W	17	4	4					400				
SJ 03385	30N	07W	17	4	4	4				520	460	60		
SJ 03006	30N	07W	24	1	3	3				100				
SJ 03082	3 ON	07W	24	3	1	1				98	61	37		
SJ 03485	30N	07W	24	3	1	1				126	60	66		
SJ 02818	30N	07W	24	3	1	2				86	42	44		
SJ 03773 POD1	30N	07W	24	3	1	2		126639	2112238	120	70	50		
SJ 03053	30N	07W	24	3	4	4				200				
SJ 03075	30N	07W	25	1	2	1				165	78	87		
SJ 03774 POD1	30N	07W	25	1	3	3		126554	2107670	300	220	80		
SJ 02983	30N	07W	25	1	4	3				262	40	222		
SJ 00035	3 0 N	07W	33	4	2	2				547	467	80		
SJ 03301	30N	07W	34	4	4	4				21	10	11		

Record Count: 16


New Mexico Office of the State Engineer POD Reports and Downloads


NAD27 X:	Y: Zone: Search Radius:
County: Basin:	Number: Suffix:
Owner Name: (First)	(Last) C Non-Domestic C Domestic C All
POD / Surface Data Report	Avg Depth to Water Report Water Column Report

WATER COLUMN REPORT 08/20/2008

(9	quarter	s are	1 =	NW	2=	NE	3=SW 4=SE)						
(9	<i>marter</i>	s are	bi.	gge	est	to	smallest	.)		Depth	Depth	Water	(in	feet)
POD Number	Tws	Rng	Sec	P	ą	đ	Zone	x	Y	Well	Water	Column		
SJ 00580	29N	07W	05	2	3						160			
SJ 02636	29N	07W	05	3	1	2				300	200	100		
SJ 03453	_ 29N	07W	05	4	1	4				355	20	335		
SJ 00541	29N	07W	06	1	4	4				360	360			
SJ 00807	29N	07W	06	2	4					290	255	35		
SJ 01199	29N	07W	09	3	2	4				265	125	140		
SJ 03390	29N	07W	13	1	2	4				320	120	200		
SJ 00053	29N	07W	13	3						536	460	76		
SJ 01228	29N	07W	23	2	1					285	205	80		• :
SJ 02891	29N	07W	24	2	3	2				210	160	50		•
SJ 03391	_ 29N	07W	24	2	3	2			1	210				
SJ 03573	29N	07W	24	2	4	1				900				
SJ 01112	29N	07W	28	2	4	4				2453	900	1553		
SJ 00039	_ 29N	07W	29	3	2					585	435	150		


Record Count: 14

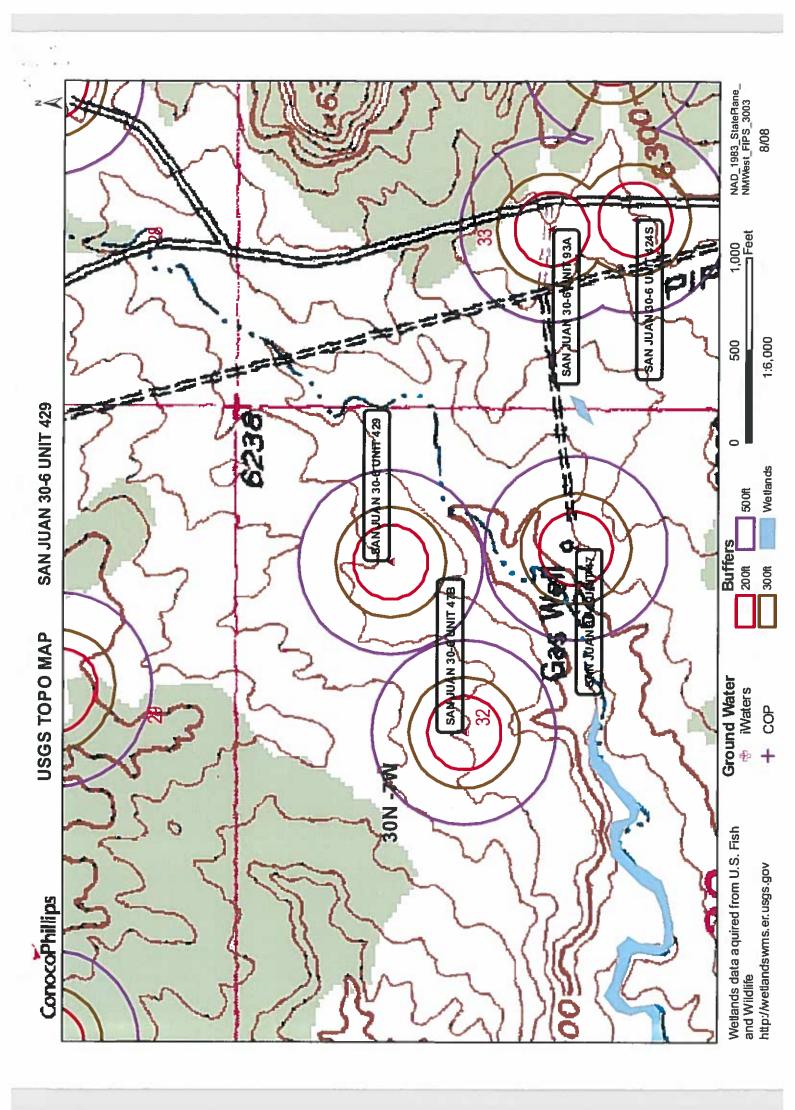

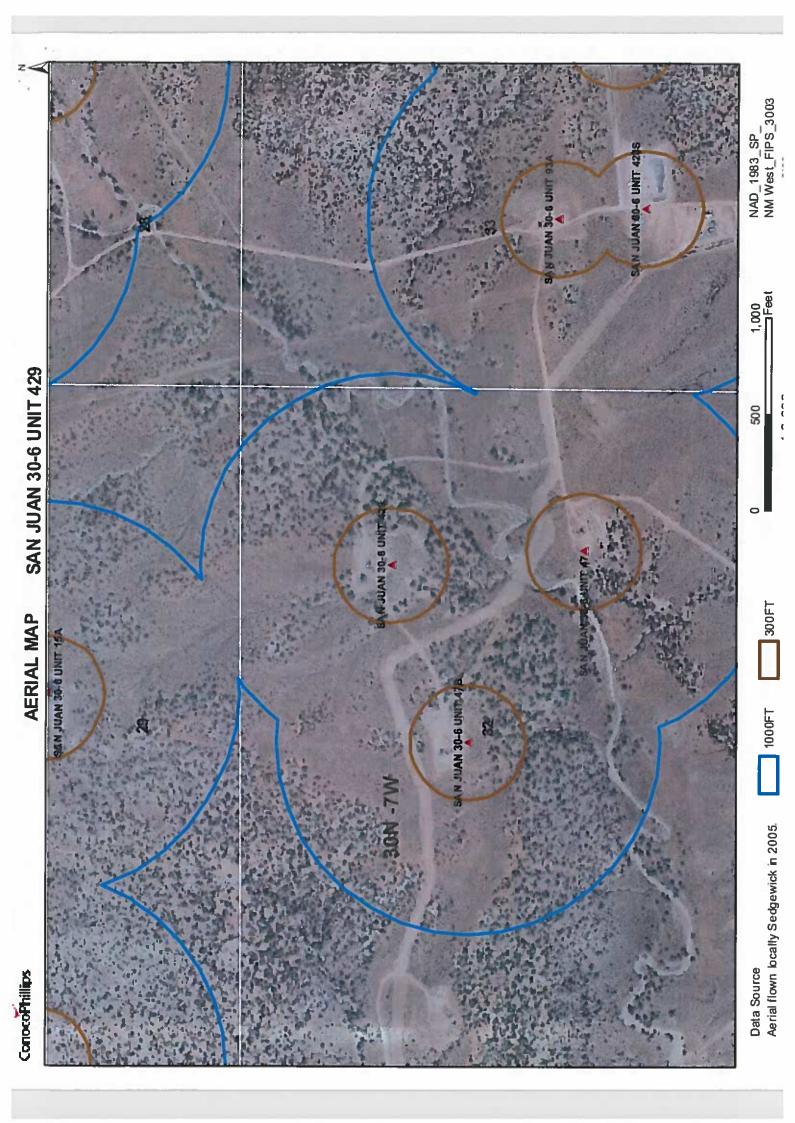


Mines, Mills and Quarries Web Map

SAN JUAN 30-6 UNIT 429 Unit Letter: A, Section: 32, Town: 030N, Range: 007W

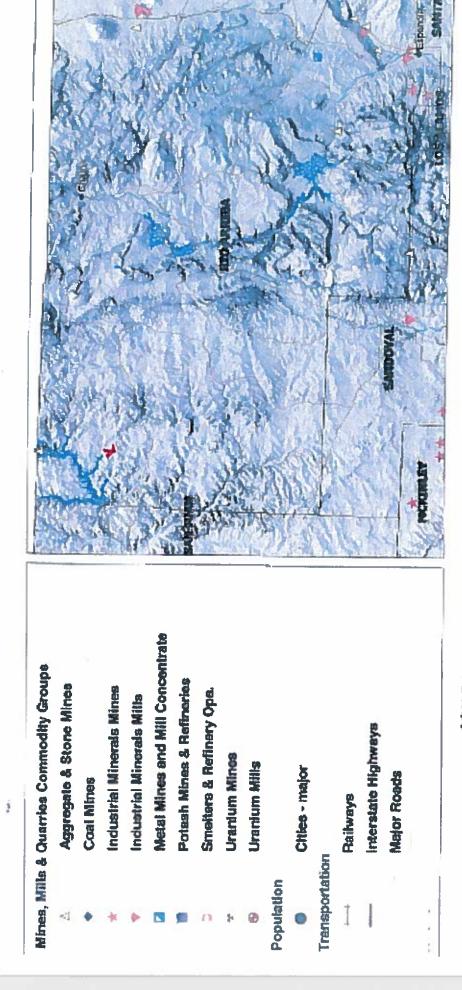

SCALE 1:1,180,363



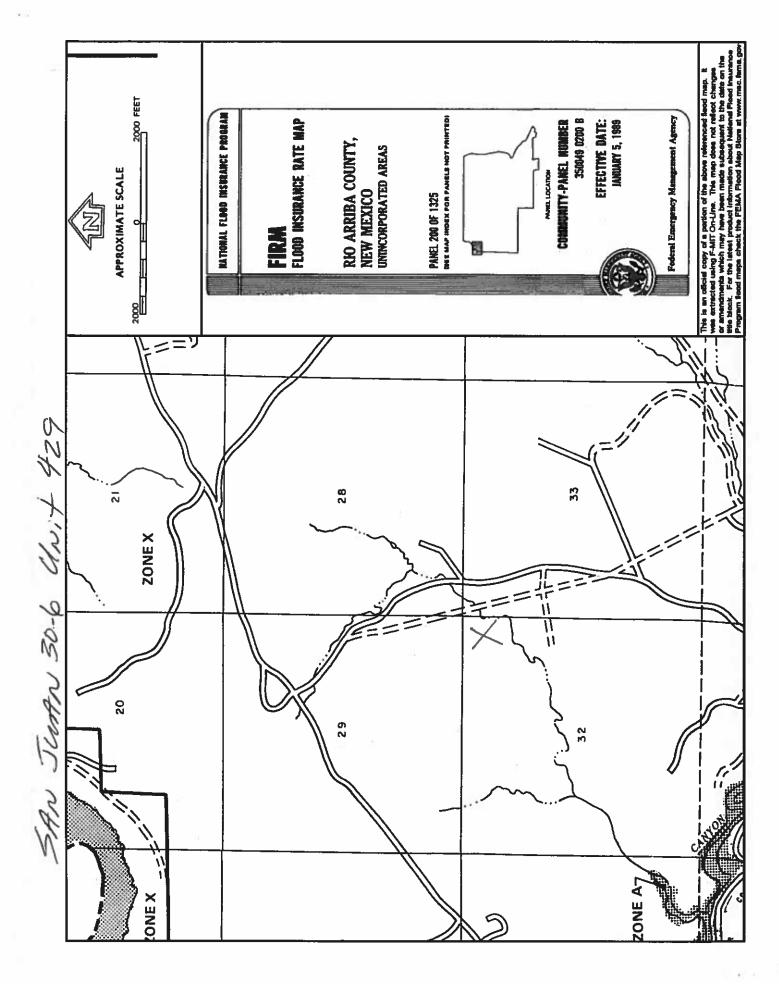

SAN JUAN 30-6 UNIT 429

Site Specific Hydrogeology

A visual site inspection confirming the information contained herein was performed on the well 'SAN JUAN 30-6 UNIT 429', which is located at 36.77415 degrees North latitude and 107.58796 degrees West longitude. This location is located on the Navajo Dam 7.5' USGS topographic quadrangle. This location is in section 32 of Township 30 North Range 7 West of the Public Land Survey System (New Mexico Principal Meridian). This location is located in Rio Arriba County, New Mexico. The nearest town is Turley, located 10.9 miles to the west. The nearest large town (population greater than 10,000) is Farmington, located 34.4 miles to the west (National Atlas). The nearest highway is State Highway 539, located 1.3 miles to the southwest. The location is on State land and is 718 feet from the edge of the parcel as notated in the BLM land status layer updated January 2008. This location is in the Upper San Juan. Colorado. New Mexico, Sub-basin. This location is located 1903 meters or 6241 feet above sea level and receives 14.5 inches of rain each year. The vegetation at this location is classified as Colorado Plateau Pinion-Juniper Woodland as per the Southwest Regional Gap Analysis Program.

The estimated depth to ground water at this point is 255 feet. This estimation is based on the data published on the New Mexico Engineer's iWaters Database website and water depth data from ConocoPhillips' Cathodic wells. Groundwater data available from the NM State Engineer's iWaters Database for wells near the proposed site are attached. The nearest stream is 327 feet to the southeast and is classified by the USGS as an intermittent stream. The nearest perrenial stream is 3,682 feet to the southwest. The nearest water body is 6,410 feet to the south. It is classified by the USGS as an intermittent lake and is 0.6 acres in size. The nearest spring is 16,959 feet to the northwest. All stream, river, water body and spring information was determined as per the USGS Hydrographic Dataset (High Resolution), downloaded 3/2008. The nearest water well is 5,756 feet to the east. The nearest wetland is a 0.2 acre other located 1,193 feet to the southeast. The slope at this location is 2 degrees to the southeast as calculated from USGS 30M National Elevation Dataset. This information is also discerned from the aerial and topographic map included. The surface geology at this location is SAN JOSE FORMATION--Siltstone, shale, and sandstone with a Sandstone dominated formations of all age's substrate. The soil at this location is 'Vessilla-Menefee-Orlie complex, 1 to 30 percent slopes' and is well drained and not hydric with severe erosion potential as taken from the NRCS SSURGO map unit, downloaded January 2008. The nearest underground mine is 14.7 miles to the east as indicated on the Mines, Mills and Quarries Map of New Mexico provided.

Regional Hydrogeological context:

The San Jose Formation of Eocene age occurs in New Mexico and Colorado, and its outcrop forms the land surface over much of the eastern half of the central basin. It overlies the Nacimiento Formation in the area generally south of the Colorado-New Mexico State line and overlies the Animas Formation in the area generally north of the State line. The San Jose Formation was deposited in various fluvial-type environments. In general, the unit consists of an interbedded sequence of sandstone, siltstone, and variegated shale. Thickness of the San Jose Formation generally increases from west to east (200 feet in the west and south to almost 2,700 feet in the center of the structural basin). Ground water is associated with alluvial and fluvial sandstone aquifers. Thus, the occurrence of ground water is mainly controlled by the distribution of sandstone in the formation. The distribution of such sandstone is the result of original depositional extent plus any post-depositional modifications, namely erosion and structural deformation. Transmissivity data for San Jose Formation are minimal. Values of 40 and 120 feet squared per day were determined from two aquifer tests (Stone et al, 1983, table 5). The reported or measured discharge from 46 water wells completed in San Jose Formation ranges from 0.15 to 61 gallons per minute and the median is 5 gallons per minute. Most of the wells provide water for livestock and domestic use. The San Jose Formation is a very suitable unit for recharge from precipitation because soils that form on the unit are sandy and highly permeable and therefore readily adsorb precipitation. However, low annual precipitation, relatively high transpiration and evaporation rates, and deep dissection of the San Jose Formation by the San Juan River and its tributaries all tend to reduce the effective recharge to the unit.

Stone et al., 1983, Hydrogeology and Water Resources of the San Juan Basin, New Mexico: Socorro, New Mexico Bureau of Mines and Mineral Resources Hydrologic Report 6, 70 p.


Burlington Resources Oil & Gas Company, LP San Juan Basin Below Grade Tank Design and Construction

In accordance with NMAC 19.15.17 the following information describes the design and construction of below grade tanks on Burlington Resources Oil & Gas Company, LP (BR) locations. This is BR's standard procedure for all below grade tanks (BGT). A separate plan will be submitted for any BGT which does not conform to this plan.

General Plan:

- BR will design and construct a properly sized and approved BGT which will contain liquids and should prevent contamination of fresh water to protect the public health and environment.
- BR signage will comply with 19.15.3.103 NMAC when BR is the operator. If BR is not the operator it will comply with 19.15.17.11NMAC. BR includes Emergency Contact information on all signage.
- 3. BR has approval to use alternative fencing that provides better protection. BR constructs fencing around the BGT using 4 foot hog wire fencing topped with two strands of barbed wire, or with a pipe top rail. A six foot chain link fence topped with three strands of barbed wire will be use if the well location is within 1000 feet of permanent residence, school, hospital, institution or church. BR ensures that all gates associated with the fence are closed and locked when responsible personnel are not onsite.
- 4. BR will construct a screened, expanded metal covering, on the top of the BGT.
- BR shall ensure that a below-grade tank is constructed of materials resistant to the below-grade tank's particular contents and resistant to damage from sunlight as shown on design drawing and specification sheet.
- The BR below-grade tank system shall have a properly constructed foundation
 consisting of a level base free of rocks, debris, sharp edges or irregularities to
 prevent punctures, cracks or indentations of the liner or tank bottom as shown on
 design drawing.
- 7. BR shall operate and install the below-grade tank to prevent the collection of surface water run-on. BR has built in shut off devices that do not allow a below-grade tank to overflow. BR constructs berms and corrugated retaining walls at least 6" above ground to keep from surface water run-on entering the below grade tank as shown on the design plan.
- 8. BR will construct and use a below-grade tank that does not have double walls. The below-grade tank's side walls will be open for visual inspection for leaks, the below-grade tank's bottom is elevated a minimum of six inches above the underlying ground surface and the below-grade tank is underlain with a geomembrane liner to divert leaked liquid to a location that can be visually inspected.

- 9. BR has equipped the below-grade tanks with the ability to detect high level in the tank and provide alarm notification and shutdown process streams into the tank. Once high level is detected RTU logic closes the inlet separator sales valve and does not permit vent valve to open. This shutdown of the sales valve and gagging of the vent valves prevents any hydrocarbon process streams from entering the pit tank once a high level is detected. Furthermore, an electronic page is sent to the BR MSO for that well site and to the designated contract "Water-Hauling" Company indicating a high level and that action must be taken to address this alarm. The environmental drain line from BR's compressor skid under normal operating conditions is in the open position. The environmental drain line is in place to capture any collected rain water or spilled lubricants from our compressor skids. The swab drain line is a manually operated drain and by normal operating procedures is in the closed position. The tank drain line is also a manually operated drain and during normal operations it is in the closed position.
- 10. The geomembrane liner consists of a 45-mil flexible LLDPE material manufactured by Raven Industries as J45BB. This product is a four layer reinforced laminated containing no adhesives. The outer layers consist of a high strength polyethylene film manufactured using virgin grade resins and stabilizers for UV resistance in exposed applications. The J45BB is reinforced with 1300 denier (minimum) tri-directional scrim reinforcement. It exceeds ASTMD3083 standard by 10%. J45BB has a warranty for 20 years from Raven Industries and is attached. It is typically used in Brine Pond, Oilfield Pit liner and other industrial applications. The manufacture specific sheet is attached and the design attached displays the proper installation of the liner.
- The general specification for design and construction are attached in the BR document.

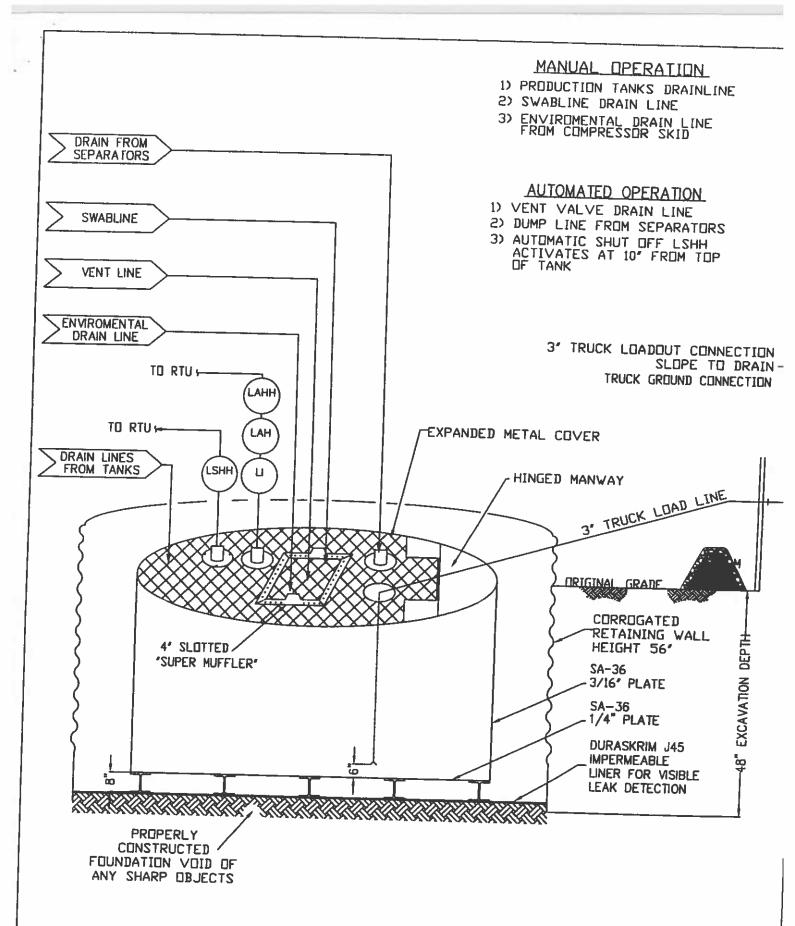

ConocoPhillips

San Juan Business Unit

PRODUCED WATER PIT TANK OPEN TOP GRAVITY FLOW TANK INTERNALLY COATED WITH 12-14 MILS AMERON AMERCOAT 385

Dura-skrim® jag, jag & jag

PROPERTIES	TEST METHOD	J	30BB	b " J3	688	J4588		
		Min. Roll Averages	Typical Roll Avernges	Min. Roll Averages	Typical Roll Averages	Min. Roll Averages	Typical Rall Averages	
Appearance		Blad	ck/Black	Blac	k/Black	Blac	k/Black	
Thickness	ASTM D 5199	27 mil	30 mil	32 mil	36 mil	40 mil	45 mil	
Weight Lbs Per MSF (oz/yd²)	ASTM D 5261	126 lbs (18.14)	140 lbs (20.16)	151 lbs (21.74)	168 lbs (24.19)	189 lbs (27.21)	210 lbs	
Construction		"Ext	rusion laminate	d with encapsula		The same of the same	(30.24)	
Ply Adhesion	ASTM D 413	16 lbs	20 lbs	19 lbs	24 lbs	25 lbs	31 lbs	
1° Tensile Strength	ASTM D 7003	88 lbf MD 63 lbf DD	110 lbf MD 79 lbf DD	90 lbf MD 70 lbf DD	113 lbf MD 87 lbf DD	110 lbf MD 84 lbf DD	138 lbf MD 105 lbf DD	
1" Tensile Elongation @ Break % (Film Break)	ASTM D 7003	550 MD 550 DD	750 MD 750 DD	550 MD 550 DD	750 MD 750 DD	550 MD 550 DD	750 MD 750 DD	
1° Tensile Elongation @ Peak % (Scrim Break)	ASTM D 7003	20 MD 20 DD	33 MD 33 DD	20 MD 20 DD	30 MD 31DD	20 MD 20 DD	36 MD 36 DD	
Tongue Tear Strength	ASTM D 5884	75 lbf MD 75 lbf DD	97 lbf MD 90 lbf DD	75 lbf MD 75 lbf DD	104 lbf MD 92 lbf DD	100 lbf MD 100 lbf DD	117 lbf MD 118 lbf DD	
Grab Tensile	ASTM D 7004	180 lbf MD 180 lbf DD	218 lbf MD 210 lbf DD	180 lbf MD 180 lbf DD	222 lbf MD 223 lbf DD	220 lbf MD 220 lbf DD	257 lbf MD 258 lbf DD	
Trapezoid Tear	ASTM D 4533	120 lbf MD 120 lbf DD	146 lbf MD 141 lbf DD	130 lbf MD 130 lbf DD	189 lbf MD 172 lbf DD	160 lbf MD 160 lbf DD	193 lbf MD 191 lbf DD	
Dimensional Stability	ASTM D 1204	<1	<0.5	<1	<0.5	<1	<0.5	
ouncture Resistance	ASTM D 4833	50 lbf	64 lbf	65 lbf	83 lbf	80 lbf		
Maximum Use Temperature		180° F	180° F	180° F	180° F		99 lbf	
Vinimum Use Temperature		-70° F	-70° F	-70° F	-70° F	180° F	180° F	
D = Machine Direction			,,,	-70 F	-/U-F	-70° F	-70° F	

MD = Machine Direction DD = Diagonal Directions



Note: Minimum Roll Averages are set to take into account product variability in addition to testing variability between laboratories,

*Dimensional Stability Maximum Value

**DURA-SKRIM J30BB, J36BB & J45BB are a four layer reinforced laminate containing no adhesives. The outer layers consist of a high strength polyethylene film manufactured using virgin grade resins and stabilizers for UV resistance in exposed applications. DURA-SKRIM J30BB, J36BB & J45BB are reinforced with a 1300 denier (minimum) tri-directional scrim reinforcement.

Note: PAVEN INDUSTRIES MAKES NO WARRANTIES AS TO THE FITNESS FOR A SPECIFIC USE OR MERCHANTABILITY OF PRODUCTS REFERRED TO, no quantities of satisfactory results from reliance upon contained information or recommendations and discussive for resulting loss or damage.

PLANT LOCATION

Sioux Falls, South Dakota

SALES OFFICE

P.O. Box 5107 Sioux Falls, SD 57117-5107 (605) 335-0174 (605) 331-0333 FAX **800-635-3456**

08/06

RAVEN

RAVEN INDUSTRIES INC. EXPOSED GEOMEMBRANE LIMITED WARRANTY

Raven Industries Inc. warrants Dura-Skrim J30BB, J36BB, and J45BB to be free from manufacturing defects and to be able to withstand normal exposure to sunlight for a period of 20 years from the date of sale for normal use in approved applications in the U.S. and Canada, excluding Hawaii. This warranty is effective for products sold and shipped from January 1, 2008 to December 31, 2008. These dates will be updated prior to December 31, 2008.

This Limited Warranty does not include damages or defects in the Raven geomembrane resulting from acts of God, casualty or catastrophe including but not limited to: earthquakes, floods, piercing hail, or tornadoes. The term "normal use" as used herein does not include, among other things improper handling during transportation, unloading, storage or installation, the exposure of Raven geomembranes to harmful chemicals, atypical atmospheric conditions, abuse of Raven geomembranes by machinery, equipment or people; improper site preparation or covering materials, excessive pressures or stresses from any source or improper application or installation. Raven geomembrane material warranty is intended for commercial use only and is not in effect for the consumer as defined in the Magnuson Moss Warranty or any similar federal, state, or local statues. The parties expressly agree that the sale hereunder is for commercial or industrial use only.

Should defects or premature loss of use within the scope of the above Limited Warranty occur, Raven Industries Inc. will, at its option, repair or replace the Raven geomembrane on a pro-rata basis at the then current price in such manner as to charge the Purchaser/User only for that portion of the warranted life which has elapsed since purchase of the material. Raven Industries Inc. will have the right to inspect and determine the cause of any alleged defect in the Raven geomembrane and to take appropriate steps to repair or replace the Raven geomembrane if a defect exists which is covered under this warranty. This Limited Warranty extends only to Raven's geomembrane, and does not extend to the installation service of third parties nor does it extend to materials furnished or installed by others in connection with the intended use of the Raven geomembranes.

Any claim for any alleged breach of this warranty must be made in writing, by certified mail, to the General Manager of Engineered Films Division of Raven Industries Inc. within ten (10) days of becoming aware of the alleged defect. Should the required notice not be given, the defect and all warranties are waived by the Purchaser, and Purchaser shall not have any rights under this warranty. Raven Industries Inc. shall not be obligated to perform repairs or replacements under this warranty unless and until the area to be repaired or replaced is clean, dry, and unencumbered. This includes, but is not limited to, the area made available for repair and/or replacement of Raven geomembrane to be free from all water, dirt, sludge, residuals and liquids of any kind. If after inspection it is determined that there is no claim under this Limited Warranty, Purchaser shall reimburse Raven Industries Inc. for its costs associated with the site inspection.

In the event the exclusive remedy provided herein fails in its essential purpose, and in that event only, the Purchaser shall be entitled to a return of the purchase price for so much of the material as Raven Industries Inc. determines to have violated the warranty provided herein. Raven Industries Inc. shall not be liable for direct, indirect, special, consequential or incidental damages resulting from a breach of this warranty including, but not limited to, damages for loss of production, lost profits, personal injury or property damage. Raven Industries Inc. shall not be obligated to reimburse Purchaser for any repairs, replacement, modifications or alterations made by Purchaser unless Raven Industries Inc. specifically authorized, in writing, said repairs, replacements, modifications or alteration in advance of them having been made. Raven Industry's liability under this warranty shall in no event exceed the replacement cost of the material sold to the Purchaser for the particular installation in which it failed.

Raven Industries Inc. neither assumes nor authorizes any person other than the undersigned of Raven Industries Inc. to assume for it any other or additional liability in connection with the Raven geomembrane made on the basis of the Limited Warranty. The Limited Warranty on the Raven geomembrane herein is given in lieu of all other possible material warranties, either expressed or implied, and by accepting delivery of the material; Purchaser waives all other possible warranties, except those specifically given. This Limited Warranty may only be modified by written document mutually executed by Owner and Raven Industries Inc.

Limited Warranty is extended to the purchaser/owner and is non-transferable and non-assignable; i.e., there are no third-party beneficiaries to this warranty.

Purchaser acknowledges by acceptance that the Limited Warranty given herein is accepted in preference to any and other possible materials warranties.

THIS LIMITED WARRANTY SHALL BE GOVERNED BY SOUTH DAKOTA LAW AND VENUE FOR ALL LEGAL PROCEEDINGS IN CONNECTION WITH THIS LIMITED WARRANTY SHALL BE IN MINNEHAHA COUNTY, SOUTH DAKOTA. RAVEN INDUSTRIES INC. MAKES NO WARRANTY OF ANY KIND OTHER THAN THAT GIVEN ABOVE AND HEREBY DISCLAIMS ALL WARRANTIES, BOTH EXPRESSED OR IMPLIED, OF MERCHANTABILITY AND FITNESS FOR A PARTICULAR PURPOSE. THIS IS THE ONLY WARRANTY THAT APPLIES TO THE MATERIALS REFERRED TO HEREIN AND RAVEN INDUSTRIES INC. DISCLAIMS ANY LIABILITY FOR ANY WARRANTIES GIVEN BY ANY OTHER PERSON OR ENTITY, EITHER WRITTEN OR ORAL.

RAVEN INDUSTRIES' WARRANTY BECOMES AN OBLIGATION OF RAVEN INDUSTRIES INC. TO PERFORM UNDER THE WARRANTY ONLY UPON RECEIPT OF FINAL PAYMENT AND EXECUTION BY A DULY AUTHORIZED OFFICER OF RAVEN INDUSTRIES INC.

Burlington Resources Oil & Gas Company, LP San Juan Basin Below Grade Tank Maintenance and Operating Plan ...

In accordance with Rule 19.15.17 the following information describes the operation and maintenance of Below Grade Tank (BGT) on Burlington Resources Oil & Gas Company, LP (BR) locations. This is BR's standard procedure for all BGT. A separate plan will be submitted for any BGT which does not conform to this plan.

General Plan:

- BR will operate and maintain a BGT to contain liquids and solids and maintain
 the integrity of the liner, liner system and secondary containment system to
 prevent contamination of fresh water and protect public health and environment.
 BR will accomplish this by performing an inspection on a monthly basis, installing
 cathodic protection, and automatic overflow shutoff devices as seen on the
 design plan.
- 2. BR will not discharge into or store any hazardous waste in the BGT.
- 3. BR shall operate and install the below-grade tank to prevent the collection of surface water run-on. BR has built in shut off devices that do not allow a belowgrade tank to overflow. BR constructs berms and corrugated retaining walls at least 6" above ground to keep from surface water run-on entering the below grade tank as shown on the design plan.
- 4. As per 19.17.15.12 Subsection D, Paragraph 3, BR will inspect the below-grade tank at least monthly reviewing several items which include 1) containment berms adequate and no oil present, 2) tanks had no visible leaks or sign of corrosion, 3) tank valves, flanges, and hatches had no visible leaks and 4) no evidence of significant spillage of produced liquids. In addition, BR's multi-skilled operators (MSOs) are required to visit each well location once per week. If detected on either inspection, BR shall remove any visible or measurable layer of oil from the fluid surface of a below-grade tank in an effort to prevent significant accumulation of oil overtime. The written record of the monthly inspections will include the items listed above and will be maintained for five years.
- BR shall require and maintain a 10" adequate freeboard to prevent overtopping of the below-grade tank.
- 6. If the below grade tank develops a leak, or if any penetration of the pit liner or below grade tank, occurs below the liquid's surface, then BR shall remove all liquid above the damage or leak line within 48 hours. BR shall notify the appropriate district office. BR shall repair or replace the pit liner or below grade tank, within 48 hours of discovery. If the below grade tank or pit liner does not demonstrate integrity, BR shall promptly remove and install a below grade tank or pit liner that complies with Subsection I of 19.15.17.11 NMAC. BR shall notify the appropriate district office of a discovery of leaks less than 25 barrels as required pursuant to Subsection B of 19.15.3.116 NMAC shall be reported within twenty-four (24) hours of discovery of leaks greater than 25 barrels. In addition, immediate verbal notification pursuant to Subsection B, Paragraph (1), and Subparagraph (d) of 19.15.3.116 NMAC shall be reported to the division's Environmental Bureau Chief.

Burlington Resources Oil & Gas Company, LP San Juan Basin Below Grade Tank Closure Plan

In accordance with Rule 19.15.17.13 NMAC the following information describes the closure requirements of Below Grade Tanks (BGTs) on Burlington Resources Oil & Gas Company, LP locations hereinafter known as BR locations. This is BR's standard procedure for all BGTs. A separate plan will be submitted for any BGT which does not conform to this plan.

General Requirements:

- 1. BR shall close a below-grade tank within the time periods provided in Subsection A of 19.15.17.13 NMAC. This will include a) below-grade tanks that do not meet the requirements of Paragraphs (1) through (4) of Subsection I of 19.15.17.11 NMAC or is not included in Paragraph (5) of Subsection I o f19.15.17.11 NMAC within five years, if not retrofitted to comply with Paragraphs (1) through (4) of Subsection I of 19.15.17.11 NMAC; b) permitted below-grade tanks within 60 days of cessation of the below-grade tank's operation., or c) an earlier date that the division requires because of imminent danger to fresh water, public health or the environment. For any closure, BR will file the C144 Closure Report as required.
- 2. BR shall remove liquids and sludge from a below-grade tank prior to implementing a closure method and shall dispose of the liquids and sludge in a division-approved facility. The facilities to be used will be Basin Disposal (Permit #NM-01-005) and Envirotech Land Farm (Permit #NM-01-011). The liner after being cleaned well (Subsection D, Paragraph 1, Subparagraph (m) of 19.15.9.712 NMAC) will be disposed of at the San Juan County Regional Landfill located on CR 3100.
- 3. BR will receive prior approval to remove the below-grade tank and dispose of it in a division-approved facility or recycle, reuse, or reclaim it in a manner that the appropriate division district office approves. Documentation of how the below-grade tank was disposed of or recycled will be provided in the closure report.
- If there is any on-site equipment associated with a below-grade tank, then BR shall remove the equipment, unless the equipment is required for some other purpose.
- 5. BR shall test the soils beneath the below-grade tank to determine whether a release has occurred. BR shall collect, at a minimum, a five point, composite sample; collect individual grab samples from any area that is wet, discolored or showing other evidence of a release; and analyze for BTEX, TPH and chlorides to demonstrate that the benzene concentration, as determined by EPA SW-846 methods 8021B or 8260B or other EPA method that the division approves, does not exceed 0.2 mg/kg; total BTEX concentration, as determined by EPA SW-846 methods 8021B or 8260B or other EPA method that the division approves, does not exceed 50 mg/kg; the TPH concentration, as determined by EPA method 418.1 or other EPA method that the division approves, does not exceed 100 mg/kg; and the chloride concentration, as determined by EPA method 300.1 or other EPA method that the division approves, does not exceed 250 mg/kg, or the background concentration, whichever is greater. BR shall notify the division of its results on form C-141.
- 6. If BR or the division determines that a release has occurred, then BR shall comply with 19.15.3.116 NMAC and 19.15.1.19 NMAC, as appropriate.

- 7. If the sampling program demonstrates that a release has not occurred or that any release does not exceed the concentrations specified in Paragraph (4) of Subsection E of 19.15.17.13 NMAC, then BR shall backfill the excavation with compacted, non-waste containing, earthen material; construct a division-prescribed soil cover; recontour and re-vegetate the site.
- Notice of Closure will be given prior to closure to the Aztec Division office between 72 hours and one week via email or verbally. The notification of closure will include the following:
 - i. Operator's name
 - ii. Location by Unit Letter, Section, Township, and Range. Well name and API number.
- The surface owner shall be notified of BR's closing of the below-grade tank prior to closure as per the approved closure plan via certified mail, return receipt requested.
- 10. Re-contouring of location will match fit, shape, line, form and texture of the surrounding. Re-shaping will include drainage control, prevent ponding, and prevent erosion. Natural drainages will be unimpeded and water bars and/or silt traps will be place in areas where needed to prevent erosion on a large scale. Final re-contour shall have a uniform appearance with smooth surface, fitting the natural landscape.
- 11. BR shall seed the disturbed areas the first growing season after the operator closes the pit. Seeding will be accomplished via drilling on the contour whenever practical or by other division-approved methods. BLM stipulated seed mixes will used on federally jurisdicted lands and division-approved seed mixtures (administratively approved if required) will be utilized on all State or private lands. Vegetative cover will equal 70% of the native perennial vegetative cover (un-impacted) consisting of at least three native plant species, including at least one grass, but not including noxious weeds, and maintain that cover through two successive growing seasons. If alternate seed mix is required by the state, private owner or tribe, it will be implemented with administrative approval if needed. BR will repeat seeding or planting will be continued until successful vegetative growth occurs.
- 12. A minimum of four feet of cover shall be achieved and the cover shall include one foot of suitable material to establish vegetation at the site, or the background thickness of topsoil, whichever is greater.
- 13. All closure activities will include proper documentation and be available for review upon request and will be submitted to OCD within 60 days of closure of the belowgrade tank. Closure report will be filed on C-144 and incorporate the following:
 - Soil Backfilling and Cover Installation
 - Re-vegetation application rates and seeding techniques
 - Photo documentation of the site reclamation
 - Confirmation Sampling Results
 - Proof of closure notice

Burlington Resources /Conoco Phillips BGT REGISTRATION

✓ Signed C-144 (Page 5 of C-144)
✓ Site Specific Hydrogeology
19.15.17.10 NMAC SITTING REQUIREMENTS
 ✓ New Mexico Office of State Engineer attachment ✓ USGS TOPO map ✓ Aerial Map ✓ Mines, Mills and Quarries Map ✓ FIRM map (flood insurance rate map from Federal Emergency Agency)
19.15.17.11 NMAC DESIGN PLAN CONTENTS
✓ Below Grade Tank Design and Construction Plan
19.15.17.12 NMAC OPERATING AND MAINTENCE PLAN
19.15.17.13 NMAC CLOSURE PLAN
✓ Below Grade Tank Closure Plan
REGISTRATION DATE:
08/13/2015
NOTES: