

District I
1625 N. French Dr., Hobbs, NM 88240
District II
811 S. First St., Artesia, NM 88210
District III
1000 Rio Brazos Road, Aztec, NM 87410
District IV
1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico
Energy Minerals and Natural Resources

Form C-141
Revised August 8, 2011

Oil Conservation Division
1220 South St. Francis Dr.
Santa Fe, NM 87505

Submit 1 Copy to appropriate District Office in
accordance with 19.15.29 NMAC.

Release Notification and Corrective Action

OPERATOR

☒ Initial Report ☐ Final Report

Name of Company: Fasken Oil and Ranch, Ltd	Contact: Aaron Pachlhofer
Address: 6101 Holiday Hill Road	Telephone No.: 432 687 1777
Facility Name: Quail State 16 Battery	Facility Type: Tank Battery

Surface Owner: State of New Mexico	Mineral Owner: State of New Mexico	API No.: 30-025-39340
------------------------------------	------------------------------------	-----------------------

LOCATION OF RELEASE

Unit Letter M	Section 16	Township 20S	Range 34E	Feet from the 1230	North/South Line South	Feet from the 1980	East/West Line West	County Lea
------------------	---------------	-----------------	--------------	-----------------------	---------------------------	-----------------------	------------------------	---------------

Latitude _____ Longitude _____

NATURE OF RELEASE

Type of Release Oil	Volume of Release 20 BBL	Volume Recovered 17 BBL
Source of Release Vessel	Date and Hour of Occurrence 5/6/15, 3:15 p.m.	Date and Hour of Discovery same
Was Immediate Notice Given? <input checked="" type="checkbox"/> Yes <input type="checkbox"/> No <input type="checkbox"/> Not Required	If YES, To Whom? Kellie Jones, OCD	
By Whom? Aaron Pachlhofer	Date and Hour 5/7/15, 10:00 a.m.	
Was a Watercourse Reached? <input type="checkbox"/> Yes <input checked="" type="checkbox"/> No	If YES, Volume Impacting the Watercourse.	

If a Watercourse was Impacted, Describe Fully.*

RECEIVED

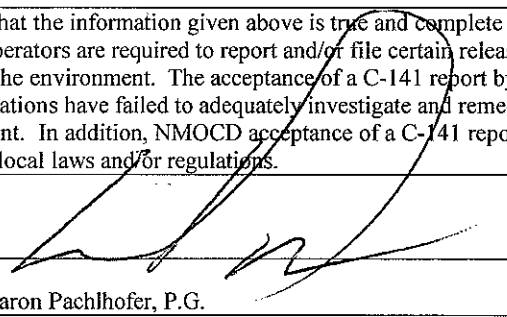

By OCD District 1 at 8:15 am, May 12, 2015

Describe Cause of Problem and Remedial Action Taken.: Pumper was making his 2nd round and found a manway gasket blown on the back of a 6' x 20' heater treater. He isolated the leak and closed all valves to prevent any more oil from getting on to the ground. He then contacted a supervisor to report the spill then they called for a vacuum truck. Vacuum truck picked up 17 bo on the ground inside the fire wall.

Describe Area Affected and Cleanup Action Taken.*

Due to gas inside the vessel there was a light overspray in a roughly 50' x 70' square area outside the firewall but no standing oil on the ground. A 30' x 80' area was stained inside the fire wall. Due to rainfall it does not appear that very much oil soaked into the soil since the ground was saturated. Area outside of fire wall was part of the pad. No pasture was affected. At this time, Fasken is waiting for the area to dry before collecting samples.

I hereby certify that the information given above is true and complete to the best of my knowledge and understand that pursuant to NMOCD rules and regulations all operators are required to report and/or file certain release notifications and perform corrective actions for releases which may endanger public health or the environment. The acceptance of a C-141 report by the NMOCD marked as "Final Report" does not relieve the operator of liability should their operations have failed to adequately investigate and remediate contamination that pose a threat to ground water, surface water, human health or the environment. In addition, NMOCD acceptance of a C-141 report does not relieve the operator of responsibility for compliance with any other federal, state, or local laws and/or regulations.

Signature: 		OIL CONSERVATION DIVISION	
Printed Name: Aaron Pachlhofer, P.G.		Approved by Environmental Specialist: 	
Title: Environmental Coordinator		Approval Date: 05/12/2015	Expiration Date: 08/12/2015
E-mail Address: aaronp@forl.com		Conditions of Approval: Site samples required. Delineate and remediate as per MNOCD guides. Geotag photographs of remediation required.	
Date: 5/8/2015 Phone: 432-687-1777		Attached <input type="checkbox"/> 151416 1RP-3631	

* Attach Additional Sheets If Necessary

pKJ1513251245
nKJ1513251046