


(SUBMIT IN TRIPLICATE)

Land Office New Mexico

Lease No. 00820

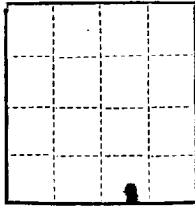

UNITED STATES  
DEPARTMENT OF THE INTERIOR  
GEOLOGICAL SURVEY

1955 JAN 31 AM 8:45

SUNDRY NOTICES AND REPORTS ON WELLS

NOTICE OF INTENTION TO DRILL		SUBSEQUENT REPORT OF WATER SHUT-OFF	
NOTICE OF INTENTION TO CHANGE PLANS		SUBSEQUENT REPORT OF SHOOTING OR ACIDIZING	
NOTICE OF INTENTION TO TEST WATER SHUT-OFF		SUBSEQUENT REPORT OF ALTERING CASING	
NOTICE OF INTENTION TO RE-DRILL OR REPAIR WELL		SUBSEQUENT REPORT OF RE-DRILLING OR REPAIR	
NOTICE OF INTENTION TO SHOOT OR ACIDIZE		SUBSEQUENT REPORT OF ABANDONMENT	X
NOTICE OF INTENTION TO PULL OR ALTER CASING		SUPPLEMENTARY WELL HISTORY	
NOTICE OF INTENTION TO ABANDON WELL	▲		

(INDICATE ABOVE BY CHECK MARK NATURE OF REPORT, NOTICE, OR OTHER DATA)

October 1954, 1954

Well No. 27011 is located 300 ft. from S line and 1000 ft. from E line of sec. 27

37 20 34   
(1/4 Sec. and Sec. No.) (Twp.) (Range) (Meridian)  
Lynx New Mexico  
(Field) (County or Subdivision) (State or Territory)

The elevation of the derrick floor above sea level is 3700 ft. (operator)

DETAILS OF WORK

(State names of and expected depths to objective sands; show sizes, weights, and lengths of proposed casings; indicate mudding jobs, cementing points, and all other important proposed work)

To 3341 - dry hole - filled hole back to 1000 ft. with gel. at bridge at 1600 ft. back to 1500 ft. put 10 sacks cement on this bridge back to 1575. put in 20 more sacks of cement. filled hole with mud and gel. pulled 4-3/8 casing. set bridge at 800 and dumped 15 sacks cement. pulled 10-3/4 casing. filled hole to top and cemented pipe in to top of 15" casing. 1x ft. of cement in top of hole.

hole plugged and abandoned.

plugging plan confirmed by tele. memo 12/17/54 with Mr. [unclear].

I understand that this plan of work must receive approval in writing by the Geological Survey before operations may be commenced.

Company W. S. [unclear]

Address Box 710

Artesia

New Mexico

By \_\_\_\_\_

Title operator