

Submit 3 Copies
to Appropriate
District Office

State of New Mexico
Energy, Minerals and Natural Resources Department

Form C-103
Revised 1-1-89

OIL CONSERVATION DIVISION

DISTRICT I
P.O. Box 1980, Hobbs NM 88241-1980

2040 Pacheco St.
Santa Fe, NM 87505

DISTRICT II
P.O. Drawer DD, Artesia, NM 88210

DISTRICT III
1000 Rio Brazos Rd., Aztec, NM 87410

WELL API NO. 30-025-29412
5. Indicate Type of Lease STATE <input checked="" type="checkbox"/> FEE <input type="checkbox"/>
6. State Oil & Gas Lease No.
7. Lease Name or Unit Agreement Name SOUTH HOBBS (GB/SA) UNIT
8. Well No. 205
9. Pool name or Wildcat HOBBS GB/SA
10. Elevation (Show whether DF, RKB, RT, GR, etc.)

SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well: OIL WELL <input checked="" type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER
2. Name of Operator ALTURA ENERGY, LTD.
3. Address of Operator P.O. BOX 4294 HOUSTON, TEXAS 77210-4294
4. Well Location Unit Letter <u>N</u> : <u>330</u> Feet From The <u>SOUTH</u> Line and <u>1650</u> Feet From The <u>WEST</u> Line Section <u>5</u> Township <u>19-S</u> Range <u>38-E</u> NMPM LEA NM County
10. Elevation (Show whether DF, RKB, RT, GR, etc.)

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:	SUBSEQUENT REPORT OF:
PERFORM REMEDIAL WORK <input type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>
OTHER: <input type="checkbox"/>	PLUG AND ABANDONMENT <input type="checkbox"/>
	CASING TEST AND CEMENT JOB <input type="checkbox"/>
	OTHER: <u>T&A</u> <input checked="" type="checkbox"/>

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

12/15/97 1. MIRU PULLING UNIT STRIP RODS OUT OF HOLE.
 12/16/97 2. 40 RODS POOH TBG RIH W/5-1/2" CSG SCRAPER.
 3. RIH W/5-1/2" CIBP SET AT 3904'.
 4. CIRC HOLE W/PKR FLUID TEST 500 PSI 30 MIN CSG LEAKED 500-0.
 12/17/97 5. POOH RIH W/5-1/2" PKR TEST FOR HOLE FOUND LEAK @ 3852'.
 12/18/97 6. POOH PKR RIH W/5-1/2" CIBP SET @ 3803' TEST.
 7. CSG 500 PSI 30 MIN CHART OK RD MO LOC.

This Approval by Abandonment Expires 1/12/2003

I hereby certify that the information above is true and complete to the best of my knowledge and belief.


SIGNATURE Jose A. Gutierrez TITLE P&A SUPERVISOR DATE 12/19/97
 TYPE OR PRINT NAME JOSE A. GUTIERREZ TELEPHONE NO. 505-392-6498

(This space for State Use)

APPROVED BY ORIGINAL SIGNED BY CHRIS WILLIAMS TITLE _____ DATE _____
DISTRICT I SUPERVISOR

CONDITIONS OF APPROVAL, IF ANY:

50565

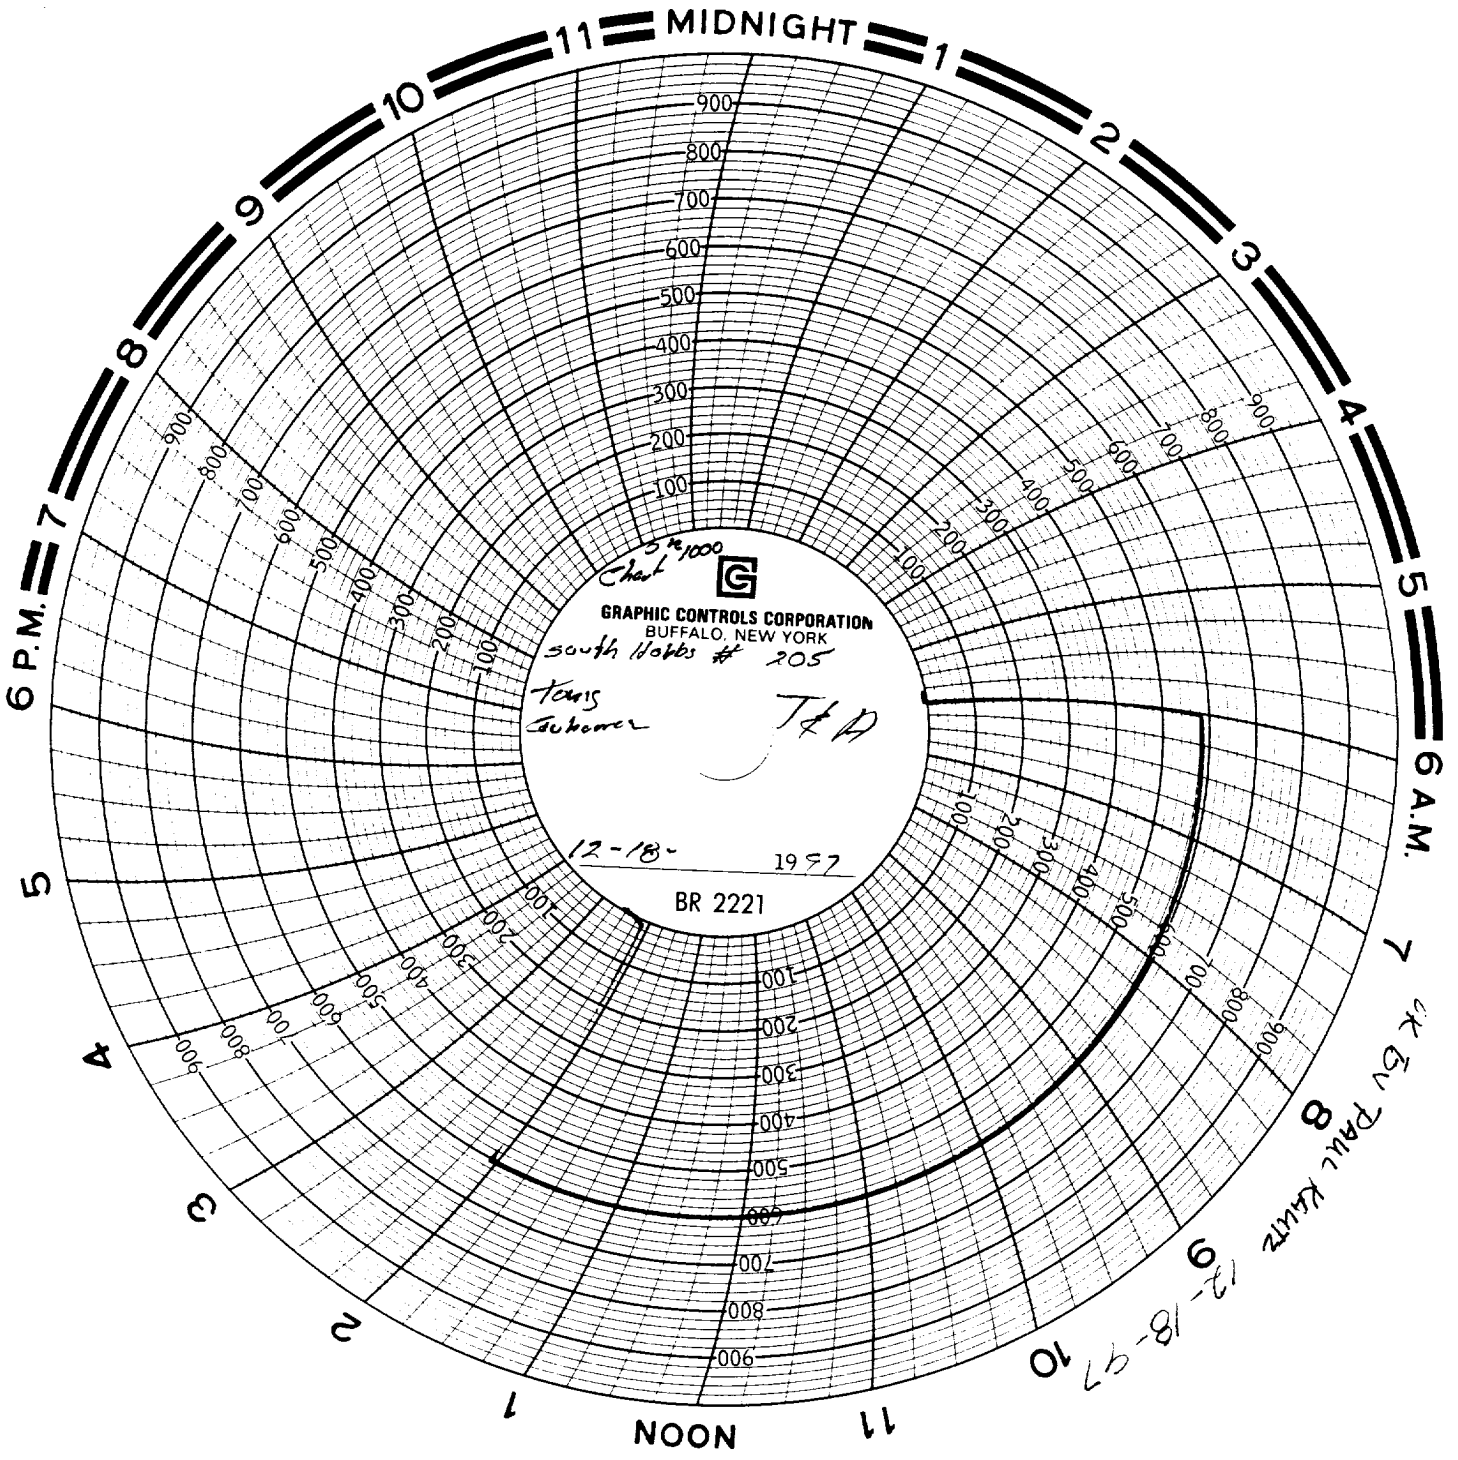

5th 1000
 Chart
GRAPHIC CONTROLS CORPORATION
 BUFFALO, NEW YORK
 South Hobbs # 205

Tours
 Cushman
 T & A

12-18-1997

BR 2221

OK BY PAUL KAMTZ

12-18-97